

22/03/2002

ASS. REC. BY:

REF: CS/SPF19000437/J gber

Special Instruction:

Survivor

ASSIGNMENT (Office)

From (Person): Lim Wei Yea of SPF Date/Time: 07012019 1132am

Estimated Cost: Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: QX 496A Insured:

at Workshop m/s SMRT Tel: 96576861

of 60 Woodlands Ind Park Ell

Policy No: Claim No: HOMSPFETD1600399

Sum Insured: Excess:

Make of Veh: D.O.A.

(Client's Record)

CA / REV / REP. / REV 24 HRS

09-01-2019 @ afternoon

H.O.D. Endorsement:

Date/Time: Person Contacted: Mr. Kong Vehicle IN / OUT

Date/Time	Action/Instruction (✓) Estimate
	QX 496A - x
	Material: @ 4089.50, man hrs: 59 hrs.

REF: SPF

ASSIGNMENT

From: Date: 09/01/2019

Estimated Cost:

① / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: QX 496A

at Workshop m/s: SMRT
of: 60 woodlands Ind. park E4

Insured:

Policy No:

Claims No:

Sum Insured:

Excess:

(Client's Record)

9857 6861


Make of Veh:

Afternoon

(Policy Condition)

Call Mr. Kong before
Survey

Remark: The veh had commenced its
repair at the time of inspection.

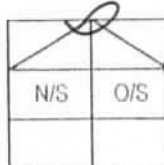

Bal. or Market Value:

IDAC Accident Rpt: Consistent?: Yes or No

GIA / PR Seen: Consistent?: Yes or No

Est. Repairs: days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / (REV) / REP. / 24 HRS

Vehicle: IN / OUT

Date: Person Contacted:

Veh No: QX 496A

Yr Regn:

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toyota Altis C.C.

Colour: White A/C Insured / Std / NI / NA

Sp. Reading T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195/65 R17S

R: -

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Falken

Front

Rear

R/Bal. 6 mm R/Bal. 6 mm

L/Bal. 6 mm L/Bal. 6 mm

D.O.A.

D.O.I. 9/1/19

Survey held at

Smrt

Des. of Damages: (Frt) Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Three Jie

Pls see my remarks

RECEIVED 05 MAR 2019

Signature
10/1

Date/Time, File Pass to?

☐ : Preli. Report

1)

☐ : Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

) S + RS SI

) Photos

) Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$))

Add Fee: ☐ : Site Insp (\$

☐ : Interview (\$

☐ : Tech. Invs (\$

☐ : Weekend (\$

200

200

Catherine Chong (LKK Auto)

From: Wei Yea LIM (SPF) <LIM_Wei_Yea@spf.gov.sg>
Sent: Monday, 7 January, 2019 11:32 AM
To: 'assignments'
Cc: Kim Pang CHAY (SPF); Kwee Huat TAN (SPF); Perry HE (SPF); Bernard SEAH (SPF); Peng Seng NG (SPF); Rashid ABU HASAN (SPF); 'Ai Phing (LKKAuto)'; 'Shiau Chan (LKKAuto)'
Subject: Appraisal Services for SPF vehicles at SMRT Automotive Services - HOMSPFETQ16000399 (QX496A)
Attachments: QX496A.xlsx

Hi Catherine,

Please provide Appraisal Services for the following SPF vehicles at SMRT Automotive Services:

- **QX496A**

In attached, please find the recommended Parts and Labour required for the repair.

Kindly contact the following SMRT personnel for viewing of the damaged vehicle:

- Mr Kong Sew Kui
- Mr Jason Yeo

Thank you and best regards,

WeiYea LIM
Contract Management
AEMD, Police Logistics Department
Singapore Police Force
DID: (65) 6478 4844



WARNING: "Privileged/Confidential information may be contained in this message. If you are not the intended addressee, you must not copy, distribute or take any action in reliance thereon. Communication of any information in this email to any unauthorized person is an offence under the Official Secrets Act (Cap 213). Please notify the sender immediately if you receive this in error."

Shiau Chan (LKKAUTO)

From: Wei Yea LIM (SPF) <LIM_Wei_Yea@spf.gov.sg>
Sent: Friday, 1 March 2019 2:21 PM
To: Shiau Chan (LKKAUTO); assignments
Cc: Kim Pang CHAY (SPF); Kwee Huat TAN (SPF); Perry HE (SPF); Bernard SEAH (SPF); Peng Seng NG (SPF); Rashid ABU HASAN (SPF); SUR
Subject: RE: Appraisal Services for SPF vehicles at SMRT Automotive Services - HOMSPFETQ16000399 (QX496A)

Hi,

Apologies for the delay.
Please close this.

Thank you and best regards,

WeiYea LIM
Contract Management
AEMD, Police Logistics Department
Singapore Police Force
DID: (65) 6478 4844



WARNING: "Privileged/Confidential information may be contained in this message. If you are not the intended addressee, you must not copy, distribute or take any action in reliance thereon. Communication of any information in this email to any unauthorized person is an offence under the Official Secrets Act (Cap 213). Please notify the sender immediately if you receive this in error."

From: Shiau Chan (LKKAUTO) <siewsc@lkkauto.com>
Sent: Thursday, 28 February 2019 09:14
To: Wei Yea LIM (SPF) <LIM_Wei_Yea@spf.gov.sg>; assignments <assignments@lkkauto.com>
Cc: Kim Pang CHAY (SPF) <CHAY_Kim_Pang@spf.gov.sg>; Kwee Huat TAN (SPF) <TAN_Kwee_Huat@spf.gov.sg>; Perry HE (SPF) <Perry_HE@spf.gov.sg>; Bernard SEAH (SPF) <Bernard_SEAH@spf.gov.sg>; Peng Seng NG (SPF) <NG_Peng_Seng@spf.gov.sg>; Rashid ABU HASAN (SPF) <Rashid_Abu_Hasan@spf.gov.sg>; SUR <sur@lkkauto.com>
Subject: RE: Appraisal Services for SPF vehicles at SMRT Automotive Services - HOMSPFETQ16000399 (QX496A)

Dear Wei Yea,

Kindly advise whether we can submit our report accordingly.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Shiau Chan (LKKAuto)

Sent: Thursday, 14 February 2019 9:26 AM

To: Wei Yea LIM (SPF) <LIM_Wei_Yea@spf.gov.sg>; assignments <assignments@lkkauto.com>

Cc: Kim Pang CHAY (SPF) <CHAY_Kim_Pang@spf.gov.sg>; Kwee Huat TAN (SPF) <TAN_Kwee_Huat@spf.gov.sg>; Perry HE (SPF) <Perry_HE@spf.gov.sg>; Bernard SEAH (SPF) <Bernard_SEAH@spf.gov.sg>; Peng Seng NG (SPF) <NG_Peng_Seng@spf.gov.sg>; Rashid ABU HASAN (SPF) <Rashid_Abu_Hasan@spf.gov.sg>; SUR <sur@lkkauto.com>

Subject: RE: Appraisal Services for SPF vehicles at SMRT Automotive Services - HOMSPFETQ16000399 (QX496A)

Dear Wei Yea,

Kindly advise whether we can submit our report accordingly.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Shiau Chan (LKKAuto)

Sent: Tuesday, 15 January 2019 3:39 PM

To: Wei Yea LIM (SPF) <LIM_Wei_Yea@spf.gov.sg>; assignments <assignments@lkkauto.com>

Cc: Kim Pang CHAY (SPF) <CHAY_Kim_Pang@spf.gov.sg>; Kwee Huat TAN (SPF) <TAN_Kwee_Huat@spf.gov.sg>; Perry HE (SPF) <Perry_HE@spf.gov.sg>; Bernard SEAH (SPF) <Bernard_SEAH@spf.gov.sg>; Peng Seng NG (SPF)

<NG_Peng_Seng@spf.gov.sg>; Rashid ABU HASAN (SPF) <Rashid_Abu_Hasan@spf.gov.sg>; SUR <sur@lkkauto.com>

Subject: RE: Appraisal Services for SPF vehicles at SMRT Automotive Services - HOMSPFETQ16000399 (QX496A)

Dear Wei Yea,

Please refer to the attachment of QX 496A.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Wei Yea LIM (SPF) <LIM_Wei_Yea@spf.gov.sg>

Sent: Monday, 7 January 2019 11:32 AM

To: assignments <assignments@lkkauto.com>

Cc: Kim Pang CHAY (SPF) <CHAY_Kim_Pang@spf.gov.sg>; Kwee Huat TAN (SPF) <TAN_Kwee_Huat@spf.gov.sg>; Perry HE (SPF) <Perry_HE@spf.gov.sg>; Bernard SEAH (SPF) <Bernard_SEAH@spf.gov.sg>; Peng Seng NG (SPF)

<NG_Peng_Seng@spf.gov.sg>; Rashid ABU HASAN (SPF) <Rashid_Abu_Hasan@spf.gov.sg>; 'Ai Phing (LKKAuto)' <aiphing@lkkauto.com>; Shiau Chan (LKKAuto) <siewsc@lkkauto.com>

Subject: Appraisal Services for SPF vehicles at SMRT Automotive Services - HOMSPFETQ16000399 (QX496A)

Hi Catherine,

Please provide Appraisal Services for the following SPF vehicles at SMRT Automotive Services:

- **QX496A**

In attached, please find the recommended Parts and Labour required for the repair.

Kindly contact the following SMRT personnel for viewing of the damaged vehicle:

- Mr Kong Sew Kui
- Mr Jason Yeo

Thank you and best regards,

WeiYea LIM
Contract Management
AEMD, Police Logistics Department
Singapore Police Force
DID: (65) 6478 4844



WARNING: "Privileged/Confidential information may be contained in this message. If you are not the intended addressee, you must not copy, distribute or take any action in reliance thereon. Communication of any information in this email to any unauthorized person is an offence under the Official Secrets Act (Cap 213). Please notify the sender immediately if you receive this in error."

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Tuesday, 15 January 2019 3:39 PM
To: Wei Yea LIM (SPF); assignments
Cc: Kim Pang CHAY (SPF); Kwee Huat TAN (SPF); Perry HE (SPF); Bernard SEAH (SPF); Peng Seng NG (SPF); Rashid ABU HASAN (SPF); SUR
Subject: RE: Appraisal Services for SPF vehicles at SMRT Automotive Services - HOMSPFETQ16000399 (QX496A)
Attachments: QX496A Photo.pdf; QX 496A.xls

Dear Wei Yea,

Please refer to the attachment of QX 496A.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Wei Yea LIM (SPF) <LIM_Wei_Yea@spf.gov.sg>
Sent: Monday, 7 January 2019 11:32 AM
To: assignments <assignments@lkkauto.com>
Cc: Kim Pang CHAY (SPF) <CHAY_Kim_Pang@spf.gov.sg>; Kwee Huat TAN (SPF) <TAN_Kwee_Huat@spf.gov.sg>; Perry HE (SPF) <Perry_HE@spf.gov.sg>; Bernard SEAH (SPF) <Bernard_SEAH@spf.gov.sg>; Peng Seng NG (SPF) <NG_Peng_Seng@spf.gov.sg>; Rashid ABU HASAN (SPF) <Rashid_Abu_Hasan@spf.gov.sg>; 'Ai Phing (LKKAUTO)' <aiphing@lkkauto.com>; Shiau Chan (LKKAUTO) <siewsc@lkkauto.com>
Subject: Appraisal Services for SPF vehicles at SMRT Automotive Services - HOMSPFETQ16000399 (QX496A)

Hi Catherine,

Please provide Appraisal Services for the following SPF vehicles at SMRT Automotive Services:

- **QX496A**

In attached, please find the recommended Parts and Labour required for the repair.

Kindly contact the following SMRT personnel for viewing of the damaged vehicle:

- Mr Kong Sew Kui
- Mr Jason Yeo

Thank you and best regards,

WeiYea LIM

Contract Management

AEMD, Police Logistics Department

Singapore Police Force

DID: (65) 6478 4844



WARNING: "Privileged/Confidential information may be contained in this message. If you are not the intended addressee, you must not copy, distribute or take any action in reliance thereon. Communication of any information in this email to any unauthorized person is an offence under the Official Secrets Act (Cap 213). Please notify the sender immediately if you receive this in error."



Scope Of Work
Home Team Agency

SCOPE OF WORK

1 To provide labour, materials, transportation, tools and parts and others deemed necessary to carry out the following repairs:

CONTRACTOR:	SMRT	VEH TYPE:	FRC	UNIT:	CHOA CHU KANG NPC	Reference No.	0496/SPF/4W/18/12/20
VEH NO:	QX496A	REPAIR TYPE:	ACCIDENT				
VEH MAKE/MODEL:	TOYOTA ALTIS	ODOMETER:	-			iLMS No.	1100016282

S/N	PARTS DESCRIPTION	PART COST (\$)	QTY	Mark Up Rate	Parts Cost Per Unit After Mark Up (\$)	Total Parts Cost Per Unit After Mark Up (\$)
1 Scope Of Repairs						
1.1	Front Bumper <i>TN</i>	\$234.00	1		234.00	234.00 ✓
1.2	Front LH Bumper Retainer <i>CRA</i>	\$30.00	1		30.00	30.00 ✓
1.3	Front RH Bumper Retainer <i>MIS</i>	\$30.00	1		30.00	30.00 ✓
1.4	Radiator Grill <i>CUT</i>	\$120.00	1		120.00	120.00 ✓
1.5	Front Bumper Lower Grill <i>MIS</i>	\$48.00	1		48.00	48.00 ✓
1.6	RHS Fog Lamp Cover <i>MIS</i>	\$36.00	1		36.00	36.00 ✓
1.7	LHS Fog Lamp Cover <i>MIS</i>	\$36.00	1		36.00	36.00 ✓
1.8	Front Bumper Reinforcement <i>DD</i>	\$138.00	1		138.00	138.00 ✓
1.9	RHS Reinforcement Bracket <i>DD</i>	\$24.00	1		24.00	24.00 ✓
1.10	LHS Reinforcement Bracket <i>DD</i>	\$24.00	1		24.00	24.00 ✓
1.11	Lock Panel <i>DEF</i>	\$48.00	1		48.00	48.00 ✓
1.12	Front Support Panel <i>BUC</i>	\$264.00	1		264.00	264.00 ✓
1.13	RHS Head Lamp <i>CRA</i>	\$180.00	1		180.00	180.00 ✓
1.14	LHS Head Lamp <i>CRA</i>	\$180.00	1		180.00	180.00 ✓
1.15	Radiator	\$456.00	1		456.00	456.00 ✓
1.16	Radiator Upper Hose	\$26.00	1		26.00	26.00 ✓
1.17	Radiator Lower Hose	\$26.00	1		26.00	26.00 ✓
1.18	Radiator Hose 2	\$24.00	1		24.00	24.00 ✓
1.19	Radiator Fan Blade	\$60.00	1		60.00	60.00 ✓
1.20	Radiator Fan Motor	\$108.00	1		108.00	108.00 ✓
1.21	Radiator Cowling	\$84.00	1		84.00	84.00 ✓
1.22	Radiator Fan Shroud <i>RST ? Repeat Item</i>	\$48.00	1		48.00	48.00 X
1.23	Radiator Spare Tank	\$72.00	1		72.00	72.00 ✓
1.24	Air-Con Condenser <i>DD</i>	\$360.00	1		360.00	360.00 ✓
1.25	Air-Con Condenser Pipe <i>BT</i>	\$192.00	1		192.00	192.00 ✓
1.26	Air-Con Discharge Hose <i>BT</i>	\$84.00	1		84.00	84.00 ✓
1.27	ABS Pump <i>CRA</i> <i>X Photo</i>	\$1,920.00	1		1920.00	1920.00 X ?
1.28	Bonnet Cover <i>BUC</i>	\$324.00	1		324.00	324.00 ✓
1.29	RHS Bonnet Cover Hinge <i>BT</i>	\$30.00	1		30.00	30.00 ✓
1.30	LHS Bonnet Cover Hinge <i>BT</i>	\$30.00	1		30.00	30.00 ✓
1.31	Bonnet Cover Lock Assy <i>MIS</i>	\$48.00	1		48.00	48.00 ✓
1.32	Bonnet Cover Insulator <i>MIS</i>	\$120.00	1		120.00	120.00 ✓
1.33	RHS Fender <i>BUC</i>	\$180.00	1		180.00	180.00 ✓
1.34	RHS Fender Lining <i>CUT</i>	\$72.00	1		72.00	72.00 ✓
1.35	LHS Fender <i>DD</i>	\$180.00	1		180.00	180.00 ✓
1.36	LHS Fender Lining <i>NN</i>	\$72.00	1		72.00	72.00 X
1.37	RHS Engine Under Cover <i>BUC</i>	\$78.00	1		78.00	78.00 ✓
1.38	Centre Engine Under Cover <i>NN</i>	\$72.00	1		72.00	72.00 X
1.39	LHS Engine Under Cover <i>NN</i>	\$78.00	1		78.00	78.00 X
1.40	Front Number Plate with Casing <i>MIS</i>	\$50.00	1		50.00	50.00 ✓
1.41	Front Bumper Clips <i>NEC</i>	\$2.50	9		2.50	22.50 ✓
1.42	Fender Lining Clips <i>NEC</i>	\$2.50	20		2.50	50.00 ✓
1.43	Bonnet Insulator Clips <i>NEC</i>	\$3.00	7		3.00	21.00 ✓
2 Additional Services						
2.1	NA	\$0.00	0	0%	0.00	0.00
Remarks:					Parts Total:	\$ 6,279.50

S/N	LABOUR DESCRIPTION	Man-Hour Rate (\$)	Man-Hour Qty	Total Man-Hour Cost (\$)
1 Scope Of Repairs				
1.1	Front Bumper, Radiator Grill, Lower Grill & Fog Lamp Cover:		7	0.00
	Remove & Replace Radiator Grill			
	Replace Front Bumper Lower Grill			
	Replace RHS Fog Lamp Cover			
	Replace LHS Fog Lamp Cover			
	Remove & Replace Front Bumper			
	Remove & Replace Both Side Front Bumper Retainers			
	Putty & Spray Paint for Front Complete Bumper (3 colours)			
1.2	Front Bumper Reinforcement, Reinforcement Brackets & Lock Panel		5	0.00
	Remove & Replace Front Bumper Reinforcement			

Name		Name		Name	
Date		Date		Date	
Sign		Sign		Sign	
All completed repairs must be verified by Home Team Contract Manager / Fleet Manager before payment can be made					

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

[Handwritten Signature]
10/1/19

Registration No. QX 496A

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
1	MATERIALS					
1.1	FRONT BUMPER	1	TORN	\$234.00	\$234.00	
1.2	FRONT LH BUMPER RETAINER	1	CRACKED	\$30.00	\$30.00	
1.3	FRONT RH BUMPER RETAINER	1	MISSING	\$30.00	\$30.00	
1.4	RADIATOR GRILL	1	CUT	\$120.00	\$120.00	
1.5	FRONT BUMPER LOWER GRILL	1	MISSING	\$48.00	\$48.00	
1.6	RHS FOG LAMP COVER	1	MISSING	\$36.00	\$36.00	
1.7	LHS FOG LAMP COVER	1	MISSING	\$36.00	\$36.00	
1.8	FRONT BUMPER REINFORCEMENT	1	DENTED	\$138.00	\$138.00	
1.9	RHS REINFORCEMENT BRACKET	1	DENTED	\$24.00	\$24.00	
1.10	LHS REINFORCEMENT BRACKET	1	DENTED	\$24.00	\$24.00	
1.11	LOCK PANEL	1	DEFORMED	\$48.00	\$48.00	
1.12	FRONT SUPPORT PANEL	1	BUCKLED	\$264.00	\$264.00	
1.13	RHS HEAD LAMP	1	CRACKED	\$180.00	\$180.00	
1.14	LHS HEAD LAMP	1	CRACKED	\$180.00	\$180.00	
1.15	RADIATOR	1	BUCKLED	\$456.00	\$456.00	
1.16	RADIATOR UPPER HOSE	1	BUCKLED	\$26.00	\$26.00	
1.17	RADIATOR LOWER HOSE	1	BUCKLED	\$26.00	\$26.00	
1.18	RADIATOR HOSE 2	1	BUCKLED	\$24.00	\$24.00	
1.19	RADIATOR FAN BLADE	1	BUCKLED	\$60.00	\$60.00	
1.20	RADIATOR FAN MOTOR	1	BUCKLED	\$108.00	\$108.00	
1.21	RADIATOR COWLING	1	BUCKLED	\$84.00	\$84.00	
1.22	RADIATOR FAN SHROUD	1	REPEATED	\$48.00	\$0.00	

1.23	RADIATOR SPARE TANK	1	BUCKLED	\$72.00	\$72.00
1.24	AIR-CON CONDENSER	1	DENTED	\$360.00	\$360.00
1.25	AIR-CON CONDENSER PIPE	1	BENT	\$192.00	\$192.00
1.26	AIR-CON DISCHARGE HOSE	1	BENT	\$84.00	\$84.00
1.27	ABS PUMP	1	UNCONFIRMED	\$1,920.00	\$0.00
1.28	BONNET COVER	1	BUCKLED	\$324.00	\$324.00
1.29	RHS BONNET COVER HINGE	1	BENT	\$30.00	\$30.00
1.30	LHS BONNET COVER HINGE	1	BENT	\$30.00	\$30.00
1.31	BONNET COVER LOCK ASSY	1	MISSING	\$48.00	\$48.00
1.32	BONNET COVER INSULATOR	1	MISSING	\$120.00	\$120.00
1.33	RHS FENDER	1	BUCKLED	\$180.00	\$180.00
1.34	RHS FENDER LINING	1	CUT	\$72.00	\$72.00
1.35	LHS FENDER	1	DENTED	\$180.00	\$180.00
1.36	LHS FENDER LINING	1	NOT NECESSARY	\$72.00	\$0.00
1.37	RHS ENGINE UNDER COVER	1	BUCKLED	\$78.00	\$78.00
1.38	CENTRE ENGINE UNDER COVER	1	NOT NECESSARY	\$72.00	\$0.00
1.39	LHS ENGINE UNDER COVER	1	NOT NECESSARY	\$78.00	\$0.00
1.40	FRONT NUMBER PLATE WITH CASING	1	MISSING	\$50.00	\$50.00
1.41	FRONT BUMPER CLIPS	9	NECESSARY	\$2.50	\$22.50
1.42	FENDER LINING CLIPS	20	NECESSARY	\$2.50	\$50.00
1.43	BONNET INSULATOR CLIPS	7	NECESSARY	\$3.00	\$21.00
2	SCOPE OF REPAIRS				
2.1	Front Bumper, Radiator Grill, Lower Grill & Fog Lamp Cover:				7
	Remove & replace radiator grill				
	Replace front bumper lower grill				
	Replace RHS fog lamp cover				
	Replace LHS fog lamp cover				
	Remove & replace front bumper				

	Remove & replace both side front bumper retainers								
	Putty & spray paint for front complete bumper (3 colours)								
2.2	Front Bumper Reinforcement, Reinforcement Brackets & Lock Panel:								5
	Remove & replace front bumper reinforcement								
	Remove & replace RHS reinforcement bracket								
	Remove & replace LHS reinforcement bracket								
	Replace lock panel								
2.3	Front Support Panel & Head Lamps:								5
	Remove & replace front support panel								
	Remove & replace RHS head lamp								
	Remove & replace LHS head lamp								
	Wiring for RHS head lamp								
	Wiring for LHS head lamp								
2.4	Radiator:								8
	Remove & replace radiator								
	Remove & replace radiator upper hose								
	Remove & replace radiator lower hose								
	Remove & replace radiator fan blade								
	Remove & replace radiator fan motor								
	Remove & replace radiator cowling								
	Remove & replace radiator spare tank								
	Top up coolant for radiator								
2.5	Air Con Condenser:								8
	Remove & replace air-con condenser								

[illegible]

[illegible]



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
AUTOMOTIVE ENGINEERING & MGT DIVISION		Ref : CS/SPF19000427/Jqbe2		
CONTRACT MANAGEMENT SECTION(SPORE POLICE FORCE) 1 MOUNT PLEASANT ROAD BLK 8 OLD POLICE ACADEMYSINGAPORE 298333		Date : 06-03-2019		
ATTN : LIM WEI YEA		Code : SPF3		
1. Policy Particulars :- OWN DAMAGE				
Insured Veh.	Veh. Inspected		QX 496A	
Policy No.	Coverage (\$)		0.00	
Claim No.	HOMSPFETQ16000399	Excess (\$)	0.00	
Assign From	LIM WEI YEA	Assign Date	07/01/2019	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA ALTIS	c.c	1598	
Engine No.	HIDDEN	Year of Reg.	2010	
Chassis No.	MR053ZEE106169075	Colour	WHITE	
Odometer	-	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	FALKEN	6 mm	
L/H Front Tyre	195/65 R15	FALKEN	6 mm	
R/H Rear Tyre	195/65 R15	FALKEN	6 mm	
L/H Rear Tyre	195/65 R15	FALKEN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	Inspection Date		09/01/2019	
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705			
5a. Remarks				



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Registration No. QX 496A

S/N	ITEM DESCRIPTION	PARTS				MAN- HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
1	MATERIALS					
1.1	FRONT BUMPER	1	TORN	\$234.00	\$234.00	
1.2	FRONT LH BUMPER RETAINER	1	CRACKED	\$30.00	\$30.00	
1.3	FRONT RH BUMPER RETAINER	1	MISSING	\$30.00	\$30.00	
1.4	RADIATOR GRILL	1	CUT	\$120.00	\$120.00	
1.5	FRONT BUMPER LOWER GRILL	1	MISSING	\$48.00	\$48.00	
1.6	RHS FOG LAMP COVER	1	MISSING	\$36.00	\$36.00	
1.7	LHS FOG LAMP COVER	1	MISSING	\$36.00	\$36.00	
1.8	FRONT BUMPER REINFORCEMENT	1	DENTED	\$138.00	\$138.00	
1.9	RHS REINFORCEMENT BRACKET	1	DENTED	\$24.00	\$24.00	
1.10	LHS REINFORCEMENT BRACKET	1	DENTED	\$24.00	\$24.00	
1.11	LOCK PANEL	1	DEFORMED	\$48.00	\$48.00	
1.12	FRONT SUPPORT PANEL	1	BUCKLED	\$264.00	\$264.00	
1.13	RHS HEAD LAMP	1	CRACKED	\$180.00	\$180.00	
1.14	LHS HEAD LAMP	1	CRACKED	\$180.00	\$180.00	
1.15	RADIATOR	1	BUCKLED	\$456.00	\$456.00	
1.16	RADIATOR UPPER HOSE	1	BUCKLED	\$26.00	\$26.00	
1.17	RADIATOR LOWER HOSE	1	BUCKLED	\$26.00	\$26.00	
1.18	RADIATOR HOSE 2	1	BUCKLED	\$24.00	\$24.00	
1.19	RADIATOR FAN BLADE	1	BUCKLED	\$60.00	\$60.00	
1.20	RADIATOR FAN MOTOR	1	BUCKLED	\$108.00	\$108.00	
1.21	RADIATOR COWLING	1	BUCKLED	\$84.00	\$84.00	
1.22	RADIATOR FAN SHROUD	1	REPEATED	\$48.00	\$0.00	
1.23	RADIATOR SPARE TANK	1	BUCKLED	\$72.00	\$72.00	
1.24	AIR-CON CONDENSER	1	DENTED	\$360.00	\$360.00	
1.25	AIR-CON CONDENSER PIPE	1	BENT	\$192.00	\$192.00	
1.26	AIR-CON DISCHARGE HOSE	1	BENT	\$84.00	\$84.00	

1.27	ABS PUMP	1	UNCONFIRMED	\$1,920.00	\$0.00	
1.28	BONNET COVER	1	BUCKLED	\$324.00	\$324.00	
1.29	RHS BONNET COVER HINGE	1	BENT	\$30.00	\$30.00	
1.30	LHS BONNET COVER HINGE	1	BENT	\$30.00	\$30.00	
1.31	BONNET COVER LOCK ASSY	1	MISSING	\$48.00	\$48.00	
1.32	BONNET COVER INSULATOR	1	MISSING	\$120.00	\$120.00	
1.33	RHS FENDER	1	BUCKLED	\$180.00	\$180.00	
1.34	RHS FENDER LINING	1	CUT	\$72.00	\$72.00	
1.35	LHS FENDER	1	DENTED	\$180.00	\$180.00	
1.36	LHS FENDER LINING	1	NOT NECESSARY	\$72.00	\$0.00	
1.37	RHS ENGINE UNDER COVER	1	BUCKLED	\$78.00	\$78.00	
1.38	CENTRE ENGINE UNDER COVER	1	NOT NECESSARY	\$72.00	\$0.00	
1.39	LHS ENGINE UNDER COVER	1	NOT NECESSARY	\$78.00	\$0.00	
1.40	FRONT NUMBER PLATE WITH CASING	1	MISSING	\$50.00	\$50.00	
1.41	FRONT BUMPER CLIPS	9	NECESSARY	\$2.50	\$22.50	
1.42	FENDER LINING CLIPS	20	NECESSARY	\$2.50	\$50.00	
1.43	BONNET INSULATOR CLIPS	7	NECESSARY	\$3.00	\$21.00	
2	SCOPE OF REPAIRS					
2.1	Front Bumper, Radiator Grill, Lower Grill & Fog Lamp Cover:					7
	Remove & replace radiator grill					
	Replace front bumper lower grill					
	Replace RHS fog lamp cover					
	Replace LHS fog lamp cover					
	Remove & replace front bumper					
	Remove & replace both side front bumper retainers					
	Putty & spray paint for front complete bumper (3 colours)					
2.2	Front Bumper Reinforcement, Reinforcement Brackets & Lock Panel:					5
	Remove & replace front bumper reinforcement					
	Remove & replace RHS reinforcement bracket					
	Remove & replace LHS reinforcement bracket					

	Replace lock panel					
2.3	Front Support Panel & Head Lamps:					5
	Remove & replace front support panel					
	Remove & replace RHS head lamp					
	Remove & replace LHS head lamp					
	Wiring for RHS head lamp					
	Wiring for LHS head lamp					
2.4	Radiator:					8
	Remove & replace radiator					
	Remove & replace radiator upper hose					
	Remove & replace radiator lower hose					
	Remove & replace radiator fan blade					
	Remove & replace radiator fan motor					
	Remove & replace radiator cowl					
	Remove & replace radiator spare tank					
	Top up coolant for radiator					
2.5	Air Con Condenser:					8
	Remove & replace air-con condenser					
	Remove & replace air-con condenser pipes					
	Top up air-con gas					
2.6	ABS Pump:					8
	Remove & replace ABS pump					
2.7	Bonnet Cover:					6
	Remove & replace bonnet cover					
	Remove & replace both side bonnet cover hinges					
	Remove & replace bonnet cover lock					

	Replace bonnet cover insulator					
	Replace bonnet cover "POLICE" wording sticker (To be provided by AEMD) Putty & spray paint for bonnet cover (2 colour)					
2.8	RHS Fender:					4
	Remove & replace RHS fender					
	Replace RHS fender lining					
	Putty & spray paint for RHS fender					
2.9	LHS Fender:					4
	Remove & replace LHS fender					
	Replace LHS fender lining					
	Putty & spray paint for LHS fender					
2.10	Engine Under Cover & Front Number Plate:					2
	Replace RHS engine under cover					
	Replace centre engine under cover					
	Replace LHS engine under cover					
	Replace front number plate					
2.11	Wheel Alignment					2
COSTING		TOTAL PARTS COST			\$4,089.50	
		TOTAL MAN-HOUR				59

Registration No. QX 496A

Registration No. QX 496A

Vehicle Inspected By

ONG HWEE JIE
Automotive Assessor

ADRIAN LING WAI PING
B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI
Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.