


Vic

Section A - Accident Details	
Registration Number	SHF187T
Case Reference Number	TAX/01/19/2053
Registration Date	12/12/2017
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS4
Name of Driver	TOH HONG LIM
Type of Accident	Head to Rear
Accident Date and Time	11/1/2019 5:30 PM
Accident Reported Date and Time	12/1/2019 11:01 AM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24099655
Special instruction to ARC, if any	DROVE IN/LONPAC
Prepared Date and Time	14/1/2019 12:49 PM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

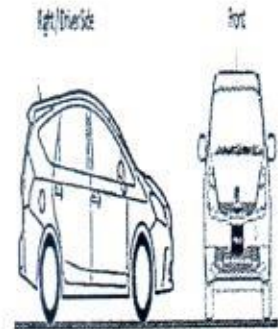

Quotation

Section B - Summary of Repair Estimates		
Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$1,214.00	\$500.00
Total Spray Cost	\$1,856.00	\$450.00
Total Spare Part Cost	\$5,962.22	\$2,096.56
Total Other Cost	\$600.00	\$110.00
TOTAL COST	\$9,632.22	\$3,156.56 (P/P)
Lump Sum Total	\$0.00	\$0.00
Number of Repair Days	7.0	4.0
Prepared / Adjusted By	Kim Ming Chin	Hwee Jie (LKK) / LONPAC
ARC / Surveyor Sign Off Date	14/01/2019 1:38 PM	14/01/2019 4:45 PM
Signature		
Remarks	P/P repair. Photo before paint.	

Section C - Quotation and Accident Invoice Details

Quotation Number	QN-1904-0333	Invoice Number	
Quotation Date	25.04.2019	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION	\$200.00	\$100.00
TO REPAIR REAR PORTION	\$1,014.00	\$400.00
Total Labour	\$1,214.00	\$500.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY REAR PANEL	\$180.00	\$100.00
TO RESPRAY REAR BUMPER	\$378.00	\$200.00
TO RESPRAY FILLER RR BUMPER LH	\$180.00	\$0.00
TO RESPRAY FILLER RR BUMPER RH	\$180.00	\$50.00
TO RESPRAY REAR PANEL	\$200.00	\$0.00
TO RESPRAY TAIL GATE	\$378.00	\$0.00
TO RESPRAY TAILGATE OUTSIDE GARNISH	\$180.00	\$100.00
TO RESPRAY BUMPER BEAM	\$180.00	\$0.00
Total Spray Painting & Panel Beating	\$1,856.00	\$450.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$20.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00	\$30.00
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	\$120.00	\$30.00
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	\$120.00	\$30.00
TO WASH AND VACUUM	\$60.00	\$0.00
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
Total Other Costs	\$600.00	\$110.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		5215947913	COVER, RR BUMPER ASSY	1.00	\$423.90	25.00	\$317.93	Replace	Replace
			PIXEL STICKER	2.00	\$60.00	0.00	\$120.00	Replace	Replace
		5202347030	REAR BUMPER REINFORCEMENT	0.00	\$318.80	0.00	\$0.00	Replace	Check
			SENSOR REVERSE	1.00	\$180.00	0.00	\$180.00	Replace	Replace
		8999730100	ANTENNA, ELECTRICAL KEY	0.00	\$60.30	0.00	\$0.00	Replace	Check
		5246247030	PAD, RR BUMPER, RH & LH, 1	2.00	\$3.80	25.00	\$5.70	Replace	Replace
		5246247020	PAD, RR BUMPER, RH & LH, 2	2.00	\$3.80	25.00	\$5.70	Replace	Replace

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
60 Woodlands Industrial Park E4, Singapore 757705
FAX Number : 63995592
Estimator Telephone Number : 68662822
Accident Reporting Number : 08662672

Date Generated : 25/04/2018
User ID : PohSuan

5246247010	PAD, RR BUMPER, RH & LH, 3	2.00	\$3.80	25.00	\$5.70	Replace	Replace	
5219147030	SEAL, RR BUMPER ARM, RH & LH	0.00	\$11.00	0.00	\$0.00	Replace	Not Given	X
5259968030	STOPPER, RR BUMPER, RH & LH	0.00	\$4.30	0.00	\$0.00	Replace	Not Given	X
5257547040	RETAINER, RR BUMPER, RH	0.00	\$112.70	0.00	\$0.00	Replace	Not Given	X
5257647040	RETAINER, RR BUMPER, LH	0.00	\$111.50	0.00	\$0.00	Replace	Not Given	X
5259147050	SEAL, RR BUMPER, RH	0.00	\$85.20	0.00	\$0.00	Replace	Not Given	X
5259247040	SEAL, RR BUMPER, LH	0.00	\$85.20	0.00	\$0.00	Replace	Not Given	X
5216116010	CLIPS PIECE, FRT & RR BUMPER	10.00	\$1.50	25.00	\$11.25	Replace	Replace	X
9046706206C0	CLIP SEAL, RR BUMPER, RH & LH	0.00	\$2.00	0.00	\$0.00	Replace	Not Given	X
5245347010	GUARD, RR BUMPER, LOWER	1.00	\$558.30	25.00	\$418.73	Replace	Replace	
5216947020	COVER, GUARD RR BUMPER LOWER	1.00	\$14.80	25.00	\$11.10	Replace	Replace	
5246147010	PAD, RR BUMPER, CTR	3.00	\$2.20	25.00	\$4.95	Replace	Replace	
5256547900	FILLER, RR BUMPER, RH	1.00	\$119.90	25.00	\$89.93	Replace	Replace	
5256647900	FILLER, RR BUMPER, LH	0.00	\$119.90	0.00	\$0.00	Replace	Not Given	X
7539235220	RETAINER, OUTSIDE, RH & LH	2.00	\$3.30	25.00	\$4.95	Replace	Replace	
5830747090	END PANEL SUB-ASSY, BODY LOWER BACK	0.00	\$629.60	0.00	\$0.00	Replace	Check	X
5839847050	COVER, REAR FLOOR UNDER, RH	0.00	\$169.50	0.00	\$0.00	Replace	Not Given	X
5839947030	COVER, REAR FLOOR UNDER, LH	0.00	\$234.30	0.00	\$0.00	Replace	Not Given	X
6625947010	COVER, REAR FLOOR UNDER CENTER	0.00	\$222.60	0.00	\$0.00	Replace	Not Given	X
6700547440	TAIL GATE PANEL SUB-ASSY, BACK DOOR	0.00	\$929.60	0.00	\$0.00	Replace	Not Given	X
6935047050	TAIL GATE LOCK ASSY, BACK DOOR	0.00	\$452.10	0.00	\$0.00	Replace	Not Given	X
6932147010	TAIL GATE LOCK COVER, BACK DOOR	0.00	\$25.30	0.00	\$0.00	Replace	Not Given	X
6943052050	TAIL GATE STRIKER ASSY, BACK DOOR	1.00	\$24.90	25.00	\$18.68	Replace	Replace	
768014710A1	TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-	1.00	\$891.20	100.00	\$0.00	Replace	Repair	
7540348010	EMBLEM SUB-ASSY REAR	1.00	\$46.30	25.00	\$34.73	Replace	Replace	
7544147090	NAME PLATE (HYBRID), LUGGAGE	1.00	\$52.30	25.00	\$39.23	Replace	Replace	
7544247130	NAME PLATE (PRIUS), LUGGAGE	1.00	\$52.30	25.00	\$39.23	Replace	Replace	
	STICKER SMRT LOGO	1.00	\$7.60	0.00	\$7.60	Replace	Replace	
	STICKER DECAL 6555 8888	1.00	\$21.60	0.00	\$21.60	Replace	Replace	
6947847010	TAIL GATE CUSHION, BACK DOOR, RH & LH	0.00	\$8.20	0.00	\$0.00	Replace	Not Given	X
8155147281	LENS & BODY, REAR COMBINATION LAMP, RH	0.00	\$438.10	0.00	\$0.00	Replace	Not Given	X
8158147010	LENS & BODY ASSY, RR BUMPER, RH	1.00	\$486.80	10.00	\$438.12	Replace	Replace	
	SEALANT SIKAFLEX	0.00	\$37.00	0.00	\$0.00	Replace	Check	X
Total			\$7,015.90		\$1,775.33			

2096.56
+ 500.00
+ 560.00
3156.56

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
		52023-12240	BUMPER REINFORCEMENT REAR	1.00	\$205.70	25.00	\$154.28	Replace	Replace
		6625947010	COVER, REAR FLOOR UNDER CENTER	1.00	\$222.60	25.00	\$166.95	Replace	Replace
Total					428.30		321.23		