

SURVEYOR COPY

AH LIM Motor Company
#01-09, AMK Autopoint, 10 Ang
Mo Kio Ind. Park 2A
568047

Claim Reference:
Assessment number: SGW9751C
Version: 1712
Date calculated: 01/15/2019 02:09 PM

Full Report
Registration: SGW9751C
Printed: 01/15/2019 2:09 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	AXA Insurance Pte Ltd
Printed by:	Kee Mui Hong	Currency:	SGD
Claim Reference:		Date of Incident:	2019-01-11
Estimated Repair Time:	5	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	MITSUBISHI		
Model:	LANCER (CY,CX)		
Sub Model:	GLS		
Model Sheet Number:	32 39 09		
Registration:	SGW9751C		
VIN number:	JMYSTCY4A8U000563		
Odometer:			
Model Specs			
2.0 LTR 110-118KW	4-DOOR SALOON	PREPARE OFF VEHICLE	

3 Days.
lumpsum repair.
After repair photos.
Guo Qiang - 82880282
17/1/19.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

AH LIM Motor Company
#01-09, AMK Autopoint, 10 Ang
Mo Kio Ind. Park 2A
568047

Claim Reference:
 Assessment number: SGW9751C
 Version: 1712
 Date calculated: 01/15/2019 02:09 PM

Full Report
 Registration: SGW9751C
 Printed: 01/15/2019 2:09 PM


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
 Date of Inspection:

Damage Areas

- All
 Underbody

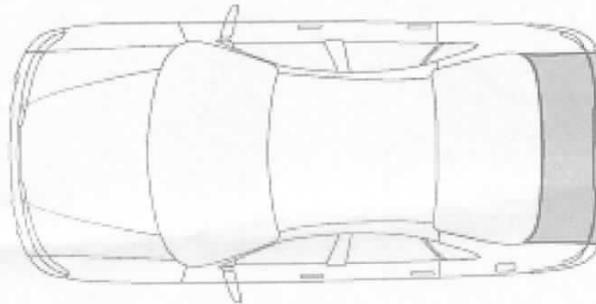

Labour

Code	Description	Time Base 10 WU/h	Price = 45.00 SGD/h	
			WU	Price SGD
NO NUMBER	PREPARATION TIME		2.0	9.00
514210 10)	R + R REAR BUMPER		4.0	18.00
514210 10)	REAR BUMPER (REMOVED) RENEW INCLUDES: REQUIRED ATTACHED PARTS REMOVE AND REFIT		3.0	13.50
NO NUMBER	R + R REAR BUMPER REINFORCEMENT (BUMPER REMOVED)		2.0	9.00
153510 10)	R + R MAIN EXHAUST SECTION		5.0	22.50
2711	REAR PANEL REPAIR ?		? 40.0*	180.00
Labour Cost			Hrs	WU
Panel / Mechanical Labour			5.60	56.0
Total of Labour				252.00

AH LIM Motor Company
#01-09, AMK Autopoint, 10 Ang
Mo Kio Ind. Park 2A
568047

Claim Reference:
 Assessment number: **SGW9751C**
 Version: **1712**
 Date calculated: **01/15/2019 02:09 PM**

Full Report
 Registration: **SGW9751C**
 Printed: **01/15/2019 2:09 PM**

Paint

Paint Work		SYSTEM AZT	Time Basis 10WU/h	
Code	Description		WU	Price SGD
	REAR COVER BUMPER NEW PART PAINT K1R		13.0	
	REAR PANEL REPAIR PAINTING >50%		16.0	
	BOOTLID SURFACE PAINT		8.0	

Paint Material Per Part

Code	Description	Price SGD
2583	REAR COVER BUMPER NEW PART PAINT K1R	57.24
2711	REAR PANEL REPAIR PAINTING >50%	13.48
2931	BOOTLID SURFACE PAINT	16.72

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	45.00 SGD/h		
Time Paint		37.0	
Preparation Main Work Metal	1.90	19.0	85.50
Preparation Comp. Work Plastic	0.30	3.0	13.50
Total		59.0	265.50

Material Cost - Paint

	Price SGD
New Part Painting - Plastic K1R	57.24
Repair Painting	13.48
Surface-/Blend Paint	16.72
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	125.04

Spare Parts

				prices as at 2015-06-01
Code	Description	Part Number	Supplier	Price SGD
2583	REAR COVER BUMPER	6410B220WA	- re.	300.00
2641	L/R BUMPER REINF	6410C543	x } NN	10.00
2642	R/R BUMPER REINF	6410C544	x } NN	10.00
2644	REAR BUMPER SUPPORT	6410B929	? i	120.00
2672	R/R REFLECTOR	8355A040	i	15.00
8834	EXH PIPE ORNAMENTAL	1570A700	- Ant.	70.00

AH LIM Motor Company
#01-09, AMK Autopoint, 10 Ang
Mo Kio Ind. Park 2A
568047

Claim Reference:
Assessment number: SGW9751C
Version: 1712
Date calculated: 01/15/2019 02:09 PM

Full Report
Registration: SGW9751C
Printed: 01/15/2019 2:09 PM

Code	Description	Part Number	Supplier	Price SGD	
1000	RR BUMPER TOW CVR	1 / <i>M's</i>		15.00	
1001	RR BUMPER CLIPS (20)	1 / <i>MCL</i>		30.00	
f: OEM Parts				Savings	0.00
n: Non-OEM Parts				Subtotal	570.00
u: Used parts				Addition(+15.00%)	85.50
Total				655.50	

Extras

Code	Description	Price SGD
1002	CHECK WIRING <i>X NN</i>	40.00*
1003	REVERSE SENSOR (2) <i>?</i>	200.00*
Total Extras		240.00

Final Calculation

	SGD	SGD
Parts	570.00	
Addition(+15.00%)	85.50	
Total Parts		655.50
Labour Time Base 10 WU/h		
Total 56.0 WU X 45.00 SGD/h	252.00	
Total of Labour		252.00
Total Of Extras		240.00
Paint Work Time Base 10 WU/h		
Labour Cost 59.0 WU X 45.00 SGD/h	265.50	
Material Cost	125.04	
Total Paint Including Material		390.54
Repair Cost Excludes GST		1,538.04
GST (+7.0%)		107.66
Repair Cost Included GST		1,645.70

**AH LIM Motor Company
#01-09, AMK Autopoint,10 Ang
Mo Kio Ind. Park 2A
568047**

Claim Reference:

Assessment number: SGW9751C

Version: 1712

Date calculated: 01/15/2019 02:09 PM

Full Report

Registration: SGW9751C

Printed: 01/15/2019 2:09 PM

Comments

* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS