

ASSIGNMENT

Date: **17/01/19**

Estimated Cost: **0**

To inspect Vehicle No: **SMC 2926X**

at Workshop no: **Premium**

of: **55 Ubi Rd 1**

Insured:

Policy No: **1800069946**

Claims No: **860142035256**

Sum Insured: **600** Excess: **18/1/19**

(Client's Record)

Make of Veh: **SMC**

(Policy Condition)

Remark: **The veh had commenced its repair at the time of inspection.**

Bal. or Market Value: **122k**

IDAC Accident Rpt: Consistent? **Yes** or No

GIA / PR Seen: ****** Consistent? **Yes** or No

Est. Repairs: **26** days Res: **Yes** or No

Lum Sum: **%** 3 Val: **Yes** or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: **IN / OUT**

Veh No: **SMC 2926X** Reg: **2018 June**

Type: **M/Car** / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover / Truck / Trailer or

Make: **Audi A3 Sedan** c.c. **999**

Colour: **Grey** A/C: **Insured / Std / NI / NA**

Sp. Roading: **12207** T/Radio: **Insured / Std / NI / NA**

Eng/No: _____

C/No: **WAAU2728V4J1074077**

Gen. Cond: **Good** / Fair / Poor / Burnt

Steering: **Ins** / Jammed / Leaked / Burnt or

Brake: **Ins** / Jammed / Leaked / Burnt or

Mod: **Nil** / STD A/Rim or

Tyre Size: F: **205/55R16**
R: **205/55R16**


BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front	Rear
R/Bal. 06 mm	R/Bal. 06 mm
L/Bal. 06 mm	L/Bal. 06 mm
D.O.A. _____	D.O.I. 17/01/19

Survey held at: **Premium**

Des. of Damages: **FR** / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision

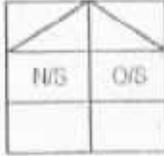

Date / Time Action / Instruction

07 Alfa

SMC 2926X - NA / TH 19000818/13

18/1/19 @ 6.07pm revert to victor via premium.

22/1/19 @ 12.33pm Andy informed via premium

22/1/19 @ 2.03pm informed Sheila c/a not more than \$70k on fip basis @ \$5.600.

31/01/19 @ 5.51pm confirmed with Carnive from fip \$6457.44, 26 days.
(Red \$33585.56, 34%)

Def: 13012019

RECEIVED 27 NOV 2019

Time/Time, File Pass to? Preli. Report

1) **26/11/19** Final Report

Days Of Repair: **26**

Resurvey No. of Trip: _____

Survey Fee: **200**

Transportation: _____

Add Fee: Site Insp (\$)

Interview (\$)

Tech Invs (\$)

Weekend (\$)

Report Format: **Micro**

Lump Sum / L.B.F: (\$) **64457.44**

TOTAL	211
-------	------------

Shiau Chan (LKKAuto)

From: Shiau Chan (LKKAuto)
Sent: Thursday, 31 October 2019 5:51 PM
To: Boo seng yak; SUR; Carrine Leong; Chang Chee Sing;
jjayee.yap@premiumauto.com.sg
Subject: RE: FINAL REVISION - SMC2926X - OD AIG - SURVEYED 17 JAN 19

Dear Carrine,

Please ignore previously email.

WITHOUT PREJUDICE

Confirm final fig \$64,457.44 before excess \$600.00 & GST and 26 repair days.

Kindly expedite the discharge voucher and tax invoice to us for close case.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Boo seng yak <boojohnny@gmail.com>
Sent: Monday, 23 September 2019 6:20 PM
To: Adrian Ling (LKKAuto) <adrianling@lkkauto.com>; Shiau Chan (LKKAuto) <siewsc@lkkauto.com>; SUR <sur@lkkauto.com>; Carrine Leong <carrine.leong@premiumauto.com.sg>; Chang Chee Sing <claims@premiumauto.com.sg>; jjayee.yap@premiumauto.com.sg
Subject: FINAL REVISION - SMC2926X - OD AIG - SURVEYED 17 JAN 19

Hi Adrian and all,

Revised estimate and photo file is attached.

Please confirm repair cost of \$65,457.44 @ 31 days of repairs exclude 7 Sundays.

Your closure is well appreciated.

Best regards - jb

Claim Audit

AUDIT TRAIL				
No.	On	Audit	Remarks	By
1	14 Jan 2019 18:04	Cim Veh Model Changed		[] Merimen Administrator
2	14 Jan 2019 18:04	Cim Created	Reg No: SMC2926X, Policy No: 1800069946, Acct Date: 2019/01/13, Claim Type: S C. Insurer: AIG Asia Pacific Insurance Pte. Ltd. (SG). Ins.Status => Notification. Cr eated from SAS:MPA119006350	[1] Merimen Administrator
3	17 Jan 2019 16:05	Cim Registration Modified	Setl.Type:3->0, Claim Type:SC->OD.	[] CATHERINE CHONG KAI LING
4	17 Jan 2019 16:05	Adj Cim Retrieved	Adj: LKK Auto Consultants Pte Ltd (HQ)	[] CATHERINE CHONG KAI LING
5	17 Jan 2019 16:05	Adj Co Assigned	LKK Auto Consultants Pte Ltd (HQ):	[A] CATHERINE CHONG KAI LING
6	17 Jan 2019 16:05	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2019/01/28	[A] CATHERINE CHONG KAI LING
7	17 Jan 2019 16:05	Adj Mandate Set	Approved:8000.00.Reinsp:Adj decides.	[A] CATHERINE CHONG KAI LING
8	17 Jan 2019 16:05	Cim Registration Modified	Rep:1137->200611.	[A] CATHERINE CHONG KAI LING
9	17 Jan 2019 16:05	Cim Veh Model Changed	(206113) AUDI A3 999cc SEDAN TFSI (A).	[A] CATHERINE CHONG KAI LING
10	17 Jan 2019 16:05	Adj Adjuster Assigned	[None] -> ADRIAN LING	[A] CATHERINE CHONG KAI LING
11	18 Jan 2019 10:54	Adj Rpt Initiated		[A] SHIAU CHAN
12	18 Jan 2019 10:54	Cim Dtl Modified	JPJ Reg. Date: -> 2018/06/28.	[A] SHIAU CHAN
13	18 Jan 2019 10:54	Cim Details Notified		[A] SHIAU CHAN
14	18 Jan 2019 11:44	Cim Registration Modified	Init.Est.->6,000 - 7,000, Excess: -> 600.00, 2F Remarks: -> Not Applicable. GST: -> 7.00.	[1] Dally Amri, Mimi Zarina
15	18 Jan 2019 11:44	Label Added	(20226):Coverage Confirmed.	[A] Merimen Administrator
16	18 Jan 2019 18:06	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2019/01/28	[A] SHIAU CHAN
17	18 Jan 2019 18:07	Adj Mandate Request	Cur.Req:79681.00:DAMAGES CONSISTENT. REPAIR COST ECONOMICAL (NEW CAR PRICE) WE HAVE NOT AUTHORISE REPAIR.	[A] SHIAU CHAN
18	22 Jan 2019 12:33	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2019/01/28, Mandate Remarks: to commence repairs, all damaged/check items to be quantified with photographs.	[1] Fong, Andy-SY
19	22 Jan 2019 12:33	Adj Mandate Set	Approved:79681.00:to commence repairs, all damaged/check items to be quantifie d with photographs.	[1] Fong, Andy-SY
20	08 Oct 2019 15:35	Adj Mandate Request	Cur.Req:64457.44:KINDLY APPROVE REPAIR COST OF \$64,457.44.	[A] SHIAU CHAN
21	31 Oct 2019 16:22	Adj Mandate Set	Approved:64457.44.	[1] Fong, Andy-SY

Date From



Date To



Audit Type None

Go

ACTIVITY

No record

Merimen Billing for this case - Transaction History

Bill Ref No	Bill Date	Bill Type	Acc Type	Acc Name	Co Name (Branch)	Ref 1	Ref 2	Amount
2033493	18 Jan 2019 10:54:38	OD/TP Case (Adjuster)	Motor	LKK Auto Consultants Pte Ltd	LKK Auto Consultants Pte Ltd (HQ)	SMC2926X		10.70

Shiau Chan (LKKAuto)

From: Shiau Chan (LKKAuto)
Sent: Wednesday, 23 January 2019 2:03 PM
To: Claims; SUR
Subject: RE: OD claim for SMC 2926 X
Attachments: SMC2926 EST.pdf

Dear Sheila,

As instructed by our client, please proceed to repair the insured vehicle **SMC 2926X** at repair cost not more than **\$79,000.00 on part by part basis. (Excess \$600/-).**

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Shiau Chan (LKKAuto)
Sent: Tuesday, 22 January 2019 8:55 AM
To: Claims <claims@premiumauto.com.sg>; SUR <sur@lkkauto.com>; Admin A <admin-a@lkkauto.com>
Subject: RE: OD claim for SMC 2926 X

Dear Sheila,

Please be informed that we are still pending for insurance's mandate approval. Once approve, we will send you an email.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims <claims@premiumauto.com.sg>
Sent: Tuesday, 22 January 2019 8:05 AM
To: 'Claims' <claims@premiumauto.com.sg>; SUR <sur@lkkauto.com>; Admin A <admin-a@lkkauto.com>
Subject: RE: OD claim for SMC 2926 X

Dear All ,

Please advise on repair approval soonest.

Claim Audit

AUDIT TRAIL				
No.	On	Audit	Remarks	By
1	14 Jan 2019 18:04	Cim Veh Model Changed		[] Merimen Administrator
2	14 Jan 2019 18:04	Cim Created	Reg No: SMC2926X, Policy No: 1800069946, Acct Date: 2019/01/13, Claim Type: S C, Insurer: AIG Asia Pacific Insurance Pte, Ltd, (SG), Ins.Status => Notification, Cr eated from SAS:MPA119006350	[1] Merimen Administrator
3	17 Jan 2019 16:05	Cim Registration Modified	Setl.Type:3->0, Claim Type:SC->OD.	[] CATHERINE CHONG KAI LING
4	17 Jan 2019 16:05	Adj Cim Retrieved	Adj: LKK Auto Consultants Pte Ltd (HQ)	[] CATHERINE CHONG KAI LING
5	17 Jan 2019 16:05	Adj Co Assigned	LKK Auto Consultants Pte Ltd (HQ):	[A] CATHERINE CHONG KAI LING
6	17 Jan 2019 16:05	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2019/01/28	[A] CATHERINE CHONG KAI LING
7	17 Jan 2019 16:05	Adj Mandate Set	Approved:8000.00.Reinsp:Adj decides.	[A] CATHERINE CHONG KAI LING
8	17 Jan 2019 16:05	Cim Registration Modified	Rep:1137->200611.	[A] CATHERINE CHONG KAI LING
9	17 Jan 2019 16:05	Cim Veh Model Changed	(206113) AUDI A3 999cc SEDAN TFSI (A).	[A] CATHERINE CHONG KAI LING
10	17 Jan 2019 16:05	Adj Adjuster Assigned	[None] -> ADRIAN LING	[A] CATHERINE CHONG KAI LING
11	18 Jan 2019 10:54	Adj Rpt Initiated		[A] SHIAU CHAN
12	18 Jan 2019 10:54	Cim Dtl Modified	JPJ Reg. Date: -> 2018/06/28.	[A] SHIAU CHAN
13	18 Jan 2019 10:54	Cim Details Notified		[A] SHIAU CHAN
14	18 Jan 2019 11:44	Cim Registration Modified	Init.Est.:->6,000 - 7,000, Excess: -> 600.00, 2F Remarks: -> Not Applicable, GST: -> 7.00.	[I] Dally Amri, Mimi Zarina
15	18 Jan 2019 11:44	Label Added	(20226):Coverage Confirmed.	[A] Merimen Administrator
16	18 Jan 2019 18:06	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2019/01/28	[A] SHIAU CHAN
17	18 Jan 2019 18:07	Adj Mandate Request	Cur.Req:79681.00:DAMAGES CONSISTENT, REPAIR COST ECONOMICAL (NEW CAR PRICE) WE HAVE NOT AUTHORISE REPAIR.	[A] SHIAU CHAN
18	22 Jan 2019 12:33	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2019/01/28, Mandate Remarks: to commence repairs, all damaged/check items to be quantified with photographs.	[I] Fong, Andy-SY
19	22 Jan 2019 12:33	Adj Mandate Set	Approved:79681.00:to commence repairs, all damaged/check items to be quantifie d with photographs.	[I] Fong, Andy-SY

Date From



Date To



Audit Type None

Go

ACTIVITY

No record

Merimen Billing for this case - Transaction History

Bill Ref No	Bill Date	Acc Type	Acc Name	Co Name (Branch)	Ref 1	Ref 2	Amount
2033493	18/01/2019 10:54	Motor	LKK Auto Consultants Pte Ltd	LKK Auto Consultants Pte Ltd (HQ)	SMC2926X		10.70

Note: This document has not been finalised.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Dally Amri, Mimi Zarina

Date: 18 Jan 2019

Preliminary Advice

Vehicle No	: SMC2926X	Accident Date	: 13/01/2019
Make	: AUDI A3	Policy No.	: 1800069946
Assignment Date	: 17/01/2019	Excess	: S\$600.00
Date of Inspection	: 17/01/2019	Est. Duration of Repair	: 18.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (UBI) 55 UBI ROAD 1 SINGAPORE 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	92,203.00
Revised Amount	:S\$	62,912.00
Check Items (Estimated)	:S\$	16,769.00
Total	:S\$	79,681.00
Lump Sum Repair	:S\$	

Total Loss Consideration

New for Old Value	:S\$	136,440.00
Pre-Accident Value	:S\$	122,000.00
COE / PARF Rebate	:S\$	51,601.00
Salvage Value	:S\$	
Margin for Repair (New for Old Value)	:S\$	84,839.00
Margin for Repair (Pre-Accident Value)	:S\$	70,399.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	4547A
Vehicle Details	
Vehicle No.:	SMC2926X
Vehicle to be Exported:	No
Intended Deregistration Date:	18 Jan 2019
Vehicle Make:	AUDI
Vehicle Model:	A3 SEDAN 1.0 TFSI S TRONIC (LED)
Primary Colour:	Grey
Manufacturing Year:	2018
Engine No.:	CHZ474413
Chassis No.:	WAUZZZ8V4J1074077
Maximum Power Output:	85.0 kW (113 bhp)
Open Market Value:	\$22,104.00
Original Registration Date:	28 Jun 2018
First Registration Date:	28 Jun 2018
Transfer Count:	0
Actual ARF Paid:	\$22,946.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	27 Jun 2028
PARF Rebate Amount:	\$17,209.00
Intended COE Rebate Details	
COE Expiry Date:	27 Jun 2028
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$36,426.00
COE Rebate Amount:	\$34,392.00
Total Rebate Amount:	\$51,601.00

The information contained herein is correct as at 18 Jan 2019

OK

500+ dealers competed to buy my car!

Sell ur Car for More Cash
Highest Price or Get \$100 Free
Get Paid Now, Handover Later

SELL YOUR CAR

SGCARMART QUOTZ

Audi Min Price No Max Depreciation Vehicle Type Category

Advanced Search

Home » New Cars » New Car Brands » Audi » Audi A3 Sedan

Resources

- Car Buying
- Car Selling
- Car Ownership
- Car Aftermarket
- On The Move
- Lifestyle

Vehicle Inspection

Professional & Hassle-free vehicle inspection!

Related Articles



Entry-level Audi A3 Sedan is a chilli padi



Audi models star in 'Fifty Shades of Grey'



The latest generation of the Audi A3 series



Buying a car - Save yourself with these tips

View More

Audi A3 Sedan

Select Another Make Select The Make First

Overview Pricing Photos Research Reviews Specs Features Similar Accessories Promo

Add to Shortlist Submit a Review Report Error Share Like 101K



Details

Distributor Premium Automobiles
Hotline 68362223
Built in Hungary (launched 2014, facelifted Jan-2017)
Pricelist 31-Dec Pricelist Select Another Date
Promotion No current promotions. Alert me when new promotions are inserted

View all other promotions Download Brochure Add to Shortlist

USER RATINGS: (14 reviews)

Submodel	Price	Depreciation ?	Fuel Economy	Power	Transmission	Detailed Info
1.4 TFSI 5 tronic (A)	POA	-	20.4km/L	148bhp	7-speed (A) 5 tronic	Specs Features
1.0 TFSI 5 tronic (A)	\$136,440	\$12,400 /yr	21.3km/L	114bhp	7-speed (A) 5 tronic	Specs Features

Price updated 14-Jan-2019

Audi A3 Sedan Photos



View All 35 Audi A3 Sedan Photos

Audi A3 Sedan Review

Car Review - Audi A3 Sedan 1.4 TFSI S-tronic Ambiente (A)

14 Apr 2014 | Audi Reviews

The Audi A3 sedan looks smart inside and out, drives exceptionally well and is positively frugal, distinguishing itself from the rest in its segment.

The Good	The Bad
<ul style="list-style-type: none"> It makes you look unique It's well-rivied in practicality and style You can door-handle it like a madman and feel rewarded 	<ul style="list-style-type: none"> Not as frugal as the Sportback

FACELIFT The Audi A3 Sedan was facelifted on Sep 2018. Read more

CONSUMER REVIEWS

One of the best driveable car around
The 1.0T car is quiet, with a solid chassis, nice handling while FC is good. It's a car that you drive daily but wouldn't get sick of it quickly.
Read More »

Driving 400km in Malaysia Johor and the ...
Get the car two weeks ago. From the exterior, it didn't tell the difference between 1.0T or 1.4T(from the previous version). But I expect the car to perform moderately. Because you really can't expect too much ...
Read More »

Submit a review Receive 3 MCF points when you submit a review View All 14 Consumer Reviews

Items for Audi



5000K Super Bright HID Conversion Kit



Plug & Play Audi Reverse Camera



3D MAXpider Car Mat

Compare (1)



Complete Bodykit



Complete Bodykit



Continental ContiSportContact 5 18"

[+ View All 598 Suitable items for Audi](#)

Similar New Cars

Similar Used Cars

Audi A3 Sportback
From : \$134,240Mercedes-Benz CLA-
Class (P1)
From : \$141,000Volkswagen Passat
From : \$129,400Opel Insignia GrandSport
From : \$130,777Subaru Legacy
From : \$134,800Toyota Camry
From : \$141,988

Audi A3 Sedan Discussion

[View All](#)

Topic Title	Replies	Last Action
Audi A3 Sedan/Sportback Owners - Check In	4035	13-Jan-2019
Wtb: Audi A3 2010 windows magnet shield	0	08-Apr-2018
Audi A3 2017	9	05-Sep-2017
New Audi A3 Sedan - "only premium petrol sedan under Cat A"	301	23-Sep-2016
Audi A3 S Line in London with a Poem	4	06-Jul-2015
BMW 218i Cabriolet or Audi A3 Cabriolet?	22	16-Apr-2015

MYCARFORUM
WHERE CAR ENTHUSIASTS CONVERGE

Above discussions are extracted from MyCarForum.com
You may login to MyCarForum using your sgCarMart username & password.

[Home](#) | [New Cars](#) | [Used Cars](#) | [Sell My Car](#) | [Directory](#) | [Products](#) | [Insurance](#) | [Article](#) | [Forum](#) | [Resources](#)

Authorised Distributor Audi cars are Audi A3 Cabriolet, Audi A3 Sportback, Audi A4 Avant, Audi A4 Sedan, Audi A5 Cabriolet, Audi A5 Coupe, Audi A5 Sportback, Audi A6, Audi A7 Sportback, Audi A8L, Audi Q2, Audi Q5, Audi Q7, Audi Q8, Audi R8, Audi RS4 Avant, Audi RS5 Coupe, Audi S3 Sedan, Audi S3 Sportback, Audi S4 Avant, Audi S4 Sedan, Audi S5 Cabriolet, Audi S5 Coupe, Audi S5 Sportback, Audi SQ5. Parallel Imported Audi cars are Audi A5 Cabriolet, Audi Q5, Audi Q7, Audi S5 Cabriolet.

All prices and other information displayed on sgCarMart.com are gathered from sources and based on algorithms that are believed by sgCarMart.com to be reliable, but no assurance can be given that this information is accurate, complete or current. sgCarMart.com does not assume any responsibility for errors or omissions or warrant the accuracy of this information.

Follow sgCarMart.com

[About Us](#) | [Careers](#) | [Contact Us](#) | [Sitemap](#) | [Terms of Service](#) | [Privacy Policy](#) | [Personal Data Protection Statement](#)

©2004-2019 sgCarMart. All rights reserved.

RETAIL PRICE LIST

Effective as of 29 Dec 2018



MODEL	Power (hp)	Torque (Nm)	Combined Fuel Consumption L/100km	VES (Band)	Retail Price	VES (rebate / surcharge)	Nett Price after VES
AUDI A3 Sportback							
A3 1.0 TFSI S tronic	116	200	4.8	C1	\$124,240	\$10,000	\$134,240
S3 2.0 TFSI qu S tronic	290	380	6.6	C2	\$219,580	\$20,000	\$239,580
AUDI A3 Sedan							
A3 1.0 TFSI S tronic	116	200	4.7	C1	\$126,440	\$10,000	\$136,440
S3 2.0 TFSI qu S tronic	290	380	6.5	C2	\$221,780	\$20,000	\$241,780
AUDI A3 Cabriolet							
A3 1.4 TFSI S tronic	150	250	5.1	B	\$178,719	\$0	\$178,719
AUDI A4 Sedan							
A4 2.0 TFSI S tronic	190	320	5.2	B	\$176,846	\$0	\$176,846
A4 2.0 TFSI qu S tronic (Design)	252	370	6.2	C2	\$223,080	\$20,000	\$243,080
S4 3.0 TFSI qu tiptronic	354	500	7.9	C1	\$284,680	\$10,000	\$294,680
AUDI A4 Avant							
A4 2.0 TFSI S tronic	190	320	5.4	B	\$178,665	\$0	\$178,665
A4 2.0 TFSI qu S tronic (Design)	252	370	6.5	C2	\$232,680	\$20,000	\$252,680
S4 3.0 TFSI qu tiptronic	354	500	8.0	C1	\$294,180	\$10,000	\$304,180
RS4 2.9 TFSI qu tiptronic	450	600	8.9	C2	\$362,280	\$20,000	\$382,280
AUDI A5 Sportback							
A5 2.0 TFSI S tronic (Design)	190	320	5.6	B	\$191,980	\$0	\$191,980
A5 2.0 TFSI qu S tronic (Sport)	252	370	6.4	C2	\$236,930	\$20,000	\$256,930
S5 3.0 TFSI qu tiptronic	354	500	7.9	C1	\$289,580	\$10,000	\$299,580
AUDI A5 Coupe							
A5 2.0 TFSI S tronic (Design)	190	320	5.5	B	\$196,580	\$0	\$196,580
A5 2.0 TFSI qu S tronic (Sport)	252	370	6.4	C2	\$242,030	\$20,000	\$262,030
S5 3.0 TFSI qu tiptronic	354	500	7.8	C1	\$296,880	\$10,000	\$306,880
RS5 2.9 TFSI qu tiptronic	450	600	8.8	C2	\$359,080	\$20,000	\$379,080
AUDI A5 Cabriolet							
A5 2.0 TFSI S tronic (Design)	190	320	5.9	B	\$235,701	\$0	\$235,701
A5 2.0 TFSI qu S tronic (Sport)	252	370	6.7	B	\$274,280	\$0	\$274,280
S5 3.0 TFSI qu tiptronic	354	500	8.1	C1	\$334,780	\$10,000	\$344,780
AUDI A6 Sedan							
A6 3.0 TFSI qu S tronic (New)	340	500	7.2	C1	\$330,800	\$10,000	\$340,800
AUDI A7 Sportback							
A7 3.0 TFSI qu S tronic (New)	340	500	7.3	C1	\$360,500	\$10,000	\$370,500
AUDI A8							
A8L 3.0 TFSI qu tip (New)	340	500	8.2	C2	\$417,479	\$20,000	\$437,479
AUDI Q2							
Q2 1.0 TFSI S tronic	116	200	5.2	C1	\$130,906	\$10,000	\$140,906
Q2 1.4 TFSI COD S tronic	150	250	5.3	B	\$150,406	\$0	\$150,406
Q2 1.4 TFSI COD S tronic (Sport)	150	250	5.3	B	\$160,380	\$0	\$160,380
AUDI Q5							
Q5 2.0 TFSI qu S tronic (Sport)	252	370	7.4	C1	\$219,080	\$10,000	\$229,080
SQ5 3.0 TFSI qu tiptronic	354	500	8.7	C2	\$286,080	\$20,000	\$306,080
AUDI Q7							
Q7 2.0 TFSI qu tip	252	370	7.4	C1	\$283,780	\$10,000	\$293,780
Q7 3.0 TFSI qu tip	333	440	7.9	C2	\$343,965	\$20,000	\$363,965
AUDI Q8							
Q8 3.0 TFSI qu tip	340	500	8.9	C2	\$349,300	\$20,000	\$369,300
AUDI R8 Coupe							
R8 5.2 FSI qu S tronic	540	540	11.4	C2	\$763,380	\$20,000	\$783,380

Terms and Conditions :

- ✓ Retail price is subject to in-house financing and insurance. Price includes 12-months road tax, registration fee and GST but without insurance.
 - ✓ COE is non-guaranteed and subject to B-bids, failing which new terms and conditions shall apply.
 - ✓ Booking deposit for all models is S\$20,000/-. Minimum booking deposit for instant order is S\$25,000/-. with the exception of RS/R8 is S\$75,000/-.
 - ✓ All deposits are non-refundable upon cancellation.
 - ✓ In-house utilization of PARF/COE Rebates for new car registration is within Premium Automobile's discretion.
- All prices and promotions are subject to change without any prior notice.

Premium Automobiles

Audi Centre Singapore
281 Alexandra Road Singapore 159938

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	14/01/2019 17:34
Date Of Accident	13/01/2019 12:30
Exact Location Of Accident	CTE EXIT BTW YIO CHU KANG ROAD & AMK AVE 5(ROAD 1)
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMC2926X
Insured/Policyholder	
Name Of Registered Owner	EWE TUCK FOONG
NRIC No	S7284547A
Email Address	EWEEWE@LIVE.COM.SG
Mobile Phone No	(LOCAL) +65-97479587
Alternative Phone No	OTHERS-97479587

Vehicle Particulars

Manufacturer	AUDI
Model	A3 SEDAN 1.0 TFSI 8V
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	1800069946
Cover Note Number	

Driver

Name of Driver	EWE TUCK FOONG
NRIC No	S7284547A
Date Of Birth	03/05/1972
Occupation	INDOOR
Date Of Driving Pass	01/12/2009
Driving Experience	9 YEARS AND 1 MONTH
Gender	MALE
Mobile Number	(LOCAL) +65-97479587
Fax Number	
Contact Number	OTHERS-97479587
EMail Address	EWEEWE@LIVE.COM.SG

Address	3 PAYA LEBAR CRESCENT #05-21
Postcode	534239
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-

General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	3
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	YES
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	4
Passenger 1	NAME: : CHAN HEI GENDER: : FEMALE
Passenger 2	NAME: : CHAN HO GENDER: : MALE
Passenger 3	NAME: : YIP WAI CHUN GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Police Station Name	TRAFFIC POLICE DIVISION HQ
Police Station Address	ROAD: 10 UBI AVENUE 3 , POSTCODE: 408865 , COUNTRY: SINGAPORE
Police Station Contact	TEL NO: 65470000 - FAX NO:
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO POLICE REPORT NO: T/20190113/2062 AND T/20190113/2059

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	VIDEO WITH TRAFFIC POLICE
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SLG14G
-----------------------------	--------

Vehicle Make/Model/Colour	HONDA / FREED / HYBRYID 1.5G AUTO
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SLL7887G
Vehicle Make/Model/Colour	SUBARU / OUTBACK 2.5-S CVT
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

DETAILS OF INJURED PERSON 1

Name	
Approximate Age	
Injuries Sustain	
Injured person in which vehicle?	SLG14G
Were seat belts worn?	
Was this injured conveyed to hospital by ambulance?	YES
Address	
Postcode	

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (A) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
- (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


Policyholder's Signature

Date & Time: 14/1/2019
2:20 pm

Driver's Signature

(If driver is not the policyholder)
Date & Time:




Reporting Centre Personnel's Signature

Name: 

NRIC/FIN No.:

Sketch Plan #2

SKETCH PLAN

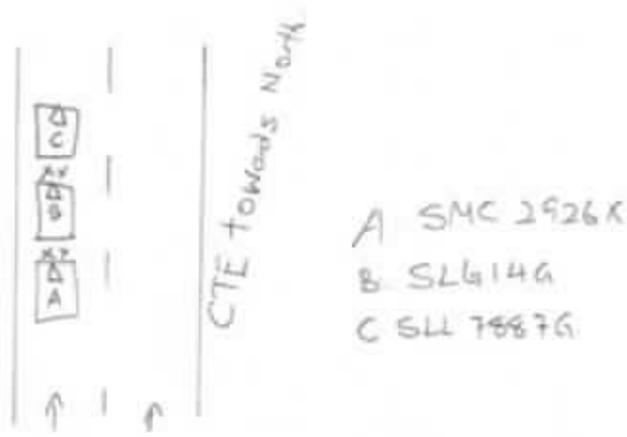

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

* RLV refer to CSF Police report *

DECLARATION

I/We declare the foregoing particulars are true in every respect.

[Signature]

Policyholder's Signature

Date & Time:

14/10/19 2.20pm

Driver's Signature

(if driver is not the policyholder)

Date & Time:



Reporting Centre Personnel's Signature

Name: Justin E

NRIC/FIN No.:

Police Report



T/20190113/2062

1 of 4

Report No. T/20190113/2062

Case Summary Form (CSF For NP168)

Manual NP168 Form Serial No T/20190113/2059
 Report Number T/20190113/2062
 Vide Report Number F/20190113/0111
 Date/Time of Report Made 13/01/2019 14:51
 Place Report Lodged Traffic Police
 Type of Informant Driver
 Name of Informant EWE TUCK POONG
 ID Type / ID No. NRIC NO / S7284547A
 Home/Office
 Mobile 97479587
 Email
 Type of Accident Non-injury / Attended by Police
 Drink Drive No
 Anyone conveyed by ambulance Yes
 Date/Time of Accident 13/01/2019 11:30



Details of Vehicle Involved						
Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
SLG14G	Car	HONDA	FREED HYBRID 1.5G AUTO			1
SLL7887G	Car	SUBARU	OUTBACK 2.5i-S CVT AWD SR			4
SMC2926X	Car	AUDI	A3 SEDAN 1.6 TFSI S TRONIC (LED)	Grey		4

Police Report



T:20190113/2062

2 of 4

Report No. T:20190113/2062

Continuation of CSF For NP168

Details of Person Involved			
Any Pedestrian Involved: No			
No. of Pedestrians Injured: NIL		Use of Pedestrian Crossing: NA	
Passenger			
Name	CHAN HEI	ID No.	S7769954H
Related Vehicle	SMC2926X (Car)	Contact No.	96489299
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL
Driver			
Name	EWE TUCK FOONG	ID No.	S7284547A
Related Vehicle	SMC2926X (Car)	Contact No.	97479587
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL
Passenger			
Name	CHAN HO	ID No.	K06210872
Related Vehicle	SMC2926X (Car)	Contact No.	96489299
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL
Passenger			
Name	YIP WAI CHUN	ID No.	K01828720
Related Vehicle	SMC2926X (Car)	Contact No.	96489299
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

Police Report



T/20190113/2062

3 of 4

Report No. T/20190113/2062

Continuation of CSF For NP168

Brief Facts.

On stated date, time and location,

I WAS ON THE MOST RIGHT LANE, AND FOR ABOUT A 1 KILOMETER AWAY, I SAW A CONSTRUCTION TRUCK WITH THE ARROW SIGNAGE ON MY LANE. SO I DECIDED TO MAKE A LANE CHANGE ON MY LEFT. AS SOON AS I MAKE THE LANE CHANGE, I SAW A STATIC VEHICLE ON THE LANE AND COULD NOT STOP IN TIME AND THUS COLLIDED ONTO THE SAID VEHICLE (SLG14G). I THEN WENT OUT FROM MY VEHICLE AND SAW THAT THERE WAS ANOTHER VEHICLE (SLL7887G) INVOLVED IN THE ACCIDENT. THE FIRST DRIVER (SLL7887G) TOLD ME THAT HE FELT 2 IMPACT PRIOR TO THE ACCIDENT. AS THE FIRST DRIVER HAD ALLREADY CALLED FOR THE AMBULANCE, THEY ARRIVED SHORTLY AND CONVEYED THE SECOND DRIVER TO THE HOSPITAL (SLG14G) AS SHE WAS PREGNANT. I NOTICED THAT THE CONES WAS TOO CLOSE TO THE CONSTRUCTION TRUCK WHICH I THINK IT WOULD BE BETTER TO PLACE IT ABIT FURTHER SO THAT OTHER ROAD USER COULD LANE CHANGE A BIT SOONER AND AVOID ANY MISHAP. ALL 3 PASSENGER WHICH WAS IN MY VEHICLE WAS NOT INJURED AFTER THE ACCIDENT HAPPENED.

Police Report



T/20190113/2062

4 of 4

Report No. T/20190113/2062

Continuation of CSF For NP168

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the **report number** as reference.

Case Sensitivity	No
Officer-In-Charge of Case	TP / OIT / MOHAMMAD ABDILLAH BIN PALIL
Classification of Case	1) NON-INJURY / ATTENDED BY POLICE

Police Report



**SINGAPORE
POLICE FORCE**



T/20190113/2059

Police Station Of Origin:
Traffic Police
10 Ubi Avenue 3 SINGAPORE 408665
Tel No: 65470000

1 of 3

Report No: T/20190113/2059

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 13/01/2019 14:34	Video Report No.: F/20190113/0111	Station Diary No.:
--	--------------------------------------	--------------------

Informant's Particulars

Name of Informant: EWE TUCK FOONG		Address: 3 PAYA LEBAR CRESCENT TANGERINE GROVE SINGAPORE 634239	
ID Type / ID No.: NRIC NO / S7284547A		Contact No.:	Mobile: 97479587
Nationality: MALAYSIAN		Email:	
Sex: Male	Age: 46	Date of Birth: 03/05/1972	Type of Informant: Driver
Race: Chinese		Language:	Institution / School Name:
Occupation: CHIEF FINANCIAL OFFICER		Driving Licence Information: Class:	Date of Expiry:

General Information of the Accident

Type of Accident: Non-Injury Attended by Police	Drink Drive: No	Date/Time of Accident: 13/01/2019 12:30	Type of Location:
Location: Along Road 1 CENTRAL EXPRESSWAY EXIT BETWEEN YIO CHU KANG AND ANG MO KIO AVE 5			
Weather:	Road Surface:	Road Speed Limit:	
Traffic Flow:	Traffic Control:	Traffic Volume:	
Type of Collision:	Anyone conveyed by ambulance: No		

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
SLG14G	Car	HONDA	FREED HYBRID 1.5G AUTO			0
SLL7887G	Car	SUBARU	OUTBACK 2.5I-S CVT AWD SR			0
SMC2926X	Car	AUDI	A3 SEDAN 1.0 TFSI S TRONIC (LED)	Grey		4

Police Report



**SINGAPORE
POLICE FORCE**



T/20190113/2059

Police Station Of Origin:
Traffic Police
10 Ubi Avenue 3 SINGAPORE 408555
Tel No: 65470000

2 of 3

Report No: T/20190113/2059

CONTINUATION OF REPORT

Details of Vehicle Insurance				
Vehicle No.	Insurance Company	Insurance No	Effective	Expiry Date
SMC2926X	AIG ASIA PACIFIC INSURANCE PTE. LTD.	1500069946	26/06/2018	27/06/2020

Details of Person Involved			
Any Pedestrian Involved: No			
No. of Pedestrians Injured: NIL		Use of Pedestrian Crossing: NA	
Driver			
Name	EWE TUCK FOONG	ID No.	S7284547A
Related Vehicle	SMC2926X (Car)	Contact No.	97479587
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

Brief Details.

On stated date, time and location,

I WAS ON THE MOST RIGHT LANE, AND FOR ABOUT A 1 KILOMETER AWAY, I SAW A CONSTRUCTION TRUCK WITH THE ARROW SIGNAGE ON MY LANE. SO I DECIDED TO MAKE A LANE CHANGE ON MY LEFT. AS SOON AS I MAKE THE LANE CHANGE, I SAW A STATIC VEHICLE ON THE LANE AND COULD NOT STOP IN TIME AND THUS COLLIDED ONTO THE SAID VEHICLE (SLG14G). I THEN WENT OUT FROM MY VEHICLE AND SAW THAT THERE WAS ANOTHER VEHICLE (SLL7887G) INVOLVED IN THE ACCIDENT. THE FIRST DRIVER (SLL7887G) TOLD ME THAT HE/SHE FELT 2 IMPACTS PRIOR TO THE ACCIDENT. AS THE FIRST DRIVER HAD ALLREADY CALLED FOR THE AMBULANCE, THEY ARRIVED SHORTLY AND CONVEYED THE SECOND DRIVER TO THE HOSPITAL (SLG14G) AS SHE WAS PREGNANT.

Police Report



SINGAPORE
POLICE FORCE



T/20190113/2059

Police Station Of Origin:
Traffic Police
10 Ubi Avenue 3 SINGAPORE 408885
Tel No: 65470000

3 of 3



Report No. T/20190113/2059

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the **report number** as reference.

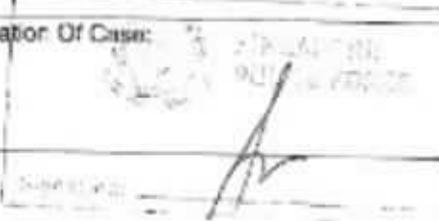Signature Of Officer Recording The Report TP / MOHAMED ANWAR BIN MOHAMED BRAHIM	Signature Of Informant: 
Signature Of Interpreter: Not applicable	Date/Time: 13/01/2019 14:34
Officer In Charge Of Case: TP / GIT / SI MOHAMMAD ABDILLAH BIN PALIL Contact No.: 65476246	Classification Of Case: 
Authentication Stamp NP163	

Accident Photo



AUDI AUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder : EWE TUCK FOONG
 Period of Insurance : 28 Jun 2018 To 27 Jun 2020
 Engine No. : CHZ 474413
 Chassis No. : WAUZZZ8V4J1074077

Vehicle No. : SMC2926X
 Policy No. : 1800069946
 Endorsement No. :
 Issued Date : 10 Jul 2018

ABOUT THE COVER

Make/Model : AUDI A3 Sedan 1.0 TFSI S tronic
 Engine Capacity/Tonnage : 999.00 CC Sum Insured : Market Value First Year of Registration : 2018
 Driver Restriction : NA Off Peak Car : No Insuring with COE/PARF : Yes
 Person or Classes of Persons Entitled to Drive* :

a) The Policyholder
 b) Any other person who is driving on the Policyholder's order or with his/her permission.
 This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDR") if You are or Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition

Limitation as to use* :

Use only for social, domestic and pleasure purposes and for the Policyholder's business.
 This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1800cc - 2000cc Optional

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

EXCESS

Section 1
 Fire - \$0 Own Damage - \$600 Theft - \$0 Flood Cover - \$0

Section 2
 Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

EWE TUCK FOONG - \$600 (Own Damage)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

1. Audi Customer Service Center Add: 55 Ubi Road 1 Singapore 408699 63662323

For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.com.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: DBS BANK LTD

We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 189), Part IV of the Road Transport Act, 1987 (Malaysia) and Motor Vehicles (Third Party Risks) Rules, 1958 (Malaysia).



0504125211

PREMIUM LEASING - NC
 281 ALEXANDRA ROAD AUDI CUSTOMER SERVICE CENTRE
 SINGAPORE 159938

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

AIG Asia Pacific Insurance Pte. Ltd.
 AUTHORISED REPRESENTATIVE

Staffery Ltd.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0069/2019/PH
Date : 16-Jan-19

Vehicle not in workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way
#07-16 AIG Building
Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr Ewe Tuck Foong
Address : 3 Paya Lebar Crescent
#05-21
Singapore 534239
Telephone : HP +65 97479587
Type of Claim : Own Damage Claims
Policy No. : 1800069946
Vehicle No : **SMC 2926 X**
Model Code : Audi A3 Sedan 1.0 TFSI
Model / Year :
Engine No :
Chassis No :
Mileage :
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 13-Jan-19
Place of Accident : CTE exit btw Yio Chu Kang Road & AMK Ave 5 (Road 1)

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SMC 2926 X

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
1	To towed and recover from scene of accident.	S/N AIG	
2	To carry out first measurement test on car o-liner.	S/N \$ 800.00	✓
3	To remove,check and reinstall front wire harness for headlights,horns,outside temperature sensor and headlight washer assy.	S/N \$ 360.00	✓
4	To remove and renew aircon condenser,additional radiator,radiator.Check electrical fans and control unit.Pressurise cooling system.To carry out vacuum and regas.	S/N \$ 1,000.00	✓
5	To remove center console,instrument panels and clusters.Renew dashboard,both frontal airbags,slip ring.Transfer old fittings.Renew seat belts and control unit,pillar trims,roof lining,both curtain air bags andknee airbag	S/N \$ 3,600.00	✓
TOTAL LABOUR CHARGES		: \$ 5,760.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SMC 2926 X

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
6	To remove and reinstall engine assy with gearbox assy to facillitate car o-liner repairs.	S/N \$ 2,800.00	? X
7	To remove and reinstall front suspension assy with subframe to facillitate car o-liner repairs. Inspect fro damages and renew if necessary.	S/N \$ 2,400.00	? X
8	To set up vehicle on car o-liner for repair.	S/N \$ 1,800.00	? X
9	To dismantle and renew front bumper, bonnet, both front fenders, both headlights and lhs front door. Cut out and reweld lhs fender top support. Align both front chassis frames to specification of origin. Renew front lock carrier and align to position. Re-organise front crash management components. Reinstall all parts removed.	\$ 9,600.00	5000 ✓
10	✓ To respray front bumper, bonnet, both front fenders, lhs fender top support, lhs upper A pillar, lhs front door and engine compartment.	\$ 6,200.00	3575 ✓ 6 x 550 = 3300 Fender Support : 275
11	To carry out wheel alignment.	S/N \$ 240.00	? X
12	To carry out diagnostic checks.	S/N \$ 384.00	✓
TOTAL LABOUR CHARGES		\$ <u>23,424.00</u>	29184

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 2926 X.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	STEERING AIRBAG	S	3,141.00 ✓ 2512.80
2	AIRBAG UNIT	S	4,238.00 ✓ 3390.40
3	HEAD AIRBAG UNIT - LH/RH	2 S	3,416.00 ✓ 2732.80
4	HEAD AIRBAG GUIDE - LH/RH	2 S	46.00 ? x
5	KNEE AIRBAG	S	1,708.00 ✓ 1366.40
6	DRIVER SIDE TRAY SOUL BLACK - RH	S	413.00 ? x
7	CONTROL UNIT FOR AIRBAG	S	1,606.00 ✓ 1284.80
8	CRASH SENSOR FOR AIRBAG	3 S	1,145.00 ✓ 915.60
9	DASHBOARD WITH AIR DUCT	S	3,887.00 ✓ 3049.60
10	MOULDED HEADLINER	S	1,613.00 ✓ 1290.40
11	A PILLAR TRIM - LH	S	147.00 ? 117.70 ✓
12	A PILLAR TRIM - RH UPPER	S	147.00 ? 117.70 ✓
13	FRONT GRAB HANDLE	2 S	258.00 ? 163.70 ✓
14	GRAB HANDLE - REAR LH/RH	2 S	260.00 ? x
15	3 POINT AUTOMATIC SEAT BELT - LH/RH	2 S	2,010.00 x 1608 ✓
16	SEAT BELT HEIGHT ADJUSTER	2 S	361.00 x
17	FRONT BUMPER	S	1,830.00 ✓ 1464
18	FRONT BUMPER FIXING PARTS	S	170.00 ✓ 136
19	FRONT BUMPER GUIDE SECTION - LH/RH	2 S	70.00 ✓ 55.04
20	FRONT BUMPER LOWER GRILLE - CENTER	S	146.00 ✓ 116.40
SUB TOTAL SPARE PARTS CHARGES			\$ 26,612.00

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 2926 X.

S/N	Parts Description		Damaged Parts & Prices	
			S/Nett	Remark
21	BUMPER GRILLE CLOSING ELEMENT-LOWER CENTRE	5	488.00	X. 390 ✓
22	BUMPER CLOSING ELEMENT - LH/RH	2 S	540.00	? X
23	FRONT BUMPER COVER TRIM - LH/RH	1/2 S	296.00	198. 118.40
24	ADAPTER HOUSING HOUSING LINER - LH/RH	2 S	68.00	X.
25	RADIATOR GRILLE	5	1,301.00	— 1040.80
26	CLOSING ELEMENT	5	174.00	138.40
27	AIR GUIDE GRILLE - LH/RH	1/2 S	342.00	171 136.40
28	FRONT REINFORCEMENT	5	660.00	— 527.60
29	FOAM FILLER PIECE	5	172.00	— 137.60
30	FOAM FILLER PIECE COVER	5	111.00	— 88.80
31	CAUTION' STICKER	5	13.00	— 9.76
32	HORN-HIGH TONE LH	5	182.00	2 ✓ 145.60
33	HORN-LOW TONE RH	5	182.00	X. 145.60 ✓
34	FRONT FENDER - LH/RH	2 S	1,556.00	— 1244
35	ATTACHMENT PARTS FOR FENDER	2 S	130.00	? 104 ✓
36	BRACKET FOR FENDER - LH/RH	2 S	50.00	25 39.52
37	BRACKET FOR FENDER-LH/RH	2 S	70.00	? 55.52 ✓
38	FENDER BRACE - LH/RH	2 S	176.00	88 139.68
39	WHEEL HOUSING LINER - LH/RH	2 S	316.00	158 252
40	ATTACHMENT PARTS FOR WHEEL HOUSING LINER	2 S	161.00	? 128.80 ✓
SUB TOTAL SPARE PARTS CHARGES			\$ 6,988.00	

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 2926 X.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
41	BONNET <i>Distorted</i>	S	2,898.00 ✓ <i>2318.00</i>
42	ATTACHMENT PARTS FOR BONNET <i>Not nec</i>	S	149.00 ? X
43	LID HINGE - LH/RH <i>Best</i>	2 S	112.00 ✓ <i>88.48</i>
44	BONNET GAS FILLED STRUT <i>rec in</i>	S	109.00+
45	BONNET CATCH HOOK <i>Best</i>	S	81.00 ✓ <i>64.72</i>
46	STRIKER - LH/RH <i>Best</i>	2 S	200.00 ✓ <i>159.04</i>
47	EDGE PROTECTION <i>rec</i>	S	25.00 ✓ <i>19.92</i>
48	COVER - LH/RH <i>Not rec</i>	2 S	74.00 ? X
49	SEAL FOR WATER BOX <i>Not rec</i>	S	53.00 ? X
50	CATCH HOOK <i>Not Best</i>	S	58.00 ? <i>45.76</i>
51	LID LOCK WITH MICRO SWITCH <i>2nd</i>	2 S	367.00 ✓ <i>293.60</i>
52	FLAT CONNECTOR <i>Not rec</i>	S	12.00 ? X
53	BOWDEN CABLE <i>2nd</i>	S	53.00 ? <i>41.68</i>
54	LID LOCK CABLE <i>Not Nec</i>	S	68.00 ? X
55	BONNET SOUND ABSORBER <i>completed</i>	S	201.00 ✓ <i>160.50</i>
56	COVER FOR PLENUM CHAMBER SATIN BLACK <i>cracked. rec in</i>	S	164.00+ <i>130.50</i> ✓
57	COVER <i>Not New</i>	S	15.00 ? X
58	LED HEADLIGHT - LH/RH <i>cracked</i>	2 S	10,058.00 ✓ <i>8046.40</i>
59	POWER MODULE FOR MAIN LIGHT ELECTRONIC <i>2nd</i>	S	693.00 ? <i>554</i> ✓
60	CONTROL UNIT FOR LIGHT CONTROL SYSTEM <i>2nd</i>	S	508.00 ? <i>406</i> ✓
SUB TOTAL SPARE PARTS CHARGES			\$ 15,898.00

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 2926 X.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
61	LED WITH HEAT SINK - LH <i>2nd</i>	\$ 666.00	? <i>532.40 ✓</i>
62	LIFT CYLINDER FOR HEADLIGHT WASHER -LH/RH <i>2nd</i>	\$ 256.00	? <i>102 ✓</i>
63	HOSE <i>Not Nec</i>	\$ 61.00	? <i>X</i>
64	WASHER TANK RESERVIOR <i>2nd</i>	\$ 186.00	✓ <i>148.40</i>
65	FENDER TOP SUPPORT - LH INNER <i>2nd</i>	\$ 214.00	? <i>171.70</i>
66	FRONT LOCK CARRIER <i>2nd</i>	\$ 663.00	✓ <i>530.40</i>
67	AIR CON CONDENSER <i>2nd</i>	\$ 503.00	✓ <i>402</i>
68	COOLER FOR COOLANT <i>2nd</i>	\$ 878.00	✓ <i>702.40</i>
69	ADDITIONAL COOLER FOR COOLANT <i>2nd</i>	\$ 837.00	✓ <i>669.60</i>
70	COOLANT <i>Nec</i>	4 \$ 84.00	✓ <i>67.20</i>
71	COOLANT HOSE WITH QUICK RELEASE COUPLING-FRONT <i>Not Nec</i>	\$ 234.00	? <i>X</i>
72	COOLANT HOSE WITH QUICK RELEASE COUPLING-UPPER <i>Not Nec</i>	\$ 143.00	? <i>X</i>
73	COOLANT HOSE WITH QUICK RELEASE COUPLING-LOWER <i>Not Nec</i>	\$ 126.00	? <i>X</i>
74	REFRIGERANT LINER <i>Bent</i>	\$ 601.00	? <i>480.40 ✓</i>
75	REFRIGERANT LINER <i>Bent</i>	\$ 461.00	? <i>368.80 ✓</i>
76	AIR GUIDE - LH/RH <i>2nd</i>	2 \$ 44.00	✓ <i>34.24</i>
77	AIR GUIDE - UPPER CENTRE <i>2nd</i>	\$ 11.00	✓ <i>8.32</i>
78	RRADIATOR FAN WITH FAN RING <i>2nd</i>	\$ 1,483.00	? <i>1186.40 ✓</i>
79	AIR GUIDE <i>2nd</i>	\$ 53.00	? <i>41.84 ✓</i>
80	AIR GUIDE <i>2nd</i>	\$ 62.00	? <i>49.20 ✓</i>
SUB TOTAL SPARE PARTS CHARGES		\$ 7,566.00	

photo
photo
photo

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 2926 X.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
81	AIR FILTER <i>Not on</i>	\$ 252.00	*
82	LH FRONT DOOR <i>Buckled</i>	\$ 2,279.00	✓ 1873.20
83	FORNT OUTER DOOR SEAL - LH <i>Not on</i>	\$ 146.00	✓ 116.50
84	BONDING AGENT <i>Not NEC</i>	\$ 45.00	" X
85	CLEANING SOLUTION <i>Not NEC</i>	\$ 65.00	" X
86	FRONT DOOR ATTACHMENT PARTS <i>Not NEC</i>	\$ 218.00	? X
87	FRONT DOOR CATCH - LH <i>Not on</i>	\$ 96.00	+
88	FRONT DOOR CATCH COVER - LH <i>Not on</i>	\$ 13.00	+
89	TRIM STRIP FOR WINDOW GUIDE - LH <i>Not on</i>	\$ 235.00	✓
90	TRIM STRIP FOR WINDOW GUIDE-RH <i>Not on</i>	\$ 235.00	+
91	CORNER TRIM BLACK-GLOSSY - LH/RH <i>Not on</i>	2 \$ 82.00	+
92	WINDOW SLOT SEAL WITH TRIM STRIP CHROME-LH <i>Not on</i>	\$ 282.00	✓ 275.60
93	WINDOW SLOT SEAL WITH TRIM STRIP CHROME-RH <i>Not on</i>	\$ 282.00	+
94	FRONT NUMBER PLATE <i>Bent</i>	S/N \$ 25.00	✓
95	ARCYLIC SEALANT	S/N \$ 180.00	✓
96	CAVITY WAX	S/N \$ 140.00	✓
97	STONE CHIP TREATMENT <i>Not on</i>	S/N \$ 180.00	✓
98	SUNDRIES <i>Nec.</i>	\$ 1,200.00	? 2640 ✓
TOTAL SPARE PARTS CHARGES		\$ 63,019.00	
TOTAL LABOUR CHARGES		\$ 23,424.00	29104
GRAND TOTAL		\$ 86,443.00	92203

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

87,367.72

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Name : Adrian Ling.
Surveyed Date : 17/01/19.
Authorised Date :
Excess Cost :
Liability :
Remarks : Not Authorised, 18 Days.

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Supplementary Estimate

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd
 78 Shenton Way
 #07-16 AIG Building
 Singapore 079120
 Attn: Mr. Adrian Ling - Motor Claims Dep
 Tel: 6841 0055 / Fax: 6256 4315

Estimate No.
Date
Service Advisor
Pages
Regn No
Model No

PA/OD/0069/2019/PH
 13-Feb-19
 CHANG
 1 of 1
 SMC 2926 X
 Audi A3 SEDAN 1.0 TFSI

Quantity	Description	Unit Price	Amount
Labours			
1	To remove and renew damaged wiring harness and connectors.	S/N \$ 480.00	✓✓
2	To cut out and weld RH front chassis cover plate.	\$ 1,200.00	500 ✓
3	To carry out sealer work and spray RH front chassis cover plate.	\$ 600.00	350 ✓
Parts			
* 1	FRONT FENDER CLOSING ELEMENT - LH FRONT <i>de</i>	\$ 66.00	57.32
- 2	OUTER TEMP. SNESOR BRACKET <i>mis</i>	\$ 17.00	13.04
* 3	OUTER TEMP. SENSOR WIRE SET <i>cont</i>	\$ 111.00	402.64
- 4	WIRE CONNECTOR - BLACK <i>con</i>	\$ 17.00	13.28
- 5	WIRE CONNECTOR - WHITE <i>con</i>	\$ 29.00	22.72
- 6	WIRE CONNECTOR - WHITE <i>de</i>	\$ 19.00	14.96
- 7	CABLE GUIDE <i>de</i>	\$ 22.00	17.52
- 8	AIR COND PIPE (COMPRESSOR > CUT-OFF POINT) <i>bl</i>	\$ 461.00	368.92
- 9	COOLANT HOSE COUPLING <i>de</i>	\$ 22.00	17.78
- 10	COOLANT PIPE <i>con</i>	\$ 28.00	22.05
- 11	FRONT CHASSIS FRAME COVER PLATE - RH <i>bl</i>	\$ 89.00	70.48
- 12	WIRE CONNECTOR - BLACK <i>con</i>	\$ 16.00	12.24
- 13	HEADLIGHT HOSE - LH <i>de</i>	\$ 36.00	28.32
- 14	INTAKE AIR DUCT COVER <i>de</i>	\$ 27.00	21.36
- 15	INTAKE AIR DUCT DRAINAGE HOSE <i>mis</i>	\$ 31.00	24.48
- 16	MULTIFUNCTIONAL STEERING WHEEL <i>de</i>	\$ 2,169.00	1735.20
GRAND TOTAL :		\$ 5,440.00	

Signature
 14/2/19

For Premium Automobiles Pte Ltd



Authorised Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 2926 X.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	STEERING AIRBAG	\$ 3,141.00	✓
2	AIRBAG UNIT	\$ 4,238.00	✓
3	HEAD AIRBAG UNIT - LH/RH	2 \$ 3,416.00	✓
4	HEAD AIRBAG GUIDE - LH/RH ?	2 \$ 46.00	?
5	KNEE AIRBAG Activated	\$ 1,708.00	✓
6	DRIVER SIDE TRAY SOUL BLACK - RH ?	\$ 413.00	?
7	CONTROL UNIT FOR AIRBAG ? Activated	\$ 1,606.00	✓
8	CRASH SENSOR FOR AIRBAG	3 \$ 1,145.00	✓
9	DASHBOARD WITH AIR DUCT torn	\$ 3,887.00	✓
10	MOULDED HEADLINER crumpled	\$ 1,613.00	✓
- 11	A PILLAR TRIM - LH ? de ✓	\$ 147.00	?
- 12	A PILLAR TRIM - RH UPPER ? de ✓	\$ 147.00	?
- 13	FRONT GRAB HANDLE ? 1pc de ✓	2 \$ 258.00	?
14	GRAB HANDLE - REAR LH/RH ?	2 \$ 260.00	?
- 15	3 POINT AUTOMATIC SEAT BELT - LH/RH not ^{out} ✓	2 \$ 2,010.00	X
16	SEAT BELT HEIGHT ADJUSTER not ✓	2 \$ 361.00	X
17	FRONT BUMPER distorted	\$ 1,830.00	✓
18	FRONT BUMPER FIXING PARTS 2nd ✓	\$ 170.00	✓
19	FRONT BUMPER GUIDE SECTION - LH/RH 2nd ✓	2 \$ 70.00	✓
20	FRONT BUMPER LOWER GRILLE - CENTER crumpled ✓	\$ 146.00	✓
SUB TOTAL SPARE PARTS CHARGES		\$ 26,612.00	

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 2926 X.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
21	BUMPER GRILLE CLOSING ELEMENT-LOWER CENTRE ^{new} old	\$ 488.00	X.
22	BUMPER CLOSING ELEMENT - LH/RH ?	2 \$ 540.00	?
23	FRONT BUMPER COVER TRIM - LH/RH LH old	2 \$ 298.00 198.	
24	ADAPTER HOUSING HOUSING LINER - LH/RH ^{new}	2 \$ 68.00	X.
25	RADIATOR GRILLE ^{cancel}	\$ 1,301.00	✓
26	CLOSING ELEMENT ^{old}	\$ 174.00	
27	AIR GUIDE GRILLE - LH/RH LH ^{missing}	2 \$ 342.00 171	
28	FRONT REINFORCEMENT ^{Bent}	\$ 660.00	✓
29	FOAM FILLER PIECE ^{cancel}	\$ 172.00	✓
30	FOAM FILLER PIECE COVER ^{old}	\$ 111.00	✓
31	CAUTION' STICKER ^{new}	\$ 13.00	✓
32	HORN-HIGH TONE LH ^{old}	\$ 182.00	2 ✓
33	HORN-LOW TONE RH ^{new}	\$ 182.00	X.
34	FRONT FENDER - LH/RH ^{Buckled}	2 \$ 1,556.00	✓
35	ATTACHMENT PARTS FOR FENDER ?	2 \$ 130.00	?
36	BRACKET FOR FENDER LH/RH ^{RH Bent} b1 ✓	2 \$ 50.00 25	
37	BRACKET FOR FENDER-LH/RH ? b1 ✓	2 \$ 70.00	?
38	FENDER BRACE - LH/RH ^{RH Bent} b1 ✓	2 \$ 176.00 88	
39	WHEEL HOUSING LINER - LH/RH ^{LH old} b1 ✓	2 \$ 316.00 158	
40	ATTACHMENT PARTS FOR WHEEL HOUSING LINER ?	2 \$ 161.00	?
SUB TOTAL SPARE PARTS CHARGES		\$ 6,988.00	

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 2926 X.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
41	BONNET <i>Distorted</i>	\$ 2,898.00	✓
42	ATTACHMENT PARTS FOR BONNET ?	\$ 149.00	?
43	LID HINGE - LH/RH <i>Best</i>	2 \$ 112.00	✓
44	BONNET GAS FILLED STRUT <i>see in</i>	\$ 109.00	+
45	BONNET CATCH HOOK <i>Best</i>	\$ 81.00	✓
46	STRIKER - LH/RH <i>Best</i>	\$ 200.00	✓
47	EDGE PROTECTION <i>see</i>	\$ 25.00	✓
48	COVER - LH/RH ?	2 \$ 74.00	?
49	SEAL FOR WATER BOX ?	\$ 53.00	?
50	CATCH HOOK ? <i>hi</i>	\$ 58.00	?
51	LID LOCK WITH MICRO SWITCH <i>end</i>	2 \$ 367.00	✓
52	FLAT CONNECTOR ?	\$ 12.00	?
53	BOWDEN CABLE ? <i>dis</i>	\$ 53.00	?
54	LID LOCK CABLE ?	\$ 68.00	?
55	BONNET SOUND ABSORBER <i>completed</i>	\$ 201.00	✓
56	COVER FOR PLENUM CHAMBER SATIN BLACK <i>see in</i>	\$ 164.00	+
57	COVER ?	\$ 15.00	?
58	LED HEADLIGHT - LH/RH <i>encl d</i>	2 \$ 10,058.00	✓
59	POWER MODULE FOR MAIN LIGHT ELECTRONIC ? <i>dis</i>	\$ 693.00	?
60	CONTROL UNIT FOR LIGHT CONTROL SYSTEM ? <i>dis</i>	\$ 508.00	?
SUB TOTAL SPARE PARTS CHARGES		\$ 15,898.00	

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 2926 X.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
61	LED WITH HEAT SINK - LH <i>2 ok ✓</i>	\$	666.00 ?
62	LIFT CYLINDER FOR HEADLIGHT WASHER -LH/RH <i>ok ✓</i>	\$	256.00 ?
63	HOSE ?	\$	61.00 ?
64	WASHER TANK RESERVIOR <i>Rehd ✓</i>	\$	186.00 ✓
65	FENDER TOP SUPPORT - LH INNER <i>Rehd ✓</i>	\$	214.00 ✓
66	FRONT LOCK CARRIER <i>ok ✓</i>	\$	663.00 ✓
67	AIR CON CONDENSER <i>Rehd ✓</i>	\$	503.00 ✓
68	COOLER FOR COOLANT <i>Rehd ✓</i>	\$	878.00 ✓
69	ADDITIONAL COOLER FOR COOLANT <i>Rehd ✓</i>	\$	837.00 ✓
70	COOLANT <i>Neu</i>	4 \$	84.00 ✓
71	COOLANT HOSE WITH QUICK RELEASE COUPLING-FRONT ?	\$	234.00 ?
72	COOLANT HOSE WITH QUICK RELEASE COUPLING-UPPER ?	\$	143.00 ?
73	COOLANT HOSE WITH QUICK RELEASE COUPLING-LOWER ?	\$	126.00 ?
74	REFRIGERANT LINER ? <i>ok ✓</i>	\$	601.00 ?
75	REFRIGERANT LINER ? <i>ok ✓</i>	\$	461.00 ?
76	AIR GUIDE - LH/RH <i>Rehd ✓</i>	2 \$	44.00 ✓
77	AIR GUIDE - UPPER CENTRE <i>Rehd ✓</i>	\$	11.00 ✓
78	RRADIATOR FAN WITH FAN RING ? <i>ok ✓</i>	\$	1,483.00 ?
79	AIR GUIDE ? <i>ok ✓</i>	\$	53.00 ?
80	AIR GUIDE ? <i>ok ✓</i>	\$	62.00 ?
SUB TOTAL SPARE PARTS CHARGES		\$	7,566.00

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

S5 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 2926 X.

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
81	AIR FILTER <i>Ne m</i>	\$ 252.00	*
82	LH FRONT DOOR <i>Bucked</i>	\$ 2,279.00	✓
83	FORNT OUTER DOOR SEAL - LH <i>me</i>	\$ 146.00	✓
84	BONDING AGENT ?	\$ 45.00	"
85	CLEANING SOLUTION ?	\$ 65.00	"
86	FRONT DOOR ATTACHMENT PARTS ?	\$ 218.00	?
87	FRONT DOOR CATCH - LH <i>me m</i>	\$ 96.00	+
88	FRONT DOOR CATCH COVER - LH <i>me m</i>	\$ 13.00	+
89	TRIM STRIP FOR WINDOW GUIDE - LH <i>Get Me m</i>	\$ 235.00	✓
90	TRIM STRIP FOR WINDOW GUIDE-RH <i>me m</i>	\$ 235.00	+
91	CORNER TRIM BLACK-GLOSSY - LH/RH <i>me m</i>	2 \$ 82.00	+
92	WINDOW SLOT SEAL WITH TRIM STRIP CHROME-LH <i>Get</i>	\$ 282.00	✓
93	WINDOW SLOT SEAL WITH TRIM STRIP CHROME-RH <i>me m</i>	\$ 282.00	+
94	FRONT NUMBER PLATE <i>Bucked</i>	S/N \$ 25.00	✓
95	ARCYLIC SEALANT ?	S/N \$ 180.00	✓
96	CAVITY WAX <i>me m</i>	S/N \$ 140.00	✓
97	STONE CHIP TREATMENT <i>me m</i>	S/N \$ 180.00	✓
98	SUNDRIES ?	\$ 1,200.00	?
TOTAL SPARE PARTS CHARGES		\$ 63,019.00	
TOTAL LABOUR CHARGES		\$ 23,424.00	
GRAND TOTAL		\$ 86,443.00	

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0069/2019/PH
Date : 13-Feb-19

Vehicle not in workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way
#07-16 AIG Building
Singapore 079120

*Hi Adrian
You recommended 21 days
We took 31 days exclude 7 Sundays
jb - 23 Sep 19*

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr. Ewe Tuck Foong
Address : 3 Paya Lebar Crescent
#05-21
Singapore 534239
Telephone : HP +65 91012197
Type of Claim : Own Damage Claims
Policy No. : 1800069946
Vehicle No : **SMC 2926 X**
Model Code : Audi A3 Sedan 1.0 TFSI
Model / Year :
Engine No :
Chassis No :
Mileage :
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 13-Jan-19
Place of Accident : CTE Exit Btw Yio Chu Kang Road & Amk Ave 5 (Road1)

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SMC 2926 X

<u>S/n</u>	<u>Nature of Jobs</u>		<u>Estimated Charges</u>	<u>Surveyor's Recommendation</u>
1	To towed and recover from scene of accident.	S/N	WAIVED	
2	To carry out first measurement test on car o-liner	S/N	\$ 800.00	\$ 800.00
3	To remove, check and reinstall front wire harness for headights, horns, outside temperature sensor and healdight washer assy.	S/N	\$ 360.00	\$ 360.00
4	To remove and renew aircon condenser, additional radiator, radiator. Check electrical fans and control unit. Pressurise cooling system. To carry out vacuum and regas.	S/N	\$ 1,000.00	\$ 1,000.00
5	To remove center console, instrustment panels and clusters. Renew dashboard, both frontal airbags, slip ring . Transfer old fittings. Renew seat belts and control unit, pillar trims, roof lining, both curtain air bags and knee air bag.	S/N	\$ 3,600.00	\$ 3,600.00
SUB- TOTAL LABOUR CHARGES			\$ 5,760.00	\$ 5,760.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SMC 2926 X

S/n	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
		<i>c/f</i>		\$ 5,760.00
6	To remove and reinstall engine assy with gearbox assy to facilitate car o-liner repairs.	S/N	\$ 2,800.00	
7	To remove and reinstall front suspension assy with subframe to facilitate car o-liner repairs. Inspect front damages and renew if necessary.	S/N	\$ 2,400.00	
8	To set up vehicle on car-o-liner for repair.	S/N	\$ 1,800.00	
9	To dismantle and renew front bumper, bonnet, both front fenders, both healdights and lhs front door. Cut out and reweld lhs fender top support . Align both front chassis frames to specification of origin. Renew front lock carrier and align to position. re-organise front crash management components. reinsall all parts removed.		\$ 9,600.00	\$ 5,000.00
10	To respray front bumper , bonnet , both front fenders, lhs fender top support, lhs upper A pilla, lhs front door and engine compartment.		\$ 6,200.00	\$ 3,575.00
11	To carry out wheel alignment.	S/N	\$ 240.00	
12	Added labour charges		\$ 2,680.00	\$ 1,730.00

12 To carry out diagnostic check.

S/N \$ 384.00 \$ 384.00

TOTAL LABOUR CHARGES

: \$ 31,864.00 \$ 16,449.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 2926 X

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	STEERING AIR BAG	\$ 3,141.00	\$ 2,512.80
2	AIR BAG UNIT	\$ 4,238.00	\$ 3,390.40
3	HEAD AIRBAG UNIT - LH/RH	2 \$ 3,416.00	\$ 2,732.80
4	HEAD AIRBAG GUIDE-LH/RH	2 \$ 46.00	
5	KNEE AIR BAG	\$ 1,708.00	\$ 1,366.40
6	DRIVER SIDE TRAY SOUL BLACK-RH	\$ 413.00	
7	CONTROL UNIT FOR AIR BAG	\$ 1,606.00	\$ 1,284.80
8	CRASH SENSOR FOR AIR BAG	3 \$ 1,145.00	\$ 915.60
9	DASHBOARD WITH AIR DUCT	\$ 3,887.00	\$ 3,109.60
10	MOULDED HEADLINER	\$ 1,613.00	\$ 1,290.40
11	A PILLAR TRIM-LH	\$ 147.00	\$ 117.20
12	A PILLAR TRIM-RH UPPER	\$ 147.00	\$ 117.20
13	FRONT GRAB HANDLE	2 \$ 258.00	\$ 103.20
14	GRAB HANDLE - REAR LH/RH	2 \$ 260.00	
15	3 POINT AUTOMATIC SEAT BEALT-LH/RH	2 \$ 2,010.00	\$ 1,608.00
16	SEAT BELT HEIGHT ADJUSTER	2 \$ 361.00	
17	FRONT BUMPER	\$ 1,830.00	\$ 1,464.00
18	FRONT BUMPER FIXING PARTS	\$ 170.00	\$ 136.00
19	FRONT BUMPER GUIDE SECTION-LH/RH	2 \$ 70.00	\$ 55.04
20	FRONT BUMPER LOWER GRILE-CENTER	\$ 146.00	\$ 116.40
SUB-TOTAL SPARE PARTS CHARGES		\$ 26,612.00	\$ 20,319.84

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 2926 X

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 20,319.84
40	BUMPER GRILLE CLOSING ELEMENT-LOWER CEM		\$ 488.00	\$ 390.00
41	BUMPER CLOSING ELEMENT-LH/RH	2	\$ 540.00	
42	FRONT BUMPER COVER TRIM-LH/RHJ	2	\$ 296.00	\$ 118.40
43	ADAPTER HOUSING LINER-LH/RH	2	\$ 68.00	
44	RADIATOR GRILLE		\$ 1,301.00	\$ 1,040.80
45	CLOSING ELEMENT		\$ 174.00	\$ 138.40
46	AIR GUIDE GRILLE-LH/RH	2	\$ 342.00	\$ 136.40
47	FRONT REINFORCEMENT		\$ 660.00	\$ 527.60
48	FOAM FILLER PIECE		\$ 172.00	\$ 137.60
49	FOAM FILLER PIECE COVER		\$ 111.00	\$ 88.80
50	CAUTION ' STICKER '		\$ 13.00	\$ 9.76
51	HORN-HIGH TONE-LH		\$ 182.00	\$ 145.60
52	HORN-LOW TONE-RH		\$ 182.00	\$ 145.60
53	FRONT FENDER-LH/RH	2	\$ 1,556.00	\$ 1,244.00
54	ATTACHMENT PARTS FOR FENDER	2	\$ 130.00	\$ 104.00
55	BRACKET FOR FENDER-LH/RH	2	\$ 50.00	\$ 39.52
56	BRACKET FOR FENDER-LH/RH	2	\$ 70.00	\$ 55.52
57	FENDER BRACE-LH/RH		\$ 176.00	\$ 139.68
58	FRONT WHEEL HOUSING LINER-LH/RH	2	\$ 316.00	\$ 252.00
59	ATTACHMENT PARTS FOR WHEEL HOUSING I	2	\$ 161.00	\$ 128.80
SUB-TOTAL SPARE PARTS CHARGES			\$ 6,988.00	\$ 25,162.32

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 2926 X

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 25,162.32
41	BONNET		\$ 2,898.00	\$ 2,318.40
42	ATTACHEMENT PARTS FOR BONNET		\$ 149.00	
43	BONNET LID HINGE-LH/RH	2	\$ 112.00	\$ 88.48
44	BONNET GAS FILLED STRUT		\$ 109.00	
45	BONNET CATCH HOOK		\$ 81.00	\$ 64.72
46	BONNET STRIKER-LH/RH	2	\$ 200.00	\$ 159.04
47	EDGE PROTECTION		\$ 25.00	\$ 19.92
48	COVER-LH/RH	2	\$ 74.00	
49	SEAL FOR WATER BOX		\$ 53.00	
50	CATCH HOCK		\$ 58.00	\$ 45.76
51	LID LOCK WITH MICRO SWITCH	2	\$ 367.00	\$ 293.60
52	FLAT CONNECTOR		\$ 12.00	
53	BOWDEN CABLE		\$ 53.00	\$ 41.68
54	LID LOCK CABLE		\$ 68.00	
55	BONNET SOUND ABSORBER		\$ 201.00	\$ 160.80
56	COVER FOR PLENUM CHAMER SATIN BLACK		\$ 164.00	\$ 130.80
57	COVER		\$ 15.00	
58	LED HEADLIGHT-LH/RH	2	\$ 10,058.00	\$ 8,046.40
59	POWER MODULE FOR MAIN LIGHT ELECTRONIC		\$ 693.00	\$ 554.00
60	CONTROL UNIT FOR LIGHT CONTROL SYSTEM		\$ 508.00	\$ 406.00
	SUB-TOTAL SPARE PARTS CHARGES		\$ 15,898.00	\$ 37,491.92

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 2926 X

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 37,491.92
61	LED WITH HEAT SINK-LH		\$ 666.00	\$ 532.40
62	LIFT CYLINDER FOR HEALDLIGHT WASHER-LH/F	2	\$ 256.00	\$ 102.00
63	HOSE		\$ 61.00	
64	WASHER TANK RESERVOIR		\$ 186.00	\$ 148.40
65	FENDER TOP SUPPORT-LH INNER		\$ 214.00	\$ 171.20
66	FRONT LOCK CARRIER		\$ 663.00	\$ 530.40
67	AIR CONDENSER		\$ 503.00	\$ 402.00
68	COOLER FOR COOLANT		\$ 878.00	\$ 702.40
69	ADDITIONAL COLLER FOR COOLANT		\$ 837.00	\$ 669.60
70	COOLANT	4	\$ 84.00	\$ 67.20
71	COOLANT HOSE WITH QUICK RELEASE COUPLING-		\$ 234.00	
72	COOLANT HOSE WITH QUICK RELEASE COUPLING-		\$ 143.00	
73	COOLANT HOSE WITH QUICK RELEASE COUPLING-		\$ 126.00	
74	REFRIGERANT LINER		\$ 601.00	\$ 480.40
75	REFRIGERANT LINER		\$ 461.00	\$ 368.80
76	AIR GUIDE-LH/RH	2	\$ 44.00	\$ 34.24
77	AIR GUIDE-UPPE CENTRE		\$ 11.00	\$ 8.32
78	RADIATOR FAN WITH FAN RING		\$ 1,483.00	\$ 1,186.40
79	AIR GUIDE		\$ 53.00	\$ 41.84
80	AIR GUIDE		\$ 62.00	\$ 49.20
SUB-TOTAL SPARE PARTS CHARGES			\$ 7,566.00	\$ 42,986.72 ✓

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 2926 X

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
			\$ 43,986.72
	<i>c/f</i>		
81	AIR FILTER	\$ 252.00	
82	LH FRONT DOOR	\$ 2,279.00	\$ 1,823.20
83	FRONT OUTER DOOR SEAL-LH	\$ 146.00	\$ 116.80
84	BONDING AGENT	\$ 45.00	
85	CLEANING SOLUTION	\$ 65.00	
86	FRONT DOOR ATTACHMENT PARTS	\$ 218.00	
87	FRONT DOOR CATCH -LH	\$ 96.00	
88	FRONT DOOR CATCH COVER-LH	\$ 13.00	
89	TRIM STRIP FOR WINDOW GUIDE-LH	\$ 235.00	
90	TRIM STRIP FOR WINDOW GUIDE-RH	\$ 235.00	
91	CORNER TRIM BLACK GLOSSY-LH/RH	2 \$ 82.00	
92	WINDOW SLOT SEAL WITH TRIM STRIP CHROME-LI	\$ 282.00	\$ 225.60
93	WINDOW SLOT SEAL WITH TRIM STRIP CHROME-R	\$ 282.00	
94	FRONT NO. PLATE	S/N \$ 25.00	\$ 25.00
95	ACRYLIC SEALNT	S/N \$ 180.00	\$ 180.00
96	CAVITY WAX	S/N \$ 140.00	\$ 140.00
97	STONE CHIP TREATMENT	S/N \$ 180.00	
98	<i>Added parts - see attached</i>	\$ 3,160.00	\$ 2,474.72
100	SUNDRIES	\$ 1,200.00	\$ 36.40
	TOTAL SPARE PARTS CHARGES	\$ 66,179.00	\$ 49,008.44
	TOTAL LABOUR CHARGES	\$ 31,864.00	\$ 16,449.00
	GRAND TOTAL	\$ 98,043.00	\$ 65,457.44

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Supplementary Estimate

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 / Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/0069/2019/PH 13-Feb-19 CHANG 1 of 1 SMC2926X AUDI A3 SEDAN 1.0 TFSI
Quantity	Description	Unit Price	Amount
Labours			
1	To remove and renew damaged wiring harness and connectors	\$ 480.00	\$ 480.00
2	To cut and weld RH chassis cover plate	\$ 1,200.00	\$ 500.00
3	To carry out sealer work and spray RH front chassis cover plate.	\$ 600.00	\$ 350.00
4	Carry out front windscreen solar film	\$ 400.00	\$ 400.00
		\$ 2,680.00	\$ 1,730.00
Parts			
1	FRONT FENDER CLOSING ELEMENT - LH FRONT	\$ 66.00	\$ 52.32
2	OUTER TEMP SENSOR BRACKET	\$ 17.00	\$ 13.04
3	OUTER TEMP SENSOR WIRE SET	\$ 111.00	\$ 40.64
4	WIRE CONNECTOR BLACK	\$ 17.00	\$ 13.28
5	WIRE CONNECTOR WHITE	\$ 29.00	\$ 22.72
6	WIRE CONNECTOR WHITE	\$ 19.00	\$ 14.96
7	CABLE GUIDE	\$ 22.00	\$ 17.52
8	AIRCOND PIPE	\$ 461.00	\$ 368.80
9	COOLANT HOSE COUPLING	\$ 22.00	\$ 17.28
10	COOLANT PIPE	\$ 28.00	\$ 22.08
11	FRONT CHASSIS FRAME COVER PLATE RH	\$ 89.00	\$ 70.48
12	WIRE CONNECTOR - BLACK	\$ 16.00	\$ 12.24
13	HEADLIGHT HOSE	\$ 36.00	\$ 28.32
14	INTAKE AIR DUCT COVER	\$ 27.00	\$ 21.36
15	INTAKE AIR DUCT DRAINAGE HOSE	\$ 31.00	\$ 24.48
16	MULTIFUNCTIONAL STEERING WHEEL	\$ 2,169.00	\$ 1,735.20
		MATERIALS	\$ 3,160.00 \$ 2,474.72
		LABOUR	\$ 2,680.00 \$ 1,730.00
		GRAND TOTAL	\$ 5,840.00 \$ 4,204.72

For Premium Automobiles Pte Ltd

 Authorised Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SMC 2926 X

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/0069/2019/NH

21 Nov 2019

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

RE: INSURANCE CLAIM FOR SMC 2926 X, Audi A3 SEDAN 1.0 TFSI.

With reference to the above-mentioned vehicle, no. **SMC 2926 X**, claimant, **Mr. Ewe Tuck Foong**, please find the related document per attached.

1. A copy of the Original invoice no. 85014502 – S\$ 68,327.46.
2. A copy of the Discharge Voucher duly signed by client.

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept

Encl
AIG – SMC 2926 X

total pages

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6388 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 1 15:31

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120		Invoice No: 85014502 Date : 20/11/2019 Order : SMC2926X Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120	
Regn No: SMC2926X (V 38496) Model: A3 SEDAN 1.0 TFSI 8VMANG You have been assisted by :- UB-Tony Foong (33)	Regn Date: 28/06/2018 Chassis: WAU2E28V4J1074077	Mileage: 4905 Engine: CH2 474413	WIP No.: 39291 Dept: U	
	Details	Qty	Unit Price	Amount
S	SUBLET M: TO SUPPLY VEHICLE NUMBER PLATE	25.00	1.00	25.00
S	SUBLET M: TO REPLACE FRONT WINDSCREEN.	400.00	1.00	400.00
Q	EXC M: 8888 Insurance Excess/Liability	-600.00	1.00	-600.00
S	BODYWORK M: TO CARRY OUT FIRST MEASUREMENT TEST ON CAR-O-LINER	800.00	1.00	800.00
S	BODYWORK M: TO REMOVE,CHECK AND REINSTALL FRONT WIRE HARNESS FOR HEADLIGHTS,HORNS,OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY	360.00	1.00	360.00
S	BODYWORK M: TO REMOVE AND RENEW AIRCON CONDENSER,RADIATOR, ADDITIONAL RADIATOR.CHECK ELECTRICAL FANS AND CONTROL UNIT.PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS	1000.00	1.00	1,000.00
S	BODYWORK M: TO REMOVE CENTER CONSOLE, INSTRUMENT PANELS AND CLUSTERS.RENEW DASHBOARD,BOTH FRONTAL AIRBAG,SLIP RING.TRANSFER OLD FITTING. RENEW SEAT BELTS AND CONTROL UNIT,PILLAR TRIM,ROOF LINING,BOTH CURTAIN AIRBAG AND KNEE AIRBAG	3600.00	1.00	3,600.00
S	BODYWORK M: TO DISMANTLE AND RENEW FRONT BUMPER,BONNET, BOTH FRONT FENDER,BOTH HEADLIGHT AND LHS FRONT DOOR.CUT OUT AND REWELD LHS FENDER TOP SUPPORT. ALIGN BOTH FRONT CHASSIS FRAME TO SPECIFICATION OF ORIGIN.RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION.REINSTALL ALL PARTS REMOVED	5000.00	1.00	5,000.00
S	BODYWORK M:	3575.00	1.00	3,575.00

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408598
Main Telephone 6388 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 2 15:31

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014502	Account: A0006 (T 0)
	Date: 20/11/2019	AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
	Order: SMC2926X	
	Term: 30	

Regn No: SMC2926X (V 38496)	Regn Date: 28/06/2018	Mileage: 4905	WIP No.: 39291
Model: A3 SEDAN 1.0 TFSI 8VMANG	Chassis: WAUZZZ8V4J1074077	Engine: CHE 474413	Dept: U
You have been assisted by :- UB-Tony Foong (33)			

	Details	Qty	Unit Price	Amount
S	BODYWORK TO RESPRAY FRONT BUMPER, BONNET, BOTH FRONT FENDER, LHS FENDER TOP SUPPORT, LHS UPPER A PILLAR AND LHS FRONT DOOR. M:	384.00	1.00	384.00
S	BODYWORK TO CARRY OUT DIAGNOSTIC CHECK M:	320.00	1.00	320.00
S	BODYWORK TO SUPPLY ACRYLIC SEALANT AND CAVITY WAX M:	480.00	1.00	480.00
S	BODYWORK TO REMOVE AND RENEW DAMAGED WIRING HARNESS AND CONNECTORS. M:	500.00	1.00	500.00
S	BODYWORK TO CUT OUT AND WELD RHS FRONT CHASSIS COVER PLATE M:	350.00	1.00	350.00
X	A8V0809147A (A) (G) PLATE 24/01/19 Less 020%	1.00	214.00	171.20
X	A8V0880201DN6P5 (A) (G) AIRBAG 24/01/1 Less 020%	1.00	3141.00	2,512.80
X	A8V5880741D (A) (G) AIRBAG 24/01/1 Less 020%	1.00	1708.00	1,366.40
X	A8V5880742D (A) (SK) AIRBAG 24/01/1 Less 020%	1.00	1708.00	1,366.40
X	A8V2880841D (A) (G) AIRBAG 24/01/1 Less 020%	1.00	1708.00	1,366.40
X	A5Q0959655BJ (A) (G) MODULE 24/01/1 Less 020%	1.00	1606.00	1,284.80
X	A8V5867505S YX7 (A) (G) ROOFLINING 24/ Less 020%	1.00	1613.00	1,290.40
X	A8V5867233A VU6 (A) (G) LINING 24/01/1 Less 020%	1.00	146.50	117.20
X	A8V5867234A VU6 (A) (G) LINING 24/01/1 Less 020%	1.00	146.50	117.20
X	A8V0419091CHINU (V) (G) STEERINGWH 30/ Less 020%	1.00	2169.00	1,735.20
X	AN 98926001 (A) (SK) SCREW 14/02/1 Less 020%	2.00	8.30	13.28
X	A8V0805029B (A) (SK) PLATE 14/02/1 Less 020%	1.00	65.40	52.32
X	A5Q0973737 (A) (SK) HOUSING 14/02 Less 020%	1.00	18.70	14.96
X	A5Q0971615P (V) (G) CONDUIT 14/02/ Less 020%	1.00	21.90	17.52
X	A5Q0804182B (A) (SK) COVERPLATE 14 Less 020%	1.00	88.10	70.48
X	A7L0973812 (A) (SK) HOUSING 14/02 Less 020%	1.00	15.30	12.24
X	A8V0941717B (V) (Ger) HOSE 14/02/1 Less 020%	1.00	35.40	28.32
X	A8V3853651AA3P5 GRILLE Less 020%	1.00	1301.00	1,040.80

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408689
Main Telephone 6388 2323
Main Telefax 6641 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9628 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 3 15:31

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120		Invoice No: 85014502 Date : 20/11/2019 Order : SMC2926X Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120			
Regn No: SMC2926X (V 38496) Model: A3 SEDAN 1.0 TFSI 8VMANG You have been assisted by :- US-Tony Foong (33)	Regn Date: 28/06/2018 Chassis: WAUZZZ8V4J1074077	Mileage: 4905 Engine: CHZ 474413	WIP No.: 39291 Dept: U			
		Details	Qty	Unit Price	Amount	
X	A8V0941773D	(A) (G) HEADLIGHT 24/0	Less 020%	1.00	5029.00	4,023.20
X	A8V0941774D	(A) (G) HEADLIGHT 24/0	Less 020%	1.00	5029.00	4,023.20
X	A8V5821105A	FENDER	Less 020%	1.00	777.50	622.00
X	A8V5821171	WHEEL HOUS	Less 020%	1.00	157.50	126.00
X	A8V0863825	(A) (SK) SILENCER 24/0	Less 020%	1.00	201.00	160.80
X	A8V5821106A	FENDER	Less 020%	1.00	777.50	622.00
X	A8V5821172	WHEEL HOUS	Less 020%	1.00	157.50	126.00
X	A8V0880204J	(A) (SK) AIRBAG 24/01/	Less 020%	1.00	4238.00	3,390.40
X	A5Q0816411AS	CONDENSER	Less 020%	1.00	502.50	402.00
X	A5Q0121251GD	RADIATOR	Less 020%	1.00	878.00	702.40
X	A5Q0121251GB	RADIATOR	Less 020%	1.00	837.00	669.60
X	A8V5807233B	PLATE	Less 020%	1.00	487.50	390.00
X	A8V5819401A 9B9	COVER	Less 020%	1.00	163.50	130.80
X	A8V0805588A	CARRIER	Less 020%	1.00	663.00	530.40
X	A5Q0121203DA	ELECTRIC F	Less 020%	1.00	1483.00	1,186.40
X	A8V5831051D	(A) (SK) DOOR 24/01/19	Less 020%	1.00	2279.00	1,823.20
X	A8V0807550A	FOAM INSER	Less 020%	1.00	172.00	137.60
X	A8V4807109E	BEAM	Less 020%	1.00	659.50	527.60
X	AG A13040M2	PREMIX-COOLANT	Less 020%	4.00	21.00	67.20
X	A8V5823029A	HOOD	Less 020%	1.00	2898.00	2,318.40
X	A8V5807065R GRU	COVER	Less 020%	1.00	1830.00	1,464.00
X	A8V2857001J 24A	(A) (G) DASHBOARD 24/0	Less 020%	1.00	3887.00	3,109.60
X	A4D0260749B	WASHER	Less 020%	1.00	3.00	2.40
X	A4D0260749B	WASHER	Less 020%	1.00	3.00	2.40
X	AN 90799102	BOLT	Less 020%	1.00	14.80	11.84
X	A8V0121285A	AIR DUCT	Less 020%	1.00	10.40	8.32
X	A8V0823126B	EDGING	Less 020%	1.00	24.90	19.92
X	A8V0807217A	(A) (SK) COVER 24/01/1	Less 020%	1.00	111.00	88.80
X	A8V5807183	GUIDE	Less 020%	1.00	34.40	27.52
X	A8V0821135A	SUPPORT	Less 020%	1.00	87.30	69.84
X	A8V5821468B	BRACKET	Less 020%	1.00	34.70	27.76
X	A8V5807184	GUIDE	Less 020%	1.00	34.40	27.52
X	A8V0823301G	HINGE	Less 020%	1.00	55.30	44.24
X	A8V0823302G	HINGE	Less 020%	1.00	55.30	44.24

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6388 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6386 2323
24-hour Breakdown Service 9628 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 4 15:31

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014502	Account: A0006 (T 0)
	Date : 20/11/2019	AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
	Order : SMC2926X	
	Term : 30	

Regn No: SMC2926X (V 38496)	Regn Date: 28/06/2018	Mileage: 4905	WIP No.: 39291
Model: A3 SEDAN 1.0 TFSI 8VMANG	Chassis: WAUZZZ8V4J1074077	Engine: CHZ 474413	Dept: U
You have been assisted by :- UB-Tony Foong (33)			

		Details		Qty	Unit Price	Amount
X	A8V0821136C	SUPPORT	Less 020%	1.00	87.30	69.84
X	A8V5807534A	COVERSTRIP	Less 020%	1.00	148.00	118.40
X	A8V5821471A	BRACKET	Less 020%	1.00	24.70	19.76
X	A8V5821467B	BRACKET	Less 020%	1.00	34.70	27.76
X	A04C121064B	PIPE	Less 020%	1.00	27.60	22.08
X	A5Q0122291BD	COUPLPIECE	Less 020%	1.00	21.60	17.28
X	A5Q0129621B	AIR DUCT	Less 020%	1.00	18.10	14.48
X	A5Q0129637B	HOSE	Less 020%	1.00	30.60	24.48
X	A5Q0129618J	AIR DUCT	Less 020%	1.00	61.50	49.20
X	A8V5837911C	SEAL	Less 020%	1.00	146.00	116.80
X	A8V0820536	BRACKET	Less 020%	1.00	16.30	13.04
X	A8V0823185C	CATCH	Less 020%	1.00	99.40	79.52
X	A8V0823186C	CATCH	Less 020%	1.00	99.40	79.52
X	A8V5821472A	BRACKET	Less 020%	1.00	24.70	19.76
X	A8V5807681AA9B9	GRILL	Less 020%	1.00	170.50	136.40
X	A8V4823485C	HOOK	Less 020%	1.00	57.20	45.76
X	A4E0260749B	WASHER	Less 020%	1.00	4.50	3.60
X	A8E0260749C	WASHER	Less 020%	1.00	3.20	2.56
X	A4E0260749A	WASHER	Less 020%	1.00	3.60	2.88
X	A3D0260749C	WASHER	Less 020%	1.00	4.00	3.20
X	A5Q0820741B	COOLANTPIP	Less 020%	1.00	600.50	480.40
X	A8V0823480A	HOOK	Less 020%	1.00	80.90	64.72
X	A8V0823509A	LOCK	Less 020%	2.00	183.50	293.60
X	A8V5857705E V04	(A) (SK)SEAT BELT 24/	Less 020%	1.00	1005.00	804.00
X	A8V5857706E V04	(A) (SK)SEAT BELT 24/	Less 020%	1.00	1005.00	804.00
X	A8V0857607 MG6	HANDLE	Less 020%	1.00	129.00	103.20
X	A8V0823531A	BOWD CABLE	Less 020%	1.00	52.10	41.68
X	A5Q0816721AD	(A) (SK)COOLANTPIP 14	Less 020%	1.00	461.00	368.80
X	A5Q0820743K	COOLANTPIP	Less 020%	1.00	461.00	368.80
X	A8V5807647B 989	GRILLE	Less 020%	1.00	145.50	116.40
X	A4A0955485	STRAINER	Less 020%	1.00	18.20	14.56
X	A6R0955681	PUMP	Less 020%	1.00	143.10	114.48
X	A5Q0959651B	SENSOR	Less 020%	3.00	381.50	915.60
X	A1K0955455	COVER	Less 020%	1.00	18.50	14.80

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6388 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9628 1233
Email: customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 5 15:31

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014502	Account: A0006 (T 0)
	Date : 20/11/2019	AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
	Order : SMC2926X	
	Term : 30	

Regn No: SMC2926X (V 38496)	Regn Date: 28/06/2018	Mileage: 4905	WIP No.: 39291
Model: A3 SEDAN 1.0 TFSI SVMANG	Chassis: WAUZZZ8V4J1074077	Engine: CHE 474413	Dept: U
You have been assisted by :- UB-Tony Foong (33)			

		Details	Qty	Unit Price	Amount	
X	ABV0955101B	CYLINDER	Less 020%	1.00	127.50	102.00
X	A431955465A	GASKET	Less 020%	1.00	6.90	5.52
X	A443955465	GASKET	Less 020%	1.00	2.90	2.32
X	A000979941	CONNECTOR (RED)	Less 020%	2.00	9.60	15.36
X	A000979941	CONNECTOR (RED)	Less 020%	2.00	9.60	15.36
X	A000979940	CONNECTOR (WHITE)	Less 020%	4.00	9.60	30.72
X	A000979940	CONNECTOR (WHITE)	Less 020%	3.00	9.60	23.04
X	A000979942	CONNECTOR (BLUE)	Less 020%	4.00	9.60	30.72
X	A000979025EA	WIRES	Less 020%	1.00	29.40	23.52
X	A000979141E	WIRE SET	Less 020%	1.00	21.40	17.12
X	A4H0973712	HOUSING	Less 020%	2.00	8.30	13.28
X	A8K0010520A	PLATE	Less 020%	1.00	12.20	9.76
X	ABV0010515A	STICKER	Less 020%	1.00	6.40	5.12
X	ABV0951210D	HORN	Less 020%	1.00	182.00	145.60
X	A5Q0129254B	AIR DUCT	Less 020%	1.00	52.30	41.84
X	ABV0121284K	AIR DUCT	Less 020%	1.00	21.40	17.12
X	ABV0121283K	AIR DUCT	Less 020%	1.00	21.40	17.12
X	ABV3853949	(SK)PLATE	Less 020%	1.00	172.99	136.40
X	A5Q0955453R	WATER RES.	Less 020%	1.00	185.50	148.40
X	A7PP941572AC	POWER MOD	Less 020%	1.00	692.50	554.00
X	A8S0907397D	CTRL UNIT	Less 020%	1.00	507.50	406.00
X	ABV0998473A	LED	Less 020%	1.00	665.50	532.40
X	A5Q0973837	HOUSING	Less 020%	1.00	28.40	22.72
X	ABV0951209C	HORN	Less 020%	1.00	182.00	145.60
X	AN 98924301	(A) (SK) SCREW 14/02/1	Less 020%	2.00	6.30	10.08
X	AN 10261501	FUSE(5A) SMALL(REQ1)	Less 020%	2.00	1.90	3.04
X	AN 10261507	FUSE 15A (SMALL)	Less 020%	2.00	1.90	3.04
X	AN 10261503	FUSE(10A) SMALL	Less 020%	2.00	1.90	3.04
X	AN 0161857	POP-RIVET	Less 020%	10.00	3.00	24.00
X	AN 91022001	NUT	Less 020%	4.00	1.50	4.80
X	AN 90687201	CLIP 40x12	Less 020%	1.00	4.90	3.92
X	AN 90686701	CLIP 14x12	Less 020%	3.00	3.00	7.20
X	AN 90739704	SCREW	Less 020%	2.00	1.40	2.24
X	AWHT005551A	(A) (SK) BOLT	Less 020%	8.00	2.10	13.44

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6388 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9628 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 6 15:31

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014502	Account: A0006 (T 0)
	Date : 20/11/2019	AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
	Order : SMC2926X	
	Term : 30	
Regn No: SMC2926X (V 38496)	Regn Date: 28/06/2018	Mileage: 4905
Model: A3 SEDAN 1.0 TFSI 8VMANG	Chassis: WAUZ228V4J1074077	WIP No.: 39291
Engine: CHZ 474413	Dept: 0	
You have been assisted by :- UB-Tony Poong (33)		

		Details	Qty	Unit Price	Amount
X	AN 91141501	RIVET	1.00	2.20	1.76
X	A5Q0129954	COVER	1.00	26.70	21.36
X	ABV5853283B 22Z	(SK)WINDOW SLO	1.00	282.00	225.60

Parts 47,663.44
Labour 0.00
Sublet 16,794.00
Menus 0.00
Lubricant 0.00

Sub-Total 63,857.44

7% GST 4,470.02

Grand Total 68,327.46



Received by

For & on behalf of
Premium Automobiles Pte Ltd

Premium Automobiles

Telefax

to **AIG Asia Pacific Insurance Pte Ltd**
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SMC 2926 X

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/0069/2019/TF
5 March 2019

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

1 total pages

RE: CLAIM – OWNER'S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi A3 SEDAN 1.0 TFSI 8V
Vehicle Chassis No. : WAUZZZ8V4J1074077
Vehicle Regn No. : **SMC2926X**
Vehicle Mileage : 2215KM
Vehicle Owner : Mr. Ewe Tuck Foong
Certificate No : 1800069946
Own Damage Excess : \$ 642.00 (Inclusive 7%GST)
Accident Date : 13 January 2019
Place : CTE EXIT BTW YIO CHU KANG ROAD & AMK AVE 5 (ROAD 1)
Repair Cost : \$ 68327.46
WIP No. : 39291
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature :

Time :

Date :



13/3/14

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	18 Jan 2019 10:54		17 Jan 2019 16:05 Edit Adj Rpt	S\$64,457.44 Edit Estimates	S\$64,457.44 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured:	WE TUCK FOONG , ID: 57284547A, Tel: +6597479587, Email: EWEEWE@LIVE.COM.SG								
Vehicle Reg. No.:	SMC2926X	Date of Loss:	13/01/2019 12:00 - :59 [6 Months and 16 Days From LTA Reg Date (Man Yr)]						
Claim Type:	OD / 8601420352SG	Policy/Cover Note No.:	1800069946 (Comprehensive) Coverage: 28/06/2018 - 27/06/2020						
		Excess:	S\$600.00						
Repairer:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911								
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Dally Amri, Mimi Zarina] MimiZarina.DallyAmri@aig.com								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 28/01/2019]								
Driver/Custodian:	WE TUCK FOONG (46 / Male), NRIC: 57284547A, Tel: +6597479587 Email: EWEEWE@LIVE.COM.SG								
ASSOCIATED MAIL RECEIVED			View All	Compose Case Mail					
<ul style="list-style-type: none"> AIG_SG (31/10/2019): Alert - Adj Mandate Approved (S\$64457.44) - SMC2926X - Claim Handler: Dally Amri... AIG_SG (22/01/2019): Alert - Adj Mandate Approved (S\$79681.00) - SMC2926X - Claim Handler: Dally Amri... AIG_SG (18/01/2019): SMC2926X / OD / 13/01/2019 / Coverage & Excess update 									
ALL ASSOCIATED TASKS			View All	Search Tasks					
			Create New Task	Complete					
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SMC2926X (8601420352SG)
OD
Jan 13 2019 12:30PM
[EWE TUCK FOONG]
Premium Automobiles Pte Ltd

Upload Documents Upload Photos Compose New Letter Upload Video Upload Audio			View <input type="button" value="View in Browser"/>
Assessment Reports			1 per page <input type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail Print
1	18/01/19 18:06	Adjuster Immediate Advice	Load HTM
Photos/Images			3 per page <input type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail Print
1	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
2	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
3	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
4	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
5	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
6	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
7	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
8	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
9	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
10	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
11	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
12	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
13	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
14	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
15	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
16	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
17	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
18	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
19	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
20	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
21	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
22	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
23	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
24	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
25	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
26	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
27	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
28	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
29	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
30	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
31	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
32	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
33	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
34	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
35	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
36	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
37	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
38	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
39	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
40	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>
41	18/01/19 10:56	General View	Load JPG <input type="checkbox"/>

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
42	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
43	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
44	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
45	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
46	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
47	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
48	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
49	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
50	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
51	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
52	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
53	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
54	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
55	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
56	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
57	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
58	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
59	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
60	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
61	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
62	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
63	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
64	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
65	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
66	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
67	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
68	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
69	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
70	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
71	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
72	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
73	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
74	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
75	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
76	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
77	18/01/19 10:56	General View		<input checked="" type="checkbox"/>
78	18/01/19 10:56	General View		<input checked="" type="checkbox"/>

Documentation			1 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	18/01/19 10:55	Singapore Accident Statement		<input checked="" type="checkbox"/>
2	18/01/19 10:55	Police Report		<input checked="" type="checkbox"/>
3	18/01/19 10:55	Certificate of Insurance		<input checked="" type="checkbox"/>
4	18/01/19 10:55	Driver's Driving License		<input checked="" type="checkbox"/>
5	18/01/19 10:55	ESTIMATE		<input checked="" type="checkbox"/>
6	15/02/19 12:08	SUPPLEMENTARY LIST		<input checked="" type="checkbox"/>
7	12/03/19 09:24	OWNER RECEIVED LAWYER LETTER FROM THIRD PARTY		<input checked="" type="checkbox"/>
8	04/10/19 16:01	SUPPLEMENTARY LIST 2		<input checked="" type="checkbox"/>

Linked Accident Report Documents

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	14/01/19 18:04	Accident Statement		<input checked="" type="checkbox"/>

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	14/01/19 17:50	Police Report		<input checked="" type="checkbox"/>
2	14/01/19 17:50	Police Report		<input checked="" type="checkbox"/>
3	14/01/19 17:50	Police Report		<input checked="" type="checkbox"/>
4	14/01/19 17:50	Police Report		<input checked="" type="checkbox"/>
5	14/01/19 17:50	Police Report		<input checked="" type="checkbox"/>
6	14/01/19 17:50	Police Report		<input checked="" type="checkbox"/>
7	14/01/19 17:50	Police Report		<input checked="" type="checkbox"/>
8	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
9	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
10	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
11	14/01/19 17:59	Driving License		<input checked="" type="checkbox"/>
12	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
13	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
14	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
15	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
16	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
17	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
18	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
19	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
20	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
21	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
22	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
23	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
24	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
25	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
26	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>
27	14/01/19 17:59	Accident Photo		<input checked="" type="checkbox"/>

Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	14/01/19 17:47	Sketch Plan		<input checked="" type="checkbox"/>
2	14/01/19 17:47	Sketch Plan #2		<input checked="" type="checkbox"/>

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
<p>Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)</p> <div style="border: 1px solid black; height: 40px; width: 100%;"></div>			
<p>Show Remarks To: <input type="checkbox"/> Handling Insurer</p> <p><small>Note: Remarks are private unless you show it to other parties.</small></p>			

LKK Auto Consultants Pte Ltd (Co. Reg. No 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #08-16
Singapore 079120

Our File No: CC3/AIG19001079/AQD3E2

Date: 28/11/2019

REFERENCE

Insured/Claimant:	EWE TUCK FOONG	Policy No:	1800069946	
Date of Loss:	13/01/2019	Nature of Claim:	OD	Claim No: 8601420352SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMC2926X		
Make & Model:	AUDI A3, 999cc SEDAN TFSI (A)	Engine No:	CHZ474413
Reg. Date:	28/08/2018 (Man. Year: 2018)	Chassis No:	WAUZZZ8V4J1074077
Colour:	Grey	Odometer:	2207 km
Engine Capacity:	999 cc		
Market Value/New Car Price:	S\$122,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	65,493.72	48,008.44	17,485.28	26.70
Miscellaneous Items	0.00	0.00	0.00	
Labour	31,864.00	16,449.00	15,415.00	48.38
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	97,357.72	64,457.44	32,900.28	33.79
- Excess (S\$)	600.00	600.00	0.00	0.00
(S\$)	96,757.72	63,857.44	32,900.28	34.00
+ GST 7.00/7.00% (S\$)	6,773.04	4,470.02	2,303.02	34.00
Nett Amount (S\$)	103,530.76	68,327.46	35,203.30	34.00

INSPECTION

Date of Assignment:	17/01/2019		
Date Inspected:	17/01/2019	Inspected At:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699
Estimated Period of Repair:	26.0 days		

Adjuster: ADRIAN LING

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*STEERING AIRBAG	Activated	3,141.00 FS	*2,512.80 FS
2	1		*AIRBAG UNIT	Activated	4,238.00 FS	*3,390.40 FS
3	2		*HEAD AIRBAG UNIT - LH/RH	Activated	3,416.00 FS	*2,732.80 FS
4	2		*HEAD AIRBAG GUIDE - LH/RH	Not Necessary	46.00 FS	*- FS
5	1		*KNEE AIRBAG	Activated	1,708.00 FS	*1,366.40 FS
6	1		*DRIVER SIDE TRAY SOUL BLACK - RH	Not Necessary	413.00 FS	*- FS
7	1		*CONTROL UNIT FOR AIRBAG	Activated	1,606.00 FS	*1,284.80 FS
8	3		*CRASH SENSOR FOR AIRBAG	Activated	1,145.00 FS	*915.60 FS
9	1		*DASHBOARD WITH AIR DUCT	Torn	3,887.00 FS	*3,109.60 FS
10	1		*MOULDED HEADLINER	Crumpled	1,613.00 FS	*1,290.40 FS
11	1		*A PILLAR TRIM - LH	Cut	147.00 FS	*117.20 FS
12	1		*A PILLAR TRIM - RH UPPER	Cut	147.00 FS	*117.20 FS
13	2		*FRONT GRAB HANDLE	Damaged	258.00 FS	*103.20 FS
14	2		*GRAB HANDLE - REAR LH/RH	Not Necessary	260.00 FS	*- FS
15	2		*3 POINT AUTOMATIC SEAT BELT - LH/RH	Activated	2,010.00 FS	*1,608.00 FS
16	2		*SEAT BELT HEIGHT ADJUSTER	Not Necessary	361.00 FS	*- FS
17	1		*FRONT BUMPER	Distorted	1,830.00 FS	*1,464.00 FS
18	1		*FRONT BUMPER FIXING PARTS	Damaged	170.00 FS	*136.00 FS
19	2		*FRONT BUMPER GUIDE SECTION - LH/RH	Damaged	70.00 FS	*55.04 FS
20	1		*FRONT BUMPER LOWER GRILLE - CENTER	Cracked	146.00 FS	*116.40 FS
21	1		*BUMPER GRILLE CLOSING ELEMENT - LOWER CENTRE	Deformed	488.00 FS	*390.00 FS
22	2		*BUMPER CLOSING ELEMENT - LH/RH	Not Necessary	540.00 FS	*- FS
23	1		*FRONT BUMPER COVER TRIM - LH/RH	N/S Deformed	296.00 FS	*118.40 FS
24	2		*ADAPTER HOUSING HOUSING LINER - LH/RH	Not Necessary	68.00 FS	*- FS
25	1		*RADIATOR GRILLE	Cracked	1,301.00 FS	*1,040.80 FS
26	1		*CLOSING ELEMENT	Damaged	174.00 FS	*138.40 FS
27	1		*AIR GUIDE GRILLE - LH/RH	N/S Missing	342.00 FS	*136.40 FS
28	1		*FRONT REINFORCEMENT	Bent	660.00 FS	*527.60 FS
29	1		*FOAM FILLER PIECE	Cracked	172.00 FS	*137.60 FS
30	1		*FOAM FILLER PIECE COVER	Damaged	111.00 FS	*88.80 FS
31	1		*CAUTION STICKER	Necessary	13.00 FS	*9.76 FS
32	1		*HORN-HIGH TONE LH	Damaged	182.00 FS	*145.60 FS
33	1		*HORN-LOW TONE RH	Damaged	182.00 FS	*145.60 FS
34	2		*FRONT FENDER - LH/RH	Buckled	1,556.00 FS	*1,244.00 FS
35	2		*ATTACHMENT PARTS FOR FENDER	Necessary	130.00 FS	*104.00 FS
36	2		*BRACKET FOR FENDER - LH/RH	Bent	50.00 FS	*39.52 FS
37	2		*BRACKET FOR FENDER - LH/RH	Damaged	70.00 FS	*55.52 FS
38	2		*FENDER BRACE - LH/RH	N/S Damaged / O/S Bent	176.00 FS	*139.68 FS
39	2		*WHEEL HOUSING LINER - LH/RH	N/S Deformed / O/S Torn	316.00 FS	*252.00 FS
40	2		*ATTACHMENT PARTS FOR WHEEL HOUSING LINER	Necessary	161.00 FS	*128.80 FS
41	1		*BONNET	Distorted	2,898.00 FS	*2,318.40 FS
42	1		*ATTACHMENT PARTS FOR BONNET	Not Necessary	149.00 FS	*- FS
43	2		*LID HINGE - LH/RH	Bent	112.00 FS	*88.48 FS
44	1		*BONNET GAS FILLED STRUT	Not Necessary	109.00 FS	*- FS
45	1		*BONNET CATCH HOOK	Bent	81.00 FS	*64.72 FS
46	2		*STRIKER - LH/RH	Bent	200.00 FS	*159.04 FS
47	1		*EDGE PROTECTION	Necessary	25.00 FS	*19.92 FS
48	2		*COVER - LH/RH	Not Necessary	74.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
49	1		*SEAL FOR WATER BOX	Not Necessary	53.00 FS	*- FS
50	1		*CATCH HOOK	Bent	58.00 FS	*45.76 FS
51	2		*LID LOCK WITH MICRO SWITCH	Damaged	367.00 FS	*293.60 FS
52	1		*FLAT CONNECTOR	Not Necessary	12.00 FS	*- FS
53	1		*BOWDEN CABLE	Damaged	53.00 FS	*41.68 FS
54	1		*LID LOCK CABLE	Not Necessary	68.00 FS	*- FS
55	1		*BONNET SOUND ABSORBER	Crumpled	201.00 FS	*160.80 FS
56	1		*COVER FOR PLENUM CHAMBER SATIN BLACK	Cracked	164.00 FS	*130.80 FS
57	1		*COVER	Not Necessary	15.00 FS	*- FS
58	2		*LED HEADLIGHT - LH/RH	Cracked	10,058.00 FS	*8,046.40 FS
59	1		*POWER MODULE FOR MAIN LIGHT ELECTRONIC	Damaged	693.00 FS	*554.00 FS
60	1		*CONTROL UNIT FOR LIGHT CONTROL SYSTEM	Cracked	508.00 FS	*406.00 FS
61	1		*LED WITH HEAT SINK - LH	Damaged	666.00 FS	*532.40 FS
62	1		*LIFT CYLINDER FOR HEADLIGHT WASHER - LH/RH	O/S Cracked	256.00 FS	*102.00 FS
63	1		*HOSE	Not Necessary	61.00 FS	*- FS
64	1		*WASHER TANK RESERVIOR	Deformed	186.00 FS	*148.40 FS
65	1		*FRONT LOCK CARRIER	Cracked	663.00 FS	*530.40 FS
66	1		*AIR CON CONDENSER	Dented	503.00 FS	*402.00 FS
67	1		*COOLER FOR COOLANT	Dented	878.00 FS	*702.40 FS
68	1		*ADDITIONAL COOLER FOR COOLANT	Dented	837.00 FS	*669.60 FS
69	4		*COOLANT	Necessary	84.00 FS	*67.20 FS
70	1		*COOLANT HOSE WITH QUICK RELEASE COUPLING - FRONT	Not Necessary	234.00 FS	*- FS
71	1		*COOLANT HOSE WITH QUICK RELEASE COUPLING - UPPER	Not Necessary	143.00 FS	*- FS
72	1		*COOLANT HOSE WITH QUICK RELEASE COUPLING - LOWER	Not Necessary	126.00 FS	*- FS
73	1		*REFRIGERANT LINER	Bent	601.00 FS	*480.40 FS
74	1		*REFRIGERANT LINER	Bent	461.00 FS	*368.80 FS
75	2		*AIR GUIDE - LH/RH	Damaged	44.00 FS	*34.24 FS
76	1		*AIR GUIDE - UPPER CENTRE	Damaged	11.00 FS	*8.32 FS
77	1		*RADIATOR FAN WITH FAN RING	Cracked	1,483.00 FS	*1,186.40 FS
78	1		*AIR GUIDE	Cracked	53.00 FS	*41.84 FS
79	1		*AIR GUIDE	Cracked	62.00 FS	*49.20 FS
80	1		*AIR FILTER	Not Necessary	252.00 FS	*- FS
81	1		*LH FRONT DOOR	Buckled	2,279.00 FS	*1,823.20 FS
82	1		*FRONT OUTER DOOR SEAL - LH	Necessary	146.00 FS	*116.80 FS
83	1		*BONDING AGENT	Not Necessary	45.00 FS	*- FS
84	1		*CLEANING SOLUTION	Not Necessary	65.00 FS	*- FS
85	1		*FRONT DOOR ATTACHMENT PARTS	Not Necessary	218.00 FS	*- FS
86	1		*FRONT DOOR CATCH - LH	Not Necessary	96.00 FS	*- FS
87	1		*FRONT DOOR CATCH COVER - LH	Not Necessary	13.00 FS	*- FS
88	1		*TRIM STRIP FOR WINDOW GUIDE - LH	Not Necessary	235.00 FS	*- FS
89	1		*TRIM STRIP FOR WINDOW GUIDE - RH	Not Necessary	235.00 FS	*- FS
90	2		*CORNER TRIM BLACK - GLOSSY - LH/RH	Not Necessary	82.00 FS	*- FS
91	1		*WINDOW SLOT SEAL WITH TRIM STRIP CHROME - LH	Cut	282.00 FS	*225.60 FS
92	1		*WINDOW SLOT SEAL WITH TRIM STRIP CHROME - RH	Not Necessary	282.00 FS	*- FS
93	1		*FRONT NUMBER PLATE	Dented	25.00 FS	*25.00 FS
94	1		*ARCYLIC SEALANT	Necessary	180.00 FS	*180.00 FS
95	1		*CAVITY WAX	Necessary	140.00 FS	*140.00 FS
96	1		*STONE CHIP TREATMENT	Not Necessary	180.00 FS	*- FS
97	1		*SUNDRIES	Necessary	1,200.00 FS	*36.40 FS
98	1		*FENDER TOP SUPPORT - LH INNER	Buckled	214.00 FS	*171.20 FS
99	1			Deformed	52.32 FS	*52.32 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
			*FRONT FENDER CLOSING ELEMENT - LH FRONT			
100	1		*OUTER TEMP. SENSOR BRACKET	Missing	13.04 FS	*13.04 FS
101	1		*OUTER TEMP. SENSOR WIRE SET	Cut	40.64 FS	*40.64 FS
102	1		*WIRE CONNECTOR - BLACK	Cracked	13.28 FS	*13.28 FS
103	1		*WIRE CONNECTOR - WHITE	Cracked	22.72 FS	*22.72 FS
104	1		*WIRE CONNECTOR - WHITE	Deformed	14.96 FS	*14.96 FS
105	1		*CABLE GUIDE	Deformed	17.52 FS	*17.52 FS
106	1		*AIR COND PIPE (COMPRESSOR>CUT-OFF POINT)	Bent	368.80 FS	*368.80 FS
107	1		*COOLANT HOSE COUPLING	Deformed	17.28 FS	*17.28 FS
108	1		*COOLANT PIPE	Bent	22.08 FS	*22.08 FS
109	1		*FRONT CHASSIS FRAME COVER PLATE - RH	Bent	70.48 FS	*70.48 FS
110	1		*WIRE CONNECTOR - BLACK	Cracked	12.24 FS	*12.24 FS
111	1		*HEADLIGHT HOSE - LH	Deformed	28.32 FS	*28.32 FS
112	1		*INTAKE AIR DUCT COVER	Deformed	21.36 FS	*21.36 FS
113	1		*INTAKE AIR DUCT DRAINAGE HOSE	Missing	24.48 FS	*24.48 FS
114	1		*MULTIFUNCTIONAL STEERING WHEEL	Deformed	1,735.20 FS	*1,735.20 FS
Total Parts (\$\$)					65,493.72	48,008.44

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO TOWED AND RECOVER FROM SCENE OF ACCIDENT.	New	-	-
2	TO CARRY OUT FIRST MEASUREMENT TEST ON CAR O-LINER.	New	800.00	800.00
3	TO REMOVE, CHECK AND REINSTALL FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY.	New	360.00	360.00
4	TO REMOVE AND RENEW AIRCON CONDENSER, ADDITIONAL RADIATOR, RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS.	New	1,000.00	1,000.00
5	TO REMOVE CENTER CONSOLE, INSTRUMENT PANELS AND CLUSTERS. RENEW DASHBOARD, BOTH FRONTAL AIRBAGS, SLIP RING. TRANSFER OLD FITTINGS. RENEW SEAT BELTS AND CONTROL UNIT, PILLAR TRIMS, ROOF LINING, BOTH CURTAIN AIR BAGS AND KNEE AIRBAG.	New	3,600.00	3,600.00
6	TO REMOVE AND REINSTALL ENGINE ASSY WITH GEARBOX ASSY TO FACILITATE CAR O-LINER REPAIRS.	New	2,800.00	0.00
7	TO REMOVE AND REINSTALL FRONT SUSPENSION ASSY WITH SUBFRAME TO FACILITATE CAR O-LINER REPAIRS. INSPECT FRO DAMAGES AND RENEW IF NECESSARY.	New	2,400.00	0.00
8	TO SET UP VEHICLE ON CAR O-LINER FOR REPAIR.	New	1,800.00	0.00
9	TO DISMANTLE AND RENEW FRONT BUMPER, BONNET, BOTH FRONT FENDERS, BOTH HEADLIGHTS AND LHS FRONT DOOR. CUT OUT AND REWELD LHS FENDER TOP SUPPORT. ALIGN BOTH FRONT CHASSIS FRAMES TO SPECIFICATION OF ORIGIN. RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANISE FRONT CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	New	9,600.00	5,000.00
10	TO RESPRAY FRONT BUMPER, BONNET, BOTH FRONT FENDERS, LHS FENDER TOP SUPPORT, LHS UPPER A PILLAR, LHS FRONT DOOR AND ENGINE COMPARTMENT.	New	6,200.00	3,575.00
11	TO CARRY OUT WHEEL ALIGNMENT.	New	240.00	0.00
12	TO CARRY OUT DIAGNOSTIC CHECKS.	New	384.00	384.00
13	TO REMOVE AND RENEW DAMAGED WIRING HARNESS AND CONNECTORS.	New	480.00	480.00
14	TO CUT OUT AND WELD RH FRONT CHASSIS COVER PLATE.	New	1,200.00	500.00
15	TO CARRY OUT SEALER WORK AND SPRAY RH FRONT CHASSIS COVER PLATE.	New	600.00	350.00
16	CARRY OUT FRONT WINDSCREEN SOLAR FILM.	New	400.00	400.00
Gross Labour Cost (\$\$)			31,864.00	16,449.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >