








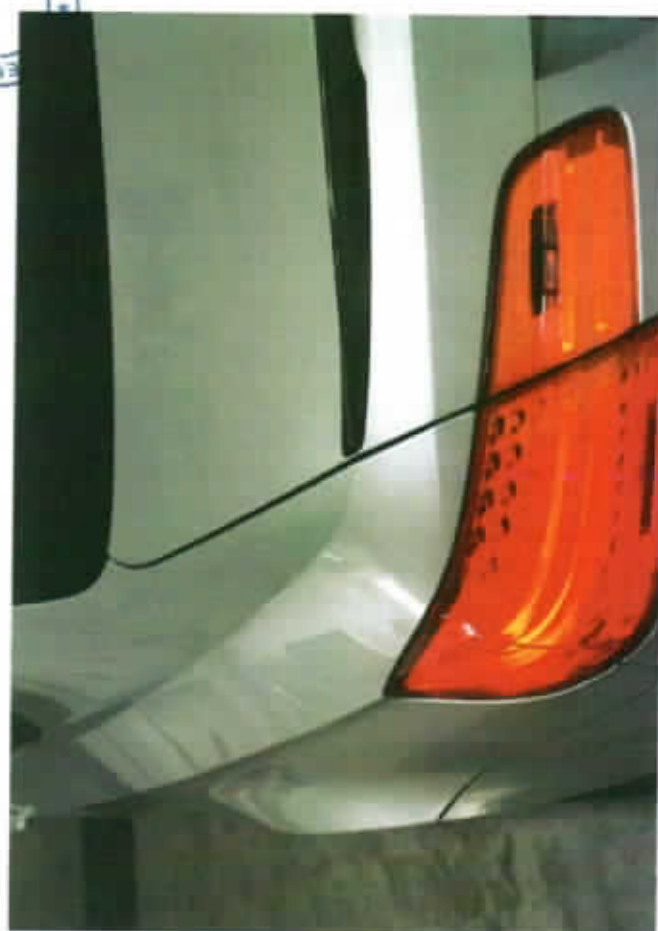

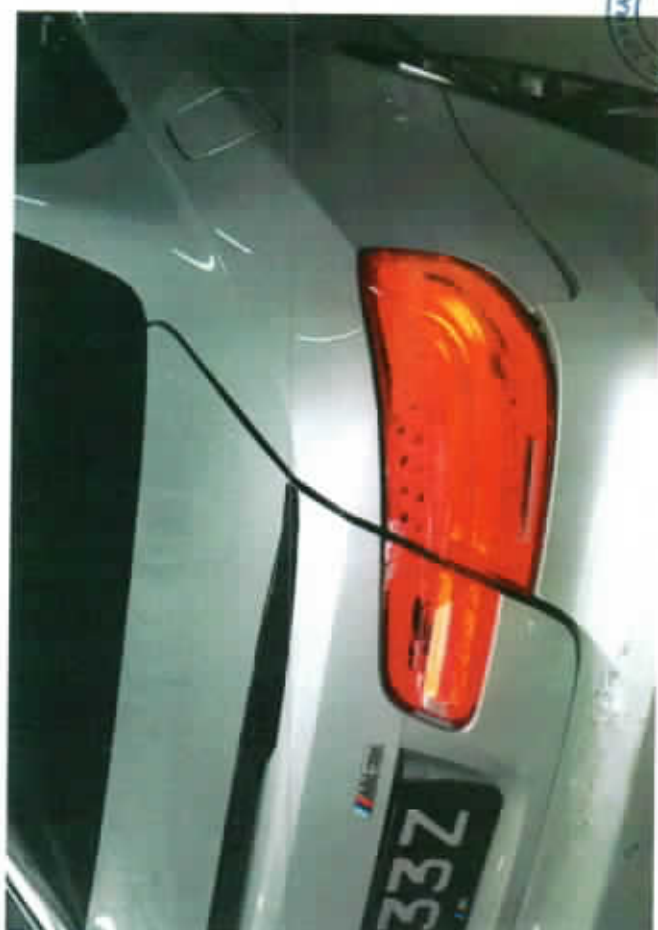

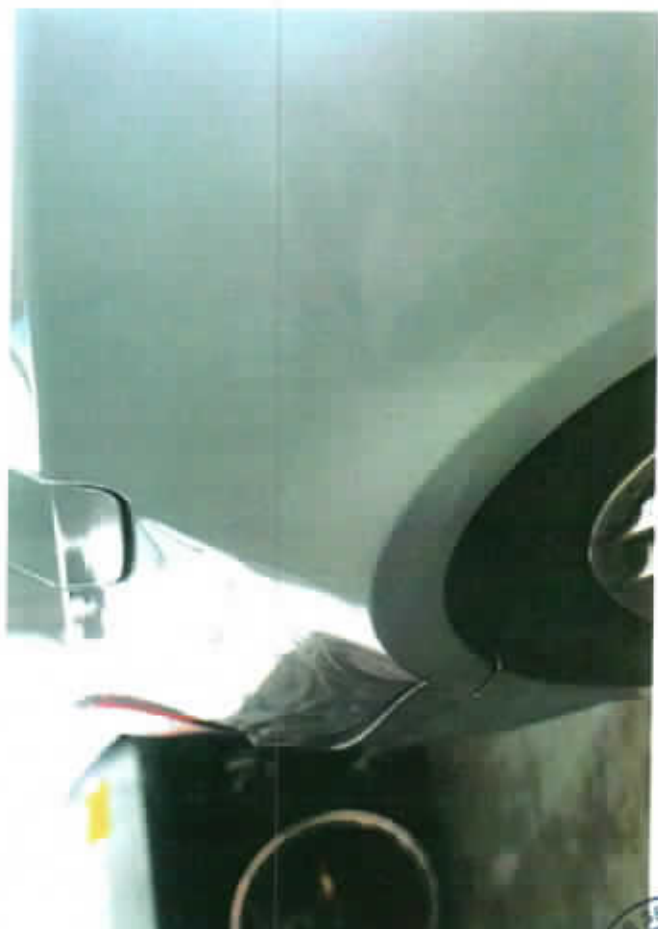






















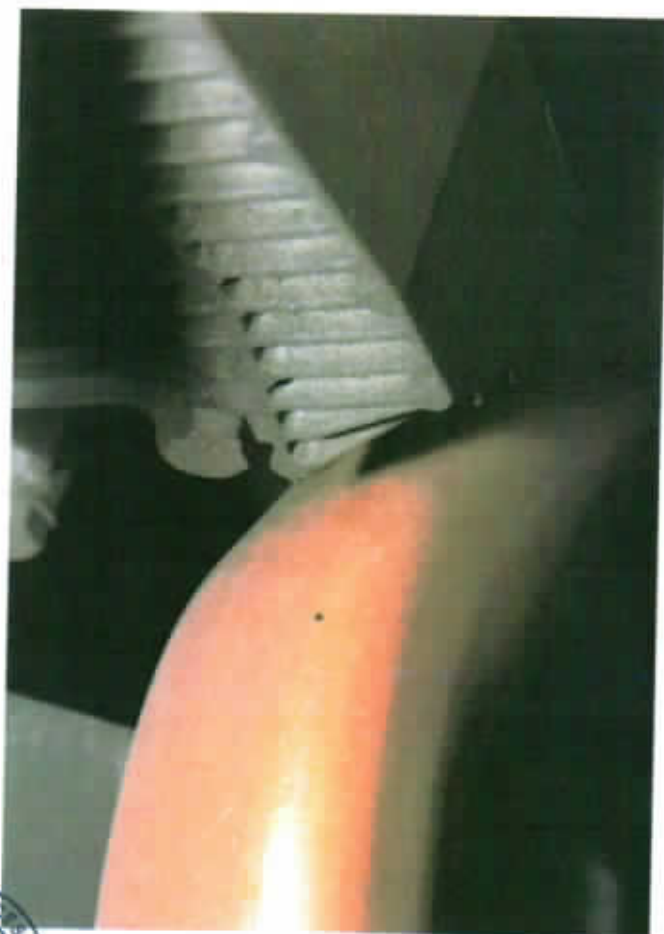


REPAIR SERVICES


REPAIR

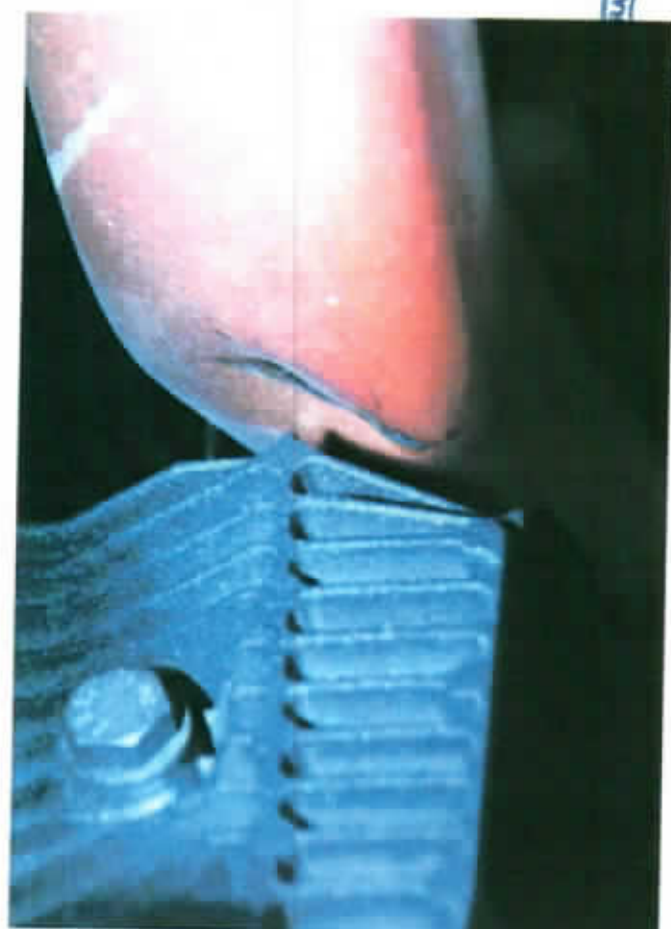

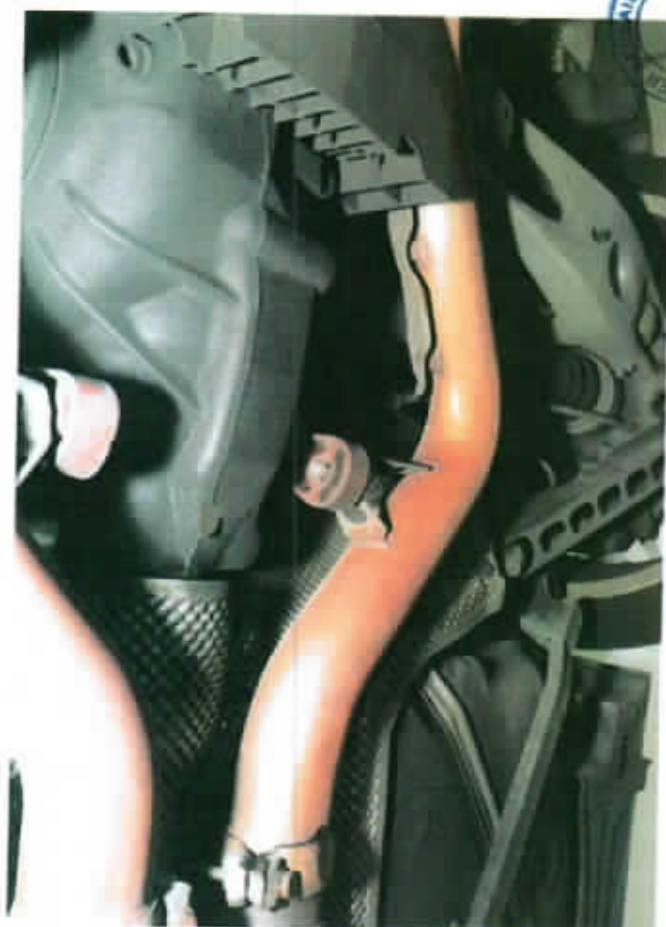

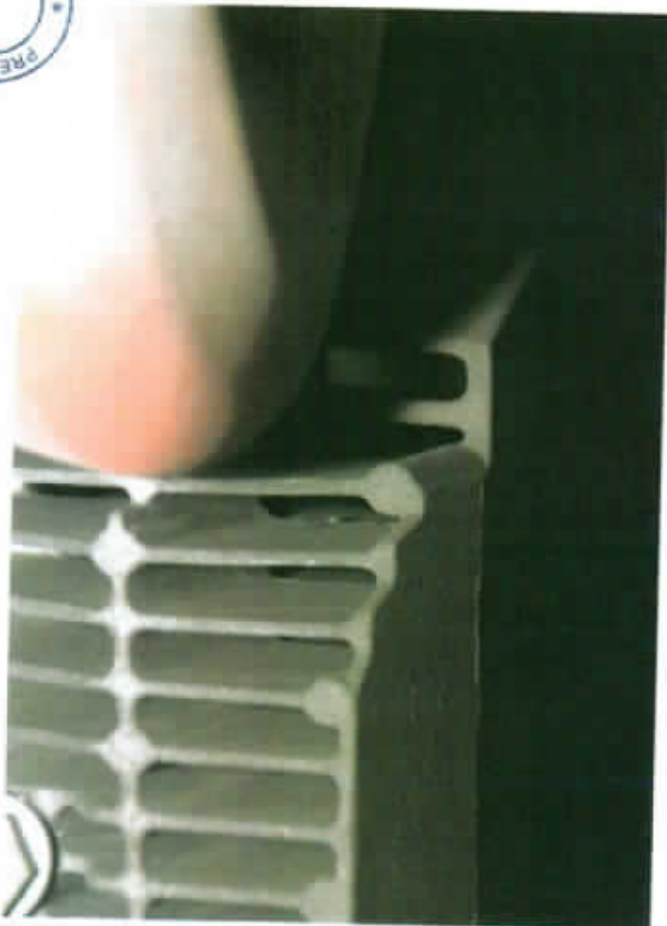





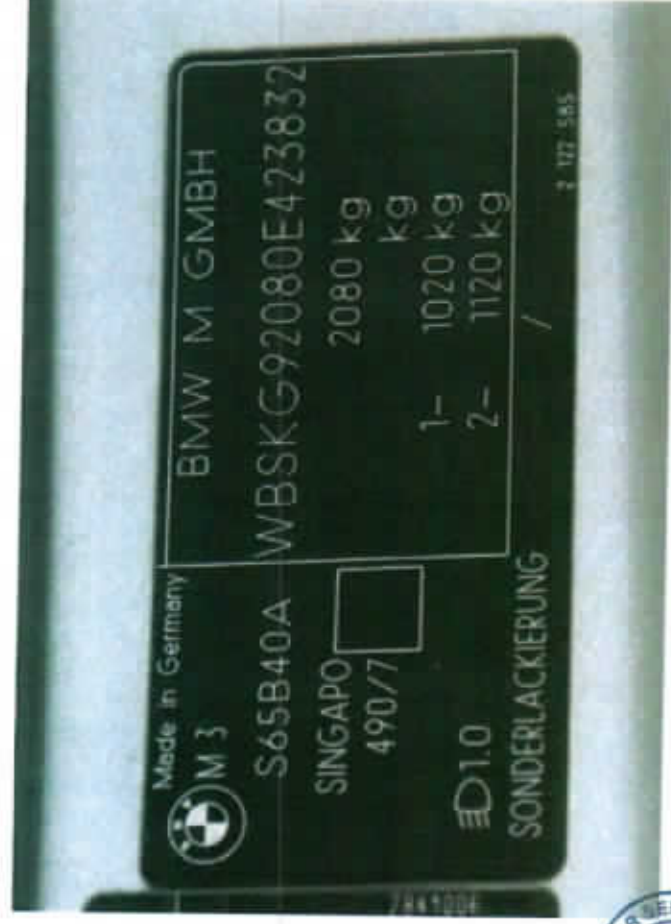







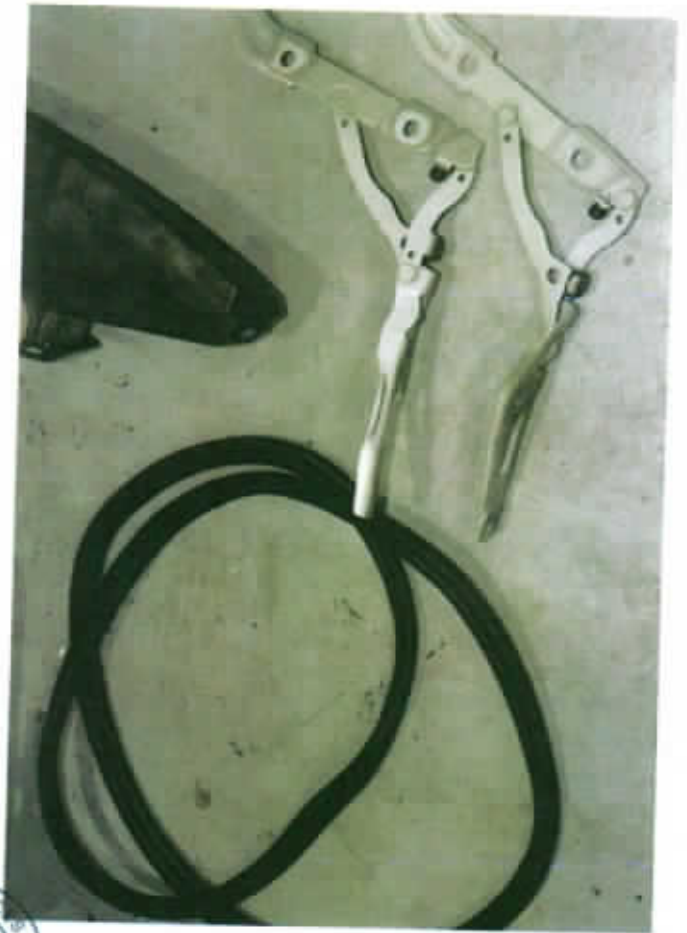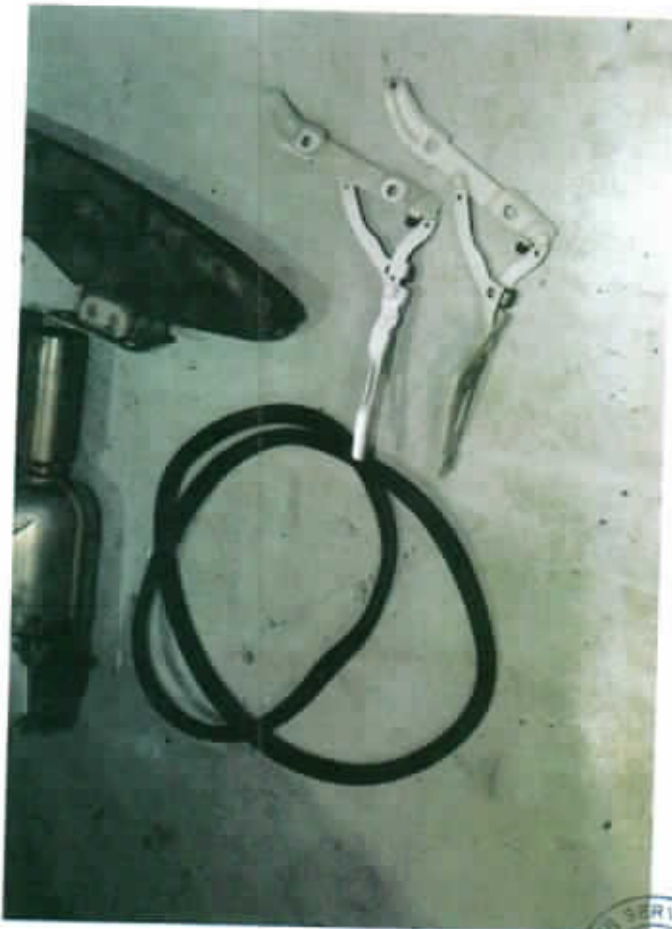






SJZ 7133Z



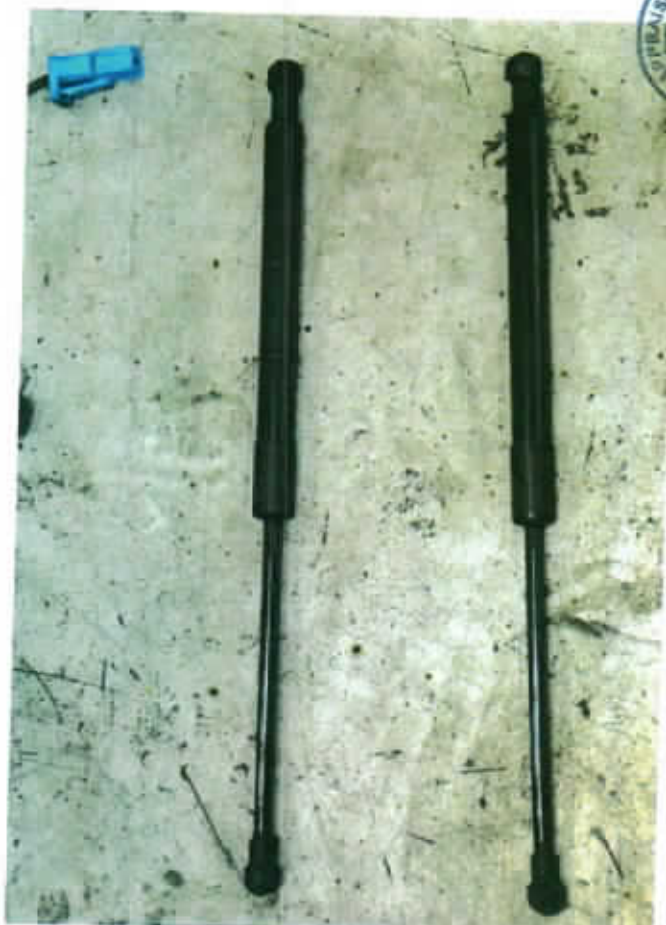





FormTeam Consultancy Pte Ltd

No.33, Ubi Ave 3
#02-15, Vertex
Singapore 408868

Tel : (65) 6509 1788
Fax : (65) 6509 6221

Email: motor survey@fta.com.sg

Co.Reg No: 200819280D

GST Reg No: 200819280D

Our Reference : RRN17-085260/PRS/AL/ADJ/AL/cc

Your Reference: MT/0959462-002

Date : 28-Nov-2017

Motor Claims Department
NTUC Income Insurance Co-operative Limited
73 Bras Basah Road
#05-01 NTUC Trade Union House
Singapore 189556

Attention : Ms Corinne Hoo

Dear Sir/Mdm,

SURVEY OF VEHICLE NO. SJZ 7133Z

Pursuant to your instruction on **23-November-2017**.

We recommend a repair cost of **\$12,500.00** (see report) based on lump sum repair and the estimated duration of repairs would take **12 days**.

We also enclosed our note of charges for your consideration.

Thank you for this assignment.

Your faithfully

FormTeam Consultancy Pte Ltd
Adjusters & Surveyors (Licensed Appraiser)



Axel Lee
Automobile Appraiser

(Email : axellee@fta.com.sg)

Encl. Survey Report

FormTeam Consultancy Pte Ltd

AUTOMOBILE ASSESSMENT REPORT

Page No. 1

Our Reference : RRN17-085260/PRS/AL/ADJ/AL/ec

Your Reference: MT/0959462-002

Date : 28-Nov-17

Attention : Ms Corinne Hoo

TO : Motor Claims Department
NTUC Income Insurance Co-operative Limited
73 Bras Basah Road
#05-01 NTUC Trade Union House
Singapore 189556

Assessment of Vehicle No : SJZ 7133Z
Date of Accident : 29-August-2017
Date of Inspection : 31-August-2017
Address of Inspection : 160 Sin Ming Drive #08-03 Sin Ming Autocity S'575722

We have carried out a physical assessment of SJZ 7133Z at M/S T&B Motor Repairs Services Pte Ltd according to your instructions on 30-August-2017, dismantled items on 07-September-2017, post repair survey on 03-October-2017 and are pleased to submit our report herewith.

1. VEHICLE PARTICULARS

Registration No. : SJZ 7133Z
Make & Model : BMW M3
Year of Registration : 2010
Engine Capacity : 3999 cc
Chassis No. : WBSKG92080E423832
Engine No. : 20204845S65B40A
Colour : Blue
Mileage (km) : 60412

2. VEHICLE CONDITION

Body Paint : Good
Steering : Serviceable
Foot Brake : Serviceable
Parking Brake : Serviceable

3. TYRE PARTICULARS & CONDITION

Front

RH Make/Size : Michelin 275/30 R19 - 60%
LH Make/Size : Michelin 275/30 R19 - 60%

Rear

RH Make/Size : Michelin 275/30 R19 - 60%
LH Make/Size : Michelin 275/30 R19 - 60%

Note : % denotes the remaining percentage of the tyre


FormTeam Consultancy Pte Ltd

Our Reference : RRN17-085260/PRS/AL/ADJ/AL/ec
Your Reference : MT/0959462-002
Vehicle Number : SJZ 7133Z

Page No. 2

4. DESCRIPTION OF DAMAGE

At the time of inspection, this vehicle sustained damages to the **Rear** portion. Please see attached scheduled for details.

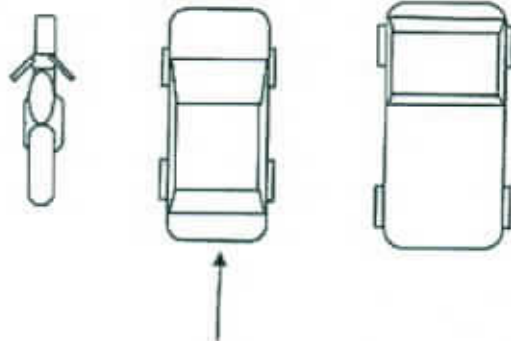

5. REMARKS

Market Value : -
Salvage Value : -
Repair Limit (Nett Loss) : -
Repairer's estimate : **Not Provided**
Nett Saving : -
Excess : -
Sum Insured : -
Our adjusted amount : \$ **12,500.00**
Estimated Repair Days : **12 days**

Additional photographs will be submitted upon request by our principal.

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.

The assessment was conducted on a "**Without Prejudice**" basis.

If we are not notified of anything to the contrary within **14 days** from the date hereof, this report shall be treated as correct.

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by **FormTeam Consultancy Pte Ltd** for any reliance on this report by any third party, unless with the permission of the addressee.

FormTeam Consultancy Pte Ltd

Our Reference : RRN17-085260/PRS/AL/ADJ/AL/cc
 Your Reference : MT/0959462-002
 Vehicle Number : SJZ 7133Z

Page No. 3

QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE (\$)	OUR ASSESSMENT (\$)
<u>PARTS (LIST ITEMS)</u>				
1	Bootlid	Dented/Distorted	-	1,582.00
1	Bootlid Inner Lock	Stiffened	-	130.20
1	Bootlid Weatherstrip	Damaged	-	274.40
1	Bootlid O/S Reflector	Broken	-	371.00
1	O/S Taillamp	Chafed/Cracked	-	529.20
1	Rear End Panel	Badly Dented	-	812.00
1	Rear Bumper	Dented/Distorted	-	2,072.00
1	Rear Bumper Sponge	Damaged	-	46.20
1	Rear Bumper Reinforcement	Carbon Type Cracked	-	1,530.20
1	Rear Bumper Reinfor N/S Bracket	Damaged	-	74.20
1	Rear Bumper Reinfor O/S Bracket	Damaged	-	74.20
1	Rear Bumper Centre Top Bracket	Damaged	-	371.70
1	Rear Bumper O/S Bracket	Damaged	-	91.45
1	Rear Bumper Tow Hook Cover	Chafed	-	67.90
1	Rear Bumper Lower Grille	Damaged	-	91.00
1	Intelligent Battery Sensor Cable A	Damaged	-	496.85
1	Intelligent Battery Sensor Cable B	Damaged	-	138.20
1	Exhaust Silencer Unit - Complete	Bent/Buckled	-	3,654.32
1	Exhaust Silencer O/S Tail Pipe	Damaged	-	455.70
1	Reverse Sensors - Original	Damaged	-	1,016.40
			-	13,879.12
Less Discount :			0%	10% 1,387.91
Parts Total :			-	12,491.21
<u>SPECIAL NETT ITEMS</u>				
1	Rear Windscreen Sealant	Necessary	-	40.00
1	Rear Windscreen Inner Seal	Necessary	-	20.00
1	Bootlid Badge	Damaged	-	95.20
1	Bootlid 'M3' Emblem	Damaged	-	109.20
Special Nett Total :			-	264.40
Parts Total :			-	12,755.61

FormTeam Consultancy Pte Ltd

Our Reference : RRN17-085260/PRS/AL/ADJ/AL/ec
 Your Reference : MT/0959462-002
 Vehicle Number : SJZ 7133Z

Page No. 4

S/N	DESCRIPTION	REPAIRER'S ESTIMATE (S\$)	OUR ASSESSMENT (S\$)
LABOUR			
1	To rewire rear portion.	-	30.00
2	To remove, refix rear exhaust.	-	200.00
3	To remove, refix driver seat and repair.	-	200.00
4	To reset diagnose, programming and replace battery terminal.	-	400.00
5	To remove, cut out damage portion, jack out, straighten, panel beating, welding, align and renew replaced parts.	-	1,000.00
6	To putty and respray painting on affected areas.	-	1,000.00
	To apply underscaling.	-	60.00
Labour Total :		-	2,890.00
TOTAL (PARTS & LABOUR) :		-	15,645.61

The final adjusted Lump Sum contract amount is **\$12,500.00**
(SINGAPORE DOLLARS TWELVE THOUSAND AND FIVE HUNDRED ONLY)


 Frankie Pang
 AMSAE(AUST), AMIRTE, AMSOE,
 MASPACI, MSAAA
 Licensed Appraiser


 Axel Lee
 Automobile Appraiser

FormTeam Consultancy Pte Ltd

Vehicle No: SJZ 7133Z

Workshop: T&B Motor Repair Service Pte Ltd

Accident Date: 29 August 2017

No. 33 Ubi Ave 3
#02-15 Vertex
Singapore 408868

Tel : (65) 6509 1788
Fax : (65) 6509 6221

Email: motorsurvey@fta.com.sg
www.fta.com.sg

Co. Reg No: 200819280D

GST Reg. No: 200819280D



