
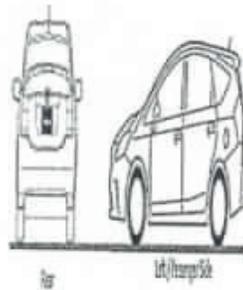


Section A - Accident Details	
Registration Number	SHC4752B
Case Reference Number	TAX01/19/2072
Registration Date	1/4/2016
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS
Name of Driver	ABDULLAH BIN MOHAMED NOR
Type of Accident	Head to Rear
Accident Date and Time	15/1/2019 12:05 AM
Accident Reported Date and Time	15/1/2019 10:02 AM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	Yes
Towed Back Date and Time	15/1/2019 12:39 AM
Replacement Vehicle Issued?	No
Job Card Number	24099690
Special Instruction to ARC, if any	TOWED \$90 / AXA
Prepared Date and Time	16/1/2019 3:35 PM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

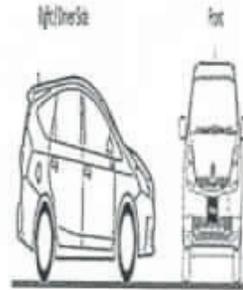

right

Section B - Summary of Repair Estimates		
Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$4,723.00	\$2,300.00
Total Spray Cost	\$9,158.00	\$2,610.00
Total Spare Part Cost	\$59,048.75	\$18,030.81
Total Other Cost	\$4,988.00	\$1,440.00
TOTAL COST	\$77,925.75	\$24,380.81 (P/P)
Lump Sum Total	\$0.00	\$0.00
Number of Repair Days	22.0	13.0
Prepared / Adjusted By	Tuck Foo Kok	Hwee Jie (LKK) / AXA
ARC / Surveyor Sign Off Date	22/01/2019 7:43 PM	21/01/2019 6:51 PM
Signature		
Remarks		P/P PHOTO BEFORE PAINT

Section C - Quotation and Accident Invoice Details			
Quotation Number	QN-1909-0259	Invoice Number	
Quotation Date	17.09.2018	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates		
Part 1 - Labour Works		
Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR MEMBER SUB ASSY RR RH	\$150.00	\$100.00
TO REPAIR REAR FENDER RH	\$400.00	\$200.00
TO REPAIR REAR WHEELHOUSE	\$500.00	\$400.00
TO REPAIR & REPLACE END PANEL, SPARE TYRE PANEL & MEMBER SUB ASSY	\$600.00	\$400.00
TO REPAIR FRONT LH PORTION	\$845.00	\$400.00
TO REPAIR REAR PORTION	\$2,028.00	\$800.00
Total Labour	\$4,723.00	\$2,300.00

Part 2 - Spray Painting & Panel Beating Related Works		
Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY REAR FENDER RH	\$378.00	\$200.00
TO RESPRAY REAR SPARE TYRE PANEL	\$180.00	\$100.00
TO RESPRAY REAR BOTH MEMBERS	\$250.00	\$100.00
TO RESPRAY REAR WHEELHOUSE	\$250.00	\$200.00
TO RESPRAY REAR PANEL	\$180.00	\$100.00
TO RESPRAY REAR DOOR RH	\$378.00	\$200.00
TO RESPRAY FRONT BUMPER	\$378.00	\$200.00
TO SPRAY FRONT BUMPER LOWER SUB GRILLE	\$180.00	\$0.00
TO RESPRAY FRONT SUPPORT PANEL	\$180.00	\$0.00
TO RESPRAY FRONT FENDER LH	\$378.00	\$200.00
TO RESPRAY RIM	\$540.00	\$50.00
TO RESPRAY FRONT PILLAR LH	\$180.00	\$80.00
TO RESPRAY FRONT DOOR LH	\$378.00	\$200.00
TO RESPRAY REAR BUMPER	\$378.00	\$200.00
TO RESPRAY TAIL GATE	\$378.00	\$200.00
TO RESPRAY TAILGATE OUTSIDE GARNISH	\$180.00	\$50.00
TO RESPRAY REAR SPOILER	\$180.00	\$80.00
TO RESPRAY REAR PANEL	\$180.00	\$0.00
TO RESPRAY REAR SPARE TYRE PANEL	\$180.00	\$0.00
TO RESPRAY REAR FLOOR SIDE PANEL RH	\$180.00	\$0.00
TO RESPRAY REAR FLOOR SIDE PANEL LH	\$180.00	\$0.00
TO RESPRAY BATTERY PANEL	\$180.00	\$0.00
TO RESPRAY REAR MEMBER_RH	\$180.00	\$0.00
TO RESPRAY REAR MEMBER_LH	\$180.00	\$0.00

TO RESPRAY RH REAR WHEEL HOUSE	\$180.00	\$0.00
TO RESPRAY REAR LH WHEEL HOUSE	\$180.00	\$0.00
TO RESPRAY FUEL LID COVER	\$180.00	\$0.00
TO RESPRAY RH RAIL ROOF SIDE	\$180.00	\$0.00
TO RESPRAY LH RAIL ROOF SIDE	\$180.00	\$80.00
TO RESPRAY MEMBER SUB-ASSY, CENTER FLOOR CROSS, NO.2	\$180.00	\$0.00
TO RESPRAY TROUGH BACK DOOR RH	\$180.00	\$0.00
TO RESPRAY TROUGH BACK DOOR LH	\$180.00	\$0.00
TO RESPRAY REAR FENDER LH	\$378.00	\$200.00
TO RESPRAY REAR FENDER RH	\$378.00	\$0.00
TO RESPRAY RH REAR DOOR	\$378.00	\$0.00
TO RESRAY REAR DOOR LH	\$378.00	\$200.00
Total Spray Painting & Panel Beating	\$9,158.00	\$2,610.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense		
Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REMOVE & REFIT BATTERY ASSY HV	\$250.00	\$200.00
TOWING CHARGE	\$120.00	\$90.00
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$20.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$300.00	\$100.00
TO DO WHEEL ALIGNMENT / TYRE BALANCING	\$120.00	\$60.00
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	\$120.00	\$30.00
TO TOP UP AC GAS	\$120.00	\$0.00
TO REMOVE & REFIX FAN ENGINE & RADIATOR ASSY & INNER COOLER & AIR CON CONDENSER	\$120.00	\$0.00
TO REMOVE / REFIT SEAT	\$120.00	\$0.00
TO ALIGN CHASSIS	\$350.00	\$0.00
TO REMOVE & REFIT FUEL TANK	\$120.00	\$0.00
TO REMOVE & REFIT EXHAUST	\$120.00	\$0.00
TO TRANSFER DOOR MECHANISM	\$240.00	\$0.00
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	\$850.00	\$600.00
TO TRANSFER REAR TAILGATE MECHANISM	\$120.00	\$50.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00	\$30.00
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR	\$120.00	\$40.00
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	\$120.00	\$50.00
TO CHECK & RESET SYSTEM FUNCTION	\$350.00	\$0.00
TO REMOVE AND REFIX REAR WINDSCREEN	\$240.00	\$120.00
TO REMOVE & REFIT REAR QUARTER GLASS RH	\$120.00	\$0.00
TO REMOVE & REFIT REAR QUARTER GLASS LH	\$120.00	\$50.00
TO REMOVE & REFIX FRONT LHS/RHS QUATER GLASS	\$120.00	\$0.00
TO REMOVE AND REFIT WIRE HARDESS	\$250.00	\$0.00
TO REMOVE AND REFIT BATTERY ASSY HV	\$120.00	\$0.00



SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
 90 Woodlands Industrial Park SE, Singapore 737700
 Fax Number: 68605502
 Estimate Telephone Number: 68622022
 Accident Reporting Number: 68622072

Date Generated: 02/08/2014
 User ID: Pulkas

TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
TO WASH AND VACUUM	\$60.00	\$0.00
Total Other Costs	\$4,990.00	\$1,440.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		61734-47020	PANEL, ROOF SIDE, / LH SIDE	0.00	\$134.80	0.00	\$0.00	Replace	Check X
		61712-47020	PANEL, ROOF SIDE OUTER LH	0.00	\$134.80	0.00	\$0.00	Replace	Not Given X
		61218-47010	RAIL, ROOF SIDE LH	1.00	\$273.80	100.00	\$0.00	Replace	Repair X
		67004-47080	DOOR RRLH	1.00	\$954.50	100.00	\$0.00	Replace	Repair X
		69060-47080	DOOR LOCK RRLH	0.00	\$709.30	0.00	\$0.00	Replace	Not Given X
		68780-52031	HINGE LOWER LHR, DOOR	0.00	\$72.20	0.00	\$0.00	Replace	Not Given X
		68750-20122	HINGE UPPER LHR, DOOR	0.00	\$81.70	0.00	\$0.00	Replace	Not Given X
		68610-47021	CHECK ASSY, FR DOOR,	0.00	\$150.30	0.00	\$0.00	Replace	Not Given X
		52582-47010	TAIL LAMP BRACKET, RH	0.00	\$30.70	0.00	\$0.00	Replace	Not Given X
		81551-47180	TAIL LAMP RH	0.00	\$557.80	0.00	\$0.00	Replace	Not Given X
		61621-47030	TROUGH, BACK DOOR	0.00	\$110.90	0.00	\$0.00	Replace	Check X
		61804-47090	FENDER RRRH	0.00	\$786.80	0.00	\$0.00	Replace	Not Given X
			SMRT LOGO	0.00	\$7.80	0.00	\$0.00	Replace	Not Given X
			STICKER DECAL 6555 8888	0.00	\$21.60	0.00	\$0.00	Replace	Not Given X
		66837-47021	FENDER LINER RRRH	0.00	\$141.38	0.00	\$0.00	Replace	Not Given X
		62940-16060	DUCT ASSY, QUARTER	2.00	\$70.40	25.00	\$105.60	Replace	Replace X
		71540-47062-C7	BACK ASSY, REAR SIDE SEAT, RH	0.00	\$643.80	0.00	\$0.00	Replace	Not Given X
		62710-47138	QUARTER GLASS RRRH	0.00	\$846.50	0.00	\$0.00	Replace	Not Given X
			SEALANT WSCREEN	0.00	\$37.00	0.00	\$0.00	Replace	Not Given X
		67003-47080	DOOR RR/RH	1.00	\$954.50	100.00	\$0.00	Replace	Repair X
		69050-47080	DOOR LOCK RRRH	0.00	\$709.30	0.00	\$0.00	Replace	Not Given X
		68770-52031	HINGE LOWER RHR, DOOR	0.00	\$52.00	0.00	\$0.00	Replace	Not Given X
		68750-20121	HINGE UPPER RHR, DOOR	0.00	\$81.70	0.00	\$0.00	Replace	Not Given X
		68410-33010	DOOR LOCK STRIKER	0.00	\$40.50	0.00	\$0.00	Replace	Not Given X
		52118-47930	BUMPER FRT	1.00	\$482.00	25.00	\$361.50	Replace	Replace X
		52161-16010	BUMPER CLIPS	10.00	\$1.61	25.00	\$12.08	Replace	Replace X
		52611-47080	BUMPER ENERGY ABSORBER FRT	0.00	\$78.80	0.00	\$0.00	Replace	Check X
		52021-47023	BUMPER REINFORCEMENT FRT	0.00	\$488.40	0.00	\$0.00	Replace	Check X
		57014-47030	ARM SUB-ASSY, FR BUMPER LH	0.00	\$250.40	0.00	\$0.00	Replace	Check X
		57013-47030	ARM SUB-ASSY, FR BUMPER RH	0.00	\$250.40	0.00	\$0.00	Replace	Check X
		53102-47020	BUMPER GRILLE SUB-ASSY, LOWER	1.00	\$311.10	25.00	\$233.33	Replace	Replace X
		61220-12230	FOG LAMP LH	1.00	\$280.10	10.00	\$252.09	Replace	Replace X
		52618-47050	BUMPER FRT ABSORBER LOWER	0.00	\$127.70	0.00	\$0.00	Replace	Check X
		52128-47803	COVER, FR BUMPER HOLE LH	1.00	\$18.50	25.00	\$13.88	Replace	Replace X
		52118-47040	BUMPER SUPPORT FLH	1.00	\$76.40	25.00	\$57.30	Replace	Replace X



SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
 81 Woodlands Avenue Park 24, Singapore 731702
 FAX Number: 63925522
 Estimate Telephone Number: 63925223
 Accident Reporting Number: 63925272

Date Generated: 22/09/2016

User ID: P016001

81529-47050	BRACKET, FR TURN CENTER LH	0.00	\$58.20	0.00	\$0.00	Replace	Check	X
81529-47040	BRACKET, FR TURN UPPER LH	0.00	\$24.40	0.00	\$0.00	Replace	Check	X
81529-47050	BRACKET, FR TURN LOWER LH	0.00	\$26.00	0.00	\$0.00	Replace	Check	X
81521-47050	LENS & BODY, FR TURN LH	1.00	\$511.80	10.00	\$460.82	Replace	Replace	/
53111-47040	GRILLE, RADIATOR	0.00	\$310.60	0.00	\$0.00	Replace	Check	X
53201-47902	SUPPORT SUB-ASSY	0.00	\$1,460.40	0.00	\$0.00	Replace	Check	X
81170-47500	HEAD LAMP LH	1.00	\$945.20	10.00	\$850.58	Replace	Replace	/
53802-47950	FENDER FRT/LH	1.00	\$723.40	25.00	\$542.55	Replace	Replace	/
75374-47051	NAME PLATE (HYBRID)	1.00	\$51.90	25.00	\$36.93	Replace	Replace	/
53876-47030	FENDER LINER FRT/LH	0.00	\$171.70	0.00	\$0.00	Replace	Check	X
53852-47020	FENDER LINER PAD, FR WHEEL LH	0.00	\$49.30	0.00	\$0.00	Replace	Not Given	X
53826-47060	PROTECTOR, FRONT FENDER SIDE PANEL LH	0.00	\$114.50	0.00	\$0.00	Replace	Check	X
	TYRE	0.00	\$126.74	0.00	\$0.00	Replace	Check	X
42811-47140 (Frt)	WHEEL DISC, FRONT	1.00	\$1,484.20	100.00	\$0.00	Replace	Repair	R
67002-47070	DOOR FRT/LH	1.00	\$684.40	100.00	\$0.00	Replace	Repair	R
	STICKER DECAL SMRT (DOOR)	1.00	\$60.00	0.00	\$60.00	Replace	Replace	/
61132-47030	PILLAR, FR BODY, LH	1.00	\$353.10	100.00	\$0.00	Replace	Repair	R
53867-47030	SEAL, FRONT FENDER TO COWL SIDE, LH	1.00	\$15.20	25.00	\$11.40	Replace	Replace	/
	COOLANT	0.00	\$12.32	0.00	\$0.00	Replace	Check	X
62120-47021	QUARTER GLASS FRT/LH	0.00	\$234.90	0.00	\$0.00	Replace	Not Given	X
	SEALANT W/SCREEN	0.00	\$37.00	0.00	\$0.00	Replace	Not Given	X
52159-47905	BUMPER REAR	1.00	\$458.60	25.00	\$343.95	Replace	Replace	/
52161-16010	BUMPER CLIPS	10.00	\$1.51	25.00	\$12.08	Replace	Replace	/
52023-12240	BUMPER REINFORCEMENT REAR	1.00	\$205.70	25.00	\$154.28	Replace	Replace	/
52016-47030	ARM SUB-ASSY, RR BUMPER LH	1.00	\$139.60	25.00	\$104.70	Replace	Replace	/
52015-47050	ARM SUB-ASSY, RR BUMPER RH	1.00	\$139.60	25.00	\$104.70	Replace	Replace	/
89997-30070	ANTENNA, ELECTRICAL LOWER REAR	0.00	\$157.40	0.00	\$0.00	Replace	Check	X
	SENSOR REVERSE	1.00	\$160.00	0.00	\$160.00	Replace	Replace	/
	PIKEL STICKER	2.00	\$60.00	0.00	\$120.00	Replace	Replace	/
76059-47020	BUMPER LIP COVER, RRLH	1.00	\$72.20	25.00	\$54.15	Replace	Replace	/
76067-47020	BUMPER LIP COVER, RRRH	0.00	\$118.10	0.00	\$0.00	Replace	Not Given	X
76891-47020	BUMPER LIP REAR	1.00	\$228.90	25.00	\$171.68	Replace	Replace	/
52592-47021	BUMPER SEAL, RR LH	1.00	\$68.90	25.00	\$66.68	Replace	Replace	/
52591-47021	BUMPER SEAL, RR RH	1.00	\$65.70	25.00	\$48.28	Replace	Replace	/
52576-47020	BUMPER SIDE RETAINER, RRLH	1.00	\$94.80	25.00	\$71.10	Replace	Replace	/
52575-47020	BUMPER SIDE RETAINER, RRRH	0.00	\$94.80	0.00	\$0.00	Replace	Not Given	X
56308-47011	UNDER COVER SUBASSY, RR FLOOR	1.00	\$514.50	25.00	\$385.88	Replace	Replace	/
56327-47020	EXHAUST HEAT SHIELD, REAR	0.00	\$107.40	0.00	\$0.00	Replace	Check	X
17430-37380	EXHAUST TAIL PIPE	0.00	\$656.20	0.00	\$0.00	Replace	Not Given	X
17410-37180	EXHAUST PIPE FRT	0.00	\$4,184.70	0.00	\$0.00	Replace	Not Given	X
17565-28010	SUPPORT EXHAUST PIPE, NO.4	0.00	\$40.30	0.00	\$0.00	Replace	Not Given	X

	17565-22030	SUPPORT, EXHAUST REAR	0.00	\$33.80	0.00	\$0.00	Replace	Not Given	X
	67005-47241	TAILGATE ASY	1.00	\$1,007.90	25.00	\$755.93	Replace	Replace	/
	75574-47020	TAIL GATE DOOR GLASS MOULDING, LH	1.00	\$29.40	25.00	\$22.05	Replace	Replace	/
	75573-47080	TAIL GATE DOOR GLASS MOULDING, RH	1.00	\$29.40	25.00	\$22.05	Replace	Replace	/
	68105-47122	TAILGATE DOOR GLASS	1.00	\$1,090.90	25.00	\$818.16	Replace	Replace	/
	75575-47030	MOULDING BACK WINDOW, LOWER NO 1	1.00	\$29.40	25.00	\$22.05	Replace	Replace	/
	84823-47030	TAILGATE LOWER WINDOW GLASS	1.00	\$721.30	25.00	\$540.98	Replace	Replace	/
		SEALANT W/SCREEN	3.00	\$37.00	0.00	\$111.00	Replace	Replace	/
	88810-47010	TAILGATE DOOR HINGE LH/RH	0.00	\$58.30	0.00	\$0.00	Replace	Check	X
	88350-47030	TAILGATE DOOR LOCK	0.00	\$444.10	0.00	\$0.00	Replace	Check	X
	88860-0W532	TAILGATE DOOR STAY LH	0.00	\$241.50	0.00	\$0.00	Replace	Check	X
	88950-0W542	TAILGATE DOOR STAY RH	0.00	\$241.50	0.00	\$0.00	Replace	Check	X
	67881-47022	TAILGATE DOOR WEATHER STRIP	0.00	\$353.40	0.00	\$0.00	Replace	Check	X
	89415-47020	TAILGATE LOCK, COVER	0.00	\$15.70	0.00	\$0.00	Replace	Check	X
	76801-47070-80	TAILGATE OUTSIDE GARNISH	1.00	\$504.90	25.00	\$378.65	Replace	Replace	/
	69431-47010	STRIKER, BACK DOOR	0.00	\$48.90	0.00	\$0.00	Replace	Check	X
	67938-47031C0	TAILGATE TRIM, LH	0.00	\$65.90	0.00	\$0.00	Replace	Check	X
	67751-47040C0	TAILGATE TRIM, LOWER	0.00	\$180.70	0.00	\$0.00	Replace	Check	X
	67837-47031C0	TAILGATE TRIM, RH	0.00	\$88.30	0.00	\$0.00	Replace	Check	X
	64750-47030C0	TAILGATE TRIM, UPPER	0.00	\$49.60	0.00	\$0.00	Replace	Check	X
	67750-47071C0	TAILGATE, BOARD ASSY	0.00	\$246.90	0.00	\$0.00	Replace	Check	X
	82184-47370	WIRE, BACK DOOR, NO.1	0.00	\$562.40	0.00	\$0.00	Replace	Check	X
	85130-47021	MOTOR ASSY, RR WIPER	0.00	\$734.60	0.00	\$0.00	Replace	Check	X
	85241-47030	ARM, RR WIPER	0.00	\$84.70	0.00	\$0.00	Replace	Check	X
	85242-47040	BLADE ASSY, REAR WIPER	0.00	\$55.00	0.00	\$0.00	Replace	Check	X
	86790-47040	CAMERA ASSY, TELEVISION, RR	0.00	\$1,438.60	0.00	\$0.00	Replace	Check	X
	84840-28040	SWITCH ASSY, BACK DOOR OPENER	0.00	\$148.10	0.00	\$0.00	Replace	Check	X
	61802-47091	FENDER RRLH	1.00	\$766.80	25.00	\$575.10	Replace	Replace	/
		SMRT LOGO	1.00	\$7.80	0.00	\$7.80	Replace	Replace	/
		STICKER DECAL 6555 8888	1.00	\$21.60	0.00	\$21.60	Replace	Replace	/
	65638-47021	FENDER LINER RRLH	0.00	\$141.30	0.00	\$0.00	Replace	Check	X
	77360-47030	LID ASSY, FUEL	0.00	\$102.00	0.00	\$0.00	Replace	Check	X
	77035-47090	CABLE SUB-ASSY, FUEL LID	0.00	\$83.90	0.00	\$0.00	Replace	Check	X
	77377-75010	RETAINER, FUEL LID CABLE	0.00	\$5.90	0.00	\$0.00	Replace	Check	X
	77300-52030	CAP ASSY, FUEL TANK	0.00	\$68.10	0.00	\$0.00	Replace	Not Given	X
	77201-47250	PIPE SUB-ASSY, FUEL NECK	0.00	\$230.60	0.00	\$0.00	Replace	Not Given	X
	77226-47040	TUBE, FUEL TANK	0.00	\$36.10	0.00	\$0.00	Replace	Not Given	X
	77001-47120	TANK SUB-ASSY, FUEL	0.00	\$745.10	0.00	\$0.00	Replace	Not Given	X
	62720-47031	QUARTER GLASS RRLH	1.00	\$168.10	25.00	\$126.08	Replace	Replace	/
		SEALANT W/SCREEN	1.00	\$37.00	0.00	\$37.00	Replace	Replace	/
		TYRE	0.00	\$126.74	0.00	\$0.00	Replace	Not Given	X



SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
 50 Woodlands Industrial Park 2A, Singapore 737738
 FAX Number: 9222212
 Estimate Telephone Number: 9992223
 Accident Reporting Number: 9992272

Date Generated: 02/05/15

User ID: Poshan

42811-47140	WHEEL, DISC	0.00	\$1,490.20	0.00	\$0.00	Replace	Not Given	X
81738-47020	REINFORCEMENT, ROOF SIDE INNER LH	0.00	\$80.30	0.00	\$0.00	Replace	Check	X
81714-47020	REINFORCE, ROOF SIDE OUTER LH	0.00	\$91.90	0.00	\$0.00	Replace	Check	X
81744-47010	REINFORCEMENT, BACK DOOR SIDE LH	0.00	\$89.50	0.00	\$0.00	Replace	Check	Y
81824-47010	EXTENSION, QUARTER PANEL FRONT LH	0.00	\$83.50	0.00	\$0.00	Replace	Check	X
8182647020	EXTENSION, QUARTER PANEL REAR LH	0.00	\$108.50	0.00	\$0.00	Replace	Check	Y
81732-47030	PANEL, ROOF SIDE, INNER LH	0.00	\$134.80	0.00	\$0.00	Replace	Check	X
75310-47028	EMBLEM REAR	1.00	\$80.30	25.00	\$45.23	Replace	Replace	Y
81271-83011	LICENSE PLATE LAMP	0.00	\$35.70	0.00	\$0.00	Replace	Check	X
	NUMBER PLATE	1.00	\$15.00	0.00	\$15.00	Replace	Replace	Y
	NUMBER PLATE FRAME	1.00	\$12.00	0.00	\$12.00	Replace	Replace	Y
75314-47051	NAME PLATE (HYBRID)	1.00	\$51.90	25.00	\$38.93	Replace	Replace	Y
75442-47030	NAME PLATE (PRIUS)	1.00	\$68.80	25.00	\$45.60	Replace	Replace	Y
75443-47030	NAME PLATE (TOYOTA)	1.00	\$51.90	25.00	\$38.93	Replace	Replace	Y
78085-47910	SPOILER REAR	1.00	\$953.70	100.00	\$0.00	Replace	Repair	R
81008-47011	3RD BRAKE LAMP	0.00	\$231.30	0.00	\$0.00	Replace	Not Given	X
	SMRT LOGO	1.00	\$7.80	0.00	\$7.80	Replace	Replace	Y
	STICKER DECAL 8555 8888	1.00	\$21.80	0.00	\$21.80	Replace	Replace	Y
58307-47060	END PANEL	0.00	\$802.10	0.00	\$0.00	Replace	Check	X
84718-47031B0	END PANEL COVER, DECK TRIM HOLE	0.00	\$46.10	0.00	\$0.00	Replace	Check	X
84718-47031B0	END PANEL COVER, DECK TRIM, RR	0.00	\$121.10	0.00	\$0.00	Replace	Check	Y
58336-12090	REINFORCEMENT, RR	0.00	\$34.80	0.00	\$0.00	Replace	Check	X
	SEALANT SIKAFLEX	0.00	\$37.00	0.00	\$0.00	Replace	Check	X
58311-47071	SPARE TYRE PANEL	0.00	\$687.70	0.00	\$0.00	Replace	Check	X
57804-47030	MEMBER SUB-ASSY, RR LH	0.00	\$174.10	0.00	\$0.00	Replace	Check	X
57803-47030	MEMBER SUB-ASSY, RR RH	0.00	\$174.10	0.00	\$0.00	Replace	Check	X
57805-12321	MEMBER SUB ASSY, REAR FLOOR CROSS NO.1	0.00	\$438.40	0.00	\$0.00	Replace	Check	X
57806-47042	MEMBER SUB ASSY, REAR FLOOR CROSS NO.2	0.00	\$655.70	0.00	\$0.00	Replace	Check	X
58303-47301	FLOOR PANEL RRLH	0.00	\$102.00	0.00	\$0.00	Replace	Check	X
58302-47030	FLOOR PANEL RR/RH	0.00	\$209.90	0.00	\$0.00	Replace	Check	X
64993-47920	BOX, DECK FLOOR, RR	0.00	\$848.70	0.00	\$0.00	Replace	Check	X
58418-47030B3	BOX, RR FLOOR, BOARD	0.00	\$879.60	0.00	\$0.00	Replace	Check	X
58418-47030	BOARD, RR FLOOR	0.00	\$392.30	0.00	\$0.00	Replace	Check	X
58490-47140B0	BOARD ASSY, RR RH	0.00	\$379.20	0.00	\$0.00	Replace	Check	X
58427-47040	SPACER, RR FLOOR	0.00	\$130.80	0.00	\$0.00	Replace	Check	Y
58418-47070B0	BOX, DECK FLOOR, COVER LH	0.00	\$230.10	0.00	\$0.00	Replace	Check	Y
64997-47020	BOX, DECK FLOOR, LH	0.00	\$198.80	0.00	\$0.00	Replace	Check	X
64910-47020-B0	COVER ASSY, TONNEAU	0.00	\$602.10	0.00	\$0.00	Replace	Check	X
84777-47090	CUSHION, SPARE WHEEL	0.00	\$230.80	0.00	\$0.00	Replace	Check	Y
64778-47050	PROTECTOR, SPARE	0.00	\$143.70	0.00	\$0.00	Replace	Check	X
51931-47020	CARRIER, SPARE	0.00	\$19.70	0.00	\$0.00	Replace	Check	X

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
			TYRE	0.00	\$126.74	0.00	\$0.00	Replace	Not Given X
42611-47140			WHEEL, DISC	0.00	\$1,460.20	0.00	\$0.00	Replace	Not Given X
			BREAKDOWN SIGN	0.00	\$35.00	0.00	\$0.00	Replace	Check X
64740-47031B2			PANEL ASSY, DECK LH	0.00	\$307.00	0.00	\$0.00	Replace	Check X
64730-47031B2			PANEL ASSY, DECK RH	0.00	\$307.00	0.00	\$0.00	Replace	Check X
82480-47050-B0			GARNISH SIDE UPPER, LHR	0.00	\$261.70	0.00	\$0.00	Replace	Check X
			BATTERY	0.00	\$278.00	0.00	\$0.00	Replace	Check X
02510-47060			BATTERY ASSY, HV	0.00	\$5,544.40	0.00	\$0.00	Replace	Check X
74481-47050			BATTERY CLAMP	0.00	\$18.10	0.00	\$0.00	Replace	Check X
74440-47030			BATTERY TRAY	0.00	\$42.80	0.00	\$0.00	Replace	Check X
82164-47070			WIRE, FRAME	0.00	\$1,680.90	0.00	\$0.00	Replace	Check X
82123-47040			WIRE, ENGINE, NO.3	0.00	\$74.00	0.00	\$0.00	Replace	Not Given X
82161-47022			WIRE, FLOOR	0.00	\$1,675.00	0.00	\$0.00	Replace	Check X
82162-47020			WIRE, FLOOR, NO.2	0.00	\$1,305.40	0.00	\$0.00	Replace	Check X
89740-47031			RECEIVER, DOOR CONTROL	0.00	\$239.70	0.00	\$0.00	Replace	Check X
81805-47010			PANEL SUB-ASSY, QTR	0.00	\$326.70	0.00	\$0.00	Replace	Check X
61667-47080			PANEL SUB-ASSY, QTR	0.00	\$588.40	0.00	\$0.00	Replace	Check X
61608-47081			PANEL SUB-ASSY, QTR WHEEL HOUSE	0.00	\$588.40	0.00	\$0.00	Replace	Check X
61606-47010			PANEL, QUARTER WHEEL HOUSE, OUTER LH	0.00	\$326.70	0.00	\$0.00	Replace	Check X
52563-47010			TAIL LAMP BRACKET, LH	0.00	\$30.70	0.00	\$0.00	Replace	Check X
81561-47170			TAIL LAMP LH	1.00	\$548.40	10.00	\$493.56	Replace	Replace
61622-47030			TROUGH, BACK DOOR LH	0.00	\$110.00	0.00	\$0.00	Replace	Check X
Total					\$62,722.96		\$8,975.59		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
		52611-47080	BUMPER ENERGY ABSORBER FRT	1.00	\$78.80	25.00	\$59.10	Replace	Replace
		53201-47002	SUPPORT SUB-ASSY	1.00	\$1,460.40	25.00	\$1,095.30	Replace	Replace
		89997-30070	ANTENNA, ELECTRICAL LOWER REAR	1.00	\$157.40	10.00	\$141.66	Replace	Replace
		68350-47030	TAILGATE DOOR LOCK	1.00	\$444.10	25.00	\$333.08	Replace	Replace
		67681-47022	TAILGATE DOOR WEATHER STRIP	1.00	\$353.40	25.00	\$265.05	Replace	Replace
		87750-47071C0	TAILGATE, BOARD ASSY	1.00	\$246.90	25.00	\$185.18	Replace	Replace
		65638-47021	FENDER LINER R/LH	1.00	\$141.30	25.00	\$105.98	Replace	Replace
		58307-47060	END PANEL	1.00	\$602.10	25.00	\$451.58	Replace	Replace
		64718-47031B0	END PANEL COVER, DECK TRIM HOLE	1.00	\$46.10	25.00	\$34.58	Replace	Replace
		64716-47031B0	END PANEL COVER, DECK TRIM, RR	1.00	\$121.10	25.00	\$90.83	Replace	Replace
		68311-47071	SPARE TYRE PANEL	1.00	\$667.70	25.00	\$500.78	Replace	Replace
		57604-47030	MEMBER SUB-ASSY, RR LH	1.00	\$174.10	25.00	\$130.58	Replace	Replace
		58303-47301	FLOOR PANEL R/LH	1.00	\$102.00	25.00	\$76.50	Replace	Replace
		64153-47020	BOX, DECK FLOOR, RH	1.00	\$649.70	25.00	\$487.28	Replace	Replace
		64778-47050	PROTECTOR, SPARE	1.00	\$143.70	25.00	\$107.78	Replace	Replace



SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
88 Woodlands Industrial Park #4, Singapore 737735
FAX Number: 67622252
Estimate Telephone Number: 67622623
Accident Reporting Number: 67622672

Estimate Generated: 13/10/2019

User ID: P66508

		Q9610-47060	BATTERY ASSY, HV	1.00	\$5,544.40	10.00	\$4,989.96	Replace	Replace <input checked="" type="checkbox"/>
Total					10,933.20		9,066.22		

18,030.81
 + 2,300.00
 + 4,050.00

 24,380.81