

NTUC Hwee Jie

REF:

NTUC

NS/INC15001970/30302

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: **SHC 6728J**
 Policy No: **5095103853** **20-10-2017**
 Claims No: **MT/1029721-002**
 Sum Insured: _____ Excess: _____
 (Client's Record) _____
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: _____ days Res.: Yes or No
 Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: **SHC 4115 R** Yr Regn: **8 Nov 2013**

Type: M.Car / M.Cycle / Bus / Van / Lorry / Truck / Prime Mover /

Truck / Trailer or

Make: **Toyota Prins** C.C. **1798**

Colour: **maroon** A/C Insured / Std / NI / NA

Sp. Reading T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: **JTDKN36U105701994**

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Order / Jammed / Leaked / Burnt or

Brake: Order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: **195/65 R15**

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or **Falken**

Front

Rear

R/Bal. **6** mm R/Bal. **6** mm

L/Bal. **6** mm L/Bal. **6** mm

D.O.A. **26/1/19**

D.O.I. **29/1/17**

Survey held at **Sumit**

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction	DA: 06-11-2018	01/19/2125
27/11/19	SHC 4115R - NS/INC15001970/30302 SHC 6728J - CS/LPC11006508/KVAI Finalize conf. \$8900, 8 days (Poh Sun) (\$ 16,055.87 - Red - 64%)	DA: 07042011	SHC 6728J

RECEIVED 06 DEC 2019

Date/Time, File Pass to? **06/12/19**
 1) **Typist**
 Date/Time, File Return to?
 2)

☐ : Preli. Report
☒ : Final Report

Days Of Repair: **8**
 Resurvey No. of Trip: **2**

Add Fee: ☐ Site Insp (\$)
☐ Interview (\$)
☐ Tech. Invs (\$)
☐ Weekend (\$)

Survey Fee:
 Transportation
) \$ + RS \$
) Photos
) Others

Report Format:
 Lump Sum / I.B.I: (\$ **8,900/- 45**)

TOTAL

160

eBaoTech

General Claim

Hello, NAC_PAYA_UBI_800601

[Change Language](#)[Change Password](#)[Log Out](#)[My Desktop](#)[Notice of Loss](#)

Policy Query

Policy No.	5095103893	Date of Accident	26/01/2019 11:40
Vehicle No. (For Motor)	SHC6728J	Certificate Number	

Select	Policy No.	Certificate Number	Policyholder Name	Policyholder NRIC	Product	Cover Type	Vehicle No.	Insured Object	Commence Date	Expiry Date
☐	5095103893		PREMIER TAXIS PTE. LTD.	200304975H	GFT	Third Party	SHC6728J	SHC6728J	20/10/2017	

TP Claims against NTUC Income: Follow-Through Survey

Date : 05/12/2019

S/No	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle No.	Date of Accident	Time of Accident	Estimate	Tentative repair cost
1	MT/1029721-002	SMRT TAXIS PTE LTD	SHC 4115R	SHC 6728J	26/01/2019	23:00	\$ 24,955.87	\$ 8,900.00
2	MT/1070567-002	SMRT BUSES PTE LTD	SG 1733A	SMN 4054R	07/11/2019	10:45	\$ 1,241.00	\$ 700.00

Claim received from LKK Auto

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	28/01/2019 09:19
Date Of Accident	26/01/2019 23:00
Exact Location Of Accident	JUNCTION OF BUKIT BATOK WEST AVE 8 AND AVE 3
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHC4115R
Insured/Policyholder	
Name Of Registered Owner	SMRT TAXIS PTE LTD
Co Reg No	198905369K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-80000000

Vehicle Particulars

Manufacturer	TOYOTA
Model	PRIUS TAXI-1.8 (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	MS FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-18090213MFSH
Cover Note Number	

Driver

Name of Driver	MOHAMMED BIN IBRAHIM
NRIC No	S1498134I
Date Of Birth	26/10/1961
Occupation	OUTDOOR
Date Of Driving Pass	26/11/1982
Driving Experience	36 YEARS AND 2 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-80000000
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	18
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - CROSS JUNCTION
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

I WAS STATIONARY ALONG BUKIT BATOK WEST AVE 8 AT THE CENTRE LANE DUE TO RED TRAFFIC LIGHT. WHEN THE TRAFFIC LIGHT TURNED GREEN IN MY FAVOUR, I STARTED TO PROCEED STRAIGHT. WHILE HALF WAY ENTERED THE JUNCTION, SUDDENLY THE SILVERCAB SHC6728J FROM BUKIT BATOK WEST AVE 3 BEAT THE RED TRAFFIC LIGHT AND COLLIDED ONTO THE LEFT PORTION OF MY TAXI.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SHC6728J
Vehicle Make/Model/Colour	SILVERCAB
Details Of Properties	
Vehicle Category	TAXI
Name of Driver	TAN GIM SAN
NRIC/Passport Number	S1298626B
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.



Policyholder's Signature
Date & Time:


Driver's Signature
(If driver is not the policyholder)
Date & Time:

28/1/19

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

28/1/19

SKETCH PLAN

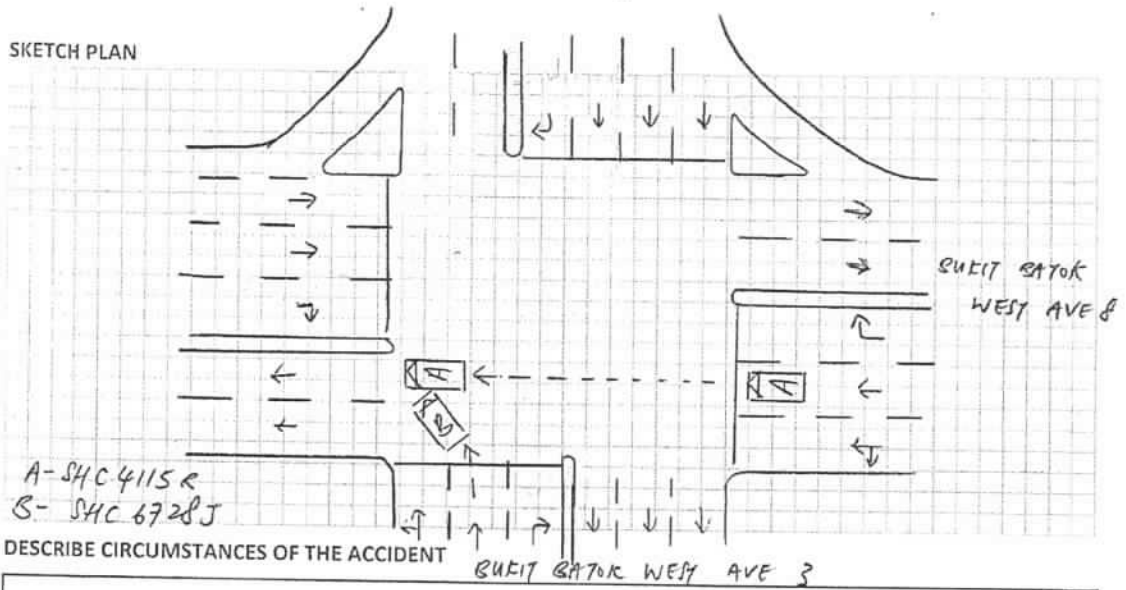

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Driver's Signature
(If driver is not the policyholder)
Date & Time:
28/11/19

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:



Case Details

Case Reference Number :

TAX/01/19/2125

Type of Repair : Accident Repair

Vehicle Registration Number :

SHC4115R

Company Type : SMRT Taxis Pte Ltd

Estimation ID : EST-5542-ID

Assigned By : Taxi Claims Manager
Team

Insurance Company Name : NTUC Income Insurance Co-operative Ltd

Accident Date and Time : 26/01/2019 03:00 PM

Vehicle Age(In Months) : 62

Documents / Photographs

View Documents / Photographs

Total Documents: 1

Estimation Details

Spare Part's Cost Detail

BOM Type	Costing Type	Portion	Material Number	SMRT Recommendation							Surveyor Approval				Remarks
				Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace		
One Time Key In	Main			BUMPER FRT ABSORBER LOWER	1	127.70	127.70	25.00	95.78	Replace	0	0	Check	•	X NM
One Time Key In	Main			HOOD PANEL	1	748.10	748.10	25.00	561.08	Replace	1	0	Repair	•	X R
One Time Key In	Main			HOOD HINGE LH	1	55.90	55.90	25.00	41.92	Replace	0	0	Not Give	•	X NM
One Time Key In	Main			SUPPORT SUB-ASSY	1	1,460.40	1,460.40	25.00	1,095.30	Replace	0	0	Check	•	X NM
One Time Key In	Main			HEAD LAMP LH	1	945.20	945.20	10.00	850.68	Replace	1	850.68	Replace	•	/ SCR
One Time Key In	Main			FENDER FRT/LH	1	723.40	723.40	25.00	542.55	Replace	1	542.55	Replace	•	/ BUC
One Time Key In	Main			NAME PLATE (HYBRID)	1	51.90	51.90	25.00	38.92	Replace	1	38.92	Replace	•	/ NEC
One Time Key In	Main			FENDER LINER FRT/LH	1	171.70	171.70	25.00	128.77	Replace	1	128.77	Replace	•	/ BUC
One Time Key In	Main			FENDER LINER PAD, FR WHEEL, LH	1	49.30	49.30	25.00	36.97	Replace	1	36.97	Replace	•	/ NEC
										4447.60					
Total Spare Part Cost									17,976.97	Surveyor Total 4,132.73					
Lump Sum Discount (%)									20.00	Lump Sum Dis (%) 20					
Final Spare Part Cost									14,381.58	Final Sur Total 3,306.18					

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			FENDER PROTECTOR FRT/LH UPPER	1	46.10	46.10	25.00	34.58	Replace	0	0	Check	X NN
One Time Key In	Main			PROTECTOR, FRONT FENDER SIDE PANEL LH	1	114.50	114.50	25.00	85.88	Replace	0	0	Check	X NN
One Time Key In	Main			FENDER APRON SUB FRT/LH	1	637.80	637.80	25.00	478.35	Replace	0	0	Check	X NN
One Time Key In	Main			TYRE	1	126.74	126.74	0.00	126.74	Replace	1	126.74	Replace	/ CUT
One Time Key In	Main			WHEEL DISC. FRONT	1	1,484.20	1,484.20	25.00	1,113.15	Replace	1	1,113.15	Replace	/ DD
One Time Key In	Main			TIE ROD END LH	1	159.30	159.30	25.00	119.48	Replace	0	0	Check	X NN
One Time Key In	Main			STEERING RACK ASSY	1	1,597.50	1,597.50	25.00	1,198.13	Replace	0	0	Check	X NN
One Time Key In	Main			POWER STEERING FLUID	1	14.00	14.00	0.00	14.00	Replace	0	0	Check	X NN
One Time Key In	Main			WHEEL HUB FRT	1	549.70	549.70	25.00	412.28	Replace	0	0	Check	X NN
One Time Key In	Main			SHOCK ABSORBER BEARING, FRT LH/RH	1	34.00	34.00	25.00	25.50	Replace	0	0	Check	X NN
One Time Key In	Main			SHOCK ABSORBER FRT/LH	1	394.20	394.20	25.00	295.65	Replace	0	0	Check	X NN
One Time Key In	Main			SHOCK ABSORBER MOUNTNG FRT, RH/LH	1	193.80	193.80	25.00	145.35	Replace	0	0	Check	X NN
One Time Key In	Main			STABILIZER BAR LINK FRT/RH/LH	1	195.00	195.00	25.00	146.25	Replace	0	0	Check	X NN
One Time Key In	Main			STABILIZER BAR FRT	1	348.80	348.80	25.00	261.60	Replace	0	0	Check	X NN
One Time Key In	Main			STEERING KNUCKLE LH FRT	1	580.80	580.80	25.00	435.60	Replace	0	0	Check	X NN

6216.44

Total Spare Part Cost 17,976.97

Surveyor Total 4,132.73

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 14,381.58

Final Sur Total 3,306.18

1/23/2019

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			DRIVE SHAFT LH	1	1,543.80	1,543.80	25.00	1,157.85	Replace	0	0	Check	X NM
One Time Key In	Main			LOWER ARM FRT/LH	1	625.90	625.90	25.00	469.42	Replace	0	0	Check	X NM
One Time Key In	Main			JOINT ASSY,LWR BALL	1	195.60	195.60	25.00	146.70	Replace	0	0	Check	X NM
One Time Key In	Main			BRAKE HOSE, FLEXIBLE FRT RH / LH	1	131.80	131.80	25.00	98.85	Replace	0	0	Check	X NM
One Time Key In	Main			BRAKE FLUID	1	20.00	20.00	0.00	20.00	Replace	0	0	Check	X NM
One Time Key In	Main			CROSS MEMBER FRT	1	2,497.50	2,497.50	25.00	1,873.13	Replace	0	0	Check	X NM
One Time Key In	Main			QUARTER GLASS FRT/LH	1	234.90	234.90	25.00	176.18	Replace	0	0	Not Give	X NM
One Time Key In	Main			SEALANT W/SCREEN	1	37.00	37.00	0.00	37.00	Replace	0	0	Not Give	X NM
One Time Key In	Main			MOULDING BODY, LH	1	673.60	673.60	25.00	505.20	Replace	1	0	Repair	X R
One Time Key In	Main			DOOR FRT/LH	1	894.40	894.40	25.00	670.80	Replace	1	670.80	Replace	/ BVC
One Time Key In	Main			STICKER DECAL SMRT (DOOR)	1	60.00	60.00	0.00	60.00	Replace	1	60.00	Replace	/ NEC
One Time Key In	Main			HINGE LOWER LHF, DOOR	1	90.10	90.10	25.00	67.57	Replace	0	0	Not Give	X NM
One Time Key In	Main			HINGE UPPER LHF, DOOR	1	80.50	80.50	25.00	60.38	Replace	0	0	Not Give	X NM
One Time Key In	Main			CHECK ASSY, FR DOOR	1	150.30	150.30	25.00	112.73	Replace	0	0	Not Give	X NM
One Time Key In	Main			DOOR LOCK FRT/LH	1	575.80	575.80	25.00	431.85	Replace	0	0	Not Give	X NM

2811-20

Total Spare Part Cost 17,976.97

Surveyor Total 4,132.73

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 14,381.58

Final Sur Total 3,306.18

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			DOOR REGULATOR SUB-ASSY, FRT/REAR LH	1	224.80	224.80	25.00	168.60	Replace	0	0	Check	X NAI
One Time Key In	Main			DOOR WEATHER STRIP FRT/LH	1	171.20	171.20	25.00	128.40	Replace	0	0	Not Give	X NAI
One Time Key In	Main			MOTOR ASSY, POWER WINDOW REGULATOR, LH	1	941.80	941.80	10.00	847.62	Replace	0	0	Check	X NAI
One Time Key In	Main			DOOR LOCK STRIKER	1	40.50	40.50	25.00	30.38	Replace	0	0	Not Give	X NAI
One Time Key In	Main			DOOR RR/LH	1	954.50	954.50	25.00	715.88	Replace	1	0	Repair	X R
One Time Key In	Main			PIXEL STICKER	1	60.00	60.00	0.00	60.00	Replace	1	60.00	Replace	/ NEC
One Time Key In	Main			ATF OIL	1	25.00	25.00	0.00	25.00	Replace	0	0	Check	X NAI
One Time Key In	Main			CAP SUB-ASSY, WHEEL	1	174.10	174.10	25.00	130.57	Replace	1	130.57	Replace	/ SCR
One Time Key In	Main			BUMPER LIP FRT	1	139.60	139.60	25.00	104.70	Replace	0	0	Check	X NAI
One Time Key In	Main			BUMPER FRT	1	482.00	482.00	25.00	361.50	Replace	1	361.50	Replace	/ DEF
One Time Key In	Main			BUMPER CLIPS	10	1.61	16.10	25.00	12.08	Replace	10	12.08	Replace	/ NEC
One Time Key In	Main			BUMPER ENERGY ABSORBER FRT	1	78.80	78.80	25.00	59.10	Replace	0	0	Check	X NAI
One Time Key In	Main			BUMPER REINFORCEMENT FRT	1	498.40	498.40	25.00	373.80	Replace	0	0	Check	X NAI
One Time Key In	Main			ARM SUB-ASSY, FR BUMPER LH	1	250.40	250.40	25.00	187.80	Replace	0	0	Check	X NAI
One Time Key In	Main			BUMPER SUPPORT F/LH	1	76.40	76.40	25.00	57.30	Replace	0	0	Check	X NAI

6133.60

Total Spare Part Cost 17,976.97

Surveyor Total 4,132.73

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 14,381.58

Final Sur Total 3,306.18

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			BRACKET, FR TURN CENTER LH	1	58.20	58.20	25.00	43.65	Replace	0	0	Check	X N/A
One Time Key In	Main			BRACKET, FR TURN LOWER LH	1	26.00	26.00	25.00	19.50	Replace	0	0	Check	X N/A
One Time Key In	Main			BRACKET, FR TURN UPPER LH	1	24.40	24.40	25.00	18.30	Replace	0	0	Check	X N/A
One Time Key In	Main			LENS & BODY, FR TURN LH	1	511.80	511.80	10.00	460.62	Replace	0	0	Check	X N/A
Total Spare Part Cost									17,976.97	Surveyor Total 4,132.73				
Lump Sum Discount (%)									20.00	Lump Sum Dis (%) 20				
Final Spare Part Cost									14,381.58	Final Sur Total 3,306.18				

Labour's Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPAIR LH PORTION	1,183.00	800	+ 100 (supp) = 900
Total:			1,183.00 1383	800.00 900	

Spray Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPSRAY FRONT BUMPER	378.00	200	
2	Main	TO REPSRAY FRONT HOOD	378.00	200	
3	Main	TO RESPRAY FRONT SUPPORT PANEL	180.00	0	39365.84
4	Main	TO RESPRAY FRONT FENDER LH	378.00	200	
5	Main	TO RESPRAY APRON PANEL LH	180.00	0	
6	Main	TO RESPRAY RIM	180.00	50	
7	Main	RESPRAY WHEEL CAP	180.00	30	
8	Main	TO RESPRAY FRONT DOOR LH	378.00	200	
9	Main	TO RESRAY REAR DOOR LH	378.00	200	
Total:			2,790.00	1,180.00	+ 100 (supp) = 1280

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
10	Main	TO RESPRAY ROCKER PANEL MOULDING	180.00	100	
Total:			2,798.00 2970	1,180.00 1280	

Other Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TOWING CHARGE	112.00	0	
2	Main	TO CHECK WIRING AND SYSTEM FUNCTION	80.00	20	/ n/c
3	Main	TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	30	/ n/c
4	Main	TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	60	/ n/c
5	Main	TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	120.00	30	/ n/c
6	Main	TO REMOVE & REFIX FRONT LHS/RHS QUATER GLASS	120.00	0	
7	Main	TO REMOVE AND REFIT WIRE HARDESS	200.00	20	/ n/c
8	Main	TO REMOVE AND REFIX UNDERCARRIAGE	250.00	0	
9	Main	TO TRANSFER DOOR MECHANISM	120.00	50	/ n/c
10	Main	TO REMOVE & REFIX FAN ENGINE & RADIATOR ASSY & INNER COOLER & AIR CON CONDENSER	120.00	0	
11	Main	TO REPLACE SUNDRY PARTS	100.00	0	
12	Main	TO WASH AND VACUUM	60.00	0	
Total:			1,502.00 1702	210.00 + 100 (Supp) = 310	

Summary

	Estimator Assesment(\$)	Surveyor Assesment(\$)
Total Spare Part Detail	14,381.58	3,306.18
Total Labour Cost	1,183.00	800.00
Total Spray Painting	2,790.00	1,180.00
Other	1,502.00	210.00
Overall Total	19,856.58 24,955.87	5,496.18
Lump Sum Repair Option		

Estimator Assessment(\$)

Surveyor Assessment(\$)

Lump Sum Total

19,850.00

5,500.00

Surveyor Approved Amount

5,500.00

No of Repair Days*

9

5

Remarks

L/S REPAIR, PHOTO AFTER PAINT.

Surveyor Name

Hwee Jie

Signature

Save

Clear

Survey Date

29/01/2019

P- 4132.73
 Supp - 4519.31
 Labour - 990
 Spray - 1280
 MTH - 310
 1,142.94
 4/5 - 8913.63
 = 8990

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company



Acknowledged by Repairer

Signature:

Date:

Section A - Accident Details

Registration Number	SHC4115R
Case Reference Number	TAX/01/19/2125
Registration Date	8/11/2013
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS
Name of Driver	MOHAMMED BIN IBRAHIM
Type of Accident	Head To Side
Accident Date and Time	26/1/2019 11:00 PM
Accident Reported Date and Time	28/1/2019 9:30 AM
Is Surveyor Required?	Yes
Survey by	
Vehicle Is Towed Back?	Yes
Towed Back Date and Time	26/1/2019 11:16 PM
Replacement Vehicle Issued?	No
Job Card Number	24099878
Special Instruction to ARC, if any	TOWED \$ 40 + \$40 = \$80 / NTUC - LKK
Prepared Date and Time	29/1/2019 2:49 PM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

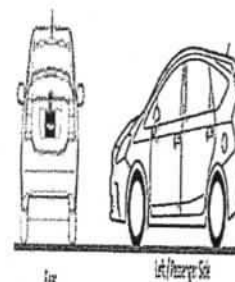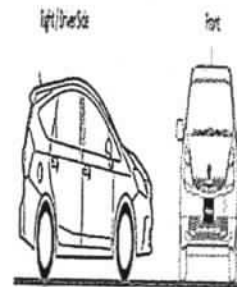

Section B - Summary of Repair Estimates

Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$1,383.00	\$900.00
Total Spray Cost	\$2,970.00	\$1,280.00
Total Spare Part Cost	\$14,880.18	\$8,652.08
Total Other Cost	\$1,702.00	(\$1,932.08)
TOTAL COST	\$20,935.18	\$8,900.00 (L/S)
Lump Sum Total	\$20,950.00	\$0.00
Number of Repair Days	12.0	8.0
Prepared / Adjusted By	Tuck Foo Kok	Hwee Jie (LKK) / NTUC
ARC / Surveyor Sign Off Date	01/02/2019 10:54 AM	29/01/2019 5:11 PM
Signature		
Remarks	Supplementary = 3	L/S REPAIR, PHOTO AFTER PAINT.

Section C - Quotation and Accident Invoice Details

Quotation Number	QN-1911-0405	Invoice Number	
Quotation Date	25.11.2019	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR FRONT WHEEL HOUSE PANEL LH	\$200.00	\$100.00 (Supp)
TO REPAIR LH PORTION	\$1,183.00	\$800.00
Total Labour	\$1,383.00	\$900.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY FRONT WHEEL HOUSE LH	\$180.00	\$100.00 (Supp)
TO REPSRAY FRONT BUMPER	\$378.00	\$200.00
TO REPSRAY FRONT HOOD	\$378.00	\$200.00
TO RESPRAY FRONT SUPPORT PANEL	\$180.00	\$0.00
TO RESPRAY FRONT FENDER LH	\$378.00	\$200.00
TO RESPRAY APRON PANEL LH	\$180.00	\$0.00
TO RESPRAY RIM	\$180.00	\$50.00
RESPRAY WHEEL CAP	\$180.00	\$30.00
TO RESPRAY FRONT DOOR LH	\$378.00	\$200.00
TO RESRAY REAR DOOR LH	\$378.00	\$200.00
TO RESPRAY ROCKER PANEL MOULDING	\$180.00	\$100.00
Total Spray Painting & Panel Beating	\$2,970.00	\$1,280.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REMOVE AND REFIT FRT UNDER CARRIAGE	\$200.00	\$100.00 (Supp)
Lump Sum Adjustment by Surveyor	\$0.00	(\$2,242.08)
TOWING CHARGE	\$112.00	\$0.00
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$20.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$100.00	\$30.00
TO DO WHEEL ALIGNMENT / TYRE BALANCING	\$120.00	\$60.00
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	\$120.00	\$30.00
TO REMOVE & REFIX FRONT LHS/RHS QUATER GLASS	\$120.00	\$0.00
TO REMOVE AND REFIT WIRE HARDESS	\$200.00	\$20.00
TO REMOVE AND REFIX UNDERCARRIAGE	\$250.00	\$0.00
TO TRANSFER DOOR MECHANISM	\$120.00	\$50.00
TO REMOVE & REFIX FAN ENGINE & RADIATOR ASSY & INNER COOLER & AIR CON CONDENSER	\$120.00	\$0.00
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
TO WASH AND VACUUM	\$80.00	\$0.00
Total Other Costs	\$1,702.00	(\$1,932.08)

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		52618-47050	BUMPER FRT ABSORBER LOWER	0.00	\$127.70	0.00	\$0.00	Replace	Check
		53301-47060	HOOD PANEL	1.00	\$748.10	100.00	\$0.00	Replace	Repair
		53420-47070	HOOD HINGE LH	0.00	\$55.90	0.00	\$0.00	Replace	Not Given
		53201-47902	SUPPORT SUB-ASSY	0.00	\$1,460.40	0.00	\$0.00	Replace	Check
		81170-47500	HEAD LAMP LH	1.00	\$945.20	10.00	\$850.68	Replace	Replace
		53802-47050	FENDER FRT/LH	1.00	\$723.40	25.00	\$542.55	Replace	Replace
		75374-47051	NAME PLATE (HYBRID)	1.00	\$51.90	25.00	\$38.92	Replace	Replace
		53876-47030	FENDER LINER FRT/LH	1.00	\$171.70	25.00	\$128.77	Replace	Replace
		53852-47020	FENDER LINER PAD, FR WHEEL LH	1.00	\$49.30	25.00	\$36.97	Replace	Replace
		53826-47010	FENDER PROTECTOR FRT/LH UPPER	0.00	\$46.10	0.00	\$0.00	Replace	Check
		53828-47060	PROTECTOR, FRONT FENDER SIDE PANEL LH	0.00	\$114.50	0.00	\$0.00	Replace	Check
		53702-47050	FENDER APRON SUB FRT/LH	0.00	\$637.80	0.00	\$0.00	Replace	Check
			TYRE	1.00	\$126.74	0.00	\$126.74	Replace	Replace
		42611-47140	WHEEL DISC. FRONT	1.00	\$1,484.20	25.00	\$1,113.15	Replace	Replace
		45510-47070	STEERING RACK ASSY	0.00	\$1,597.50	0.00	\$0.00	Replace	Check
			POWER STEERING FLUID	0.00	\$14.00	0.00	\$0.00	Replace	Check
		48619-28010	SHOCK ABSORBER BEARING, FRT LH/RH	0.00	\$34.00	0.00	\$0.00	Replace	Check
		48811-47060	STABILIZER BAR FRT	0.00	\$348.80	0.00	\$0.00	Replace	Check
		43330-49185	JOINT ASSY, LWR BALL	0.00	\$195.60	0.00	\$0.00	Replace	Check
		90947-02F83	BRAKE HOSE, FLEXIBLE FRT RH / LH	0.00	\$131.80	0.00	\$0.00	Replace	Check
			BRAKE FLUID	0.00	\$20.00	0.00	\$0.00	Replace	Check
		51201-12441	CROSS MEMBER FRT	0.00	\$2,497.50	0.00	\$0.00	Replace	Check
		62120-47021	QUARTER GLASS FRT/LH	0.00	\$234.90	0.00	\$0.00	Replace	Not Given
			SEALANT W/SCREEN	0.00	\$37.00	0.00	\$0.00	Replace	Not Given
		75852-47900	MOULDING BODY, LH	1.00	\$673.60	100.00	\$0.00	Replace	Repair
		67002-47070	DOOR FRT/LH	1.00	\$894.40	25.00	\$670.80	Replace	Replace
			STICKER DECAL SMRT (DOOR)	1.00	\$60.00	0.00	\$60.00	Replace	Replace
		68610-47021	CHECK ASSY, FR DOOR	0.00	\$150.30	0.00	\$0.00	Replace	Not Given
		69040-47070	DOOR LOCK FRT/LH	0.00	\$575.80	0.00	\$0.00	Replace	Not Given
		69802-52070	DOOR REGULATOR SUB-ASSY, FRT/REAR LH	0.00	\$224.80	0.00	\$0.00	Replace	Check
		67662-47030	DOOR WEATHER STRIP FRT/LH	0.00	\$171.20	0.00	\$0.00	Replace	Not Given
		85720-47110	MOTOR ASSY, POWER WINDOW REGULATOR	0.00	\$941.80	0.00	\$0.00	Replace	Check
		69410-33010	DOOR LOCK STRIKER	0.00	\$40.50	0.00	\$0.00	Replace	Not Given
		67004-47080	DOOR RR/LH	1.00	\$954.50	100.00	\$0.00	Replace	Repair
			PIXEL STICKER	1.00	\$60.00	0.00	\$60.00	Replace	Replace
			CAP SUB-ASSY, WHEEL	1.00	\$174.10	25.00	\$130.57	Replace	Replace
		52119-47930	BUMPER FRT	1.00	\$482.00	25.00	\$361.50	Replace	Replace
		52161-16010	BUMPER CLIPS	10.00	\$1.61	25.00	\$12.08	Replace	Replace
		52611-47080	BUMPER ENERGY ABSORBER FRT	0.00	\$78.80	0.00	\$0.00	Replace	Check
		52021-47023	BUMPER REINFORCEMENT FRT	0.00	\$498.40	0.00	\$0.00	Replace	Check
		57014-47030	ARM SUB-ASSY, FR BUMPER LH	0.00	\$250.40	0.00	\$0.00	Replace	Check
		81529-47060	BRACKET, FR TURN CENTER LH	0.00	\$58.20	0.00	\$0.00	Replace	Check
		81529-47050	BRACKET, FR TURN LOWER LH	0.00	\$26.00	0.00	\$0.00	Replace	Check

	81529-47040	BRACKET, FR TURN UPPER LH	0.00	\$24.40	0.00	\$0.00	Replace	Check	X
	81521-47050	LENS & BODY, FR TURN LH	0.00	\$511.80	0.00	\$0.00	Replace	Check	X
Total				\$18,706.65		\$4,132.73			

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
		51410-12105	UNDER COVER CENTER	1.00	\$448.30	25.00	\$336.23	Replace	Replace
		69802-52070	DOOR REGULATOR SUB-ASSY, FRT/REAR LH	1.00	\$224.80	25.00	\$168.60	Replace	Replace
	VE	8954347040	SENSOR, SPEED, FRONT LH	1.00	\$450.50	10.00	\$405.45	Replace	Replace
		48157-47020	INSULATOR, FRONT COIL SPRING, UPPER LH	1.00	\$47.50	25.00	\$35.63	Replace	Replace
		52114-47140	BRACKET, FR BUMPER	1.00	\$110.40	25.00	\$82.80	Replace	Replace
		45047-49165	TIE ROD END LH	1.00	\$159.30	25.00	\$119.48	Replace	Replace
		43550-47011	WHEEL HUB FRT	1.00	\$549.70	25.00	\$412.28	Replace	Replace
		48520-80294	SHOCK ABSORBER FRT/LH	1.00	\$394.20	25.00	\$295.65	Replace	Replace
		48609-47040	SHOCK ABSORBER MOUNTNG FRT, RH/LH	1.00	\$193.80	25.00	\$145.35	Replace	Replace
		48820-47020	STABILIZER BAR LINK FRT/RH/LH	1.00	\$195.00	25.00	\$146.25	Replace	Replace
		43202-47030	STEERING KNUCKLE LH FRT	1.00	\$580.80	25.00	\$435.60	Replace	Replace
		43420-47030	DRIVE SHAFT LH	1.00	\$1,543.80	25.00	\$1,157.85	Replace	Replace
		48069-47050	LOWER ARM FRT/LH	1.00	\$625.90	25.00	\$469.42	Replace	Replace
		68740-12120	HINGE LOWER LHF, DOOR	1.00	\$90.10	25.00	\$67.57	Replace	Replace
		68720-15151	HINGE UPPER LHF, DOOR	1.00	\$80.50	25.00	\$60.38	Replace	Replace
		08886-02305	ATF OIL	1.00	\$25.00	25.00	\$18.75	Replace	Replace
		76851-47020	BUMPER LIP FRT	1.00	\$139.60	25.00	\$104.70	Replace	Replace
		52116-47040	BUMPER SUPPORT F/LH	1.00	\$76.40	25.00	\$57.30	Replace	Replace
Total					5,485.10		4,519.29		

Scr	A
B+	A
Cut	A
B+	A
Crg	A
B+	A
B+	A
B+	A
B+	A
B+	A
B+	A
Scr	A
Buc	A
B+	A
B+	A
NBC	A
Scr	A
CRA	A

4925-60

8652.08

+ 900.00

+ 1590.00

11,142.08

- 207

8913.66

45 \$8900/-

REQUEST FOR SUPPLEMENT PARTS

Contractor:			
Accident Case Number	Tax/01/19/2125	Date of Collection	1 1
Vehicle No	SHC 4115R	Date of Request	4 12/19
Vehicle Model	Toyota Prius	Number of Days to Extend (if any)	53

S/N	Part Number	Part Description	Quantity	Unit Price	
		Frt Bumper Support LH	1pc	/ CAA	\$57.30
		ATF	4L	/ NEC	\$18.75
		Frt Wheel Hub LH	1pc	/ BT	\$412.18
		Frt Shock Absorber LH	1pc	/ BT	\$295.65
		Frt Shock Mounting	1pc	/ BT	\$145.35
		Frt Lower Arm LH	1pc	/ BLC	\$469.43

<<Please submit photographs for damaged parts>>

I, (Name) _____

(Position) _____

do solemnly and sincerely declare that:- Supplementary Parts are used for replacement for the aforesaid vehicle.

Signature of person making this declaration
[to be signed in front of an authorised witness]

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff

Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form 22 / PO / WOC / Reservation / Number
Photo Submitted	YES / NO	Date of submission

191

REQUEST FOR SUPPLEMENT PARTS

Contractor:			
Accident Case Number	Tax/01/19/2125	Date of Collection	1 1
Vehicle No	SHC 4115R	Date of Request	4 12 19
Vehicle Model	Toyota Prius	Number of Days to Extend (if any)	5 3

S/N	Part Number	Part Description	Quantity	Unit Price	
		FA Knuckle Arm LH	1PC	✓ BT	\$ 435.60
		FA Stab. Link LH	1PC	✓ BT	\$ 146.25
		Tie Rod End LH	1PC	✓ BT	\$ 119.48
		Drive Shaft LH	1PC	✓ SC	\$ 1157.85
		FA Bumper Lip	1PC	✓ SC	\$ 104.70
		Engine Under Cover Center	1PC	✓ SC	\$ 336.23

<<Please submit photographs for damaged parts>>

I, (Name) _____

(Position) _____

do solemnly and sincerely declare that:- Supplementary Parts are raised for replacement for the aforesaid vehicle.

Signature of person making this declaration
[to be signed in front of an authorised witness]

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff

Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form 22 / PO / WOC / Reservation / Number
Photo Submitted	YES / NO	Date of submission

REQUEST FOR SUPPLEMENT PARTS

Contractor			
Accident Case Number	Tax/01/19/2125	Date of Collection	1 1
Vehicle No	SHC 4115R	Date of Request	4 12 19
Vehicle Model	Toyota Prius	Number of Days to Extend (if any)	53

S/N	Part Number	Part Description	Quantity	Unit Price
		Frt. Door Hinge Upper LH	1pc	BT \$67.58
		Frt. Door Hinge Lower LH	1pc	BT \$60.38
		Frt. Door Window Regulator Assy	1pc	BT \$168.69
		Labour to Remove and Refix Frt. Under Carriage		\$100
		Labour to Repair Frt. Wheel House panel LH		\$100
		Labour to Spray Frt. Wheel House panel LH		\$100

<<<Please submit photographs for damaged parts>>>

I, (Name) _____

(Position) _____

do solemnly and sincerely declare that:- Supplementary Parts are used for replacement for the aforesaid vehicle.

.....
Signature of person making this declaration
(to be signed in front of an authorised witness)

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff

Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form 22 / PO / WOC / Reservation / Number
Photo Submitted	YES / NO	Date of submission

REQUEST FOR SUPPLEMENT PARTS

Contractor:			
Accident Case Number	Tax/01/19/2125	Date of Collection	1 1
Vehicle No	SHE 4115R	Date of Request	4 12 19
Vehicle Model	Toyota Prius	Number of Days to Extend (if any)	5 3

S/N	Part Number	Part Description	Quantity	Unit Price
	to	Request Additional Repair days		
		License plate Bracket	ipc	CRA
		Frt Shock Absorber Inner Boots	ipc	BT

\$82.80
\$ 35.63

<<<Please submit photographs for damaged parts>>>

8/2/19
21

I, (Name)

(Position)

do solemnly and sincerely declare that:- Supplementary Parts are raised for replacement for the aforesaid vehicle.

Signature of person making this declaration
(to be signed in front of an authorised witness)

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

Per SMRT Staff

Acknowledge By	ARCExecutive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form 22 / PO / WOC / Reservation / Number
Photo Submitted	YES / NO	Date of submission

Pg 4

REQUEST FOR SUPPLEMENT PARTS

Contractor:			
Accident Case Number	Tax 01/19/2125	Date of Collection	1/1
Vehicle No	SHC 41152	Date of Request	9/21/19
Vehicle Model	Toyota Prius	Number of Days to Extend (If any)	1

S/N	Part Number	Part Description	Quantity	Unit Price
		FA Wheel Speed Sensor LH	1PC	

COT \$495.45

Supp Parts \$4519.31

<<Please submit photographs for damaged parts>>

11/2/19

I, (Name) _____
 (Position) _____

do solemnly and sincerely declare that:- Supplementary Parts are raised for replacement for the aforesaid vehicle.

.....
 Signature of person making this declaration
 [to be signed in front of an authorised witness]

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff		
Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form 22 / PO / WOC / Reservation / Number
Photo Submitted	YES / NO	Date of submission



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC19001970/Esd3e2

73 BRAS BASAH ROAD

#05-01 NTUC TRADE UNION HOUSESINGAPORE Date: 11-12-2019

189556



Code: INC4

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHC 6728J	Veh. Inspected	SHC 4115R
Policy No.	5095103893	Coverage (\$)	0.00
Claim No.	MT/1029721-002	Excess (\$)	0.00
Assign From		Assign Date	29/01/2019

2. Vehicle Particulars & Condition

Make & Model	TOYOTA PRIUS	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2013
Chassis No.	JTDKN36U105701994	Colour	MAROON
Odometer	-	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	FALKEN	6 mm
L/H Front Tyre	195/65 R15	FALKEN	6 mm
R/H Rear Tyre	195/65 R15	FALKEN	6 mm
L/H Rear Tyre	195/65 R15	FALKEN	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	26/01/2019	Inspection Date	29/01/2019
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	8 Working Days
-------------------------------------	----------------



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 4115R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FENDER FRT / LH (DISC 25%)	BUCKLED	723.40	542.55
1	NAME PLATE (HYBRID) (DISC 25%)	NECESSARY	51.90	38.92
1	FENDER LINER FRT / LH (DISC 25%)	BUCKLED	171.70	128.77
1	FENDER LINER PAD, FR WHEEL, LH (DISC 25%)	NECESSARY	49.30	36.97
1	WHEEL DISC. FRONT (DISC 25%)	DENTED	1,484.20	1,113.15
1	DOOR FRT / LH (DISC 25%)	BUCKLED	894.40	670.80
1	CAP SUB-ASSY, WHEEL (DISC 25%)	SCRATCHED	174.10	130.57
1	BUMPER FRT (DISC 25%)	DEFORMED	482.00	361.50
10	BUMPER CLIPS @\$1.61 (DISC 25%)	NECESSARY	16.10	12.08
1	HEAD LAMP LH (DISC 10%)	SCRATCHED	945.20	850.68
1	TYRE (SN)	CUT	126.74	126.74
1	STICKER DECAL SMRT (DOOR) (SN)	NECESSARY	60.00	60.00
1	PIXEL STICKER (SN)	NECESSARY	60.00	60.00
1	UNDER COVER CENTER (DISC 25%)	SCRATCHED	448.30	336.23
1	DOOR REGULATOR SUB-ASSY, FRT / REAR LH (DISC 25%)	BENT	224.80	168.60
1	INSULATOR, FRONT COIL SPRING, UPPER LH (DISC 25%)	BENT	47.50	35.63
1	BRACKET, FR BUMPER (DISC 25%)	CRACKED	110.40	82.80
1	TIE ROD END LH (DISC 25%)	BENT	159.30	119.48
1	WHEEL HUB FRT (DISC 25%)	BENT	549.70	412.28
1	SHOCK ABSORBER FRT / LH (DISC 25%)	BENT	394.20	295.65
1	SHOCK ABSORBER MOUNTING FRT, RH / LH (DISC 25%)	BENT	193.80	145.35
1	STABILIZER BAR LINK FRT / RH / LH (DISC 25%)	BENT	195.00	146.25
1	STEERING KNUCKLE LH FRT (DISC 25%)	BENT	580.80	435.60
1	DRIVE SHAFT LH (DISC 25%)	SCRATCHED	1,543.80	1,157.85
1	LOWER ARM FRT / LH (DISC 25%)	BUCKLED	625.90	469.42
1	HINGE LOWER LHF, DOOR (DISC 25%)	BENT	90.10	67.57
1	HINGE UPPER LHF, DOOR (DISC 25%)	BENT	80.50	60.38
1	ATF OIL (DISC 25%)	NECESSARY	25.00	18.75
1	BUMPER LIP FRT (DISC 25%)	SCRATCHED	139.60	104.70

Report Ref No. NS/INC19001970/Esd3e2



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BUMPER SUPPORT F/LH (DISC 25%)	CRACKED	76.40	57.30
1	SENSOR, SPEED, FRONT LH (DISC 10%)	CUT	450.50	405.45
1	BUMPER FRT ABSORBER LOWER	NOT NECESSARY	127.70	-
1	HOOD HINGE LH	NOT NECESSARY	55.90	-
1	SUPPORT SUB-ASSY	NOT NECESSARY	1,460.40	-
1	FENDER PROTECTOR FRT / LH UPPER	NOT NECESSARY	46.10	-
1	PROTECTOR, FRONT FENDER SIDE PANEL LH	NOT NECESSARY	114.50	-
1	FENDER APRON SUB FRT / LH	NOT NECESSARY	637.80	-
1	TIE ROD END LH	NOT NECESSARY	159.30	-
1	STEERING RACK ASSY	NOT NECESSARY	1,597.50	-
1	POWER STEERING FLUID	NOT NECESSARY	14.00	-
1	WHEEL HUB FRT	NOT NECESSARY	549.70	-
1	SHOCK ABSORBER BEARING, FRT LH / RH	NOT NECESSARY	34.00	-
1	SHOCK ABSORBER FRT / LH	NOT NECESSARY	394.20	-
1	SHOCK ABSORBER MOUNTING FRT, RH / LH	NOT NECESSARY	193.80	-
1	STABILIZER BAR LINK FRT / RH / LH	NOT NECESSARY	195.00	-
1	STABILIZER BAR FRT	NOT NECESSARY	348.80	-
1	STEERING KNUCKLE LH FRT	NOT NECESSARY	580.80	-
1	DRIVE SHAFT LH	NOT NECESSARY	1,543.80	-
1	LOWER ARM FRT / LH	NOT NECESSARY	625.90	-
1	JOINT ASSY, LWR BALL	NOT NECESSARY	195.60	-
1	BRAKE HOSE, FLEXIBLE FRT RH / LH	NOT NECESSARY	131.80	-
1	BRAKE FLUID	NOT NECESSARY	20.00	-
1	CROSS MEMBER FRT	NOT NECESSARY	2,497.50	-
1	QUARTER GLASS FRT / LH	NOT NECESSARY	234.90	-
1	SEALANT W/SCREEN	NOT NECESSARY	37.00	-
1	HINGE LOWER LHF, DOOR	NOT NECESSARY	90.10	-
1	HINGE UPPER LHF, DOOR	NOT NECESSARY	80.50	-
1	CHECK ASSY, FR DOOR	NOT NECESSARY	150.30	-
1	DOOR LOCK FRT / LH	NOT NECESSARY	575.80	-
1	DOOR REGULATOR SUB-ASSY, FRT / REAR LH	NOT NECESSARY	224.80	-
1	DOOR WEATHERSTRIP FRT / LH	NOT NECESSARY	171.20	-
1	MOTOR ASSY, POWER WINDOW REGULATOR, LH	NOT NECESSARY	941.80	-

Report Ref No. NS/INC19001970/Esd3e2



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	DOOR LOCK STRIKER	NOT NECESSARY	40.50	-
1	ATF OIL	NOT NECESSARY	25.00	-
1	BUMPER LIP FRT	NOT NECESSARY	139.60	-
1	BUMPER ENERGY ABSORBER FRT	NOT NECESSARY	78.80	-
1	BUMPER REINFORCEMENT FRT	NOT NECESSARY	498.40	-
1	ARM SUB-ASSY, FR BUMPER LH	NOT NECESSARY	250.40	-
1	BUMPER SUPPORT F/LH	NOT NECESSARY	76.40	-
1	BRACKET, FR TURN CENTER LH	NOT NECESSARY	58.20	-
1	BRACKET, FR TURN LOWER LH	NOT NECESSARY	26.00	-
1	BRACKET, FR TURN UPPER LH	NOT NECESSARY	24.40	-
1	LENS & BODY, FR TURN LH	NOT NECESSARY	511.80	-
1	HOOD PANEL	TO REPAIR SEE LABOUR	748.10	-
1	MOULDING BODY, LH	TO REPAIR SEE LABOUR	673.60	-
1	DOOR RR/LH	TO REPAIR SEE LABOUR	954.50	-
			29,310.84	8,652.02
	LABOUR			
	PANEL BEATING & BODY WORK. INCLUSIVE OF THE REPAIR OF HOOD PANEL, MOULDING BODY, LH AND DOOR RR/LH.		1,383.00	900.00
	SPRAY PAINT.		2,970.00	1,280.00
	TOWING CHARGE.		112.00	-
	TO CHECK WIRING AND SYSTEM FUNCTION.		80.00	20.00
	TO APPLY RUST-PROOFING ON AFFECTED AREA.		100.00	30.00
	TO DO WHEEL ALIGNMENT / TYRE BALANCING.		120.00	60.00
	TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE).		120.00	30.00
	TO REMOVE & REFIX FRONT LHS / RHS QUATER GLASS.	NOT NECESSARY	120.00	-
	TO REMOVE AND REFIT WIRE HARDESS.		200.00	20.00
	TO REMOVE AND REFIX UNDERCARRIAGE.	NOT NECESSARY	250.00	-
	TO TRANSFER DOOR MECHANISM.		120.00	50.00
	TO REMOVE & REFIX FAN ENGINE & RADIATOR ASSY & INNER COOLER & AIR CON CONDENSER.	NOT NECESSARY	120.00	-

Report Ref No. NS/INC19001970/Esd3e2



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
	TO WASH AND VACUUM.	NOT NECESSARY	60.00	-
	TO REMOVE AND REFIT FRT UNDER CARRIAGE.		200.00	100.00
			6,055.00	2,490.00
GRAND TOTAL			35,365.84	11,142.02
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)				8,900.00

Report Ref No. NS/INC19001970/Esd3e2

CHEN TSUE YEE

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons), B.Bus, MBA, PEng, PE,
MInstAEA, MASME, MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report in whole or in part does so at his or her own risk.