

Surveyor:

DOI:

ASSIGNMENT

Date / Time:

Registered in Merimen:

Pre-assign / CCU / FTE



Insured Vehicle No.:

Name of Insured:

Insured Tel No.:

HP:

Excess Sec II :SS

D.O.A.:

Is driver the owner?

(YES / NO)

Nature of Accident:

If NO, Driver Name / Age:

Driver Tel No.:

(V/L: YES / NO)

OI GIA REPORT: YES / NO ; TP GIA REPORT: YES / NO

Insured Liability: % Final ? Yes / No



INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:

Date / Time

STAGE

DATE / PIC

Non-Reporting ltr (1st):

Non-Reporting ltr (2nd):

Non-Reporting ltr (Final):

Notification ltr (if non-pickup):

Call OI:

EMAIL 10-05-19

After call ltr to OI:

Documentation Check List: Handler Typist

Notification ltr (if non-pickup)

After call ltr to OI:

Authorisation To Act:

Release Voucher:

Final Repair Bill:

Car Rental Invoice:

Towing Invoice

LTA / GIA:

Medical Bill:

PIR:

Mandate/Reject Instruction:

LOD

Payment Breakdown Form:

Post-Repair Photos:

Others:

PRELIMINARY ADVICE Date/Time:

Sent By:

FINALIZATION

Date/Time:

Confirm with:

Repair Cost:

S\$

days) Reduction:

%

Confirm by:

Email

Call

FINAL SETTLEMENT

Date/Time:

Confirm with:

Jasmine

Email

Call

Final Liability:

% 100

(Agreed / Assessed) BOLA S/N No.:

31

If NO or B 28, Ass. Lia:

Repair Cost:

S\$

6233.00

Loss of Rental (LOR):

S\$

397.28

(4 days)

X 99.22

Loss of Use (LOU):

S\$

-

(\$ x days)

Loss of Income (LOI):

S\$

-

(\$ x days)

LOR only

LOU only

LOR + LOU

LOR + LOI

[Tick only one]

GIA/LTA Search

S\$

7.45

Medical:

S\$

-

Disbursement:

S\$

-

Legal Cost

S\$

-

Total:

S\$

6717.73

Global Sum S\$:

FINAL PAYMENT

Date/Time:

Confirm with:

Email

Call

Payee 1:

S\$

6717.73

Name 1:

Trans cab Auto Services Pte Ltd,

Payee 2: (Strike if N.A.)

S\$

Name 2:

Payee 3: (Strike if N.A.)

S\$

Name 3:

ASS. REC. BY:

REF:

ANA/

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

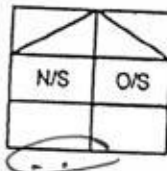

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

03

days

Res.:

Yes or No

Lum Sum:

20

%

3 Val.:

Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

S17F 858B

Yr Regn:

06, 14

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Perant Landa

C.C.

1995

Colour:

m. White / Red

A/C:

Insured / Std / NI / NA

Sp. Reading

467517

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

VI-1A9L15AUC-278718

Gen. Cond:

Good / Fair / Poor / Burnt

Steering:

In order / Jammed / Leaked / Burnt or

Brake:

In order / Jammed / Leaked / Burnt or

Modl:

N/S / R/im / STD A/R/im or

Tyre Size:

F:

215/60R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Giti

Front

R/Bal.

8

mm

Rear

R/Bal.

9

mm

L/Bal.

8

mm

L/Bal.

9

mm

D.O.A.

5/12/19

D.O.I.

8/2/19

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1

File pass to
C12p 85900

Date/Time, File Pass to?

☐

: Prel. Report

1)

Date/Time, File Return to?

☐

: Final Report

2)

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + R.S. SI

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$

Credit 43157.30 / 8/6/19

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF 658B**AAD1902-048***Not Notarised
61 Sep @ 5900*

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration :

SHF 658B

VF1ABL15AUC278716

RENAULT

LATITUDE

5.2.2019

AXA

30/6/2014

PART**LIST**

1	1 BUMPER COVER REAR	\$	<i>CM</i> 1,108.46	✓
2	1 BUMPER LOWER REAR	\$	<i>Dollar</i> 768.84	✓
3	1 BUMPER BRACKET CTR REAR	\$	<i>SL</i> 113.47	X
4	1 BUMPER BRACKET SIDE RH REAR	\$	<i>SL</i> 135.97	X
5	1 BUMPER RETAINER RH REAR	\$	<i>SL</i> 44.99	X
6	1 BUMPER REFLECTOR RH	\$	<i>SL</i> 43.61	X
7	1 BUMPER BRACKET SIDE LH REAR	\$	<i>SL</i> 135.97	X
8	1 BUMPER RETAINER LH REAR	\$	<i>DI</i> 44.99	✓
9	1 BUMPER REFLECTOR LH	\$	<i>CM</i> 43.61	✓
10	1 BUMPER BEAM REAR	\$	<i>R</i> 777.52	✓
11	1 BUMPER BEAM BRACKET LH REAR	\$	<i>R</i> 225.95	✓
12	1 BUMPER BEAM BRACKET RH REAR	\$	<i>R</i> 225.95	X
13	1 BOOT REAR	\$	<i>R</i> 2,872.68	✓
14	1 BOOT FINISHER	\$	<i>SL</i> 470.06	X
15	1 BOOT WHEATERSTRIP	\$	<i>SL</i> 323.05	X
16	1 BOOT REFLECTOR LAMP LH	\$	<i>SL</i> 493.35	X
17	1 BOOT REFLECTOR LAMP RH	\$	<i>SL</i> 493.35	X
18	1 BOOT BADGE 'RENAULT'	\$	<i>RE</i> 225.36	✓
19	1 BOOT BADGE	\$	<i>RE</i> 225.36	✓
20	1 BOOT STRUT LH	\$	<i>SL</i> 276.08	} X
21	1 BOOT STRUT RH	\$	<i>SL</i> 276.08	
22	1 BOOT HINGE LH	\$	<i>R</i> 367.84	
23	1 BOOT HINGE RH	\$	<i>R</i> 367.84	
24	1 BOOT INNER TRIM	\$	<i>SL</i> 586.45	
25	1 BOOT SWITCH	\$	<i>SL</i> 168.13	
26	1 BOOT LOCK	\$	<i>R</i> 202.67	
27	1 BOOT LOCK CATCH	\$	<i>R</i> 74.40	
28	2 LICENCE PLATE LAMP	\$	<i>SL</i> 50.52	}
29	2 BOOT RUBBER PLUG	\$	<i>SL</i> 221.81	

Trans-cab Auto Services Pte Ltd**AAD1902-048**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF 658B

30	1 FENDER PANEL REAR RH	\$	<i>R</i>	3,299.13	}
31	1 WHEELARCH REAR RH	\$	<i>Sn</i>	543.47	
32	1 FENDER PANEL INNER TRIM REAR RH	\$	<i>Sn</i>	671.45	
33	1 WHEEL HOUSING PANEL REAR RH	\$	<i>R</i>	4,682.09	
34	1 TAILLAMP LH	\$	<i>Sn</i>	552.55	
35	1 TAILLAMP PANEL LH	\$	<i>R</i>	986.70	
36	1 TAILLAMP RH	\$	<i>Sn</i>	552.55	
37	1 TAILLAMP PANEL RH	\$	<i>R</i>	986.70	
38	1 OUTER PANEL REAR (End Panel)	\$	<i>R</i>	1,471.77	
39	1 OUTER PANEL REAR (End Panel)TRIM	\$	<i>Sn</i>	404.56	
40	1 SPARE WHEEL PANEL (Luggage Floor Panel)	\$	<i>R</i>	2,189.88	
41	1 SPARE WHEEL PANEL TRIM	\$	<i>Sn</i>	612.21	
42	1 EXHAUST REAR	\$	<i>R</i>	7,489.05	}
43	1 EXHAUST CAP REAR	\$	<i>R</i>	230.49	

TOTAL	\$	36,036.98
10%	\$	3,603.70
	\$	32,433.28

Special Nett

1	1SET PARKING AID	\$	<i>Shan</i>	700.00	<i>Good</i>
2	1SET REAR BUMPER CLIP	\$	<i>me</i>	66.00	✓
3	1SET BUMPER BRACKET CTR CLIP	\$	<i>me</i>	33.00	—
4	1SET BUMPER BRACKET SIDE CLIP RH RR	\$	<i>me</i>	10.00	X
5	1SET BUMPR RETAINER RH CLIP RR	\$	<i>me</i>	20.00	X
6	1SET BUMPR BRACKET SIDE CLIP LH RR	\$	<i>me</i>	10.00	X
7	1SET BUMPR RETAINER CLIP LH RR	\$	<i>me</i>	20.00	X
8	1SET BUMPER LOWER REAR RIVET	\$	<i>me</i>	22.00	X
9	1SET BUMPER LOWER REAR CLIP	\$	<i>me</i>	66.00	✓
10	1 EXHAUST MOUNTING REAR	\$	<i>me</i>	17.82	X
11	1SET BOOT FINISHER CLIP	\$	<i>me</i>	24.20	X
12	1 REAR BOOT STICKER 'Trans-cab'	\$	<i>me</i>	80.00	<i>30.00</i>
13	1 REAR BOOT STICKER '6555-3333'	\$	<i>me</i>	80.00	<i>30.00</i>

Trans-cab Auto Services Pte Ltd

AAD1902-048

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF 658B

16	1SET FENDER WHEELARCH REAR RH CLIP	\$	nn	35.00	}	X
17	1SET FENDER WHEELARCH REAR LH CLIP	\$	nn	35.00		
18	1 FENDER INNER TRIM CLIP LH	\$	nn	28.00		
19	1 FENDER INNER TRIM CLIP LH	\$	nn	28.00		
20	1 TAILLAMP CLIP RH	\$	nn	5.00		
21	1 TAILLAMP CLIP LH	\$	nn	5.00		
22	2 REAR WINDSCREEN SELANT	\$	nn	80.00		
23	1 WINDSCREEN MOULDING	\$	nn	100.00		
24	1 REAR WINDSCREEN INNER SPONGE SEAL	\$	nn	100.00	}	
25	1 SPARE TYRE RIM (ROUE 7J 16H 2547)	\$	nn	385.00		
26	1 SPARE TYRE	\$	nn	330.00		

TOTAL \$ 2,280.02**TOTAL PARTS \$ 34,713.30****LABOUR**

Putty And Spray Painting Of The Affected Portion.	\$	6,000.00	440l
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	6,000.00	300l
To Rust-Proofing Of The Affected Areas.	\$	nn 170.00	X
To reinstall rear bumper parking sensor.	\$	170.00	60l
To transfer of bootlid fittings, attachments and perform water seepage test.	\$	170.00	60l
To repair and realign rear exhaust pipe.	\$	nn 170.00	X
To drop rear exhaust box, renew the same, to repair and realign centre exhaust pipe.	\$	nn 170.00	X

Trans-cab Auto Services Pte Ltd

AAD1902-048

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHF 658B

To transfer of rear end panel fittings, attachment and perform water seepage test.	\$	~ 170.00	X
To transfer of rear luggage floor panel fittings, attachment and perform water seepage test.	\$	~ 170.00	X
To supply and re-do rear luggage floor panel insulation padding.	\$	~ 380.00	X
To transfer of rear fender fittings, attachment and perform water seepage test.	\$	~ 380.00	X
To transfer of rear windscreen fittings and conduct water seepage test.	\$	~ 170.00	X
To check steering geometry and computer wheel alignment	\$	~ 220.00	X
To transfer of rear door fittings, attachment and perform water seepage test.	\$	~ 380.00	X

TOTAL \$ 14,340.00**Over All Total \$ 49,053.30**

49433.28

(LUMP SUM)**Repair Days****20 DAYS**

3 day,

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Company

Owner ID: 3878K

Vehicle Details

Vehicle No.: SHF658B

Vehicle to be Exported: Yes

Intended Deregistration Date: 07 Feb 2019

Vehicle Make: RENAULT

Vehicle Model: LATITUDE 2.0L DCI AUTO D/AB 4DR

Primary Colour: Red

Manufacturing Year: 2014

Engine No.: M9R8839C001751

Chassis No.: VF1ABL15AUC278716

Maximum Power Output: 127.0 kW (170 bhp)

Open Market Value: \$19,998.00

Original Registration Date: 30 Jun 2014

First Registration Date: 30 Jun 2014

Transfer Count: 0

Actual ARF Paid: \$12,498.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 29 Jun 2022

PARF Rebate Amount: \$9,373.00

Intended COE Rebate Details

COE Expiry Date: 29 Jun 2022

COE Category: A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years): 8

PQP Paid: \$57,338.00

COE Rebate Amount: \$24,328.00

Total Rebate Amount: \$33,701.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 07 Feb 2019

OK



<TP - Mandate IA> - S9M01D8X [ACCIDENT INVOLVING SLQ 6702L(OI) & SHF 658B(TP) ON 05/02/2019]

Type

🔗 Question

Message

Liability: 100%. Insured rear-ended third party. Inform OI about third party claim. Agreed to settle at best and aware NCD issue. We seek your mandate at \$7,220.45(all-in). TP-Mandate IA had been uploaded in Smartclaims. Kindly let us have your approval/instruction. Hsiao Tong - 29 June 2019

Reply



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Immediate Advice

To : AXA Insurance Pte Ltd

Date: 29/6/2019

Survey Details:

Date of loss	5-Feb-19
Date of appointment	8-Feb-19
Date of survey	8-Feb-19
Location of survey	TRANS-CAB AUTO SERVICES PTE LTD

Vehicle Details:

Claim Type:	THIRD PARTY CLAIM
Vehicle number	SHF 658B
Make and Model	RENAULT LATITUDE 2.0L DCI - 1995cc
Date of registration	30-Jun-14
Parf Rebate	
Market Value	\$ -
Parf Rebate	\$ -
Nett Loss	\$ -

Repair details:

Initial Estimate	\$ 49,053.30
------------------	--------------

Proposed/Revised repair cost:

Parts	\$ 6,488.49
Check items (estimate)	\$ -
Labour	\$ 860.00
Total	\$ 7,348.49
Lump Sum(if applicable)	\$ 5,900.00

Number of days for repair	3 days
---------------------------	---------------



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Remarks:

--

Mandate:

Liability(TP)		100%
Proposed repair cost (w/GST)	\$	6,313.00
Loss of use		NIL
Loss of rental	\$	650.00
Loss of income	\$	250.00
LTA search fees	\$	7.45
Others		NIL
Proposed Total	\$	7,220.45



Re:<TP - Mandate IA> - S9M01D8X [ACCIDENT INVOLVING SLQ 6702L(OI) & SHF 658B(TP) ON 05/02/2019]

Type

🔍 Question

Message

Hi, pls proceed as per mandate. TY.

Reply

Hsiao Tong (LKKAUTO)

From: Jasmine Tan <jasminetan@transcab.com.sg>
Sent: Tuesday, 23 July 2019 11:46 AM
To: Hsiao Tong (LKKAUTO); 'Ng Wai Yin'
Cc: claims@transcab.com.sg
Subject: RE: Your Ref: AAD1902-048 (SHF 658B) *Our Ref: CC3/ASM19002388/Kpa3 [ACCIDENT INVOLVING SLQ 6702L(AXA) & SHF 658B ON 05/02/2019]

Without Prejudice

Dear Hsiao Tong

Please proceed to send us the DV.

Thank you
Best Regards
Jasmine Tan



TRANS-CAB SERVICES PTE LTD

No. 2 Ang Mo Kio Street 63, Singapore 569111
Main Line : (65) 6287 6666 Fax Line: (65) 6257 1330
Direct Line : (65) 6603 1250
Website: www.transcab.com.sg

This message is confidential. It may also be privileged or otherwise protected by work product immunity or other legal rules. If you have received it by mistake, please let us know by e-mail reply and delete it from your system; you may not copy this message or disclose its contents to anyone. Please send us by fax any message containing deadlines as incoming e-mails are not screened for response deadlines. The integrity and security of this message cannot be guaranteed on the Internet

From: Hsiao Tong (LKKAUTO) [mailto:chewht@lkkauto.com]
Sent: Monday, 8 July 2019 5:56 PM
To: 'jasminetan@transcab.com.sg' <jasminetan@transcab.com.sg>; Ng Wai Yin <waiyin.ng@transcab.com.sg>; claims@transcab.com.sg
Subject: Your Ref: AAD1902-048 (SHF 658B) *Our Ref: CC3/ASM19002388/Kpa3 [ACCIDENT INVOLVING SLQ 6702L(AXA) & SHF 658B ON 05/02/2019]

Your Ref: **AAD1902-048 (SHF 658B)**
Our Ref: CC3/ASM19002388/Kpa3

Without Prejudice

Dear Sirs/Mdm,

ACCIDENT INVOLVING SLQ 6702L(AXA) & SHF 658B ON 05/02/2019

We refer to the above matter.

We propose settlement as follows: -

1. Cost of Repair (w/GST)	\$ 6,313.00
2. Loss of Rental (4days x \$99.32)	\$ 397.28
3. LTA/GIA Search Fee	\$ 7.45
TOTAL	\$ 6,717.73

Please confirm acceptance.

"Kindly note that this negotiation between parties on this matter is purely on a without prejudice basis with the sole intention of resolving the matter amicably without parties resorting to legal proceedings. No admission of liability, whatsoever, should be deemed / inferred from this negotiation of terms/settlement.

In the event of new evidence being discovered or subsequently produced by either party that will materially affect/influence on the issues of liability/damages, either party is not bound, thereafter, by the negotiation terms/settlement."

Best Regards,

Hsiao Tong, Chew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6742-3197 | email: chewht@lkkauto.com | fax: 6741-4108

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

Trans-Cab Services Pte Ltd

No. 2 Ang Mo Kio Street 63

Tel No.: 6287 6666 Fax No. 6281 1400

Co./GST Reg. No. 200303878K

Our Ref : AAD1902-048

Your Ref : SLQ6702L

Date : 13.May 2019

AXA INSURANCE S PTE LTD

Dear Sir/Madam,

ACCIDENT INVOLVING SHF0658B AND SLQ6702L ON 05/02/19 08:20 PM ALONG ANG MO KIO AVE 5 X ANG MO KIO AVE 4

It appears that the above accident was caused by your insured's negligence. We, therefore seeking compensation from you for our financial loss as itemized below :-

1.	Cost of Repair (inclusive of 7% GST)	\$	6,313.00
2.	Loss of Rental for <u>5</u> days @ \$ <u>99.32</u> per day	\$	496.60
3.	Loss of Income for _____ days @ \$ _____ per day	\$	0.00
4.	LTA Search Fee	\$	7.49
5.	Survey Fee	\$	0.00
	Total	\$	6,817.09

We enclose a copy of the following documents for your consideration :-

GIA report lodged by our driver

Rental rate and mileage records

Certificate of Insurance

Authorization To Act

Original final repair bill

LTA Search Fee

Kindly let us have the discharge voucher within the next 14 days, failing which we shall proceed to hand over the conduct of this matter to our solicitors without further reference to you.

Yours Faithfully

Trans-Cab Services Pte Ltd



Jasmine Tan

General Manager

Tel No. : 6603 1250 (DID)

Note : Please email any further correspondence to claims@transcab.com.sg (6603 1259)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
AXA INSURANCE PTE LTD		Ref : CC3/ASM19002388/Kpa3s2		
8 SHENTON WAY #24-01 AXA TOWERSINGAPORE 068811 ATTN: RICHARD ANG		Date : 16-08-2019 Code : ASM		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLQ 6702L	Veh. Inspected	SHF 658B	
Policy No.	CN004843	Coverage (\$)	0.00	
Claim No.	S9M01D8X	Excess (\$)	0.00	
Assign From		Assign Date	08/02/2019	
2. Vehicle Particulars & Condition				
Make & Model	RENAULT LATITUDE (A)	c.c	1995	
Engine No.	HIDDEN	Year of Reg.	2014	
Chassis No.	VF1ABL15AUC278716	Colour	METALLIC WHITE / RED	
Odometer	467517	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	GITI	8 mm	
L/H Front Tyre	215/60 R16	GITI	8 mm	
R/H Rear Tyre	215/60 R16	GITI	9 mm	
L/H Rear Tyre	215/60 R16	GITI	9 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	05/02/2019	Inspection Date	08/02/2019	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHF 658B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER REAR (CONSISTENT)	CRACKED	1,108.46	1,108.46
1	BUMPER LOWER REAR (CONSISTENT)	DENTED / CUT	768.84	768.84
1	BUMPER BRACKET CTR REAR (CONSISTENT)	SERVICEABLE	113.47	-
1	BUMPER BRACKET SIDE RH REAR (CONSISTENT)	SERVICEABLE	135.97	-
1	BUMPER RETAINER RH REAR (CONSISTENT)	SERVICEABLE	44.99	-
1	BUMPER REFLECTOR RH (CONSISTENT)	SERVICEABLE	43.61	-
1	BUMPER BRACKET SIDE LH REAR (CONSISTENT)	SERVICEABLE	135.97	-
1	BUMPER RETAINER LH REAR (CONSISTENT)	DISTORTED	44.99	44.99
1	BUMPER REFLECTOR LH (CONSISTENT)	CRACKED	43.61	43.61
1	BUMPER BEAM REAR (CONSISTENT)	BENT	777.52	777.52
1	BUMPER BEAM BRACKET LH REAR (CONSISTENT)	BENT	225.95	225.95
1	BUMPER BEAM BRACKET RH REAR (CONSISTENT)	TO REPAIR SEE LABOUR	225.95	-
1	BOOT REAR (CONSISTENT)	BENT	2,872.68	2,872.68
1	BOOT FINISHER (CONSISTENT)	SERVICEABLE	470.06	-
1	BOOT WEATHERSTRIP (CONSISTENT)	SERVICEABLE	323.05	-
1	BOOT REFLECTOR LAMP LH (CONSISTENT)	SERVICEABLE	493.35	-
1	BOOT REFLECTOR LAMP RH (CONSISTENT)	SERVICEABLE	493.35	-
1	BOOT BADGE 'RENAULT' (CONSISTENT)	NECESSARY	225.36	225.36
1	BOOT BADGE (CONSISTENT)	NECESSARY	225.36	225.36
1	BOOT STRUT LH (CONSISTENT)	SERVICEABLE	276.08	-
1	BOOT STRUT RH (CONSISTENT)	SERVICEABLE	276.08	-
1	BOOT HINGE LH (CONSISTENT)	TO REPAIR SEE LABOUR	367.84	-
1	BOOT HINGE RH (CONSISTENT)	TO REPAIR SEE LABOUR	367.84	-
1	BOOT INNER TRIM (CONSISTENT)	SERVICEABLE	586.45	-
1	BOOT SWITCH (CONSISTENT)	SERVICEABLE	168.13	-
1	BOOT LOCK (CONSISTENT)	TO REPAIR SEE LABOUR	202.67	-
1	BOOT LOCK CATCH (CONSISTENT)	TO REPAIR SEE LABOUR	74.40	-

Report Ref No. CC3/ASM19002388/Kpa3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	LICENCE PLATE LAMP (CONSISTENT)	SERVICEABLE	50.52	-
2	BOOT RUBBER PLUG (CONSISTENT)	SERVICEABLE	221.81	-
1	FENDER PANEL REAR RH (CONSISTENT)	TO REPAIR SEE LABOUR	3,299.13	-
1	WHEELARCH REAR RH (CONSISTENT)	SERVICEABLE	543.47	-
1	FENDER PANEL INNER TRIM REAR RH (CONSISTENT)	SERVICEABLE	671.45	-
1	WHEEL HOUSING PANEL REAR RH (CONSISTENT)	TO REPAIR SEE LABOUR	4,682.09	-
1	TAILLAMP LH (CONSISTENT)	SERVICEABLE	552.55	-
1	TAILLAMP PANEL LH (CONSISTENT)	TO REPAIR SEE LABOUR	986.70	-
1	TAILLAMP RH (CONSISTENT)	SERVICEABLE	552.55	-
1	TAILLAMP PANEL RH (CONSISTENT)	TO REPAIR SEE LABOUR	986.70	-
1	OUTER PANEL REAR (END PANEL) (CONSISTENT)	TO REPAIR SEE LABOUR	1,471.77	-
1	OUTER PANEL REAR (END PANEL) TRIM (CONSISTENT)	SERVICEABLE	404.56	-
1	SPARE WHEEL PANEL (LUGGAGE FLOOR PANEL) (CONSISTENT)	TO REPAIR SEE LABOUR	2,189.88	-
1	SPARE WHEEL PANEL TRIM (CONSISTENT)	SERVICEABLE	612.21	-
1	EXHAUST REAR (CONSISTENT)	TO REPAIR SEE LABOUR	7,489.05	-
1	EXHAUST CAP REAR (CONSISTENT)	TO REPAIR SEE LABOUR	230.49	-
	LESS 10% DISCOUNT		-3,603.70	-629.28
			32,433.26	5,663.49
SPECIAL NETT ITEMS				
1	SET PARKING AID (SN) (CONSISTENT)	SHORTED	700.00	600.00
1	SET REAR BUMPER CLIP (SN) (CONSISTENT)	NECESSARY	66.00	66.00
1	SET BUMPER BRACKET CTR CLIP (SN) (CONSISTENT)	NECESSARY	33.00	33.00
1	SET BUMPER BRACKET SIDE CLIP RH RR (SN) (CONSISTENT)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER RH CLIP RR (SN) (CONSISTENT)	NOT NECESSARY	20.00	-
1	SET BUMPER BRACKET SIDE CLIP LH RR (SN) (CONSISTENT)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER CLIP LH RR (SN) (CONSISTENT)	NOT NECESSARY	20.00	-

Report Ref No. CC3/ASM19002388/Kpa3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET BUMPER LOWER REAR RIVET (SN) (CONSISTENT)	NOT NECESSARY	22.00	-
1	SET BUMPER LOWER REAR CLIP (SN) (CONSISTENT)	NECESSARY	66.00	66.00
1	EXHAUST MOUNTING REAR (SN) (CONSISTENT)	NOT NECESSARY	17.82	-
1	SET BOOT FINISHER CLIP (SN) (CONSISTENT)	NOT NECESSARY	24.20	-
1	REAR BOOT STICKER 'TRANS-CAB' (SN) (CONSISTENT)	NECESSARY	80.00	30.00
1	REAR BOOT STICKER '6555-3333' (SN) (CONSISTENT)	NECESSARY	80.00	30.00
1	SET FENDER WHEELARCH REAR RH CLIP (SN) (CONSISTENT)	NOT NECESSARY	35.00	-
1	SET FENDER WHEELARCH REAR LH CLIP (SN) (CONSISTENT)	NOT NECESSARY	35.00	-
1	FENDER INNER TRIM CLIP LH (SN) (CONSISTENT)	NOT NECESSARY	28.00	-
1	FENDER INNER TRIM CLIP LH (SN) (CONSISTENT)	NOT NECESSARY	28.00	-
1	TAILLAMP CLIP RH (SN) (CONSISTENT)	NOT NECESSARY	5.00	-
1	TAILLAMP CLIP LH (SN) (CONSISTENT)	NOT NECESSARY	5.00	-
2	REAR WINDSCREEN SEALANT (SN) (CONSISTENT)	NOT NECESSARY	80.00	-
1	WINDSCREEN MOULDING (SN) (CONSISTENT)	NOT NECESSARY	100.00	-
1	REAR WINDSCREEN INNER SPONGE SEAL (SN) (CONSISTENT)	NOT NECESSARY	100.00	-
1	SPARE TYRE RIM (ROUE 7J 16H 2547) (SN) (CONSISTENT)	SERVICEABLE	385.00	-
1	SPARE TYRE (SN) (CONSISTENT)	SERVICEABLE	330.00	-
			2,280.02	825.00
	LABOUR			
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		6,000.00	440.00
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF BUMPER BEAM BRACKET RH REAR, BOOT HINGE LH, BOOT HINGE RH, BOOT LOCK, BOOT LOCK CATCH, FENDER PANEL REAR RH, WHEEL HOUSING PANEL REAR RH, TAILLAMP PANEL LH, TAILLAMP PANEL RH, OUTER PANEL REAR (END PANEL), SPARE WHEEL PANEL (LUGGAGE FLOOR PANEL), EXHAUST REAR AND EXHAUST CAP REAR.		6,000.00	300.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.	NOT NECESSARY	170.00	-
	TO REINSTALL REAR BUMPER PARKING SENSOR.		170.00	60.00

Report Ref No. CC3/ASM19002388/Kpa3s2

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO TRANSFER OF BOOTLID FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.		170.00	60.00
	TO REPAIR AND REALIGN REAR EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO DROP REAR EXHAUST BOX, RENEW THE SAME, TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR END PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR LUGGAGE FLOOR PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO SUPPLY AND RE-DO REAR LUGGAGE FLOOR PANEL INSULATION PADDING.	NOT NECESSARY	380.00	-
	TO TRANSFER OF REAR FENDER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF REAR WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER OF REAR DOOR FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
			14,720.00	860.00
GRAND TOTAL			49,433.28	7,348.49
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,900.00

Report Ref No. CC3/ASM19002388/Kpa3s2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.