

10/2001
ASS REE, IVY

REF: CS/FWD19003223/Grd3ch Special Instruction

SA/VG/01

ASSIGNMENT (Office)

merimen

From (Person): Josey loh

of FWD

Date/Time: 20/2/19 @ 11:14am

Estimated Cost:

Bill to:

(10) TP/WS/TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SLA 3388P

Insured:

at Workshop info:

Trans Eunkeats

Tel:

8128 9802

of

Subi close

Policy No:

Claim No:

1201900004836

Sum Insured:

Excess:

\$500.00

Make of Veh:

(Client's Record)

D.O.A. 13/02/2019

CA / REV

REP. / REV 24 HRS

21/2/19 @ 4pm

H.O.D. Endorsement:

Date/Time:

11:35am @ 20/2/19

Person Contacted:

Jes

Vehicle IN/OUT

Date/Time

Action/Instruction (✓) Estimate

SLA 3388P-x

22/2/19

Revert via merimen, pending lug card from repairer

25/2/19

Revert via merimen with mtv

26/2/19

Rece approved \$6344.50 from Josey by merimen

26/2/19

Informed Jess CIA ex \$500 by email

Stringer: Xhe

REF:

FWD

6597A

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: _____

at Workshop m/s Trans Eurocars

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: \$500

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. on Market Value: \$58K

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 4 days Res: Yes or No

Lum Sum: _____ % 3 Val: Yes or No

CA / ☒ REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SLA3388P Yr Regn: 16

Type: ☒ Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Mazda 3 C.C. 1496

Colour: Grey A/C: Insured / Std / NI / NA

Sp. Reading: 46176 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JM6BM 42A 8G 032 8325

Gen. Cond: Good / Fair / Poor / Burnt

Steering: ☒ In order / Jammed / Leaked / Burnt or

Brake: ☒ In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD ☒ A/Rim or

Tyre Size: F: 205/60 R16

R: 11

BS / DUN / EXNOVA / GY / FS / LIZA / ☒ MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 6 mm R/Bal. 6 mm

L/Bal. 6 mm L/Bal. 6 mm

D.O.A. _____ D.O.I. 21-02-19

Survey held at w/s 11:20 am

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

W/o/s

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

22/2 owner's IC can't check LTA record informed Jess to provide log card.

Final fig \$ 5374.45 (Red 4739.74, 4790)

RECEIVED 1 MAR 2019

Date/Time, File Pass to?

☐ : Preli. Report

Days Of Repair: 4

1) 19/3 Typst

☒ : Final Report

Resurvey No. of Trip: _____

Date/Time, File Return to?

2)

Add Fee: ☐ : Site Insp (\$)

☐ : Interview (\$)

☐ : Tech. Invs (\$)

☐ : Weekend (\$)

Survey Fee: 150

Transportation: 50

\$ + RS. \$

Photos

Others 16

TOTAL

310

Report Format: OD

Lump Sum / LB: (\$ 5374.45)

Veron Chen (LKKAUTO)

From: Veron Chen (LKKAUTO)
Sent: Tuesday, 26 February 2019 10:41 AM
To: 'jess.francis@eurokars.com.sg'
Cc: ronald.yap@eurokars.com.sg; motorclaims.sg@fwd.com; SUR
Subject: RE: Our ref - SLA3388P / DOA 13 02 2019 / Own damage claim survey

Dear Jess,

As instructed by our client, please proceed to repair the **insured vehicle SLA 3388P (Excess S500/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: jess.francis@eurokars.com.sg <jess.francis@eurokars.com.sg>
Sent: Monday, 25 February 2019 3:21 PM
To: Veron Chen (LKKAUTO) <veronchen@lkkauto.com>
Cc: ronald.yap@eurokars.com.sg; motorclaims.sg@fwd.com; SUR <sur@lkkauto.com>
Subject: RE: Our ref - SLA3388P / DOA 13 02 2019 / Own damage claim survey

Hi Veron,

Please refer to the attachment above.

Sincerely,

Jess Francis Carlos
Insurance Claims Executive
Trans Eurokars Pte Ltd
5 Ubi Close
Singapore 408605
Email: jess.francis@eurokars.com.sg
HP no.: 8128 9802

From: Jess Francis Amurao Carlos
Sent: 22 February 2019 4:13 PM
To: 'Veron Chen (LKKAuto)' <veronchen@lkkauto.com>
Cc: Ronald Yap <ronald.yap@eurokars.com.sg>; motorclaims.sg@fwd.com; SUR <sur@lkkauto.com>
Subject: RE: Our ref - SLA3388P / DOA 13 02 2019 / Own damage claim survey

We already ask the owner.

Sincerely,

Jess Francis Carlos
Insurance Claims Executive
Trans Eurokars Pte Ltd
5 Ubi Close
Singapore 408605
Email: jess.francis@eurokars.com.sg
HP no.: 8128 9802

From: Veron Chen (LKKAuto) <veronchen@lkkauto.com>
Sent: 22 February 2019 4:12 PM
To: Jess Francis Amurao Carlos <jess.francis@eurokars.com.sg>
Cc: Ronald Yap <ronald.yap@eurokars.com.sg>; motorclaims.sg@fwd.com; SUR <sur@lkkauto.com>
Subject: RE: Our ref - SLA3388P / DOA 13 02 2019 / Own damage claim survey

Dear Jess,

Please get from owner.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: jess.francis@eurokars.com.sg <jess.francis@eurokars.com.sg>
Sent: Friday, 22 February 2019 4:09 PM
To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>
Cc: ronald.yap@eurokars.com.sg; motorclaims.sg@fwd.com; SUR <sur@lkkauto.com>
Subject: RE: Our ref - SLA3388P / DOA 13 02 2019 / Own damage claim survey

Hi Veron,

We cannot access it thru one motoring.

Sincerely,

Jess Francis Carlos
Insurance Claims Executive
Trans Eurokars Pte Ltd

5 Ubi Close
Singapore 408605
Email: jess.francis@eurokars.com.sg
HP no.: 8128 9802

From: Veron Chen (LKKAuto) <veronchen@lkkauto.com>
Sent: 22 February 2019 2:47 PM
To: Jess Francis Amurao Carlos <jess.francis@eurokars.com.sg>
Cc: Ronald Yap <ronald.yap@eurokars.com.sg>; motorclaims.sg@fwd.com; SUR <sur@lkkauto.com>
Subject: RE: Our ref - SLA3388P / DOA 13 02 2019 / Own damage claim survey

Dear Jess,

Kindly provides us LTA as soon as possible for approval.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: jess.francis@eurokars.com.sg <jess.francis@eurokars.com.sg>
Sent: Wednesday, 20 February 2019 11:50 AM
To: Admin-D (LKKAuto) <admin-d@lkkauto.com>
Cc: ronald.yap@eurokars.com.sg; motorclaims.sg@fwd.com
Subject: RE: Our ref - SLA3388P / DOA 13 02 2019 / Own damage claim survey

Hi LKK Auto,

Please book the car for the survey on Feb 21, 2019 at 4 pm.

Regards,

 Jess Francis Carlos
Insurance Claims Executive
Trans Eurokars Pte Ltd
5 Ubi Close
Singapore 408605
Tel no.: 81289802

From: motorclaims.sg@fwd.com <motorclaims.sg@fwd.com>
Sent: 20 February 2019 11:15 AM
To: Jess Francis Amurao Carlos <jess.francis@eurokars.com.sg>
Cc: Ronald Yap <ronald.yap@eurokars.com.sg>; motorclaims.sg@fwd.com
Subject: RE: Our ref - SLA3388P / DOA 13 02 2019 / Own damage claim survey

Hi Jess,

Please be advised that we will be appointing LKK.

Thanks.


Regards,
Josey

From: jess.francis@eurokars.com.sg [mailto:jess.francis@eurokars.com.sg]
Sent: Wednesday, 20 February, 2019 9:47 AM
To: Motor Claims SG - SG Common
Cc: ronald.yap@eurokars.com.sg
Subject: Our ref - SLA3388P / DOA 13 02 2019 / Own damage claim survey

Dear FWD Team,

Please arrange the survey to your insured's vehicle on Feb 21, 2019. Let us have the timing for our arrangements.

Regards.

 Jess Francis Carlos
Insurance Claims Executive
Trans Eurokars Pte Ltd
5 Ubi Close
Singapore 408605
Tel no.: 81289802

From: mazdacanon@mazda.com.sg <transeurokars@eurokars.com.sg>
Sent: 20 February 2019 10:00 AM
To: Jess Francis Amurao Carlos <jess.francis@eurokars.com.sg>
Subject: Attached Image

ATTENTION:

The email and any attachments transmitted with it are private and confidential and intended solely for the use of the individual or entity to whom they are addressed. If you have received this email in error, please notify the sender immediately and delete this email and any attachments from your system. You should not use, disclose, copy or store this email and any attachments.

Messages and attachments are scanned for all viruses known. However, you are advised that you open any attachments at your own risk. If this message contains password-protected attachments, the files have NOT been scanned for viruses by our mail domain. Please always scan for viruses before opening any attachments.

Denise Tay (LKKAuto)

From: Denise Tay (LKKAuto)
Sent: Monday, 18 March 2019 9:19 AM
To: catherinechua@eurokars.com.sg
Cc: Guo Qiang (LKKAuto); 'jess.francis@eurokars.com.sg'; CS A Team; Admin A
Subject: RE: SLA3388P - FINALIZATION OF COR

Dear Catherine,

\$5374.45 before excess of \$500.00 and before GST

Please submit all relevant documents to FWD insurance

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: catherinechua@eurokars.com.sg <catherinechua@eurokars.com.sg>
Sent: Friday, 15 March, 2019 3:05 PM
To: Guo Qiang (LKKAuto) <GuoQiang@lkkauto.com>; jess.francis@eurokars.com.sg
Cc: CS A Team <cs-a@lkkauto.com>; Admin A <admin-a@lkkauto.com>
Subject: SLA3388P - FINALIZATION OF COR

Dear Guo Qiang

Our COR computation is attached for your agreement.

COR: \$5374.45 before excess of \$500.00 and before GST

4 repair days (not including preparation of estimate, wait for survey/authorization/spare parts, Sat/Sun/PH)

Kindly confirm the above as soon as possible.

Aside to Jess: Please send before-paint photos to Guo Qiang

Thanks n Regards



Driving luxury experiences since 1985

Catherine Chua

Insurance Claims Executive

23 Leng Kee Road Singapore 159095

T: (65) 6603 6128 D: (65) 6603 6121 F: (65) 6476 7417

E: catherinechua@mazda.com.sg

This email, including any attachment, is intended for the sole use of the recipient(s) named above and may contain information that is confidential and/or proprietary to the Eurokars Group. If you have received it in error, please notify us immediately by reply email and then

View Received Message

This mail is associated with :

***SLA3388P (1201900004836)**

OD

Feb 13 2019 4:00PM

[HO WEI HAR]

Trans Eurokars Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From FWD Singapore Pte. Ltd. (HQ) (FWD_SG), sent on 26/02/2019 09:31 AM.
To LKK_HQ
Subject Alert - Adj Mandate Approved (S\$6341.50) - SLA3388P - Claim Handler: Josey Loh

Approved:6341.50.

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To:	FWD Singapore Pte. Ltd. 6 Temasek Boulevard #18-01 Suntec Tower 4 Singapore 038986	From:	LKK Auto Consultants Pte Ltd 51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park Singapore 408933
Attn:	Josey Loh	Date:	25 Feb 2019
<u>Preliminary Advice</u>			

Vehicle No	: SLA3388P	Accident Date	: 13/02/2019
Make	: MAZDA 3	Policy No.	: PNPV2019-00002002
Assignment Date	: 22/02/2019	Excess	: S\$500.00
Date of Inspection	: 21/2/2019	Est. Duration of Repair	: 4
Inspection At	: TRANS EUROKARS PTE LTD		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front o/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	10,114.19
Revised Amount	:S\$	5,374.45
Check Items (Estimated)	:S\$	967.05
Total	:S\$	6,341.50
Lump Sum Repair	:S\$	
Total Loss Consideration		
New for Old Value	:S\$	
Pre-Accident Value	:S\$	58,000.00
COE / PARF Rebate	:S\$	40,638.00
Salvage Value	:S\$	
Margin for Repair	:S\$	17,362.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To:	FWD Singapore Pte. Ltd. 6 Temasek Boulevard #18-01 Suntec Tower 4 Singapore 038986	From:	LKK Auto Consultants Pte Ltd 51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park Singapore 408933
Attn:		Date:	22 Feb 2019
<u>Preliminary Advice</u>			

Vehicle No	: SLA3388P	Accident Date	: 13/02/2019
Make	: MAZDA 3	Policy No.	: PNPV2019-00002002
Assignment Date	: 22/02/2019	Excess	: S\$0.00
Date of Inspection	: 21/2/2019	Est. Duration of Repair	: 4
Inspection At	: TRANS EUROKARS PTE LTD		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front o/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	10,114.19
Revised Amount	:S\$	5,374.45
Check Items (Estimated)	:S\$	967.05
Total	:S\$	6,341.50

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	
COE / PARF Rebate	:S\$	
Salvage Value	:S\$	
Margin for Repair	:S\$	

Remarks

- () The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : Pending log card from repairer.

Veron Chen (LKKAUTO)

From: motorclaims.sg@fwd.com
Sent: Wednesday, 20 February 2019 11:18 AM
To: assignments; SUR; Admin A; Admin-D (LKKAUTO)
Cc: motorclaims.sg@fwd.com
Subject: RE: Our ref - SLA3388P / DOA 13 02 2019 / Own damage claim survey (Our Ref: 1201900004836)

Hi LKK team,

Please take note that policy excess is \$500.00.

Thank you.

Regards,
Josey

From: Motor Claims SG - SG Common
Sent: Wednesday, 20 February, 2019 11:14 AM
To: assignments@lkkauto.com; sur@lkkauto.com; admin-a@lkkauto.com; admin-d@lkkauto.com
Cc: Motor Claims SG - SG Common
Subject: FW: Our ref - SLA3388P / DOA 13 02 2019 / Own damage claim survey (Our Ref: 1201900004836)

Hi LKK team,

Please refer to the email below and liaise with the repairer for OD survey arrangement. Policy excess \$600.00.

Attached is the repair estimate & OI GIA report. The password to open the attachment is "FWDENCRYPT".

Please create the case in Merimen and revert to us with your preliminary report.

Thank you.

Regards,
Josey

From: jess.francis@eurokars.com.sg [<mailto:jess.francis@eurokars.com.sg>]
Sent: Wednesday, 20 February, 2019 9:47 AM
To: Motor Claims SG - SG Common
Cc: ronald.yap@eurokars.com.sg
Subject: Our ref - SLA3388P / DOA 13 02 2019 / Own damage claim survey

Dear FWD Team,

Please arrange the survey to your insured's vehicle on Feb 21, 2019. Let us have the timing for our arrangements.

Regards,

Jess Francis Carlos
Insurance Claims Executive
Trans Eurokars Pte Ltd
5 Ubi Close
Singapore 408605
Tel no.: 81289802

From: mazdacanon@mazda.com.sg <transeurokars@eurokars.com.sg>

Sent: 20 February 2019 10:00 AM

To: Jess Francis Amurao Carlos <jess.francis@eurokars.com.sg>

Subject: Attached Image

ATTENTION:

The email and any attachments transmitted with it are private and confidential and intended solely for the use of the individual or entity to whom they are addressed. If you have received this email in error, please notify the sender immediately and delete this email and any attachments from your system. You should not use, disclose, copy or store this email and any attachments.

Messages and attachments are scanned for all viruses known. However, you are advised that you open any attachments at your own risk. If this message contains password-protected attachments, the files have NOT been scanned for viruses by our mail domain. Please always scan for viruses before opening any attachments.

Nivitha (LKK Auto)

From: motorclaims.sg@fwd.com
Sent: Wednesday, 20 February 2019 11:14 AM
To: assignments@lkkauto.com; sur@lkkauto.com; admin-a@lkkauto.com; admin-d@lkkauto.com
Cc: motorclaims.sg@fwd.com
Subject: FW: Our ref - SLA3388P / DOA 13 02 2019 / Own damage claim survey (Our Ref: 1201900004836)
Attachments: 1639_190220095947_001.pdf

Hi LKK team,

Please refer to the email below and liaise with the repairer for OD survey arrangement. Policy excess \$600.00.

Attached is the repair estimate & OI GIA report. The password to open the attachment is "FWDENCRYPT".

Please create the case in Merimen and revert to us with your preliminary report.

Thank you.

Regards,
Josey

From: jess.francis@eurokars.com.sg [mailto:jess.francis@eurokars.com.sg]
Sent: Wednesday, 20 February, 2019 9:47 AM
To: Motor Claims SG - SG Common
Cc: ronald.yap@eurokars.com.sg
Subject: Our ref - SLA3388P / DOA 13 02 2019 / Own damage claim survey

Dear FWD Team,

Please arrange the survey to your insured's vehicle on Feb 21, 2019. Let us have the timing for our arrangements.

Regards,

Jess Francis Carlos
Insurance Claims Executive
Trans Eurokars Pte Ltd
5 Ubi Close
Singapore 408605
Tel no.: 81289802

From: mazdacanon@mazda.com.sg <transeurokars@eurokars.com.sg>
Sent: 20 February 2019 10:00 AM
To: Jess Francis Amurao Carlos <jess.francis@eurokars.com.sg>
Subject: Attached Image

ATTENTION:

The email and any attachments transmitted with it are private and confidential and intended solely for the

use of the individual or entity to whom they are addressed. If you have received this email in error, please notify the sender immediately and delete this email and any attachments from your system. You should not use, disclose, copy or store this email and any attachments.

Messages and attachments are scanned for all viruses known. However, you are advised that you open any attachments at your own risk. If this message contains password-protected attachments, the files have NOT been scanned for viruses by our mail domain. Please always scan for viruses before opening any attachments.

> Back to OneMotoring

D.O.A. 13/2/2019
Bal : 6 yrs 11 mths.

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	6597A
Vehicle Details	
Vehicle No.:	SLA3388P
Vehicle to be Exported:	No
Intended Deregistration Date:	25 Feb 2019
Vehicle Make:	MAZDA
Vehicle Model:	MAZDA3 4-DOOR SEDAN 1.5L SP.6EAT
Primary Colour:	Grey
Manufacturing Year:	2015
Engine No.:	P520337003
Chassis No.:	JM6BM42A8G0328325
Maximum Power Output:	88.0 kW (118 bhp)
Open Market Value:	\$17,812.00
Original Registration Date:	18 Jan 2016
First Registration Date:	18 Jan 2016
Transfer Count:	0
Actual ARF Paid:	\$12,812.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	17 Jan 2026
PARF Rebate Amount:	\$9,609.00
Intended COE Rebate Details	
COE Expiry Date:	17 Jan 2026
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$45,002.00
COE Rebate Amount:	\$31,029.00
Total Rebate Amount:	\$40,638.00

M.V. \$58,000

6,406

The information contained herein is correct as at 25 Feb 2019

OK

Owner Particulars

NRIC/Passport/Company Cert No.: SB366597A
Owner ID Type: Singapore NRIC
Owner Name: HO WEI HAR
Registered Address: 103 CARDIFF GROVE #04-37 SINGAPORE 558962
Mailing Address: -
Birth Date: 14 Sep 1983

Vehicle Particulars

Vehicle No.: SLA3388P
Previous Vehicle No.: -
Effective Date of Ownership: 18 Jan 2016
Original Regn Date: 18 Jan 2016
Registration Date: 18 Jan 2016
Year of Manufacture: 2015
Vehicle Type: Passenger Motor Car
Vehicle Scheme: -
Vehicle Attachment 1: With Sun Roof
Vehicle Attachment 2: -
Vehicle Attachment 3: -
Vehicle Make: MAZDA
Vehicle Model: MAZDA3 4-DOOR SEDAN 1.5L SP 6EAT
Primary Colour: Grey
Secondary Colour: -
Passenger Capacity: 4
Chassis No.: JM6BM42ABG0328325
Engine No.: P520337003
Engine Capacity / Power Rating: 1496 cc / -
Maximum Power Output: 88.0 kW (118 bhp)
Propellant: Petrol
Max Unladen Weight: 1321 kg
Maximum Laden Weight: 1835 kg
Open Market Value: \$17,812.00
PARF Eligibility: Yes
PARF Eligibility Expiry Date: 17 Jan 2026
Minimum PARF Benefit: \$6,406.00
No. of Transfers: 0
IU Label No.: 1126193943
COE No.: 2016020101001035M
COE Expiry Date: 17 Jan 2026
COE Category: A - Car up to 1600cc & 97kW (130bhp)
COE Registration Category: A - Car up to 1600cc & 97kW (130bhp)
Quota Premium (QP) / Prevailing Quota Premium: \$45,002.00 / -
Actual QP Paid: \$45,002.00
QP (Regn Cat): \$45,002.00
OPC Cash Rebate Eligibility: No
QP during COE Bidding Exercise: \$45,002.00
Additional Registration Fee Rate: First \$17,812.00 (100%)
Actual ARF Paid: \$12,812.00
Vehicle Lifespan Expiry Date: No Lifespan
CO2 Emission: 135.00 (g/km)
CEV/VES Rebate Utilised Amount: \$5,000.00
CO Emission: -
HC Emission: -
NOx Emission: -
PM Emission: -
Message: -

To renew the COE, the Prevailing Quota Premium payable is that of Category A.

Print

OK

Save as PDF

ID=F1801091ET

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT	
Date Of Report	14/02/2019 14:56
Date Of Accident	13/02/2019 16:30
Exact Location Of Accident	ALONG CTE TOWARDS TOA PAYOH
Country/State of Loss	SINGAPORE
DETAILS OF OWN VEHICLE	
Vehicle Registration Number	SLA3388P
Insured/Policyholder	
Name Of Registered Owner	HO WEI HAR
NRIC No	S8366597A
Email Address	HO_EUNICE2001@HOTMAIL.COM
Mobile Phone No	(LOCAL) +65-93226008
Alternative Phone No	OFFICE-93226008
Vehicle Particulars	
Manufacturer	MAZDA
Model	MAZDA3 4-DOOR SEDAN 1.5L SP.6EAT
Exact Purpose for which vehicle was being used at time of accident	PRIVATE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR
Insurance Company	
Name of Insurance Company	FWD SINGAPORE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	PNPV2019-00002002
Cover Note Number	
Driver	
Name of Driver	HO WEI HAR
NRIC No	S8366597A
Date Of Birth	14/09/1983
Occupation	OUTDOOR
Date Of Driving Pass	05/04/2016
Driving Experience	2 YEARS AND 10 MONTHS
Gender	FEMALE
Mobile Number	(LOCAL) +65-93226008
Fax Number	
Contact Number	OFFICE-93226008
Email Address	HO_EUNICE2001@HOTMAIL.COM

Address	NIL
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (Including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

I (SLA3388P) was driving along CTE towards Toa Payoh on the most right lane when suddenly a car (SMA4120B) in front jam brake. I tried to avoid the car, swerving to my left but as a result the front right side of my car make contact with the rear left side of the car. No injuries involved.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SMA4120B
Vehicle Make/Model/Colour	MAZDA/MAZDA3 HATCHBACK 1.5 AT DELUXE EU6/WHITE
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	DAVEN
NRIC/Passport Number	
Contact Number	97332360
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	1

Sketch Plan

IMPORTANT NOTICE

1. Please report accurately the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or omission of material facts may allow insurance companies to repudiate policy validity.
4. The issue and acceptance of this form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by insured persons.
7. By the submission of this report to the insurers, you hereby consent to the archiving of this report at the centre and the report being made available to insured persons.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

 - (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may be permitted to collect, use, process my personal data/personal information set out in this form and any other personal information provided by me or by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) and vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as "Insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the making of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/postal packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
 - (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may be permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
 - (c) my Personal Information may be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be based outside of Singapore, for one or more of the above Purposes.


VERIFIED BY AJAX MARS
REPORTING OFFICER
MOHAMMAD SULHANI BIN
MOHD AFFANDI

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre
Personnel

Sketch Plan

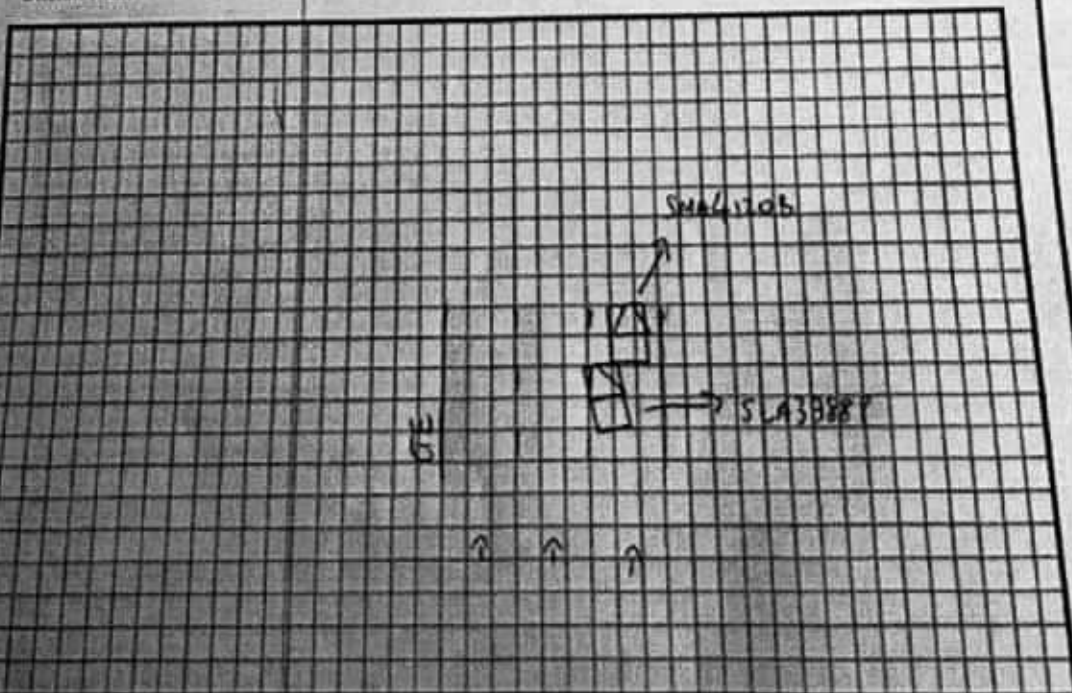

ACCIDENT STATEMENT (2000 characters)

I (SLA3388P) was driving along CTE towards Toa Payoh on the most right lane when suddenly a car (SMA4120B) in front jam brake. I tried to avoid the car, swerving to my left but as a result the front right side of my car make contact with the rear left side of the car. No injuries involved.

Taxi Voucher No.:

DECLARATION

I/We declare that the above particulars & information provided above are true in every aspect

VERIFIED BY AJAX MARS REPORTING OFFICER -
MOHAMMAD SULHANDI BIN MOH AFFANDI

MARS Officer



Registered Owner or Driver's Signature

Job Complete Date/Time

14 February 2019 at 10:28 AM

Date/Time:

14 February 2019 at 10:28 AM

Identification Card

REPUBLIC OF SINGAPORE
IDENTITY CARD NO. S8366597A



Name
HO WEI HAR
何慧霞

Race
CHINESE

Date of birth
14-09-1983

Sex
F

Country/Place of birth
MALAYSIA

S8366597A

REPUBLIC OF SINGAPORE DRIVING LICENCE



License Number
S8366597A

Name
HO WEI HAR

Birth Date
14 Sep 1983

Issue Date
05 Apr 2016

0025546448

Identification Card

9395764



NRIC No: S8366597A



Nationality
MALAYSIAN
Date of birth
10-03-2016


103 CARDIFF GROVE #04-37
SINGAPORE 558062
NRIC No: S8366597A Date: 20/05/2018

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(ES)

	EFFECTIVE DATE
Class 3 Motor cars with unladen weight \leq 3000kg with \leq 7 passengers, exclusive of driver; and other motor vehicles with unladen weight \leq 2500kg	05 Apr 2016

NP 428A

Licence No: S8366597A





TRANS EUROKARS PTE LTD



ESTIMATE COST OF REPAIRS

FWD SINGAPORE PTE LTD		NAME : Ms Ho Wei Har		WIP : 43510	
6 TEMASEK BOULEVARD		ADDRESS : Blk 564 Ang Mo Kio Ave 3		EXCESS :	
#18-01 SUNTEC TOWER 4		#06-3469		DATE: 19-Feb-19	
SINGAPORE 038986		Singapore 560564			
ATTN. : MOTOR CLAIMS		TEL : 93226008			
FAX :					
VEH NO :	SLA3388P	DATE IN :		CONTACT PERSON :	Jess 63957874
CHASSIS NO :	JM6BM42A8G0328325	MILEAGE :	4176	TYPE OF CLAIM :	OWN DAMAGED CLAIM
MODEL :	MAZDA3	DATE REG.:	18-Jan-16	POLICY NO. :	

NATURE OF WORKS

Parts Description

NO	QTY	REVISED	PRICES
1	FRONT BUMPER / BL 1 MBHR3-50-03188B		\$ 1,031.70 ✓
2	RETAINER RHS / MC 1 MBHN1-50-0T1F		\$ 18.70 ✓
3	BRACKET RHS X NN 1 MBHN1-50-152		\$ 15.10
4	FRONT REINFORCEMENT ? X NN 1 MB45A-50-070A		\$ 444.50
5	CHROME RHS, FOGLAMP X NN 1 MBJE1-50-C12		\$ 106.70
6	COVER RHS, FOGLAMP / SR 1 MBJE1-50-C11A		\$ 46.40 ✓
7	STIFF'A', FRONT BUMPER X NN 1 MBHN1-50-0S0B		\$ 83.70
8	CLIP, FRONT BUMPER / 12 MC274-50-133		\$ 42.00 ✓
9	FASTENER, FRONT BUMPER / 2 MB45A-56-146A		\$ 5.60 ✓
10	GROMMET, FRONT BUMPER / MC 2 MGHP9-50-025		\$ 5.40 ✓
11	RIVET, FRONT BUMPER / 4 MTK21-50-355		\$ 34.80 ✓
12	RIVET, FRONT BUMPER / 6 MS515-51-833		\$ 22.80 ✓
13	CHROME RHS X 1 MBHN1-50-7J1A		\$ 176.70
14	FRONT GRILLE X 1 MBJE1-50-712B		\$ 581.60
15	BRACKET RHS, FRONT GRILLE X NN 1 MBHN1-50-153		\$ 15.10
16	PIN LOCATOR, FRONT GRILLE X 2 MKD45-50-1K5A		\$ 5.40
17	GROMMET, FRONT GRILLE / MC 2 MKD45-50-ES1		\$ 5.40 ✓
18	RIVET, FRONT GRILLE / MC 2 MEA01-50-037		\$ 15.20 ✓
19	PLATE SET, FRONT REINFORCEMENT X 1 MBHN3-50-1C0		\$ 92.70
20	FASTENER, PLATE SET X 4 MGD7A-50-EA1		\$ 12.00
21	PLATE SEAL RHS X NN 1 MBHN1-50-1U1A		\$ 35.60
22	FASTENER, PLATE SEAL X 4 MKD45-50-EA1		\$ 10.00
23	HEADLAMP RHS / SR 1 MBHT6-51-031A		\$ 2,245.00 ✓
24	HID CONTROL UNIT X 1 MBHN3-51-0H3		\$ 895.50
25	GASKET, CONTROL UNIT X NN 1 MC236-51-0B2		\$ 13.60
26	CLIP, HEADLAMP X 2 MFB01-50-133C		\$ 7.60
27	RIVET, HEADLAMP / MC 1 MB092-51-833		\$ 3.30 ✓
28	LAMP RHS, SIDE TURN ? X 1 MB45A-51-350A		\$ 157.30
29	FOGLAMP RHS ? X 1 MTK21-51-680A		\$ 351.40
30	BRACKET RGS, FOGLAMP ? X NN 1 MBHR1-51-684A		\$ 17.30
31	WASHER TANK ? X 1 MGHP9-67-481		\$ 104.00

32	COVER RHS, HEADLAMP WASHER	1	MBHT4-51-8G1 27	\$ 75.40
33	CLAMP, ACUTATOR	1	MTK33-51-829	\$ 16.40
34	ACTUATOR RHS, HEADLAMP WASHER	1	MBHT4-51-82X	\$ 242.40
35	FRONT FENDER RHS	1	MB45A-52-111B	\$ 333.90
36	STAY RHS, FENDER	1	MB4YA-52-10Y	\$ 39.90
37	MUDGUARD RHS	1	MB45A-56-130H	\$ 97.00
38	FASTENER, MUDGUARD	15	MB45A-56-146A	\$ 42.00
TOTAL PARTS				\$ 7,449.10
LESS 10%				\$ 744.91
TOTAL PARTS COST				\$ 6,704.19

Labour Description				
1		TO REPLACE FRONT BUMPER, FRONT REINFORCEMENT, FRONT FENDER RH. REPAIR ALL AREAS AFFECTED BY THE ACCIDENT.	✓ 660	\$ 1,260.00
2		TO RESPRAY FRONT BUMPER, FRONT REINFORCEMENT, FRONT FENDER RH.	✓ 945	\$ 1,200.00
3	MZ-BR-CAVITY	TO CARRY-OUT BODY CAVITY PRESERVATION.	NN X	\$ 250.00
4	MZ-BR-ELECTR	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.	✓ 150	\$ 250.00
5	MZ-BR-REPROG	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.	✓ 180	\$ 350.00
6	MZ-BR-SUNDRI	SUNDRIES.	✓ NETT 10	\$ 100.00

TOTAL LABOUR	\$ -	\$ 3,410.00
TOTAL PARTS	\$ -	\$ 6,704.19
TOTAL	\$ -	\$ 10,114.19
LESS EXCESS	\$ -	\$ -
TOTAL AFTER EXCESS	\$ -	\$ -
GST 7%	\$ -	\$ -
GRAND TOTAL	\$ -	\$ -

4 Days.
before paint photos.
N.t Authorised.
excess \$500
21/2/18.

REMARKS:
THIS IS ONLY AN ESTIMATE FROM VISUAL INSPECTION AND SHOULD THERE BE MORE DAMAGES FOUND DURING THE PROCESS OF REPAIRING, YOU WILL BE INFORMED BEFORE THE REPAIRS ARE BEING CARRIED OUT. TAKE NOTE THAT SHOULD YOU DECIDE NOT TO PROCEED WITH THE REPAIRS, A **QUOTATION FEE OF \$400** WILL BE APPLIED ACCORDINGLY FOR MAN-HOURS INVOLVED IN SOURCING FOR PARTS PRICE AS WELL AS LABOUR CHARGES.

TRANS EUROKARS PTE LTD

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Authorised Signature

Acknowledged by Repairer

Signature:

Date:



TRANS EUROKARS PTE LTD



FINALISED COST OF REPAIRS

FWD SINGAPORE PTE LTD 6 TEMASEK BOULEVAED #18-01 SUNTEC TOWER 4 SINGAPORE 038986 ATTN : MOTOR CLAIMS FAX :		NAME : Ms Ho Wei Har ADDRESS : Blk 564 Ang Mo Kio Ave 3 #06-3469 Singapore 560564 TEL : 93226008		WIP : 43510 EXCESS : \$ 500.00 DATE: 19-Feb-19	
VEH NO :	SLA3388P	DATE IN :		CONTACT PERSON :	Jess 63957874
CHASSIS NO :	JM6BM42A8G0328325	MILEAGE :		TYPE OF CLAIM :	OWN DAMAGED CLAIM
MODEL :	MAZDA3	DATE REG.:	18-Jan-16	POLICY NO. :	
NATURE OF WORKS					
Parts Description					
NO	QTY		REVISED	PRICES	
1	1	MBHR3-50-031888	\$ 1,031.70	\$ 1,031.70	
2	1	MBHN1-50-0T1F	\$ 18.70	\$ 18.70	
3	1	MBHN1-50-152		\$ 15.10	
4	1	MB45A-50-070A		\$ 444.50	
5	1	MBJE1-50-C12		\$ 106.70	
6	1	MBJE1-50-C11A	\$ 46.40	\$ 46.40	
7	1	MBHN1-50-050B		\$ 83.70	
8	12	MC274-50-133	\$ 42.00	\$ 42.00	
9	2	MB45A-56-146A	\$ 5.60	\$ 5.60	
10	2	MGHP9-50-025	\$ 5.40	\$ 5.40	
11	4	MTK21-50-355	\$ 34.80	\$ 34.80	
12	6	MS515-51-833	\$ 22.80	\$ 22.80	
13	1	MBHN1-50-7J1A		\$ 176.70	
14	1	MBJE1-50-712B		\$ 581.60	
15	1	MBHN1-50-153		\$ 15.10	
16	2	MKD45-50-1K5A		\$ 5.40	
17	2	MKD45-50-E51	\$ 5.40	\$ 5.40	
18	2	MEA01-50-037	\$ 15.20	\$ 15.20	
19	1	MBHN3-50-1C0		\$ 92.70	
20	4	MGD7A-50-EA1		\$ 12.00	
21	1	MBHN1-50-1U1A		\$ 35.60	
22	4	MKD45-50-EA1		\$ 10.00	
23	1	MBHT6-51-031A	\$ 2,245.00	\$ 2,245.00	
24	1	MBHN3-51-0H3		\$ 895.50	
25	1	MC236-51-0B2		\$ 13.60	
26	2	MFB01-50-133C		\$ 7.60	
27	1	MB092-51-833	\$ 3.30	\$ 3.30	
28	1	MB45A-51-350A		\$ 157.30	
29	1	MTK21-51-680A		\$ 351.40	
30	1	MBHR1-51-684A		\$ 17.30	
31	1	MGHP9-67-481		\$ 104.00	

32	COVER RHS, HEADLAMP WASHER	1	MBHT4-51-8G1 27	\$ 75.40	\$ 75.40
33	CLAMP, ACUTATOR	1	MTK33-51-829	\$ 16.40	\$ 16.40
34	ACTUATOR RHS, HEADLAMP WASHER	1	MBHT4-51-82X	\$ 242.40	\$ 242.40
35	FRONT FENDER RHS	1	MB45A-52-111B		\$ 333.90
36	STAY RHS, FENDER	1	MB4YA-52-10Y		\$ 39.90
37	MUDGUARD RHS	1	MB45A-56-130H		\$ 97.00
38	FASTENER, MUDGUARD	15	MB45A-56-146A		\$ 42.00
			TOTAL PARTS	\$ 3,810.50	\$ 7,449.10
			LESS 10%	\$ 381.05	\$ 744.91
			TOTAL PARTS COST	\$ 3,429.45	\$ 6,704.19

<u>Labour Description</u>					
1		TO REPLACE FRONT BUMPER. REPAIR ALL AREAS AFFECTED BY THE ACCIDENT.		\$ 660.00	\$ 1,260.00
2		TO RESPRAY FRONT BUMPER AND FRONT FENDER RH.		\$ 945.00	\$ 1,200.00
3	MZ-BR-CAVITY	TO CARRY-OUT BODY CAVITY PRESERVATION.			\$ 250.00
4	MZ-BR-ELECTR	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.		\$ 150.00	\$ 250.00
5	MZ-BR-REPROG	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.		\$ 180.00	\$ 350.00
6	MZ-BR-SUNDRI	SUNDRIES.		\$ 10.00	\$ 100.00
			TOTAL LABOUR	\$ 1,945.00	\$ 3,410.00
			TOTAL PARTS	\$ 3,429.45	\$ 6,704.19
			TOTAL	\$ 5,374.45	\$ 10,114.19
			LESS EXCESS	\$ 500.00	\$ -
			TOTAL AFTER EXCESS	\$ 4,874.45	
			GST 7%	\$ 341.21	\$ -
			GRAND TOTAL	\$ 5,215.66	\$ -

REMARKS:

4 REPAIR DAYS (exclude preparation of estimate, wait for survey/authorization/spare parts, Sat/Sun/PH)

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	22 Feb 2019 Edit Reg		20 Feb 2019 00:00 Edit Adj Rpt	\$45,374.45 Edit Estimates	\$45,374.45 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS		[Created by adjuster]							
Insured:	HO WEI HAR , ID: S8366597A								
Vehicle Reg. No.:	SLA3388P	Date of Loss:	13/02/2019 16:00 - :59 [36 Months and 26 Days From LTA Reg Date (Man Yr)]						
Claim Type:	OD / 1201900004836	Policy/Cover Note No.:	PNPV2019-00002002 (Comprehensive)						
		Excess:	S\$500.00						
Repairer:	Trans Eurokars Pte Ltd (HQ) 5 Ubi Close, 408605 Ubi - Tel:								
Handling Insurer:	FWD Singapore Pte. Ltd. (HQ) - Tel: 6727 5700 ... [Handled by Josey Loh]								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by XING GUO QIANG] ... [Final Rpt due 05/03/2019]								
ASSOCIATED MAIL RECEIVED		View All Compose Case Mail							
<ul style="list-style-type: none"> FWD_SG (26/02/2019): Alert - Adj Mandate Approved (\$6341.50) - SLA3388P - Claim Handler: Josey Loh FWD_SG (22/02/2019): Alert - Adj Mandate Maintained - SLA3388P - Claim Handler: Josey Loh 									
ALL ASSOCIATED TASKS		View All Search Tasks Create New Task Complete							
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SLA3388P (1201900004836)

OD

Feb 13 2019 4:00PM

[HO WEI HAR]

Trans Eurokars Pte Ltd

[Upload Documents](#)
[Upload Photos](#)
[Compose New Letter](#)

View View in Browser

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	22/02/19 16:21	Adjuster Immediate Advice	Load HTM	
2	25/02/19 16:15	Adjuster Immediate Advice	Load HTM	

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
2	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
3	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
4	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
5	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
6	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
7	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
8	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
9	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
10	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
11	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
12	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
13	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
14	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
15	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
16	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
17	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
18	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
19	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
20	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
21	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
22	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
23	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
24	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
25	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
26	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
27	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
28	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
29	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>
30	22/02/19 14:54	General View	Load JPG	<input checked="" type="checkbox"/>

Documentation			1 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	22/02/19 14:58	MARK ESTIMATE	Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)
<div></div>
Show Remarks To: <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small>

LKK Auto Consultants Pte Ltd (Co.Reg No:199807198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

FWD Singapore Pte. Ltd.
6 Temasek Boulevard, #18-01 Suntec Tower 4
Singapore 038986

Our File No: CS/FWD19003223/GVD3E2

Date: 19/03/2019

REFERENCE

Insured/Claimant: HO WEI HAR Policy No: PNPV2019-00002002
Date of Loss: 13/02/2019 Nature of Claim: OD Claim No: 1201900004836

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SLA3388P
Make & Model: MAZDA 3, 1.5 (A) Engine No: P520337003
Reg. Date: 18/01/2016 (Man. Year: 2015) Chassis No: JM6BM42A8G0328325
Colour: Grey Odometer: 46176 km
Engine Capacity: 1496 cc
Market Value/New Car Price: S\$58,000.00
Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/60 R16 Rear Tyre Size: 205/60 R16
Front Left Side: Michelin 6 mm Rear Left Side: Michelin 6 mm
Front Right Side: Michelin 6 mm Rear Right Side: Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	6,804.19	3,439.45	3,364.74	49.45
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,310.00	1,935.00	1,375.00	41.54
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	10,114.19	5,374.45	4,739.74	46.86
- Excess (S\$)	500.00	500.00	0.00	0.00
(S\$)	9,614.19	4,874.45	4,739.74	49.30
+ GST 7.00/7.00% (S\$)	672.99	341.21	331.78	49.30
Nett Amount (S\$)	10,287.18	5,215.66	5,071.52	49.30

INSPECTION

Date of Assignment: 20/02/2019
Date Inspected: 21/02/2019 Inspected At: Trans Eurokars Pte Ltd (HQ)
5 Ubi Close
Singapore 408605
Estimated Period of Repair: 4.0 days

Adjuster: XING GUO QIANG

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 19 Mar 2019)
Parts: 144	MAZDA 3 1.5 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SLA3388P)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed	1,031.70 FL	*1,031.70 FL
2	1		*RETAINER RHS	Necessary	18.70 FL	*18.70 FL
3	1		*BRACKET RHS	Not Necessary	15.10 FL	*- FL
4	1		*FRONT REINFORCEMENT	Not Necessary	444.50 FL	*- FL
5	1		*CHROME RHS, FOG LAMP	Not Necessary	106.70 FL	*- FL
6	1		*COVER RHS, FOG LAMP	Scratched	46.40 FL	*46.40 FL
7	1		*STIFFA, FRONT BUMPER	Not Necessary	83.70 FL	*- FL
8	12		*CLIP, FRONT BUMPER	Necessary	42.00 FL	*42.00 FL
9	2		*FASTENER, FRONT BUMPER	Necessary	5.60 FL	*5.60 FL
10	2		*GROMMET, FRONT BUMPER	Necessary	5.40 FL	*5.40 FL
11	4		*RIVET, FRONT BUMPER	Necessary	34.80 FL	*34.80 FL
12	6		*RIVET, FRONT BUMPER	Necessary	22.80 FL	*22.80 FL
13	1		*CHROME RHS	Not Necessary	176.70 FL	*- FL
14	1		*FRONT GRILLE	Not Necessary	581.60 FL	*- FL
15	1		*BRACKET RHS, FRONT GRILLE	Not Necessary	15.10 FL	*- FL
16	2		*PIN LOCATOR, FRONT GRILLE	Not Necessary	5.40 FL	*- FL
17	2		*GROMMET, FRONT GRILLE	Necessary	5.40 FL	*5.40 FL
18	2		*RIVET, FRONT GRILLE	Necessary	15.20 FL	*15.20 FL
19	1		*PLATE SET, FRONT REINFORCEMENT	Not Necessary	92.70 FL	*- FL
20	4		*SET FASTENER, PLATE	Not Necessary	12.00 FL	*- FL
21	1		*PLATE SEAL RHS	Not Necessary	35.60 FL	*- FL
22	4		*FASTENER, PLATE SEAL	Not Necessary	10.00 FL	*- FL
23	1		*HEADLAMP RHS	Scratched	2,245.00 FL	*2,245.00 FL
24	1		*HID CONTROL UNIT	Not Necessary	895.50 FL	*- FL
25	1		*GASKET, CONTROL UNIT	Not Necessary	13.60 FL	*- FL
26	2		*CLIP, HEADLAMP	Not Necessary	7.60 FL	*- FL
27	1		*RIVET, HEADLAMP	Necessary	3.30 FL	*3.30 FL
28	1		*LAMP RHS, SIDE TURN	Not Necessary	157.30 FL	*- FL
29	1		*FOGLAMP RHS	Not Necessary	351.40 FL	*- FL
30	1		*BRACKET RHS, FOG LAMP	Not Necessary	17.30 FL	*- FL
31	1		*WASHER TANK	Not Necessary	104.00 FL	*- FL
32	1		*COVER RHS, HEADLAMP WASHER	Missing	75.40 FL	*75.40 FL
33	1		*CLAMP, ACTUATOR	Missing	16.40 FL	*16.40 FL
34	1		*ACTUATOR RHS, HEADLAMP WASHER	Missing	242.40 FL	*242.40 FL
35	1		*FRONT FENDER RHS	Not Necessary	333.90 FL	*- FL
36	1		*STAY RHS, FENDER	Not Necessary	39.90 FL	*- FL
37	1		*MUDGUARD RHS	Not Necessary	97.00 FL	*- FL
38	15		*FASTENER, MUDGUARD	Not Necessary	42.00 FL	*- FL
39	1		*SUNDRIES	Necessary	100.00 FS	*10.00 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
F=Franchise part. S=SpcNett. L=ListItemDisc.						
Sub Total (\$\$)					7,549.10	3,820.50
- List Item Discount on L Items 10.00/10.00% (\$\$)					744.91	381.05
Total Parts (\$\$)					6,804.19	3,439.45

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REPLACE FRONT BUMPER, FRONT REINFORCEMENT, FRONT FENDER RH, REPAIR ALL AREAS AFFECTED BY THE ACCIDENT	New	1,260.00	660.00
2	TO RESPRAY FRONT BUMPER, FRONT REINFORCEMENT, FRONT FENDER RH	New	1,200.00	945.00
3	TO CARRY-OUT BODY CAVITY PRESERVATION	New	250.00	0.00
4	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING	New	250.00	150.00
5	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS	New	350.00	180.00
Gross Labour Cost (S\$)			3,310.00	1,935.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >