

ASS. REC. BY

REF: CS/FCI19003634/Ktd3n2

Special Instruction

Surveyor

CWS

ASSIGNMENT (Office)

From (Person)

Eileen Lee

of

FCS

Date/Time

2:59pm @ 26/2/19

Estimated Cost

Bill to:

OD / ☒ WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No.

8HC5407S

Insured:

8HC8048A

at Workshop info

Trans-cab

Tel

62876666

of

No. 2 Armic 84-63

Policy No.

Claim No.

D19001403MF5H

Sum Insured:

Excess:

Make of Veh:

D.O.A.

24/2/19

(Client's Record)

CA / REV / REP. / REV 24 HRS

'DS'

27/2/19

H.O.D. Endorsement:

Date/Time:

5:10pm @ 26/2/19

Person Contacted:

Candy

Vehicle

☒ IN ☐ OUT

Date/Time

Action/Instruction

( ) Estimate

8HC5407S - CS/TP15013190/Krbcl

DOA: 29/7/15

8HC8048A - CS/FCI12003011/Ryl

DOA: 4/2/12

REF: FCI

ASSIGNMENT

SITE 5407S

11. 14

Form

Date: 27/12/19

Estimated Cost:

OD ☒ WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

8HC 5407S

at Workshop No:

Trans-Cab

or

No. 2 AMK St-63

Insured

Policy No:

Claim No:

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

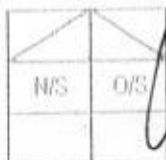

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GLA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

04

days

Res.: Yes or No

Lum Sum:

20

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS 'DS'

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No:

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Renault Latitude

C.C.

1995

Colour:

White / Red

A/C

Insured / Std / NI / NA

Sp. Reading:

610146

TRadio: Insured / Std / NI / NA

Eng No:

Chassis:

VF-ABCL15AUC 279608

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / SRim / STD A/Rim or

Tyre Size:

F:

R:

215/60R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Giti

Front

R/Bal:

8

mm

Rear

R/Bal:

8

mm

L/Bal:

8

mm

L/Bal:

8

mm

D.O.A.

24/12/19

D.O.I.

27/12/19

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

o/s body

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

11 Sep 87200L CRed: 37374.11; 83%

RECEIVED 06 MAR 2019.

Date/Time, File Pass to:

53 Typist.

Date/Time, File Return to:



Prel. Report



Final Report

Days Of Repair: 4

Resurvey No. of Trip: -

Survey Fee:

Transportation:

Add Fee:



Site Insp. (\$



Interview (\$



Tech. Insp. (\$



Week-end (\$

1. S. P. 24

1. Photo

1. Collar

1. ...

TOTAL

Report Format:

Lump Sum / L.B.L. (\$

TP

7200x

350

**MOTOR SURVEY ASSIGNMENT**

|                    |                                                             |                               |
|--------------------|-------------------------------------------------------------|-------------------------------|
| Date               | 26-02-2019                                                  | Our Ref No. D19001403MFSH     |
| Accident Date      | 24-02-2019                                                  | Claim Type. Third Party       |
| Insured Vehicle    | SHC8048A                                                    | Third Party Vehicle. SHC5407S |
| Survey Location    | NO. 2 ANG MO KIO STREET 63                                  |                               |
| Contact Person.    | CANDY KONG                                                  |                               |
| Contact No.        | 62876666/ 0                                                 | Fax No. 62571330              |
| Survey Type        | WITHOUT PREJUDICE: WE ADMIT LIABILITY QUANTUM TO BE AGREED: |                               |
| Appointed Surveyor | LKK AUTO CONSULTANTS PTE LTD                                |                               |
| Contact Person     | NA                                                          | Fax No. 68416315              |
| Contact Number.    | NA                                                          |                               |

**FOR DIRECT SETTLEMENT**

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

**THIRD PARTY SURVEY REQUEST**

|                   |                                 |                         |
|-------------------|---------------------------------|-------------------------|
| Cc : Workshop     | TRANS-CAB AUTO SERVICES PTE LTD | Attention. NIL          |
| Cc : TP Solicitor | NA                              | TP Solicitor Fax No. NA |
| Officer Incharge  | EILEEN LEE                      |                         |

**IMPORTANT NOTE**

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.  
This is a computer generated letter, no signature required.

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle****Vehicle Owner Particulars**

Owner ID Type: Company

Owner ID: 3878K

**Vehicle Details**

Vehicle No.: SHC5407S

Vehicle to be Exported: Yes

Intended Deregistration Date: 25 Feb 2019

Vehicle Make: RENAULT

Vehicle Model: LATITUDE 2.0L DCI AUTO D/AB 4DR

Primary Colour: Red

Manufacturing Year: 2014

Engine No.: M9R8839C002015

Chassis No.: VF1ABL15AUC279608

Maximum Power Output: 127.0 kW (170 bhp)

Open Market Value: \$19,998.00

Original Registration Date: 04 Nov 2014

First Registration Date: 04 Nov 2014

Transfer Count: 0

Actual ARF Paid: \$12,498.00

**Intended PARF Rebate Details**

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 03 Nov 2022

PARF Rebate Amount: \$9,373.00

**Intended COE Rebate Details**

COE Expiry Date: 03 Nov 2022

COE Category: A - Car up to 1600cc &amp; 97kW (130bhp)

COE Period(Years): 8

PQP Paid: \$51,337.00

COE Rebate Amount: \$23,686.00

**Total Rebate Amount: \$33,059.00****Message**

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 25 Feb 2019

OK

**Trans-cab Auto Services Pte Ltd**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHC 5407S****AAD1902-199**

*Not Authorized*  
*11 Sep @ 7200L*  
*Direct Settle*

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration :

**SHC 5407S**

VF1ABL15AUC279608

RENAULT

LATITUDE

24.2.2019

**FCIL**

4/11/2014

**PART****LIST**

|   |                             |    |          |     |
|---|-----------------------------|----|----------|-----|
| 1 | BUMPER COVER FRT            | \$ | 1,259.42 | } X |
| 1 | BUMPER SPOILER FRT          | \$ | 181.75   |     |
| 1 | BUMPER ABSORBER FRT         | \$ | 394.68   |     |
| 1 | BUMPER RETAINER FRT RH      | \$ | 151.41   |     |
| 1 | BUMPER SUPPORT FRT          | \$ | 123.88   |     |
| 1 | BUMPER RETAINER FRT RH      | \$ | 150.77   |     |
| 1 | BUMPER SUPPORT FRT          | \$ | 123.88   |     |
| 1 | BUMPER UNDERTRAY FRT        | \$ | 472.83   |     |
| 1 | BUMPER GRILLE LOWER FRT     | \$ | 266.80   |     |
| 1 | BUMPER FOG LAMP GRILLE RH   | \$ | 207.21   |     |
| 1 | BUMPER BEAM FRT             | \$ | 914.08   |     |
| 1 | HEADLAMP RH                 | \$ | 1,184.43 |     |
| 1 | HEADLAMP PANEL FRT RH       | \$ | 152.15   |     |
| 1 | FENDER PANEL FRT RH         | \$ | 783.83   |     |
| 1 | WHEELARCH FRT RH            | \$ | 278.84   |     |
| 1 | FENDER BRACKET LOWER RH     | \$ | 15.79    | } X |
| 1 | FENDER INSULATOR RH         | \$ | 130.84   |     |
| 1 | DOOR PANEL FRT RH           | \$ | 2,844.66 |     |
| 1 | DOOR HINGE UPPER RH         | \$ | 261.28   |     |
| 1 | DOOR HINGE LOWER RH         | \$ | 300.55   |     |
| 1 | DOOR CHECK FRT RH           | \$ | 194.77   |     |
| 1 | DOOR LOCK FRT RH            | \$ | 908.75   |     |
| 1 | DOOR CATCH FRT RH           | \$ | 131.23   |     |
| 1 | DOOR HANDLE OUTER FRT RH    | \$ | 477.76   |     |
| 1 | DOOR HANDLE COVER FRT RH    | \$ | 13.22    |     |
| 1 | DOOR HANDLE MODULE FRT RH   | \$ | 133.60   |     |
| 1 | DOOR REGULATOR FRT RH       | \$ | 505.19   |     |
| 1 | DOOR REGULATOR MOTOR FRT RH | \$ | 796.46   |     |
| 1 | DOOR REGULATOR GUIDE FRT RH | \$ | 120.97   |     |

**Trans-cab Auto Services Pte Ltd****AAD1902-199**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHC 5407S**

|   |                                      |    |               |
|---|--------------------------------------|----|---------------|
| 1 | DOOR PANEL REAR RH                   | \$ | B1 2,844.66 ✓ |
| 1 | DOOR GUIDE REAR RH                   | \$ | SL 176.82     |
| 1 | DOOR HINGE UPPER RH                  | \$ | N 274.50      |
| 1 | DOOR HINGE LOWER RH                  | \$ | N 300.55      |
| 1 | DOOR CHECK REAR LH/RH L70Y           | \$ | SL 203.06     |
| 1 | DOOR LOCK REAR RH                    | \$ | N 908.75      |
| 1 | DOOR HANDLE OUTER REAR RH            | \$ | SL 126.49     |
| 1 | DOOR HANDLE CAP REAR RH              | \$ | SL 35.52      |
| 1 | DOOR HANDLE SEAL REAR RH             | \$ | SL 7.89       |
| 1 | DOOR HANDLE COVER REAR RH            | \$ | SL 13.22      |
| 1 | DOOR HANDLE MODULE REAR RH           | \$ | SL 133.60     |
| 1 | DOOR REGULATOR REAR RH               | \$ | SL 1,135.10   |
| 1 | DOOR REGULATOR MOTOR REAR RH         | \$ | SL 893.75     |
| 1 | DOOR REGULATOR NUT REAR L70Y         | \$ | SL 12.43      |
| 1 | DOOR REGULATOR MOTOR SCREW REAR L70Y | \$ | SL 6.31       |
| 1 | DOOR FINISHER REAR RH                | \$ | SL 423.10     |
| 1 | DOOR MOULDING REAR RH                | \$ | SL 176.82     |
| 1 | DOOR MOULDING CLIP L70Y              | \$ | NN 5.92       |
| 1 | DOOR MOULDING SCREW L70Y             | \$ | NN 6.91       |
| 1 | DOOR CASING REAR RH                  | \$ | SL 1,509.06   |
| 1 | DOOR WATER SHIELD REAR RH            | \$ | SL 30.39      |
| 1 | DOOR CASING CLIP                     | \$ | NN 12.63      |
| 1 | DOOR CASING LIGHT L70Y               | \$ | NN 48.74      |
| 1 | DOOR FINISHER INNER REAR RH          | \$ | SL 323.44     |
| 1 | DOOR FINISHER BRACKET INNER REAR RH  | \$ | N 46.97       |
| 1 | DOOR FINISHER BRACKET INNER REAR RH  | \$ | N 20.33       |
| 1 | DOOR FINISHER BRACKET INNER REAR RH  | \$ | N 20.33       |
| 1 | DOOR FINISHER BRACKET INNER REAR RH  | \$ | N 20.33       |
| 1 | DOOR GRAB HANDLE REAR RH             | \$ | N 210.96      |
| 1 | DOOR BLIND REAR RH                   | \$ | SL 741.80     |
| 1 | DOOR WHEATHESTRIIP REAR RH           | \$ | SL 410.66     |
| 1 | DOOR SEAL REAR RH                    | \$ | SL 162.02     |
| 1 | DOOR GLASS RUNNER SEAL REAR RH       | \$ | SL 229.31     |
| 1 | DOOR WAIST SEAL OUTER REAR RH        | \$ | SL 334.69     |
| 1 | DOOR WAIST SEAL INNER REAR RH        | \$ | SL 115.64     |
| 1 | FENDER PANEL REAR RH                 | \$ | N 3,299.13    |
| 1 | FENDER PANEL INNER TRIM REAR         | \$ | SL 671.45     |
| 1 | WHEELARCH REAR RH                    | \$ | SL 543.47     |

**Trans-cab Auto Services Pte Ltd**

AAD1902-199

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHC 5407S**

|   |                               |    |                      |
|---|-------------------------------|----|----------------------|
| 1 | DOOR MIRROR ASSY RH           | \$ | <i>CM</i> 1,483.40 ✓ |
| 1 | ROCKER PANEL INNER GARNISH RH | \$ | <i>Sn</i> 466.51 X   |
| 1 | ROCKER PANEL INNER RH         | \$ | <i>n</i> 1,024.79 X  |
| 1 | ROCKER PANEL CENTER RH        | \$ | <i>n</i> 990.25 X    |

|    |                  |
|----|------------------|
| \$ | <b>33,882.75</b> |
|----|------------------|

|        |                 |
|--------|-----------------|
| 10% \$ | <b>3,388.28</b> |
|--------|-----------------|

|    |                  |
|----|------------------|
| \$ | <b>30,494.48</b> |
|----|------------------|

**Special Nett**

|      |                                |    |                              |     |
|------|--------------------------------|----|------------------------------|-----|
| 1SET | FRAME FULL SUPPORT PANEL CLIP  | \$ | <i>nn</i> 70.00              | } X |
| 2    | FRAME FULL SUPPORT PANEL NUT   | \$ | <i>nn</i> 20.00              |     |
| 2    | FRAME FULL SUPPORT PANEL STUD  | \$ | <i>nn</i> 30.00              |     |
| 1SET | WHEELARCH CLIP FRT RH          | \$ | <i>nn</i> 30.50              |     |
| 1SET | BUMPER CLIP FRT                | \$ | <i>nn</i> 66.00              |     |
| 1    | BUMPER BRACKET CLIP FRT RH     | \$ | <i>nn</i> 12.00              |     |
| 1    | BUMPER SUPPORT CLIP FRT RH     | \$ | <i>nn</i> 10.50              | } X |
| 1SET | BUMPER GRILLE LOWER CLIP       | \$ | <i>nn</i> 69.00              |     |
| 1    | FRONT DOOR STICKER 'Trans-cab' | \$ | <i>nn</i> 80.00 <i>60sn</i>  |     |
| 1    | FRONT DOOR STICKER 'Chassis'   | \$ | <i>nn</i> 300.00 <i>15sn</i> | } X |
| 1    | DOOR CHECK BOLT                | \$ | <i>nn</i> 22.69              |     |
| 1    | DOOR GUIDE SCREW               | \$ | <i>nn</i> 10.85              |     |
| 1    | DOOR HINGE BOLT                | \$ | <i>nn</i> 10.85              |     |
| 1    | DOOR HINGE NUT RH              | \$ | <i>nn</i> 14.60              |     |
| 1    | DOOR CHECK BOLT                | \$ | <i>nn</i> 22.69              |     |
| 1    | DOOR CHECK NUT                 | \$ | <i>nn</i> 3.75               |     |
| 1    | DOOR LOCK SCREW L70Y           | \$ | <i>nn</i> 6.12               |     |
| 1    | DOOR CATCH SCREW L70Y          | \$ | <i>nn</i> 10.06              | } X |
| 1SET | PARKING AID                    | \$ | <i>Sn</i> 700.00             |     |

|              |    |                 |
|--------------|----|-----------------|
| <b>TOTAL</b> | \$ | <b>1,489.63</b> |
|--------------|----|-----------------|

|                    |    |                  |
|--------------------|----|------------------|
| <b>TOTAL PARTS</b> | \$ | <b>31,984.11</b> |
|--------------------|----|------------------|

**Trans-cab Auto Services Pte Ltd**

AAD1902-199

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5407S

**LABOUR**

|                                                                                                                           |    |          |       |
|---------------------------------------------------------------------------------------------------------------------------|----|----------|-------|
| Panel beating, knocking and straightening the necessary portion, remove and renewal of parts, adjust and realign the same | \$ | 4,500.00 | 600/  |
| Putty and spray painting of the affected portion.                                                                         | \$ | 4,200.00 | 1100/ |
| To rust-proofing of the affected areas.                                                                                   | \$ | 170.00   | 60/   |
| To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.                           | \$ | 380.00   | nn X  |
| To check steering geometry and computer wheel alignment                                                                   | \$ | 220.00   | nn X  |
| To transfer of tire, rim and on wheel balancing.                                                                          | \$ | 170.00   | nn X  |
| To Check Electrical Lighting Concerned.                                                                                   | \$ | 170.00   | 20/   |
| To transfer of front fender fittings, attachment and perform water seepage test.                                          | \$ | 380.00   | nn X  |
| To transfer of front door fittings, attachment and perform water seepage test.                                            | \$ | 380.00   | 60/   |
| To transfer of Rear door fittings, attachment and perform water seepage test.                                             | \$ | 380.00   | 60/   |
| To transfer of Rear fender fittings, attachment and perform water seepage test.                                           | \$ | 380.00   | nn X  |
| To transfer of Rear bumper fittings, attachment and perform water seepage test.                                           | \$ | 380.00   | nn X  |
| Towing Fees.                                                                                                              | \$ | 120.00   | 50/   |

**Trans-cab Auto Services Pte Ltd****AAD1902-199**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHC 5407S**

To pull and jack out chassis frame and correct it to symmetrical position with the aid of hydraulic pneumatic jack.

\$ *nn* 380.00 *X*

Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.

\$ *nn* 380.00 *X***TOTAL** \$ 12,590.00**Over All Total** \$ 44,574.11**LUMP SUM (REPAIR DAY)**~~15 DAYS~~*4 days*

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

| Affiliated to Federation Internationale Des Experts En Automobile                                                                                                                  |                                                                              |                 |                             |                                                                                     |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------|-----------------|-----------------------------|-------------------------------------------------------------------------------------|
| MS FIRST CAPITAL INSURANCE LTD                                                                                                                                                     |                                                                              |                 | Ref : CS/FCI19003634/Ktd3n2 |                                                                                     |
| 36 ROBINSON ROAD<br>#16-01 CITY HOUSESINGAPORE 068877                                                                                                                              |                                                                              |                 | Date : 06-03-2019           |  |
|                                                                                                                                                                                    |                                                                              |                 | Code : FCI2                 |                                                                                     |
| <b>1. Policy Particulars :- THIRD PARTY CLAIM</b>                                                                                                                                  |                                                                              |                 |                             |                                                                                     |
| Insured Veh.                                                                                                                                                                       | SHC 8048A                                                                    | Veh. Inspected  | SHC 5407S                   |                                                                                     |
| Policy No.                                                                                                                                                                         |                                                                              | Coverage (\$)   | 0.00                        |                                                                                     |
| Claim No.                                                                                                                                                                          | D19001403MFSH                                                                | Excess (\$)     | 0.00                        |                                                                                     |
| Assign From                                                                                                                                                                        | EILEEN                                                                       | Assign Date     | 26/02/2019                  |                                                                                     |
| <b>2. Vehicle Particulars &amp; Condition</b>                                                                                                                                      |                                                                              |                 |                             |                                                                                     |
| Make & Model                                                                                                                                                                       | RENAULT LATITUDE (A)                                                         | c.c             | 1995                        |                                                                                     |
| Engine No.                                                                                                                                                                         | HIDDEN                                                                       | Year of Reg.    | 2014                        |                                                                                     |
| Chassis No.                                                                                                                                                                        | VF1ABL15AUC279608                                                            | Colour          | METALLIC WHITE / RED        |                                                                                     |
| Odometer                                                                                                                                                                           | 610146                                                                       | Steering        | IN ORDER                    |                                                                                     |
| Brakes                                                                                                                                                                             | IN ORDER                                                                     | Modification    | NIL                         |                                                                                     |
| General                                                                                                                                                                            | GOOD                                                                         |                 |                             |                                                                                     |
| <b>3. Conditions of Tyres</b>                                                                                                                                                      |                                                                              |                 |                             |                                                                                     |
|                                                                                                                                                                                    | Size                                                                         | Make            | Balance                     |                                                                                     |
| R/H Front Tyre                                                                                                                                                                     | 215/60 R16                                                                   | GITI            | 8 mm                        |                                                                                     |
| L/H Front Tyre                                                                                                                                                                     | 215/60 R16                                                                   | GITI            | 8 mm                        |                                                                                     |
| R/H Rear Tyre                                                                                                                                                                      | 215/60 R16                                                                   | GITI            | 8 mm                        |                                                                                     |
| L/H Rear Tyre                                                                                                                                                                      | 215/60 R16                                                                   | GITI            | 8 mm                        |                                                                                     |
| <b>4. Description of Damages</b>                                                                                                                                                   |                                                                              |                 |                             |                                                                                     |
| THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY.                                                                                                                                     |                                                                              |                 |                             |                                                                                     |
| DAMAGES SEE DETAILS.                                                                                                                                                               |                                                                              |                 |                             |                                                                                     |
| <b>5. General Information</b>                                                                                                                                                      |                                                                              |                 |                             |                                                                                     |
| Accident Date                                                                                                                                                                      | 24/02/2019                                                                   | Inspection Date | 27/02/2019                  |                                                                                     |
| Survey held at                                                                                                                                                                     | TRANS-CAB AUTO SERVICES PTE LTD<br>NO.2 ANG MO KIO ST 63<br>SINGAPORE 569111 |                 |                             |                                                                                     |
| <b>5a. Remarks</b>                                                                                                                                                                 |                                                                              |                 |                             |                                                                                     |
| A)DAMAGES CONSISTENT TO ACCIDENT REPORT.<br>B)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.<br>C)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS. |                                                                              |                 |                             |                                                                                     |
| <b>5b. Estimate Days of Repair</b>                                                                                                                                                 |                                                                              |                 |                             |                                                                                     |
| ESTIMATED NORMAL PERIOD FOR REPAIR:                                                                                                                                                |                                                                              | 4 Working Days  |                             |                                                                                     |



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 5407S

| Qty | Description of Parts               | Condition            | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|------------------------------------|----------------------|---------------------------|-------------------|
|     | <b><u>REPLACEMENT OF PARTS</u></b> |                      |                           |                   |
| 1   | BUMPER COVER FRT                   | SERVICEABLE          | 1,259.42                  | -                 |
| 1   | BUMPER SPOILER FRT                 | SERVICEABLE          | 181.75                    | -                 |
| 1   | BUMPER ABSORBER FRT                | SERVICEABLE          | 394.68                    | -                 |
| 1   | BUMPER RETAINER FRT RH             | SERVICEABLE          | 151.41                    | -                 |
| 1   | BUMPER SUPPORT FRT                 | SERVICEABLE          | 123.88                    | -                 |
| 1   | BUMPER RETAINER FRT RH             | SERVICEABLE          | 150.77                    | -                 |
| 1   | BUMPER SUPPORT FRT                 | SERVICEABLE          | 123.88                    | -                 |
| 1   | BUMPER UNDERTRAY FRT               | SERVICEABLE          | 472.83                    | -                 |
| 1   | BUMPER GRILLE LOWER FRT            | SERVICEABLE          | 266.80                    | -                 |
| 1   | BUMPER FOG LAMP GRILLE RH          | SERVICEABLE          | 207.21                    | -                 |
| 1   | BUMPER BEAM FRT                    | TO REPAIR SEE LABOUR | 914.08                    | -                 |
| 1   | HEADLAMP RH                        | SERVICEABLE          | 1,184.43                  | -                 |
| 1   | HEADLAMP PANEL FRT RH              | TO REPAIR SEE LABOUR | 152.15                    | -                 |
| 1   | FENDER PANEL FRT RH                | TO REPAIR SEE LABOUR | 783.83                    | -                 |
| 1   | WHEELARCH FRT RH                   | SERVICEABLE          | 278.84                    | -                 |
| 1   | FENDER BRACKET LOWER RH            | SERVICEABLE          | 15.79                     | -                 |
| 1   | FENDER INSULATOR RH                | SERVICEABLE          | 130.84                    | -                 |
| 1   | DOOR PANEL FRT RH                  | BENT                 | 2,844.66                  | 2,844.66          |
| 1   | DOOR HINGE UPPER RH                | DISTORTED            | 261.28                    | 261.28            |
| 1   | DOOR HINGE LOWER RH                | DISTORTED            | 300.55                    | 300.55            |
| 1   | DOOR CHECK FRT RH                  | SERVICEABLE          | 194.77                    | -                 |
| 1   | DOOR LOCK FRT RH                   | TO REPAIR SEE LABOUR | 908.75                    | -                 |
| 1   | DOOR CATCH FRT RH                  | SERVICEABLE          | 131.23                    | -                 |
| 1   | DOOR HANDLE OUTER FRT RH           | TO REPAIR SEE LABOUR | 477.76                    | -                 |
| 1   | DOOR HANDLE COVER FRT RH           | TO REPAIR SEE LABOUR | 13.22                     | -                 |
| 1   | DOOR HANDLE MODULE FRT RH          | SERVICEABLE          | 133.60                    | -                 |
| 1   | DOOR REGULATOR FRT RH              | SERVICEABLE          | 505.19                    | -                 |

Report Ref No. CS/FCI19003634/Ktd3n2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

| Qty | Description of Parts                 | Condition            | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|--------------------------------------|----------------------|---------------------------|-------------------|
| 1   | DOOR REGULATOR MOTOR FRT RH          | SERVICEABLE          | 796.46                    | -                 |
| 1   | DOOR REGULATOR GUIDE FRT RH          | SERVICEABLE          | 120.97                    | -                 |
| 1   | DOOR PANEL REAR RH                   | BENT                 | 2,844.66                  | 2,844.66          |
| 1   | DOOR GUIDE REAR RH                   | SERVICEABLE          | 176.82                    | -                 |
| 1   | DOOR HINGE UPPER RH                  | TO REPAIR SEE LABOUR | 274.50                    | -                 |
| 1   | DOOR HINGE LOWER RH                  | TO REPAIR SEE LABOUR | 300.55                    | -                 |
| 2   | DOOR CHECK REAR LH/RH L70Y           | SERVICEABLE          | 203.06                    | -                 |
| 1   | DOOR LOCK REAR RH                    | TO REPAIR SEE LABOUR | 908.75                    | -                 |
| 1   | DOOR HANDLE OUTER REAR RH            | SERVICEABLE          | 126.49                    | -                 |
| 1   | DOOR HANDLE CAP REAR RH              | SERVICEABLE          | 35.52                     | -                 |
| 1   | DOOR HANDLE SEAL REAR RH             | SERVICEABLE          | 7.89                      | -                 |
| 1   | DOOR HANDLE COVER REAR RH            | SERVICEABLE          | 13.22                     | -                 |
| 1   | DOOR HANDLE MODULE REAR RH           | SERVICEABLE          | 133.60                    | -                 |
| 1   | DOOR REGULATOR REAR RH               | SERVICEABLE          | 1,135.10                  | -                 |
| 1   | DOOR REGULATOR MOTOR REAR RH         | SERVICEABLE          | 893.75                    | -                 |
| 1   | DOOR REGULATOR NUT REAR L70Y         | SERVICEABLE          | 12.43                     | -                 |
| 1   | DOOR REGULATOR MOTOR SCREW REAR L70Y | SERVICEABLE          | 6.31                      | -                 |
| 1   | DOOR FINISHER REAR RH                | SERVICEABLE          | 423.10                    | -                 |
| 1   | DOOR MOULDING REAR RH                | SERVICEABLE          | 176.82                    | -                 |
| 1   | DOOR MOULDING CLIP L70Y              | NOT NECESSARY        | 5.92                      | -                 |
| 1   | DOOR MOULDING SCREW L70Y             | NOT NECESSARY        | 6.91                      | -                 |
| 1   | DOOR CASING REAR RH                  | SERVICEABLE          | 1,509.06                  | -                 |
| 1   | DOOR WATER SHIELD REAR RH            | SERVICEABLE          | 30.39                     | -                 |
| 1   | DOOR CASING CLIP                     | NOT NECESSARY        | 12.63                     | -                 |
| 1   | DOOR CASING LIGHT L70Y               | NOT NECESSARY        | 48.74                     | -                 |
| 1   | DOOR FINISHER INNER REAR RH          | SERVICEABLE          | 323.44                    | -                 |
| 1   | DOOR FINISHER BRACKET INNER REAR RH  | TO REPAIR SEE LABOUR | 46.97                     | -                 |
| 1   | DOOR FINISHER BRACKET INNER REAR RH  | TO REPAIR SEE LABOUR | 20.33                     | -                 |
| 1   | DOOR FINISHER BRACKET INNER REAR RH  | TO REPAIR SEE LABOUR | 20.33                     | -                 |



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

| Qty | Description of Parts                   | Condition            | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|----------------------------------------|----------------------|---------------------------|-------------------|
| 1   | DOOR FINISHER BRACKET INNER REAR RH    | TO REPAIR SEE LABOUR | 20.33                     | -                 |
| 1   | DOOR GRAB HANDLE REAR RH               | TO REPAIR SEE LABOUR | 210.96                    | -                 |
| 1   | DOOR BLIND REAR RH                     | SERVICEABLE          | 741.80                    | -                 |
| 1   | DOOR WEATHERSTRIP REAR RH              | SERVICEABLE          | 410.66                    | -                 |
| 1   | DOOR SEAL REAR RH                      | SERVICEABLE          | 162.02                    | -                 |
| 1   | DOOR GLASS RUNNER SEAL REAR RH         | SERVICEABLE          | 229.31                    | -                 |
| 1   | DOOR WAIST SEAL OUTER REAR RH          | SERVICEABLE          | 334.69                    | -                 |
| 1   | DOOR WAIST SEAL INNER REAR RH          | SERVICEABLE          | 115.64                    | -                 |
| 1   | FENDER PANEL REAR RH                   | TO REPAIR SEE LABOUR | 3,299.13                  | -                 |
| 1   | FENDER PANEL INNER TRIM REAR           | SERVICEABLE          | 671.45                    | -                 |
| 1   | WHEELARCH REAR RH                      | SERVICEABLE          | 543.47                    | -                 |
| 1   | DOOR MIRROR ASSY RH                    | CRACKED              | 1,483.40                  | 1,483.40          |
| 1   | ROCKER PANEL INNER GARNISH RH          | SERVICEABLE          | 466.51                    | -                 |
| 1   | ROCKER PANEL INNER RH                  | TO REPAIR SEE LABOUR | 1,024.79                  | -                 |
| 1   | ROCKER PANEL CENTER RH                 | TO REPAIR SEE LABOUR | 990.25                    | -                 |
|     | LESS 10% DISCOUNT                      |                      | -3,388.27                 | -773.46           |
|     |                                        |                      | 30,494.46                 | 6,961.09          |
|     | <b>SPECIAL NETT ITEMS</b>              |                      |                           |                   |
| 1   | SET FRAME FULL SUPPORT PANEL CLIP (SN) | NOT NECESSARY        | 70.00                     | -                 |
| 2   | FRAME FULL SUPPORT PANEL NUT (SN)      | NOT NECESSARY        | 20.00                     | -                 |
| 2   | FRAME FULL SUPPORT PANEL STUD (SN)     | NOT NECESSARY        | 30.00                     | -                 |
| 1   | SET WHEELARCH CLIP FRT RH (SN)         | NOT NECESSARY        | 30.50                     | -                 |
| 1   | SET BUMPER CLIP FRT (SN)               | NOT NECESSARY        | 66.00                     | -                 |
| 1   | BUMPER BRACKET CLIP FRT RH (SN)        | NOT NECESSARY        | 12.00                     | -                 |
| 1   | BUMPER SUPPORT CLIP FRT RH (SN)        | NOT NECESSARY        | 10.50                     | -                 |
| 1   | SET BUMPER GRILLE LOWER CLIP (SN)      | NOT NECESSARY        | 69.00                     | -                 |
| 1   | FRONT DOOR STICKER "TRANS-CAB" (SN)    | NECESSARY            | 80.00                     | 60.00             |
| 1   | FRONT DOOR STICKER "CHASSIS" (SN)      | NECESSARY            | 300.00                    | 15.00             |
| 1   | DOOR CHECK BOLT (SN)                   | NOT NECESSARY        | 22.69                     | -                 |

Report Ref No. CS/FCI19003634/Ktd3n2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

| Qty | Description of Parts                                                                                                                                                                                                                                                                                                                                                | Condition     | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|---------------------------|-------------------|
| 1   | DOOR GUIDE SCREW (SN)                                                                                                                                                                                                                                                                                                                                               | NOT NECESSARY | 10.85                     | -                 |
| 1   | DOOR HINGE BOLT (SN)                                                                                                                                                                                                                                                                                                                                                | NOT NECESSARY | 10.85                     | -                 |
| 1   | DOOR HINGE NUT RH (SN)                                                                                                                                                                                                                                                                                                                                              | NOT NECESSARY | 14.60                     | -                 |
| 1   | DOOR CHECK BOLT (SN)                                                                                                                                                                                                                                                                                                                                                | NOT NECESSARY | 22.69                     | -                 |
| 1   | DOOR CHECK NUT (SN)                                                                                                                                                                                                                                                                                                                                                 | NOT NECESSARY | 3.75                      | -                 |
| 1   | DOOR LOCK SCREW L70Y (SN)                                                                                                                                                                                                                                                                                                                                           | NOT NECESSARY | 6.12                      | -                 |
| 1   | DOOR CATCH SCREW L70Y (SN)                                                                                                                                                                                                                                                                                                                                          | NOT NECESSARY | 10.06                     | -                 |
| 1   | SET PARKING AID (SN)                                                                                                                                                                                                                                                                                                                                                | SERVICEABLE   | 700.00                    | -                 |
|     |                                                                                                                                                                                                                                                                                                                                                                     |               | 1,489.61                  | 75.00             |
|     | <b>LABOUR</b>                                                                                                                                                                                                                                                                                                                                                       |               |                           |                   |
|     | PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. }                                                                                                                                                                                                                                        |               | 4,500.00                  | 600.00            |
|     | INCLUSIVE OF THE REPAIR OF BUMPER BEAM FRT, HEADLAMP PANEL FRT RH, FENDER PANEL FRT RH, DOOR LOCK FRT RH, DOOR HANDLE OUTER FRT RH, DOOR HANDLE COVER FRT RH, DOOR HINGE UPPER RH, DOOR HINGE LOWER RH, DOOR LOCK REAR RH, DOOR FINISHER BRACKET INNER REAR RH, DOOR GRAB HANDLE REAR RH, FENDER PANEL REAR RH, ROCKER PANEL INNER RH AND ROCKER PANEL CENTER RH. } |               | -                         | -                 |
|     | PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.                                                                                                                                                                                                                                                                                                                   |               | 4,200.00                  | 1,100.00          |
|     | TO RUST-PROOFING OF THE AFFECTED AREAS.                                                                                                                                                                                                                                                                                                                             |               | 170.00                    | 60.00             |
|     | TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR.                                                                                                                                                                                                                                                                     | NOT NECESSARY | 380.00                    | -                 |
|     | TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.                                                                                                                                                                                                                                                                                                            | NOT NECESSARY | 220.00                    | -                 |
|     | TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.                                                                                                                                                                                                                                                                                                                    | NOT NECESSARY | 170.00                    | -                 |
|     | TO CHECK ELECTRICAL LIGHTING CONCERNED.                                                                                                                                                                                                                                                                                                                             |               | 170.00                    | 20.00             |
|     | TO TRANSFER OF FRONT FENDER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.                                                                                                                                                                                                                                                                                    | NOT NECESSARY | 380.00                    | -                 |
|     | TO TRANSFER OF FRONT DOOR FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.                                                                                                                                                                                                                                                                                      |               | 380.00                    | 60.00             |

Report Ref No. CS/FCI19003634/Ktd3n2