

Adrian

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

1800116727

Claims No.

778755451186

Sum Insured:

Excess:

\$300/-

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.



Bal. or Market Value:

155K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

24 1/2 days

Res: Yes or No

Lum Sum:

%

3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SME466SA

Yr Regn:

2017 April

Type:

M/Cay / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Andi AS SB

cc 1984

Colour:

Black

A/C:

Insured / Std / Nil / NA

Sp. Reading

11322

T/Radio:

Insured / Std / Nil / NA

Eng/No:

C/No:

WAU222 FSSJA13424Y

Gen. Cond:

Good / Fair / Poor / Burnt

Steering:

In order / Jammed / Leaked / Burnt or

Brake:

In order / Jammed / Leaked / Burnt or

Modi:

Nil / SRim / STD A/Rim or

Tyre Size:

F:

245/40 R18

R:

245/40 R18

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Continental

Front

Rear

R/Bal.

06

mm

R/Bal.

06

mm

L/Bal.

06

mm

L/Bal.

06

mm

D.O.A.

D.O.I.

01/03/19

Survey held at

Premium

Des. of Damages:

Fit / Rear / O/S / NIS / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

ODALG.

04/03/19

@ 15:11 p.m. revised PA to Sathe via mmm

04/03/19

@ 15:15 p.m. mandate requested authorise repair to Sathe via mmm

MV:

PV:

Nett:

05/03/19

@ 11:30 a.m. mandate approved by Victor Koh via mmm

05/03/19

@ 13:17 p.m. revert authorise repair to Kelvin Ongpin via email.

Adrian Condon P/P \$36,163.68 @ 24 days with Buss. (\$26,990.32

Date/Time, File Pass to?

Date/Time, File Return to?

1)

Type

2)

Part Prices Check:

IN

OUT

Survey Fee:

Date:

Red - 45%)

Basic & Add.

200

S + R5, SI

Photos

Others

TOTAL

11

211

Prel. Report:

Final Report:

\$36,163.68 P/P

Resurvey No. of Trip - 3

[Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	3580E
Vehicle Details	
Vehicle No.:	SME4665A
Vehicle to be Exported:	No
Intended Deregistration Date:	04 Mar 2019
Vehicle Make:	AUDI
Vehicle Model:	A5 SB 2.0 TFSI S TRONIC (DESIGN)
Primary Colour:	Black
Manufacturing Year:	2018
Engine No.:	CVK068790
Chassis No.:	WAUZZZF59JA134244
Maximum Power Output:	140.0 kW (187 bhp)
Open Market Value:	\$39,572.00
Original Registration Date:	28 Sep 2018
First Registration Date:	28 Sep 2018
Transfer Count:	0
Actual ARF Paid:	\$47,401.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	27 Sep 2028
PARF Rebate Amount:	\$35,550.00
Intended COE Rebate Details	
COE Expiry Date:	27 Sep 2028
COE Category:	E - Open - all except motorcycle
COE Period(Years):	10
QP Paid:	\$32,000.00
COE Rebate Amount:	\$29,941.00
Total Rebate Amount:	\$65,491.00

The information contained herein is correct as at 04 Mar 2019

OK

Shirley Hiew (LKK Auto)

From: Shirley Hiew (LKK Auto)
Sent: Tuesday, 21 January 2020 11:14 am
To: Boo seng yak; Carrine Leong
Cc: Adrian Ling (LKKAuto); SUR; jiajee.yap@premiumauto.com.sg; Chang Chee Sing
Subject: RE: FINAL REVISION - SME4665S - OD AIG - SURVEYED 1 MAR 19

Dear Mr. Boo/Carrine,

Confirmed final fig \$ 36,163.68 @ 24 days of repairs before excess \$ 800/- & GST.

Kindly expedite the discharge voucher and tax invoice to us for close case.

"Wishing you a Happy and Prosperous Lunar New Year"



Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Boo seng yak <boojohnny@gmail.com>

Sent: Tuesday, 22 October 2019 6:21 pm

To: Adrian Ling (LKKAuto) <adrianling@lkkauto.com>; Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>; SUR <sur@lkkauto.com>; Carrine Leong <carrine.leong@premiumauto.com.sg>; jiajee.yap@premiumauto.com.sg; Chang Chee Sing <claims@premiumauto.com.sg>

Subject: FINAL REVISION - SME4665S - OD AIG - SURVEYED 1 MAR 19

Hi Adrian and all,

Revised estimate and photographs is attached.

Please confirm repair cost of \$36,374.88 at 28 days exclude 4 Sundays.

Shirley Hiew (LKK Auto)

From: glory.tan@premiumauto.com.sg
Sent: Thursday, 4 April 2019 9:28 AM
To: ShirleyHiew@lkkauto.com
Subject: Regarding the pricing of the tyre for SME 4665 A

Hi Shirley,

I heard Tony said you are asking about the real price of the new tyre for SME 4665 A.
Yesterday I did send two email to you guys, the first one with pricing SGD 943 was a mistake, the second email with SGD 420 is true one.
Any further enquiries you can come and ask me.

Thank you.

Best Regard,
Glory Tan
Bodyworks Department

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 f. +65 6841 1183
e. glory.tan@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223

Shirley Hiew (LKK Auto)

From: Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>
Sent: Tuesday, 5 March 2019 1:17 PM
To: 'Claims Dept'
Cc: SUR
Subject: RE: OD CLAIM FOR SME 4665 A - VEHICLE IN
Attachments: ESTIMATE.pdf

Dear Kelvin,

As instructed by our client, please proceed to repair the insured vehicle **SME 4665A (Excess \$ 800/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right not to pay if there is no valid approval obtained before repair.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Shirley Hiew (LKK Auto) [mailto:ShirleyHiew@lkkauto.com]
Sent: Tuesday, 5 March 2019 9:54 AM
To: 'Claims Dept' <claims@premiumauto.com.sg>
Cc: SUR <sur@lkkauto.com>
Subject: RE: OD CLAIM FOR SME 4665 A - VEHICLE IN

Hi Kelvin,

Pending Mandate Request							
Claim Type	Branch	Claimant	Adjuster	Manager	File Ref. No.	Insurer	
OD	HQ	*SME4665A [ABDUL AZIZ BIN ABDUL RAHMAN]	ADRIAN LING	Hiew May Fung	CC3/AIG19003926/ASD3	AIG Asia Pacific Insurance Pte. Ltd. (SG)	Pre

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

From: Claims Dept [<mailto:claims@premiumauto.com.sg>]
Sent: Monday, 4 March 2019 8:25 PM
To: SUR <sur@lkkauto.com>
Cc: 'Claims Dept' <claims@premiumauto.com.sg>
Subject: RE: OD CLAIM FOR SME 4665 A - VEHICLE IN

Dear All,

Kindly advise who is the officer in-charge of this case to follow up on repair approval.

Thank You.

Best Regards,
Kelvin Khoo
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Claims Dept [<mailto:claims@premiumauto.com.sg>]
Sent: Friday, 1 March 2019 2:56 PM
To: 'SUR'
Cc: 'Claims Dept'
Subject: OD CLAIM FOR SME 4665 A - VEHICLE IN

Dear all,

Kindly assist on repair approval. Vehicle survey by Adrian earlier just now

Best regards,
Kee Siang

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you.

View Received Message

This mail is associated with :

***SME4665A (7787554511SG)**

OD

Feb 26 2019 5:00PM

[ABDUL AZIZ BIN ABDUL RAHMAN]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 21/01/2020 10:29 AM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$36163.68) - SME4665A - Claim Handler: Yap, Weijoe

Approved:36163.68.

DOCUMENTS SUMMARY

There are no documents.

View Received Message

This mail is associated with :

***SME4665A (7787554511SG)**

OD

Feb 26 2019 6:00PM

[ABDUL AZIZ BIN ABDUL RAHMAN]

Premium Automobiles Pte Ltd

[Reply](#)[Reply All](#)[Mark as Unread](#)[Print Message](#)[Delete Message](#)[Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 05/03/2019 11:30 AM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$34147.00) - SME4665A - Claim Handler: Mohd Zawaye, Norsazani

Approved:34147.00:Re-inspection to be done for damage check and supplementary items / labour.

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Mohd Zawaye, Norsazani

Date: 08 Apr 2019

Preliminary Advice

Vehicle No	: SME4665A	Accident Date	: 26/02/2019
Make	: AUDI A5	Policy No.	:
Assignment Date	: 04/03/2019	Excess	: S\$800.00
Date of Inspection	: 01/03/2019	Est. Duration of Repair	: 21 days
Inspection At	: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages o/s body and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	62,800.00
Revised Amount	:S\$	35,767.00
Check Items (Estimated)	:S\$	4,096.00
Total	:S\$	39,863.00

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	155,000.00
COE / PARF Rebate	:S\$	65,491.00
Salvage Value	:S\$	
Margin for Repair	:S\$	89,509.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : Supplementary amount is \$ 1,620.00.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Mohd Zawaye, Norsazani

Date: 26 Mar 2019

Preliminary Advice

Vehicle No	: SME4665A	Accident Date	: 26/02/2019
Make	: AUDI A5	Policy No.	: 1800116727
Assignment Date	: 04/03/2019	Excess	: S\$800.00
Date of Inspection	: 01/03/2019	Est. Duration of Repair	: 21 days
Inspection At	: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages o/s body and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	62,380.00
Revised Amount	:S\$	35,347.00
Check Items (Estimated)	:S\$	4,096.00
Total	:S\$	39,443.00

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	155,000.00
COE / PARF Rebate	:S\$	65,491.00
Salvage Value	:S\$	
Margin for Repair	:S\$	89,509.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : Supplementary amount is \$ 1,200.00 .

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Syed-Yusoff, Saliha

Date: 04 Mar 2019

Preliminary Advice

Vehicle No	: SME4665A	Accident Date	: 26/02/2019
Make	: AUDI A5	Policy No.	: 1800116727
Assignment Date	: 04/03/2019	Excess	: S\$0.00
Date of Inspection	: 01/03/2019	Est. Duration of Repair	: 21 days
Inspection At	: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages o/s body and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	61,180.00
Revised Amount	:S\$	34,147.00
Check Items (Estimated)	:S\$	4,096.00
Total	:S\$	38,243.00
Lump Sum Repair	:S\$	

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	155,000.00
COE / PARF Rebate	:S\$	65,491.00
Salvage Value	:S\$	
Margin for Repair	:S\$	89,509.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	27/02/2019 11:21
Date Of Accident	26/02/2019 18:00
Exact Location Of Accident	CTE LEADING TO UPPER SERANGOON / CHANGI / PIE
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SME4665A
Insured/Policyholder	
Name Of Registered Owner	ABDUL AZIZ BIN ABDUL RAHMAN
NRIC No	S1643580E
Email Address	AAZIZ.ARAHMAN@GMAIL.COM
Mobile Phone No	(LOCAL) +65-97994746
Alternative Phone No	OTHERS-97994746

Vehicle Particulars

Manufacturer	AUDI
Model	A5 SB 2.0 TFS
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	1800116727
Cover Note Number	

Driver

Name of Driver	ABDUL AZIZ BIN ABDUL RAHMAN
NRIC No	S1643580E
Date Of Birth	27/04/1964
Occupation	INDOOR
Date Of Driving Pass	05/04/1982
Driving Experience	36 YEARS AND 10 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-97994746
Fax Number	
Contact Number	OTHERS-97994746
Email Address	AAZIZ.ARAHMAN@GMAIL.COM

Address	BLK 536 BEDOK NORTH STREET 3 #04-888
Postcode	460536
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - MAJOR/MINOR RD
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

ON 26 FEB 2019 @ ABOUT 6 PM, I WAS DRIVING ALONG CTE TOWARDS UPPER SERANGOON / CHANGI / PIE. MY VEHICLE, SME4665A, WAS HIT BY A TRUCK, XD9471J. THE ROAD WAS CONGESTED AND TRAFFIC MOVEMENT CONSIDERED VERY SLOW. ALONG THE WAY TO MY DESTINATION, I SAW A STATIONARY VEHICLE SJQ1736X. I SIGNALLLED TO THE RIGHT TO MOVE TO MIDDLE OF 2 LANES AWAY FROM SJQ1736X. MY VEHICLE HAD ALREADY IN THE MIDDLE OF THE 2 LANES. I WAS HIT MY THE TRUCK. STATIONARY VEHICLE OCCUPIED ALMOST HALF OF LEFT LANE. I DID NOT INTEND TO STAY ON RIGHT AFTER PASSING STATIONARY CAR AS I WANT TO MOVE BACK TO LEFT LANE TO MY DESTINATION.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	XD9471J
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	

Nature Of Damage

No. Of Passenger (Including Driver)

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE


1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


Policyholder's Signature
Date & Time:

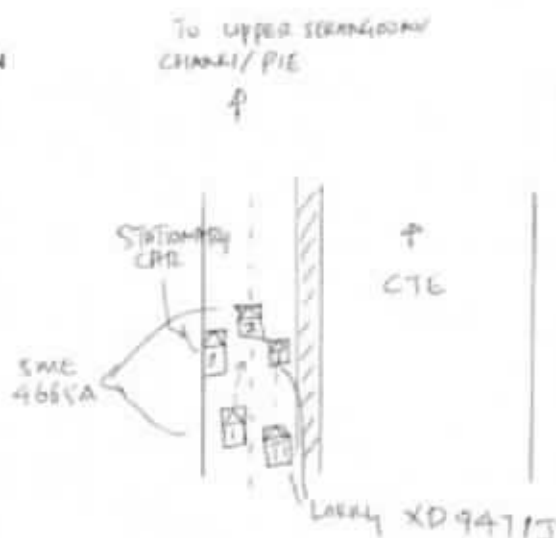

Driver's Signature
(if driver is not the policyholder)
Date & Time:


Reporting Centre Personnel's Signature
Name: Wendy Hilda Selva, Gimp
NRIC/FIN No.: G 24871034



Sketch Plan #2

SKETCH PLAN



DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

ON 26 FEB 2019 @ ABOUT 6PM, I WAS DRIVING ALONG
CIE TOWARD UPPER SERANGOON/CHANGI/PIE, MY VEHICLE
SME 4665A WAS HIT BY A TRUCK XD94715
THE ROAD WAS CONGESTED AND TRAFFIC MOVEMENT
CONSIDERED VERY SLOW ALONG THE WAY TO MY
DESTINATION I SAW A STATIONARY VEHICLE SJQ1736X. I SIGNALLED
TO THE RIGHT TO MOVE TO MIDDLE OF 2 LANES
AWAY FROM SJQ1736X. MY CAR VEHICLE HAD
HAD ALREADY BEFORE IN THE MIDDLE OF THE
2 LANES I WAS HIT BY THE TRUCK.
STATIONARY VEHICLE OCCUPIED ALMOST HALF OF
LEFT LANE. my car was hit I DID
NOT INTEND TO STAY ON RIGHT AFTER
PASSING STATIONARY CAR AS I WANT TO MOVE
BACK TO LEFT LANE TO MY DESTINATION

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature

Date & Time:

Driver's Signature

(If driver is not the policyholder)

Date & Time:

Reporting Centre Personnel's Signature

Name: *Wong Eileen Seraphina*

NRIC/IN No: *G039143K*



Accident Photo



Addendum Sheet



GENERAL INSURANCE ASSOCIATION OF SINGAPORE RECORDS MANAGEMENT CENTRE
5 Raffles Quay #18-00 Singapore 048580
Tel (65) 6224 0020 Fax (65) 6224 0030
Operating Hours : Monday to Friday, 09:00 - 17:00
UEN: S865300206 / GST Reg. No.: M400017785

IMPORTANT NOTE: Please submit the completed Addendum form to the same Authorised Reporting Centre with whom you submitted the Original Report.

ADDENDUM

(A) PARTICULARS OF PERSON MAKING THE AMENDMENTS:

Original Report No : MPA 119027121-01 Vehicle Registration No: SME 4665A
Name (as shown in NRIC) : ABDUL AZIZ BIN ABDUL RAHMAN NRIC/FIN/Passport No : S 1643580E
(*Vehicle Driver / Vehicle Owner) (*) Please delete as appropriate
Address : _____ Singapore ()
Contact (Tel) : _____ Mobile No. : _____
Email Address : _____
Date of Accident : 26/02/2019 Time of Accident : 1800
Place of Accident : CTE LEADING TO UPPER SERANGOON / CHANGI / PIE
Insurance Company: AIG

(B) ADDITIONAL INFORMATION / AMENDMENTS:

I have made a report on the above mentioned accident and would like to include additional information or make the following amendments:

To amend vehicle number of the third party
in sketch plan.

Policyholder / Driver's Signature
Date:

Reporting Centre Personnel's Signature
Name: MASTURA BTE OSMAN
NRIC/FIN No.: SB607625H
Date:



Name of Policyholder : ABDUL AZIZ BIN ABDUL RAHMAN
Period of Insurance : 28 Sep 2018 To 27 Sep 2019
Engine No. : CVK 068790
Chassis No. : WAUZZZF59JA134244

Vehicle No. : SME4665A
Policy No. : 1800116727
Endorsement No. :
Issued Date : 04 Oct 2018

Make/Model	: AUDI A5 Sportback 2.0TFSI S Tronic (Design)		
Engine Capacity/Tonnage	: 1,984.00 CC	Sum Insured	: Market Value
Driver Restriction	: NA	Off Peak Car	: No
		First Year of Registration	: 2018
		Insuring with COE/PARF	: Yes

a) The Policyholder

b) Any other person who is driving on the Policyholder's order or with his/her permission

This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDR") if You are or Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition

Limitation as to use*

Use only for social, domestic and pleasure purposes and for the Policyholder's business

This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1800cc - 2000cc Optional

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

Section 1

Fire - \$0 Own Damage - \$1600 Theft - \$0 Flood Cover - \$0

Section 2

Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

ABDUL AZIZ BIN ABDUL RAHMAN - \$1600 (Own Damage)

1 Audi Customer Service Center Add: 55 Ubi Road 1 Singapore 408699 63682323

For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 8338 8200. Alternatively, you may refer to AIG website www.aig.com.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

Hire Purchase Company/Employer's Loan: DBS BANK LTD

(We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 189), Part IV of the Road Transport Act, 1987 (Malaysia) and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia).)

0504125219

PREMIUM LEASING - KATL
281 ALEXANDRA ROAD AUDI CUSTOMER SERVICE CENTRE
SINGAPORE 159938

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

Manila

AIG Asia Pacific Insurance Pte. Ltd.
AUTHORISED REPRESENTATIVE

Cheng-Cheng Chen

What can the 24-hour AIG Auto Emergency Hotline provide for you?

- Immediate assistance after an accident
- Emergency breakdown service
- Towing service (accident or non-accident related)
- Advice on Motor Claims procedures
- Medical Referral Assistance

If no one is injured in the accident:

- You are not required to make any police report.
- Record vehicle number, name and address, insurance company and policy number of the other driver(s) and vehicle(s).
- Collect details (name, address and contact number) of witnesses and/or try to take photographs of the scene of the accident.
- Report the accident to us with your accident vehicle (whether damaged or not) via our approved reporting centres or authorised repairers within 24 hours or the next working day of the accident.

If the accident involves injuries or damage to government property & vehicles, foreign registered vehicles or non-injury hit & run case:

- Report the accident to the police, providing full details of the circumstances of the accident.
- Record vehicle number, name and address, insurance company and policy number of the other driver(s) and vehicle(s), if applicable.
- Collect details (name, address and contact number) of witnesses and/or try to take photographs of the scene of the accident.
- Report the accident to us with your accident vehicle (whether damaged or not) via our approved reporting centres or authorised repairers within 24 hours or the next working day of the accident.

What should I do in the event of an accident?

- Keep calm and move your car to a safe place.
- Do not admit or discuss fault or blame with the other party(ies).
- Report the accident to us with your accident vehicle (whether damaged or not) via our approved reporting centres or authorised repairers within 24 hours or the next working day of the accident.
- Submit Writ/Summons/Correspondences from third party(ies) to AIG immediately.

LOSS OF USE CAR REPLACEMENT BENEFIT

Applicable only if this benefit is included in your motor insurance. Please refer to your Policy Schedule for details. Policy terms and conditions apply. Please call our customer service hotline number **(65) 6419-3000** for assistance.

The Certificate of Insurance (CI) should be produced without demand when collecting the Rental Car and the Rental Car Company reserves the right to verify the identity of the holder. The CI is the property of AIG and its use is subject to the terms and conditions contained in the Loss of Use Endorsement under the policy issued to the policyholder.

Steps to activate Loss of Use Car Replacement Benefit and Important Information

1. To activate your loss of use car replacement, please contact the Rental Car Company (listed below) after filing/reporting your accident claim.
2. Your rental car will be made available within **5** working hours of activation with the Rental Car Company.
3. At the time of collection of the Rental Car, the **original** insurance policy and schedule issued by AIG, a copy of the Accident Report from **Audi Customer Service Centre** must be produced.
4. The number of days is based on the period your vehicle is in the repair workshop unless the number of days of loss of use entitlement is stated in the Policy.
5. Rental cars are strictly for use in Singapore only.
6. Extension of rental beyond repair period approved by AIG surveyor will be chargeable by the Rental Car Company on per day basis.
7. Upgrade of Rental Car is available upon request subject to additional charges by the Rental Car Company.

Rental Car Company: Popular Rent A Car Pte. Ltd.

Activation Hotline: 67428888

501 Guillemard Road Singapore 399840

Operation Hours: Monday to Friday: 9am to 6pm Saturday (Half Day): 9am to 4pm

*The Rental Car Company's Terms & Conditions apply (i.e., refundable security deposit, excess liability for the Rental Car, Collision Damage Waiver, etc).

IMPORTANT NOTICE

If you sell your motor vehicle, this Notice is **IMPORTANT** and **MUST** be complied with. Policyholders are hereby warned that under the Motor Vehicles (Third Party Risks and Compensation) Act (Cap.99), it shall be unlawful for any person to use or cause or permit any other person to use a motor vehicle without a valid policy of insurance under the Act.

The Policyholder is further warned that on the sale of a motor vehicle, they must surrender the Certificate of Insurance and the Policy to the insurance company. If the Certificate of Insurance has been lost or destroyed, a Statutory Declaration to that effect must be made. Failure to comply with this obligation is an offence under the Motor Vehicles (Third Party Risks and Compensation) Act (Cap.88).

This Policy will cease to be valid once the motor vehicle has been sold to another person unless the transfer of interest has been duly notified to and agreed to by the insurance company concerned. If the insurance company agrees to cover the new owner, they will issue a new Certificate of Insurance in the new owner's name. The premium chargeable may vary according to the new owner's profile.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/TP/0266/2019/KN
Date : 28-Feb-19

Does not include bottom plate, pillar reinforcement

Vehicle IN workshop.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr. Abdul Aziz Bin Abdul Rahman
Address : Blk 536 Bedok North Street 3
#04-888
Singapore 460536
Telephone : 97994746
Type of Claim : Own Damage Claims
Policy No. : 1800116727
Vehicle No : **SME 4665 A**
Model Code : A5 COUPE 2.0 TFSI
Model / Year : 29/4/2017
Engine No : CVK 068790
Chassis No : WAUZZZF59JA134244
Mileage :
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 26-Feb-19
Place of Accident : CTE LEADING TO UPPER SERANGOON / CHANGI / PIE

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SME 4665 A

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
1	To remove and transfer rear parking aid and rear lid kick sensor. Check function	S/N \$ 360.00 ✓	
2	To renew RHS 1/4 glass to facillitate fender renewal.	S/N \$ 300.00 ✓	
3	To remove and transfer RHS front and rear door's multi-lock sysem and power window devices. Inspect for damages.	S/N \$ 560.00 ✓	
4	To dislodge and reinstall rear wire harness for lights, battery manager, fuse and relay trays, electrical and audio equipment.	S/N \$ 1,400.00 ✓	
5	To remove and reinstall rear seat, back rest, hat tray, abcd pillar trims, luggage compartment trims. Dislodge roof liner and disengage curtain airbag etc.	\$ 1,400.00 ✓	
6	To dismantle rear bumper, rear lid, RHS sill panel, RHS rear outer wheel housing, RHS rear connecting plate, RHS rear bottom plate, RHS B-pillar and RHS sill panel. Renew rear bumper, RHS front door, RHS wing mirror assy, RHS rear door and RHS sill panel trim. Re-organize rear crash management components. Reinstall all parts removed.	\$ 15,750.00 5000. ✓	6000/- H.S.
TOTAL LABOUR CHARGES		: <u>\$ 19,770.00</u>	

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Estimated Labour Charges for Accident Vehicle SME 4665 A

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
7	To respray rear bumper, RHS front door, RHS rear door, RHS rear fender, RHS wing mirror cover, hinges, RHS rear outer wheel housing, RHS rear connecting plate, RHS rear bottom plate, RHS B-pillar, RHS sill panel, RHS sill panel trim, door entrances, roof channel, drain panel and end panelling. To carry out stone chip treatment and joint sealer works.	4450 4200 S 10,300.00	5000/- sl/s. SSO x 6 = 3300 Mirror : 150 2 Handle : 200 SSO miscellaneous Sealant work 250.
8	To renew RHS rear rim and carry out wheel alignment. To inspect RHS rear suspension for futher damages.	S/N S 280.00	✓
9	To carry out diagnostic check.	S/N S 384.00	✓
TOTAL LABOUR CHARGES		: S 30,734.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SME 4665 A

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	LED TAIL LIGHT - RH <i>3 piece</i>	\$ 1,044.00	+
2	LED TAIL LIGHT TRIM - RH	\$ 27.00	+
3	REAR SIDE PANEL FRAME - RH <i>Distorted</i>	\$ 3,432.00	✓ 2745.60
4	REAR SIDE WINDOW - RH <i>re</i>	\$ 653.00	✓ 522.40
5	REAR OUTER BOTTOM PLATE - RH <i>Distorted</i>	\$ 439.00	7 ✓ 350.80
6	REAR OUTER WHEEL HOUSING - RH <i>Distorted</i>	\$ 574.00	7 ✓ 459.20
7	REAR CONNECTING PLATE - RH <i>Distorted</i>	\$ 133.00	7 ✓ 106
8	FRONT DOOR - RH <i>Dented</i>	\$ 2,829.00	✓ 2263.20
9	FRONT OUTER DOOR SEAL - RH <i>re</i>	\$ 201.00	✓ 160.80
10	BONDING AGENT <i>Not New</i>	\$ 45.00	7 X
11	CLEANING SOLUTION <i>Not New</i>	\$ 65.00	7 X
12	APPLICATOR <i>Not New</i>	\$ 7.00	7 X
13	FRONT DOOR CATCH - RH <i>re</i>	\$ 109.00	+
14	FRONT DOOR CATCH COVER - RH <i>re</i>	\$ 13.00	+
15	FRONT DOOR HANDLE TRIM PLATE - RH <i>cut</i>	\$ 80.00	✓ 63.52
16	FRONT DOOR HANDLE EXTERIOR - RH <i>Repaired cut</i>	\$ 35.00	✓ 27.52
17	FRONT DOOR MOUNTING BAR - RH <i>Not damaged</i>	\$ 149.00	✓ 118.80
18	FRONT DOOR HANDLE SENSOR - RH <i>Not damaged</i>	\$ 208.00	✓ 166.40
19	FRONT PERIPHERAL LIGHT - RH <i>Not damaged</i>	\$ 66.00	✓ 52.72
20	FRONT DOOR TRIM - RH <i>Not New</i>	\$ 145.00	✓ 115.60

SUB TOTAL SPARE PARTS

: \$ 10,254.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SME 4665 A**

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
21	FRONT EXTERIOR MIRROR MOUNTING - RH <i>Engd</i>	\$ 999.00 ✓	799.20
22	FRONT MIRROR CAP - RH <i>Missing</i>	\$ 220.00 ✓	175.60
23	FRONT MIRROR GLASS - RH <i>Missing</i>	\$ 1,553.00 ✓	1242.40
24	FRONT MOULDING FOR ROOF - RH <i>new</i>	\$ 574.00 +	
25	FRONT EDGE PROTECTIO-RH <i>new</i>	\$ 141.00 +	
26	FRONT WINDOW SLOT SEAL WITH TRIM STRIP-RH <i>lit</i>	\$ 364.00 ✓	291.20
27	FRONT DOOR EXTERIOR B PILLAR TRIM-RH <i>new</i>	\$ 247.00 +	
28	REAR DOOR-RH <i>Engd</i>	\$ 2,829.00 ✓	2263.20
29	REAR OUTER DOOR SEAL-RH <i>new</i>	\$ 201.00 ✓	160.80
30	BONDING AGENT <i>Not New</i>	\$ 45.00 ? X	
31	CLEANING SOLUTION <i>Not New</i>	\$ 65.00 ? X	
32	APPLICATOR <i>new</i>	\$ 7.00 ? X	
33	REAR DOOR CATCH-RH <i>Engd</i>	\$ 109.00 ? ✓	87.20
34	REAR DOOR CATCH COVER-RH <i>Not New</i>	\$ 12.00 ? X	
35	REAR DOOR HINGE HALF-RH UPPER <i>Best</i>	\$ 41.00 ✓	32.08
36	REAR DOOR HINGE HALVES-RH LOWER <i>Best</i>	\$ 42.00 ✓	33.04
37	REAR DOOR HINGE HALVES-RH <i>Best</i>	\$ 42.00 ✓	33.04
38	REAR DOOR HINGE HALF-RH LOWER <i>Best</i>	\$ 68.00 ✓	54.24
39	REAR DOOR HANDLE TRIM PLATE <i>lit</i>	\$ 80.00 ✓	63.52
40	REAR DOOR HOUSING <i>new</i>	\$ 7.00 ✓	5.36

SUB TOTAL SPARE PARTS: **\$ 7,646.00**

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SME 4665 A**

S/N	Parts Description		Damaged Parts & Prices	
			S/Nett	Remark
41	REAR DOOR COVER-RH <i>new</i>	S	6.00 ✓	4.08
42	REAR DOOR HANDLE COVER-RH <i>lt</i>	S	208.00 ✓	166.40
43	REAR DOOR HANDLE EXTERIOR-RH <i>lt</i>	S	35.00 -	27.52
44	REAR DOOR HANDLE TRIM-RH <i>lt</i>	S	124.00 ✓	98.80
45	REAR DOOR PERIPHERAL LIGHT-RH <i>new</i>	S	66.00 +	
46	REAR DOOR MOUNTING BAR-RH <i>Not Damaged</i>	S	149.00 + ✓	118.80
47	REAR WINDOW REGULATOR WITHOUT MOTOR-RH <i>Damaged</i>	S	320.00 ? ✓	256.00
48	REAR WINDOW REGULATOR MOTOR-RH <i>Not Nec</i>	S	278.00 ? X	
49	REAR DOOR CONTROL UNIT-RH <i>Not Nec</i>	S	685.00 +	
50	REAR DOOR INNER PANEL COVER-RH <i>Not Nec</i>	S	29.00 ? X	
51	REAR DOOR LOCK-RH <i>Not Damaged</i>	S	604.00 + ✓	482.80
52	REAR WINDOW APERTURE SEAL-RH INNER <i>Not Nec</i>	S	268.00 ? X	
53	REAR WINDOW SLOT SEAL WITH TRIM STRIP-RH <i>Not Nec</i>	S	335.00 + ✓	267.60
54	REAR DOOR TRIM PANEL WIRING HARNESS-RH <i>new</i>	S	198.00 +	
55	REAR ALUMINIUM RIM-RH <i>lt</i>	S	943.00 ✓	754.40
56	RUBBER VALVE <i>new</i>	4 S	13.00 +	
57	REAR WHEEL HOUSING LINER-RH <i>tom</i>	S	256.00 ✓	204.80
58	REAR WHEEL HOUSING LINER ATTACHMENT PARTS-RH <i>Not Nec</i>	S	82.00 ? X	
59	REAR BUMPER <i>Dislud</i>	S	2,491.00 ✓	1992.80
60	REAR BUMPER FIXING PARTS <i>new</i>	S	150.00 +	
SUB TOTAL SPARE PARTS			\$ 7,240.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SME 4665 A**

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
61	REAR BUMPER SECURING STRIP <i>NEC</i>	\$ 203.00	✓ 162.40
62	REAR BUMPER SPOILER	\$ 746.00	+
63	REAR BUMPER DIFUSSER-RH	\$ 264.00	+
64	REAR BUMPER TRIM-RH	\$ 37.00	+
65	REAR LIGHT RELECTOR-RH	\$ 38.00	+
66	REAR BUMPER GUIDIE SECTION-RH	\$ 40.00	✓ X
67	REAR BUMPER UPPER GUIDE SECTIO-RH	\$ 20.00	✓ 15.92
68	REAR SENSOR-INNER/OUTER <i>NEC</i>	2 \$ 462.00	+
69	REAR SENSOR SEAL RING <i>NEC</i>	4 \$ 12.00	+
70	REAR SIDE MEMBER TRIM <i>TOIN</i>	\$ 794.00	✓ 634.80
71	REAR SIDE MEMBER TRIM ATTACHMENT PARTS <i>NEC</i>	\$ 118.00	✓ 8.94
72	REAR SIDE MEMBER ADHESIVE TEPES <i>NEC</i>	\$ 192.00	✓ 153.20
73	ACRYLIC SEALANT	S/N \$ 180.00	✓
74	CAVITY WAX	S/N \$ 140.00	✓
75	STONE CHIP	S/N \$ 180.00	✓
76	METAL FILLER POWDER	S/N \$ 280.00	✓
77	1/4 GLASS SELANT	S/N \$ 100.00	✓
78	SUNDRIES <i>NEC.</i>	\$ 1,500.00	✓ 61.92
TOTAL SPARE PARTS		\$ 30,446.00	
TOTAL LABOUR CHARGES		\$ 30,734.00	
GRAND TOTAL		\$ 61,180.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

63154

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name

: Adrian Lj

Surveyed Date

: 01/03/19

Authorised Date

:

Excess Cost

:

Liability

:

Remarks

: not Authorised, 21 Days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Please Note

: This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel: 6768 9828 for appointment.

Yours faithfully,

Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way
#07-16 AIG Building
Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/TP/0266/2019/KN

3-Apr-19

Glory Tan

1 of 1

SME 4665 A

AS COUPE 2.0 TFSI

Quantity	Description	Unit Price	Amount
<u>Parts</u> 1	Rear tyre - RH <i>tan</i>	\$ 420.00	✓ 510
		<u>\$ 420.00</u>	
<u>LABORS</u>			
	TOTAL	\$ 420.00	

For Premium Automobiles Pte Ltd

A.S. Adrian Ling 

Authorised Signature

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/TP/0266/2019/KN 3-Apr-19 Glory Tan 1 of 1 SME 4665 A A5 COUPE 2.0 TFSI
Quantity	Description	Unit Price	Amount
<u>Parts</u>			
1	Rear tyre - RH <i>to in</i>	\$ 510.00	\$ 510.00
2	Rear bumper chrome moulding <i>Not new</i>	\$ 264.00	\$ 211.20
		\$ 774.00	\$ 721.20
<u>LABORS</u>			
	TOTAL	\$ 510.00	\$ 721.20

✓ Adrian
Spoken to Alan
Alan agreed
to take out.

For Premium Automobiles Pte Ltd

Authorised Signature

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

GST Reg No. 19-9902271-W

For Premium Automobiles Pte Ltd

Adrian Ling
25/03/19.
sls

For Premium Automobiles Pte Ltd



Authorised Signature

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khal@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/TP/0266/2019/KN
Date : 28-Feb-19

Vehicle IN workshop.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Hi Adrian

28 days exclude 4 Sundays

jb - 22 Oct 19

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr. Abdul Aziz Bin Abdul Rahman
Address : Blk 536 Bedok North Street 3
#04-888
Singapore 460536
Telephone : 97994746
Type of Claim : Own Damage Claims
Policy No. : 1800116727
Vehicle No : **SME 4665 A**
Model Code : A5 COUPE 2.0 TFSI
Model / Year : 29/4/2017
Engine No : CVK 068790
Chassis No : WAUZZZF59JA134244
Mileage :
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 26-Feb-19
Place of Accident : CTE LEADING TO UPPER SERANGOON / CHANGI / PIE

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SME 4665 A

S/n	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To remove and transfer rear parking aid and rear lid kick sensor. Check function	S/N \$	360.00	\$ 360.00
2	To renew RHS 1/4 glass to facilitate fender renewal.	S/N \$	300.00	\$ 300.00
3	To remove and transfer RHS front and rear door's multi-lock sysem and power window devices. Inspect for damages.	S/N \$	560.00	\$ 560.00
4	To dislodge and reinstall rear wire harness for lights, battery manager, fuse and relay trays, electrical and audio equipment.	S/N \$	1,400.00	\$ 1,400.00
5	To remove and reinstall rear seat, back rest, hat tray, abcd pillar trims, luggage compartment trims. Dislodge roof liner and disengage curtain airbag etc.	\$	1,400.00	\$ 1,400.00
6	To dismantle rear bumper, rear lid, RHS sill panel, RHS rear outer wheel housing, RHS rear connecting plate, RHS rear bottom plate, RHS B-pillar and RHS sill panel. Renew rear bumper, RHS front door, RHS wing mirror assy, RHS rear door and RHS sill panel trim. Reorganize rear crash management components. Reinstall all parts removed. (Added 2 days for Bottom plate, wheelhouse)	\$	15,750.00	\$ 6,000.00
TOTAL LABOUR CHARGES		:	<u>\$ 19,770.00</u>	<u>\$ 10,020.00</u>

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SME 4665 A

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
	<i>c/f</i>		\$ 10,020.00
7	To respray rear bumper, RHS front door, RHS rear door, RHS rear fender, RHS wing mirror cover, hinges, RHS rear outer wheel housing, RHS rear connecting plate, RHS rear bottom plate, RHS B-pillar, RHS sill panel, RHS sill panel trim, door entrances, roof channel, drain panel and end panelling. To carry out stone chip treatment and joint sealer works. (Added \$550.00 for wheelhouse, bottom plate, chassis and luggage compartment)	\$ 10,300.00	\$ 5,000.00
8	To renew RHS rear rim and carry out wheel alignment. To inspect RHS rear suspension for further damages.	S/N \$ 280.00	\$ 280.00
9	Added labour charge - see attached	\$ 1,200.00	\$ 1,200.00
10	To carry out diagnostic check.	S/N \$ 384.00	\$ 384.00
TOTAL LABOUR CHARGES		: \$ 31,934.00	\$ 16,884.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SME 4665 A**

S/N	Parts Description	<u>Damaged Parts & Prices</u>	
		<u>S/Nett</u>	<u>Remark</u>
1	LED TAIL LIGHT - RH	\$ 1,044.00	
2	LED TAIL LIGHT TRIM- RH	\$ 27.00	
3	REAR SIDE PANEL FRAME - RH	\$ 3,432.00	\$ 2,745.60
4	REAR SIDE WINDOW - RH	\$ 653.00	\$ 522.40
5	REAR OUTER BOTTOM PLATE - RH	\$ 439.00	\$ 350.80
6	REAR OUTER WHEEL HOUSING - RH	\$ 574.00	\$ 459.20
7	REAR CONNECTING PLATE - RH	\$ 133.00	\$ 106.00
8	FRONT DOOR - RH	\$ 2,829.00	\$ 2,263.20
9	FRONT OUTER DOOR SEAL -RH	\$ 201.00	\$ 160.80
10	BONDING AGENT	\$ 45.00	
11	CLEANING SOLUTION	\$ 65.00	
12	APPLICATOR	\$ 7.00	
13	FRONT DOOR CATCH -RH	\$ 109.00	
14	FRONT DOOR CATCH COVER-RH	\$ 13.00	
15	FRONT DOOR HANDLE TRIM PLATE-RH	\$ 80.00	\$ 63.52
16	FRONT DOOR HANDLE EXTERIOR-RH	\$ 35.00	\$ 27.52
17	FRONT DOOR MOUNTING BAR-RH	\$ 149.00	\$ 118.80
18	FRONT DOOR HANDLE SENSOR-RH	\$ 208.00	\$ 166.40
19	FRONT PERIPHERAL LIGHT-RH	\$ 66.00	\$ 52.72
20	FRONT DOOR TRIM-RH	\$ 145.00	\$ 115.60
SUB TOTAL SPARE PARTS		\$ 10,254.00	\$ 7,152.56

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SME 4665 A**

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
	c/f		\$ 7,152.56
21	FRONT EXTERIOR MIRROR MOUNTING - RH	\$ 999.00	\$ 799.20
22	FRONT MIRROR CAP - RH	\$ 220.00	\$ 175.60
23	FRONT MIRROR GLASS - RH	\$ 1,553.00	\$ 1,242.40
24	FRONT MOULDING FOR ROOF - RH	\$ 574.00	
25	FRONT EDGE PROTECTIO-RH	\$ 141.00	
26	FRONT WINDOW SLOT SEAL WITH TRIM STRIP-RH	\$ 364.00	\$ 291.20
27	FRONT DOOR EXTERIOR B PILLAR TRIM-RH	\$ 247.00	
28	REAR DOOR-RH	\$ 2,829.00	\$ 2,263.20
29	REAR OUTER DOOR SEAL-RH	\$ 201.00	\$ 160.80
30	BONDING AGENT	\$ 45.00	
31	CLEANING SOLUTION	\$ 65.00	
32	APPLICATOR	\$ 7.00	
33	REAR DOOR CATCH-RH	\$ 109.00	\$ 87.20
34	REAR DOOR CATCH COVER-RH	\$ 12.00	
35	REAR DOOR HINGE HALF-RH UPPER	\$ 41.00	\$ 32.08
36	REAR DOOR HINGE HALVES-RH LOWER	\$ 42.00	\$ 33.04
37	REAR DOOR HINGE HALVES-RH	\$ 42.00	\$ 33.04
38	REAR DOOR HINGE HALF-RH LOWER	\$ 68.00	\$ 54.24
39	REAR DOOR HANDLE TRIM PLATE	\$ 80.00	\$ 63.52
40	REAR DOOR HOUSING	\$ 7.00	\$ 5.36
SUB TOTAL SPARE PARTS		\$ 7,646.00	\$ 12,393.44

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SME 4665 A**

S/N	Parts Description		Damaged Parts & Prices	
			S/Nett	Remark
		<i>c/f</i>		\$ 12,393.44
41	REAR DOOR COVER-RH		\$ 6.00	\$ 4.08
42	REAR DOOR HANDLE COVER-RH		\$ 208.00	\$ 166.40
43	REAR DOOR HANDLE EXTERIOR-RH		\$ 35.00	\$ 27.52
44	REAR DOOR HANDLE TRIM-RH		\$ 124.00	\$ 98.80
45	REAR DOOR PERIPHERAL LIGHT-RH		\$ 66.00	
46	REAR DOOR MOUNTING BAR-RH		\$ 149.00	\$ 118.80
47	REAR WINDOW REGULATOR WITHOUT MOTOR-RH		\$ 320.00	\$ 256.00
48	REAR WINDOW REGULATOR MOTOR-RH		\$ 278.00	
49	REAR DOOR CONTROL UNIT-RH		\$ 685.00	
50	REAR DOOR INNER PANEL COVER-RH		\$ 29.00	
51	REAR DOOR LOCK-RH		\$ 604.00	\$ 482.80
52	REAR WINDOW APERTURE SEAL-RH INNER		\$ 268.00	
53	REAR WINDOW SLOT SEAL WITH TRIM STRIP-RH		\$ 335.00	\$ 267.60
54	REAR DOOR TRIM PANEL WIRING HARNESS-RH		\$ 198.00	
55	REAR ALUMINIUM RIM-RH		\$ 943.00	\$ 754.40
56	RUBBER VALVE	4	\$ 13.00	
57	REAR WHEEL HOUSING LINER-RH		\$ 256.00	\$ 204.80
58	REAR WHEEL HOUSING LINER ATTACHMENT PARTS-RH		\$ 82.00	
59	REAR BUMPER		\$ 2,491.00	\$ 1,992.80
60	REAR BUMPER FIXING PARTS		\$ 150.00	
SUB TOTAL SPARE PARTS			\$ 7,240.00	\$ 16,767.44

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SME 4665 A**

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 16,767.44
61	REAR BUMPER SECURING STRIP		\$ 203.00	\$ 162.40
62	REAR BUMPER SPOILER		\$ 746.00	
63	REAR BUMPER DIFUSSER-RH		\$ 264.00	
64	REAR BUMPER TRIM-RH		\$ 37.00	
65	REAR LIGHT RELECTOR-RH		\$ 38.00	
66	REAR BUMPER GUDIE SECTION-RH		\$ 40.00	
67	REAR BUMPER UPPER GUIDE SECTIO-RH		\$ 20.00	\$ 15.92
68	REAR SENSOR-INNER/OUTER	2	\$ 462.00	
69	REAR SENSOR SEAL RING	4	\$ 12.00	
70	REAR SIDE MEMBER TRIM		\$ 794.00	\$ 634.80
71	REAR SIDE MEMBER TRIM ATTACHMENT PARTS		\$ 118.00	\$ 94.00
72	REAR SIDE MEMBER ADHESIVE TEPEs		\$ 192.00	\$ 153.20
73	ACRYLIC SEALANT	S/N	\$ 180.00	\$ 180.00
74	CAVITY WAX	S/N	\$ 140.00	\$ 140.00
75	STONE CHIP	S/N	\$ 180.00	\$ 180.00
76	METAL FILLER POWDER	S/N	\$ 280.00	\$ 280.00
77	1/4 GLASS SELANT	S/N	\$ 100.00	\$ 100.00
78	<i>Added parts - see attached</i>		\$ 774.00	\$ 721.20
80	SUNDRIES		\$ 1,500.00	\$ 61.92
	TOTAL SPARE PARTS	:	\$ 31,220.00	\$ 19,490.88
	TOTAL LABOUR CHARGES		\$ 19,770.00	\$ 16,884.00
	GRAND TOTAL		\$ 50,990.00	\$ 36,374.88

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/TP/0266/2019/KN

25-Mar-19

Glory Tan

1 of 1

SME 4665 A

A5 COUPE 2.0 TFSI

Quantity	Description	Unit Price	Amount
<u>Parts</u>			
		\$ -	
<u>LABORS</u>			
1	To place vehicle on cellete bench.	S/N \$ 1,200.00	\$ 1,200.00
TOTAL		\$ 1,200.00	\$ 1,200.00

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SME 4665 A

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/0266/2019/NH

19th February 2020

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

total pages

RE: INSURANCE CLAIM FOR SME 4665 A, Audi A5 SB 2.0 TFSI S-TRONIC.

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

With reference to the above-mentioned vehicle, no. **SME 4665 A**, claimant, **Mr. Abdul Aziz Bin Abdul Rahman**, please find the related document per attached.

1. A copy of the Original invoice no. 85014854 – S\$ 37,839.14.
2. A copy of the Discharge Voucher duly signed by client.

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept

Encl
AIG – SME 4665 A

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6388 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 1 10:10

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014854 Date : 18/02/2020 Order : SME4665A Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	--	--

Regn No: SME4665A (V 39465) Regn Date: 28/09/2018 Mileage: 14938 WIP No.: 44250

Model: A5 SPORTBACK 2.0 TFSI S tronic Chassis: WAUZZZF59JA134244 Engine: CVK 068790 Dept: U

You have been assisted by :- UB-Tony Foong (33)

		Details	Qty	Unit Price	Amount
Q	EXC	M: 8888 Insurance Excess/Liability	-800.00	1.00	-800.00
S	BODYWORK	M: TO REMOVE AND TRANSFER REAR PARKING AID AND REAR LID KICK SENSOR.CHECK FUNCTION.	360.00	1.00	360.00
S	BODYWORK	M: TO RENEW RHS 1/4 GLASS TO FACILITATE FENDER RENEWAL	300.00	1.00	300.00
S	BODYWORK	M: TO REMOVE AND TRANSFER RHS FRONT AND REAR DOOR'S MULTI LOCL SYSTEM AND POWER WINDOW DEVICES.INSPECT FOR DAMAGE	560.00	1.00	560.00
S	BODYWORK	M: TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS,BATTERY MANAGER,FUSE AND RELAY TRAYS,ELECTRICAL AND AUDIO EQUIPMENT	1400.00	1.00	1,400.00
S	BODYWORK	M: TO REMOVE AND REINSTALL REAR SEAT,BACK REST, HAT TRAY,ABCD PILLAR TRIM,LUGGAGE COMPARTMENT TRIMS.DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAG	1400.00	1.00	1,400.00
S	BODYWORK	M: TO DISMANTLE REAR BUMPER,REAR LID,RHS SILL PANEL, RHS REAR OUTER WHEEL HOUSING,RHS REAR CONNECTING PLATE,REAR BOTTOM PLATE,RHS B PILLAR AND SILL PANE RENEW REAR BUMPER,RHS FRONT DOOR,RHS WING MIRROR ASSY,RHS REAR DOOR AND SILL PANEL.REORGANISE CRASH MANAGEMENT COMPONENTS.REINSTALL ALL PARTS REMOVED	6000.00	1.00	6,000.00
S	BODYWORK	M: TO RESPRAY REAR BUMPER,RHS FRONT DOOR,RHS REAR DOOR,RHS REAR FENDER,RHS WING MIRROR COVER,RHS REAR OUTER WHEEL HOUSING,RHS REAR CONNECTING PLATE,RHS REAR BOTTOM PLATE,RHS B PILLAR,RHS SILL PANEL AND RHS SILL PANEL TRIM.TO CARRY	5000.00	1.00	5,000.00

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6475 1023

Ubi Service Centre
65 Ubi Road 1
Singapore 408699
Main Telephone 6386 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6386 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 2 10:10

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014854 Date : 18/02/2020 Order : SME4665A Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	--	--

Regn No: SME4665A (V 39465)	Regn Date: 28/09/2018	Mileage: 14938	WIP No.: 44250
Model: A5 SPORTBACK 2.0 TFSI S tronic	Chassis: WAUZZZF59JA134244	Engine: CVK 068790	Dept: U
You have been assisted by :- UB-Tony Poong (33)			

		Details	Qty	Unit Price	Amount
S	BODYWORK	OUT STONE CHIP TREATMENT AND JOINT SEALER WORK M: TO RENEW RHS REAR RIM AND TYRE. TO CARRY OUT WHEEL ALIGNMENT AND INSPECT RHS REAR SUSPENSION FOR FURTHER DAMAGES	280.00	1.00	280.00
S	BODYWORK	M: TO CARRY OUT DIAGNOSTIC CHECK	384.00	1.00	384.00
S	BODYWORK	M: TO SUPPLY ACRYLIC SEALANT,CAVITY WAX, STONE CHIP,METAL FILLER POWDER AND 1/4 GLASS SEALANT	880.00	1.00	880.00
S	BODYWORK	M: TO PLACE VEHICLE ON CELLETE BENCH	1200.00	1.00	1,200.00
X	A8W8810076	(A) (G)FRAME 07/03/19 Less 020%	1.00	3432.00	2,745.60
X	A8W8845298F NVB	SIDE WINDO Less 020%	1.00	653.00	522.40
X	A8W0802090A	(V) (G)FLOOR PAN 07/0 Less 020%	1.00	438.50	350.80
X	A8W6809410TA	(V) (G)HOUSING 08/03/ Less 020%	1.00	574.00	459.20
X	A8W6809424	(V) (G)PLATE 07/03/19 Less 020%	1.00	132.50	106.00
X	A8W8831052F	DOOR Less 020%	1.00	2829.00	2,263.20
X	A8W8837911	SEAL Less 020%	1.00	201.00	160.80
X	AWHT003237	BOLT Less 020%	2.00	1.00	1.60
X	AWHT003497	BOLT Less 020%	1.00	2.10	1.68
X	A8W2837240D GRU	TRIM Less 020%	1.00	79.40	63.52
X	A8W0837206	HANDLE Less 020%	1.00	34.40	27.52
X	A8W2837812A	(A) (G)SUPPORT 07/03/ Less 020%	1.00	148.50	118.80
X	A8W0927754	(A) (SK)SENSOR 07/03/ Less 020%	2.00	208.00	332.80
X	A8W0947134	LIGHT Less 020%	1.00	65.90	52.72
X	A8W6853604A PUZ	TRIM Less 020%	1.00	144.50	115.60
X	A8W8857410M 9B9	MOUNTING Less 020%	1.00	999.00	799.20
X	A8W0857528 GRU	CAP Less 020%	1.00	219.50	175.60
X	A8W0857536H	(A) (SK)MIRROR 07/03/ Less 020%	1.00	1553.00	1,242.40
X	A8W8853284 2ZE	(A) (G)WINDOW SLO 07/ Less 020%	1.00	364.00	291.20
X	A8W8833052J	DOOR Less 020%	1.00	2829.00	2,263.20
X	A8W8839912	SEAL Less 020%	1.00	201.00	160.80

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6388 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6386 2223
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 3 10:10

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014854 Date: 18/02/2020 Order: SME4665A Term: 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	--

Regn No: SME4665A (V 39465)	Regn Date: 28/09/2018	Mileage: 14938	WIP No.: 44250
Model: A5 SPORTBACK 2.0 TFSI S tronic	Chassis: WAUZZZF59JA134244	Engine: CVK 068790	Dept: U
You have been assisted by :- UB-Tony Foong (33)			

		Details	Qty	Unit Price	Amount
X	ABW8839249	CHECK ROD	Less 020%	1.00	109.00
X	ABX4833408A	(A) (SK)HINGE 07/03/1	Less 020%	1.00	40.10
X	ABW0833406A	(A) (SK)HINGE 07/03/1	Less 020%	1.00	41.30
X	ABW0831404A	(A) (G)HINGE 07/03/19	Less 020%	1.00	41.30
X	ABW8833404A	(A) (G)HINGE 07/03/19	Less 020%	1.00	67.80
X	ABW0837240B GRU	TRIM	Less 020%	1.00	79.40
X	ABW0837167	HOUSING	Less 020%	1.00	6.70
X	ABW0837878	COVER	Less 020%	1.00	5.10
X	ABW0837206	(A) (SK)HANDLE 07/03/	Less 020%	1.00	34.40
X	ABW0837900A	TRIM	Less 020%	1.00	123.50
X	ABW0837812A	SUPPORT	Less 020%	1.00	148.50
X	ABW8839462	REGULATOR	Less 020%	1.00	320.00
X	A4G0839016H	LATCH	Less 020%	1.00	603.50
X	ABW8853764 2ZZ	(V) (SK)WINDOW SLO 26	Less 020%	1.00	334.50
X	ABW0601025AL	RIM 19" V85	Less 020%	1.00	943.00
X	ABW6810172A	(A) (SK)WHEEL HOUS 07	Less 020%	1.00	256.00
X	ABW6807067AAGRU	(A) (SK)COVER 07/03/1	Less 020%	1.00	2491.00
X	ABW6807900	(A) (G)STRIP 07/03/19	Less 020%	1.00	203.00
X	ABW6807838	(A) (SK)TRIM 07/03/19	Less 020%	1.00	36.20
X	ABW6945106B	(A) (SK)REFLECTOR 07/	Less 020%	1.00	37.10
X	ABW6807890	GUIDE	Less 020%	1.00	19.90
X	ABW8853856A GRU	TRIM	Less 020%	1.00	793.50
X	ABW6898909	SECUR.SET	Less 020%	1.00	117.50
X	ABW6898909A	ADHES.TAPE	Less 020%	1.00	191.50
X	EC245/40R18CSCS	CONTI SPORT CONTACT	1.00	510.00	510.00

Parts 18,399.68
Labour 0.00
Sublet 17,764.00
Menus 0.00
Lubricant 0.00

Sub-Total 35,363.68

7% GST 2,475.46

Grand Total 37,839.14



Received by

For & on behalf of
Premium Automobiles Pte Ltd

Premium Automobiles

Telefax

to **AIG Asia Pacific Insurance Pte Ltd**
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SME 4665 A

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/0266/2019/KK
6 April 2019

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

1 total pages

RE: CLAIM – OWNER'S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi A5 COUPE 2.0 TFSI
Vehicle Chassis No. : WAUZZZF59JA134244
Vehicle Regn No. : **SME 4665 A**
Vehicle Mileage : 11522 KM
Vehicle Owner : Mr. Abdul Aziz Bin Abdul Rahman
Certificate No : 1800116727
Own Damage Excess : \$856.00 (Inclusive 7%GST)
Accident Date : 26/2/2019
Place : CTE Leading To Upper Serangoon/Changi/PIE
Repair Cost : \$ 37,839.14
WIP No. : 44250
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature : Chy
Time : 1026 hrs
Date : 06 apr 2019

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	01 Mar 2019		04 Mar 2019 13:24 Edit Adj Rpt	\$336,163.68 Edit Estimates	\$336,163.68 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured:	ABDUL AZIZ BIN ABDUL RAHMAN, ID: S1643580E, Tel: +6597994746, Email: AAZIZ.ARAHMAN@GMAIL.COM								
Vehicle Reg. No.:	SME4665A		Date of Loss:	26/02/2019 17:00 - :59 [4 Months and 29 Days From LTA Reg Date (Man Yr)]					
Claim Type:	OD / 7787554511SG		Policy/Cover Note No.:	(Comprehensive)					
			Excess:	\$800.00					
Reparer:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911								
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Yap, Weijoe] Weijoe.Yap@aig.com								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 13/03/2019]								
Driver/Custodian:	ABDUL AZIZ BIN ABDUL RAHMAN (54 / Male) , NRIC: S1643580E, Tel: +6597994746 Email: AAZIZ.ARAHMAN@GMAIL.COM								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
- AIG_SG (21/01/2020): Alert - Adj Mandate Approved (\$336163.68) - SME4665A - Claim Handler: Yap, Weijoe... - AIG_SG (08/04/2019): Alert - Adj Mandate Approved (\$335767.00) - SME4665A - Claim Handler: Mohd Zaway... - AIG_SG (04/04/2019): Alert - Adj Mandate Maintained - SME4665A - Claim Handler: Mohd Zaway, Norsazan... - AIG_SG (05/03/2019): Alert - Adj Mandate Approved (\$34147.00) - SME4665A - Claim Handler: Mohd Zaway... - AIG_SG (05/03/2019): SME4665A / OD / 26/02/2019 / Coverage & Excess update									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SME4665A (7787554511SG)
 OD
 Feb 26 2019 5:00PM
 [ABDUL AZIZ BIN ABDUL RAHMAN]
 Premium Automobiles Pte Ltd

Upload Documents			Upload Photos			Compose New Letter			Upload Video			Upload Audio			View View in Browser		
Video															1 per page		☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)												Thumbnail		Print	
1	27/02/19 11:41	Video - Accident [Linked Accident Report Documents]													Load MP4		
2	27/02/19 11:41	Video - Accident [Linked Accident Report Documents]													Load MP4		
Assessment Reports															1 per page		☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)												Thumbnail		Print	
1	04/03/19 15:11	Adjuster Immediate Advice													Load HTM		
2	26/03/19 09:24	Adjuster Immediate Advice													Load HTM		
3	08/04/19 09:04	Adjuster Immediate Advice													Load HTM		
Photos/Images															3 per page		☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)												Thumbnail		Print	
1	04/03/19 15:14	General View													Load JPG	☒	
2	04/03/19 15:14	Chassis Number													Load JPG	☒	
3	04/03/19 15:14	General View													Load JPG	☒	
4	04/03/19 15:14	General View													Load JPG	☒	
5	04/03/19 15:14	General View													Load JPG	☒	
6	04/03/19 15:14	General View													Load JPG	☒	
7	04/03/19 15:14	General View													Load JPG	☒	
8	04/03/19 15:14	General View													Load JPG	☒	
9	04/03/19 15:14	General View													Load JPG	☒	
10	04/03/19 15:14	General View													Load JPG	☒	
11	04/03/19 15:14	General View													Load JPG	☒	
12	04/03/19 15:14	General View													Load JPG	☒	
13	04/03/19 15:14	General View													Load JPG	☒	
14	04/03/19 15:14	General View													Load JPG	☒	
15	04/03/19 15:14	General View													Load JPG	☒	
16	04/03/19 15:14	General View													Load JPG	☒	
17	04/03/19 15:14	General View													Load JPG	☒	
18	04/03/19 15:14	General View													Load JPG	☒	
19	04/03/19 15:14	General View													Load JPG	☒	
20	04/03/19 15:14	General View													Load JPG	☒	
21	04/03/19 15:14	General View													Load JPG	☒	
22	04/03/19 15:14	General View													Load JPG	☒	
23	04/03/19 15:14	General View													Load JPG	☒	
24	04/03/19 15:14	General View													Load JPG	☒	
25	04/03/19 15:14	General View													Load JPG	☒	
26	04/03/19 15:14	General View													Load JPG	☒	
27	04/03/19 15:14	General View													Load JPG	☒	
28	04/03/19 15:14	General View													Load JPG	☒	

Video			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
29	04/03/19 15:14	General View	 Load JPG	☒
30	04/03/19 15:14	General View	 Load JPG	☒
31	25/03/19 18:00	Reinspection Photo	 Load JPG	☒
32	25/03/19 18:00	Reinspection Photo	 Load JPG	☒
33	25/03/19 18:00	Reinspection Photo	 Load JPG	☒
34	25/03/19 18:00	Reinspection Photo	 Load JPG	☒
35	25/03/19 18:00	Reinspection Photo	 Load JPG	☒
36	25/03/19 18:00	Reinspection Photo	 Load JPG	☒
37	25/03/19 18:00	Reinspection Photo	 Load JPG	☒
38	25/03/19 18:00	Reinspection Photo	 Load JPG	☒
39	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
40	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
41	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
42	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
43	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
44	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
45	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
46	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
47	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
48	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
49	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
50	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
51	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
52	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
53	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
54	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
55	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
56	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
57	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
58	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
59	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
60	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
61	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
62	25/03/19 18:01	Reinspection Photo	 Load JPG	☒
63	08/04/19 09:05	Reinspection Photo	 Load JPG	☒
64	08/04/19 09:05	Reinspection Photo	 Load JPG	☒
65	08/04/19 09:05	Reinspection Photo	 Load JPG	☒
66	08/04/19 09:05	Reinspection Photo	 Load JPG	☒
67	08/04/19 09:05	Reinspection Photo	 Load JPG	☒
68	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
69	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
70	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
71	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
72	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
73	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
74	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
75	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
76	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
77	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
78	24/10/19 09:48	Reinspection Photo	 Load JPG	☒

Video			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
79	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
80	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
81	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
82	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
83	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
84	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
85	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
86	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
87	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
88	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
89	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
90	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
91	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
92	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
93	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
94	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
95	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
96	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
97	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
98	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
99	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
100	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
101	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
102	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
103	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
104	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
105	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
106	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
107	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
108	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
109	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
110	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
111	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
112	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
113	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
114	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
115	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
116	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
117	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
118	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
119	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
120	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
121	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
122	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
123	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
124	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
125	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
126	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
127	24/10/19 09:48	Reinspection Photo	 Load JPG	☒
128	24/10/19 09:48	Reinspection Photo	 Load JPG	☒

Video			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
Documentation			1 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	04/03/19 15:12	SME 4665A GIA.pdf		Load PDF
2	04/03/19 15:12	DRIVING & CI.pdf		Load PDF
3	04/03/19 15:12	ESTIMATE.pdf		Load PDF
4	08/04/19 09:05	SUPPLEMENTARY.pdf		Load PDF
5	23/12/19 14:18	ESTIMATE & SUPP MARKED.pdf		Load PDF
6	28/02/20 16:58	Workshop Invoice		Load PDF
7	28/02/20 16:58	Discharge Voucher		Load PDF

Linked Accident Report Documents

Video			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	27/02/19 11:41	Video - Accident		Load MP4
2	27/02/19 11:41	Video - Accident		Load MP4
Assessment Reports			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	27/02/19 12:09	Addendum Sheet		Load JPG ☒
2	03/09/19 23:47	Accident Statement		Load HTM
3	03/09/19 23:47	Accident Statement		Load HTM
Photos/Images			3 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	27/02/19 11:50	Accident Photo		Load JPG ☒
2	27/02/19 11:50	Accident Photo		Load JPG ☒
3	27/02/19 11:50	Accident Photo		Load JPG ☒
4	27/02/19 11:50	Accident Photo		Load JPG ☒
5	27/02/19 11:50	Accident Photo		Load JPG ☒
6	27/02/19 11:50	Accident Photo		Load JPG ☒
7	27/02/19 11:50	Accident Photo		Load JPG ☒
8	27/02/19 11:50	Accident Photo		Load JPG ☒
9	27/02/19 11:50	Accident Photo		Load JPG ☒
10	27/02/19 11:50	Accident Photo		Load JPG ☒
11	27/02/19 11:50	Accident Photo		Load JPG ☒
12	27/02/19 11:50	Accident Photo		Load JPG ☒
13	27/02/19 11:50	Accident Photo		Load JPG ☒
14	27/02/19 11:50	Accident Photo		Load JPG ☒
15	27/02/19 11:50	Accident Photo		Load JPG ☒
16	27/02/19 11:50	Accident Photo		Load JPG ☒
17	27/02/19 12:14	ACCIDENT SCENE PHOTO		Load JPG ☒
18	27/02/19 12:14	ACCIDENT SCENE PHOTO		Load JPG ☒
Documentation			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	27/02/19 11:51	Sketch Plan		Load JPG ☒
2	27/02/19 11:51	Sketch Plan #2		Load JPG ☒

Documents Checklist

DOCUMENTS CHECKLIST

Reset Save Print

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co. Reg. No. 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #08-16
Singapore 079120

Our File No: CC3/AIG19003926/ASD3E2

Date: 28/02/2020

REFERENCE

Insured/Claimant: ABDUL AZIZ BIN ABDUL RAHMAN

Policy No:

Date of Loss: 26/02/2019

Nature of Claim: OD Claim No: 7787554511SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SME4665A

Make & Model: AUDI A5, 2.0 SPORTBACK (A)

Engine No: CVK068790

Reg. Date: 28/09/2018 (Man. Year: 2018)

Chassis No: WAUZZZF59JA134244

Colour: Black

Odometer: 11322 km

Engine Capacity: 1984 cc

Market Value/New Car Price: S\$155,000.00

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 245/40 R18

Rear Tyre Size: 245/40 R18

Front Left Side: Continental 6 mm

Rear Left Side: Continental 6 mm

Front Right Side: Continental 6 mm

Rear Right Side: Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	31,220.00	19,279.68	11,940.32	38.25
Miscellaneous Items	0.00	0.00	0.00	
Labour	31,934.00	16,884.00	15,050.00	47.13
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	63,154.00	36,163.68	26,990.32	42.74
- Excess (S\$)	800.00	800.00	0.00	0.00
(S\$)	62,354.00	35,363.68	26,990.32	43.29
+ GST 7.00/7.00% (S\$)	4,364.78	2,475.46	1,889.32	43.29
Nett Amount (S\$)	66,718.78	37,839.14	28,879.64	43.29

INSPECTION

Date of Assignment: 04/03/2019

Date Inspected: 01/03/2019 Inspected At:

Premium Automobiles Pte Ltd (UBI)
55 Ubi Road 1
Singapore 408699

Estimated Period of Repair: 24.0 days

Adjuster: ADRIAN LING

Manager: Hiew May Fung

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*LED TAIL LIGHT - RH	Not Necessary	1,044.00 FS	*- FS
2	1		*LED TAIL LIGHT TRIM - RH	Not Necessary	27.00 FS	*- FS
3	1		*REAR SIDE PANEL FRAME - RH	Distorted	3,432.00 FS	*2,745.60 FS
4	1		*REAR SIDE WINDOW - RH	Necessary	653.00 FS	*522.40 FS
5	1		*REAR OUTER BOTTOM PLATE - RH	Distorted	439.00 FS	*350.80 FS
6	1		*REAR OUTER WHEEL HOUSING - RH	Distorted	574.00 FS	*459.20 FS
7	1		*REAR CONNECTING PLATE - RH	Distorted	133.00 FS	*106.00 FS
8	1		*FRONT DOOR - RH	Dented	2,829.00 FS	*2,263.20 FS
9	1		*FRONT OUTER DOOR SEAL - RH	Necessary	201.00 FS	*160.80 FS
10	1		*BONDING AGENT	Not Necessary	45.00 FS	*- FS
11	1		*CLEANING SOLUTION	Not Necessary	65.00 FS	*- FS
12	1		*APPLICATOR	Not Necessary	7.00 FS	*- FS
13	1		*FRONT DOOR CATCH - RH	Not Necessary	109.00 FS	*- FS
14	1		*FRONT DOOR CATCH COVER - RH	Not Necessary	13.00 FS	*- FS
15	1		*FRONT DOOR HANDLE TRIM PLATE - RH	Cut	80.00 FS	*63.52 FS
16	1		*FRONT DOOR HANDLE EXTERIOR - RH	Cut	35.00 FS	*27.52 FS
17	1		*FRONT DOOR MOUNTING BAR - RH	Damaged	149.00 FS	*118.80 FS
18	1		*FRONT DOOR HANDLE SENSOR - RH	Damaged	208.00 FS	*166.40 FS
19	1		*FRONT PERIPHERAL LIGHT - RH	Damaged	66.00 FS	*52.72 FS
20	1		*FRONT DOOR TRIM - RH	Necessary	145.00 FS	*115.60 FS
21	1		*FRONT EXTERIOR MIRROR MOUNTING - RH	Damaged	999.00 FS	*799.20 FS
22	1		*FRONT MIRROR CAP - RH	Missing	220.00 FS	*175.60 FS
23	1		*FRONT MIRROR GLASS - RH	Missing	1,553.00 FS	*1,242.40 FS
24	1		*FRONT MOULDING FOR ROOF - RH	Not Necessary	574.00 FS	*- FS
25	1		*FRONT EDGE PROTECTION - RH	Not Necessary	141.00 FS	*- FS
26	1		*FRONT WINDOW SLOT SEAL WITH TRIM STRIP - RH	Cut	364.00 FS	*291.20 FS
27	1		*FRONT DOOR EXTERIOR B PILLAR TRIM - RH	Not Necessary	247.00 FS	*- FS
28	1		*REAR DOOR - RH	Distorted	2,829.00 FS	*2,263.20 FS
29	1		*REAR OUTER DOOR SEAL - RH	Necessary	201.00 FS	*160.80 FS
30	1		*BONDING AGENT	Not Necessary	45.00 FS	*- FS
31	1		*CLEANING SOLUTION	Not Necessary	65.00 FS	*- FS
32	1		*APPLICATOR	Not Necessary	7.00 FS	*- FS
33	1		*REAR DOOR CATCH - RH	Damaged	109.00 FS	*87.20 FS
34	1		*REAR DOOR CATCH COVER - RH	Not Necessary	12.00 FS	*- FS
35	1		*REAR DOOR HINGE HALF - RH UPPER	Bent	41.00 FS	*32.08 FS
36	1		*REAR DOOR HINGE HALVES - RH LOWER	Bent	42.00 FS	*33.04 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
37	1		*REAR DOOR HINGE HALVES - RH	Bent	42.00 FS	*33.04 FS
38	1		*REAR DOOR HINGE HALF - RH LOWER	Bent	68.00 FS	*54.24 FS
39	1		*REAR DOOR HANDLE TRIM PLATE	Cut	80.00 FS	*63.52 FS
40	1		*REAR DOOR HOUSING	Necessary	7.00 FS	*5.36 FS
41	1		*REAR DOOR COVER - RH	Necessary	6.00 FS	*4.08 FS
42	1		*REAR DOOR HANDLE COVER - RH	Cut	208.00 FS	*166.40 FS
43	1		*REAR DOOR HANDLE EXTERIOR - RH	Cut	35.00 FS	*27.52 FS
44	1		*REAR DOOR HANDLE TRIM - RH	Cut	124.00 FS	*98.80 FS
45	1		*REAR DOOR PERIPHERAL LIGHT - RH	Not Necessary	66.00 FS	*- FS
46	1		*REAR DOOR MOUNTING BAR - RH	Damaged	149.00 FS	*118.80 FS
47	1		*REAR WINDOW REGULATOR WITHOUT MOTOR - RH	Damaged	320.00 FS	*256.00 FS
48	1		*REAR WINDOW REGULATOR MOTOR - RH	Not Necessary	278.00 FS	*- FS
49	1		*REAR DOOR CONTROL UNIT - RH	Not Necessary	685.00 FS	*- FS
50	1		*REAR DOOR INNER PANEL COVER - RH	Not Necessary	29.00 FS	*- FS
51	1		*REAR DOOR LOCK - RH	Damaged	604.00 FS	*482.80 FS
52	1		*REAR WINDOW APERTURE SEAL - RH INNER	Not Necessary	268.00 FS	*- FS
53	1		*REAR WINDOW SLOT SEAL WITH TRIM STRIP - RH	Necessary	335.00 FS	*267.60 FS
54	1		*REAR DOOR TRIM PANEL WIRING HARNESS - RH	Not Necessary	198.00 FS	*- FS
55	1		*REAR ALUMINIUM RIM - RH	Cut	943.00 FS	*754.40 FS
56	4		*RUBBER VALVE	Not Necessary	13.00 FS	*- FS
57	1		*REAR WHEEL HOUSING LINER - RH	Torn	256.00 FS	*204.80 FS
58	1		*REAR WHEEL HOUSING LINER ATTACHMENT PARTS - RH	Not Necessary	82.00 FS	*- FS
59	1		*REAR BUMPER	Distorted	2,491.00 FS	*1,992.80 FS
60	1		*REAR BUMPER FIXING PARTS	Not Necessary	150.00 FS	*- FS
61	1		*REAR BUMPER SECURING STRIP	Necessary	203.00 FS	*162.40 FS
62	1		*REAR BUMPER SPOILER	Not Necessary	746.00 FS	*- FS
63	1		*REAR BUMPER DIFUSSER - RH	Not Necessary	264.00 FS	*- FS
64	1		*REAR BUMPER TRIM - RH	Not Necessary	37.00 FS	*- FS
65	1		*REAR LIGHT REFLECTOR - RH	Not Necessary	38.00 FS	*- FS
66	1		*REAR BUMPER GUIDE SECTION - RH	Not Necessary	40.00 FS	*- FS
67	1		*REAR BUMPER UPPER GUIDE SECTION - RH	Damaged	20.00 FS	*15.92 FS
68	2		*REAR SENSOR - INNER / OUTER	Not Necessary	462.00 FS	*- FS
69	4		*REAR SENSOR SEAL RING	Not Necessary	12.00 FS	*- FS
70	1		*REAR SIDE MEMBER TRIM	Torn	794.00 FS	*634.80 FS
71	1		*REAR SIDE MEMBER TRIM ATTACHMENT PARTS	Necessary	118.00 FS	*94.00 FS
72	1		*REAR SIDE MEMBER ADHESIVE TEPEs	Necessary	192.00 FS	*153.20 FS
73	1		*ACRYLIC SEALANT	Necessary	180.00 FS	*180.00 FS
74	1		*CAVITY WAX	Necessary	140.00 FS	*140.00 FS
75	1		*STONE CHIP	Necessary	180.00 FS	*180.00 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
76	1		*METAL FILLER POWDER	Necessary	280.00 FS	*280.00 FS
77	1		*1/4 GLASS SEALANT	Necessary	100.00 FS	*100.00 FS
78	1		*SUNDRIES	Necessary	1,500.00 FS	*61.92 FS
79	1		*REAR TYRE - RH	Torn	510.00 FS	*510.00 FS
80	1		*REAR BUMPER CHROME MOULDING	Not Necessary	264.00 FS	*- FS

F=Franchise part. S=SpcNett.

Total Parts (S\$)	31,220.00	19,279.68
--------------------------	------------------	------------------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND TRANSFER REAR PARKING AID AND REAR LID KICK SENSOR. CHECK FUNCTION	New	360.00	360.00
2	TO RENEW RHS 1/4 GLASS TO FACILITATE FENDER RENEWAL	New	300.00	300.00
3	TO REMOVE AND TRANSFER RHS FRONT AND REAR DOORS MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES	New	560.00	560.00
4	TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT	New	1,400.00	1,400.00
5	TO REMOVE AND REINSTALL REAR SEAT, BACK REST, HAT TRAY, ABCD PILLAR TRIMS, LUGGAGE COMPARTMENT TRIMS. DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAG ETC	New	1,400.00	1,400.00
6	TO DISMANTLE REAR BUMPER, REAR LID, RHS SILL PANEL, RHS REAR OUTER WHEEL HOUSING, RHS REAR CONNECTING PLATE, RHS REAR BOTTOM PLATE, RHS B-PILLAR AND RHS SILL PANEL. RENEW REAR BUMPER, RHS FRONT DOOR, RHS WING MIRROR ASSY, RHS REAR DOOR AND RHS SILL PANEL TRIM. RE-ORGANIZE REAR CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	15,750.00	6,000.00
7	TO RESPRAY REAR BUMPER, RHS FRONT DOOR, RHS REAR DOOR, RHS REAR FENDER, RHS WING MIRROR COVER, HINGES, RHS REAR OUTER WHEEL HOUSING, RHS REAR CONNECTING PLATE, RHS REAR BOTTOM PLATE, RHS B-PILLAR, RHS SILL PANEL, RHS SILL PANEL TRIM, DOOR ENTRANCES, ROOF CHANNEL, DRAIN PANEL AND END PANELLING. TO CARRY OUT STONE CHIP TREATMENT AND JOINT SEALER WORKS	New	10,300.00	5,000.00
8	TO RENEW RHS REAR RIM AND CARRY OUT WHEEL ALIGNMENT. TO INSPECT RHS REAR SUSPENSION FOR FUTHER DAMAGES	New	280.00	280.00
9	TO CARRY OUT DIAGNOSTIC CHECK	New	384.00	384.00
10	TO PLACE VEHICLE ON CELLETE BENCH	New	1,200.00	1,200.00
Gross Labour Cost (S\$)			31,934.00	16,884.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >