

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


Policyholder's Signature

Date & Time: 28/2/19

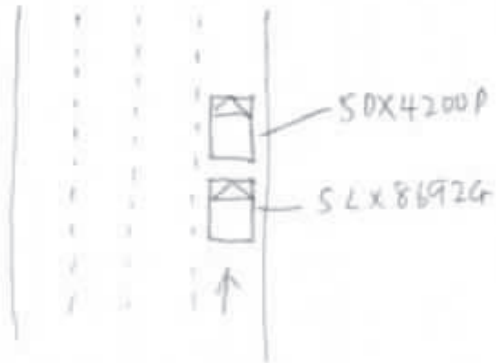

Driver's Signature

(If driver is not the policyholder)
Date & Time: 28/2/19


Reporting Centre Personnel's Signature

Name: Way Fei
NRIC/FIN No.: 62044078

SKETCH PLAN



DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I accidentally collided with the car in front of me when the car e-brake suddenly.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature _____

Date & Time: 23/2/19

4.53a.

Driver's Signature: _____

(If driver is not the policyholder)

Date & Time: 29/2/17

9.509.171



Reporting Centre Personnel's Signature _____

Name: Tina Fajal

NRIC/FIN No.: 67208-01

Accident Photo





CERTIFICATE OF INSURANCE

AUDI AUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder	: NG TZE KWOK, BENJAMIN (HUANG ZHIGUO, BENJAMIN)	Vehicle No.	: SLX8692G
Period of Insurance	: 14 Apr 2018 To 13 Apr 2020	Policy No.	: 1800038355
Engine No.	: CHZ 678168	Endorsement No.	:
Chassis No.	: WAUZZZ8V3JA087063	Issued Date	: 18 Apr 2018

ABOUT THE COVER

Make/Model	: AUDI A3 Sportback 1.0 TFSI S tronic		
Engine Capacity/Tonnage	: 999.00 CC	Sum Insured	: Market Value
Driver Restriction	: NA	Off Peak Car	: No
		First Year of Registration	: 2018
		Insuring with COE/PARF	: Yes

Person or Classes of Persons Entitled to Drive* :

a) The Policyholder
b) Any other person who is driving on the Policyholder's order or with his/her permission.
This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.
You have to pay an additional sum of \$3,000 as "Inexperienced Driver Excess" ("IDR") if You are or Your Authorised Driver (named or unnamed) has less than 2 years' driving experience.

Age Condition : 30 years old and above

Limitation as to use* :

Use only for social, domestic and pleasure purposes and for the Policyholder's business.
This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1800cc - 2000cc Optional

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

EXCESS

Section 1
Fire - \$0 Own Damage - \$600 Theft - \$0 Flood Cover - \$0

Section 2
Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

NG TZE KWOK, BENJAMIN (HUANG ZHIGUO, BENJAMIN) - \$600 (Own Damage)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

1. Audi Customer Service Center Add: 55 Ubi Road 1 Singapore 408699 63662323

For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.com.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: MALAYAN BANKING BERHAD

I/We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles(Third Party Risks and Compensation) Act (Cap. 189), Part IV of the Road Transport Act, 1987 (Malaysia) and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia).

0504125275

PREMIUM LEASING -EBC

281 ALEXANDRA ROAD AUDI CUSTOMER SERVICE CENTRE

SINGAPORE 159938

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.


AIG Asia Pacific Insurance Pte. Ltd.
AUTHORISED REPRESENTATIVE

Steffany Loh



Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0269/2019/GW
Date : 1-Mar-19

Vehicle IN workshop.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr. Ng Tze Kwok, Ben Jamin
Address : Blk 7 Tampines Avenue 8
#01 -09
Singapore 529597
Telephone : 97762367
Type of Claim : Own Damage Claims
Policy No. : 1800038355
Vehicle No : **SLX 8692 G**
Model Code : A3 SB 1.0 TFSI
Model / Year : 14/4/2018
Engine No : CHZ 678168
Chassis No : WAUZZZ8V3JA087063
Mileage :
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 28-Feb-19
Place of Accident : PIE Tuas 12.6KM L1

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLX 8692 G

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
1	To tow and recovery vehicle from scene of accident.	S/N WAIVE	✓
2	To carry out first measurement test on car O-liner.	S/N \$ 800.00	? X
3	To remove, check and reinstall front wire harness for headlights, horns, outside temperature sensor and headlight washer assy.	S/N \$ 360.00	✓
4	To remove and transfer both front door's multi-lock system and power window devices. Inspect for damages and renew if necessary.	S/N \$ 560.00	X
5	To remove and renew air condenser, radiator and additional radiator. Check electrical fans and control unit. Pressurise cooling system. To carry out vacuum and regas.	S/N \$ 1,200.00	✓
6	To remove center console, instrument panels and clusters. Rene dashboard, both frontal airbags, slip ring. Transfer old fittings. Renew seat belts and control unit, pillar trims, roof lining, both curtain air bags and knee airbag.	S/N \$ 3,600.00	✓
SUB-TOTAL LABOUR CHARGES		: \$ 6,520.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLX 8692 G

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
7	To renew front windscreen.	S/N \$ 480.00 ✓	
8	To remove and reinstall engine assy with gearbox assy to facillitate car -o-liner repairs.	S/N \$ 2,800.00 ? X	
9	To remove and reinstall front suspension assy with subframe to facillitate car -oliner repairs. Inspect for damages and renew if necessary .	S/N \$ 2,400.00 ? X	
10	To place vehicle on car- o-liner.	S/N \$1,800.00 ? X	
11	To dismantle and renew front bumper, bonnet and both front fenders, both headlights and both front doors. Cut out and reweld lhs fender support and closing element. Align both front chassis frames to specification of origin. Renew front lock carrier and align to position. re-organise front crash management components. reinsall all parts removed.	\$10,200.00 4500 3500	Excluding Engine Bay.
12	✓ To respray front bumper, both front fenders, bonnet, hinges, both upper A-pillar, lhs fender top support, both front doors and engine compartment. ✓ To carry out joint sealant work and stone chip treatment.	4815. \$7,700.00	8 x 550 = 4400. Fender Top Support & 275 Hinge x 2 = 200.
SUB-TOTAL LABOUR CHARGES		: \$ 25,380.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLX 8692 G

S/n	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
13	To carry out wheel alignment.	S/N	\$240.00	? X
14	To carry out diagnostic check.	S/N	\$384.00	✓
TOTAL LABOUR CHARGES		:	<u>\$32,524.00</u>	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLX 8692 G

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	FRONT BUMPER <i>Distorted</i>	\$ 1,698.00 ✓	1358.80
2	FRONT BUMPER FIXING PARTS <i>new</i>	\$ 170.00 ✗	
3	FRONT BUMPER GUIDE SECTION-LH/RH <i>new Damaged 2</i>	\$ 70.00 ✗	55.04 ✓
4	FRONT BUMPER GRILLE-CENTER <i>Not New</i>	\$ 146.00 ✗	
5	FRONT BUMPER CLOSING ELEMEN-LOWER CENTRE <i>used</i>	\$ 270.00 ✓	216 ✓
6	FRONT BUMPER CLOSING ELEMEN-LH /RH <i>Damaged 2</i>	\$ 540.00 ✗	432 ✓
7	RADIATOR GRILLE <i>Smashed</i>	\$ 1,301.00 ✓	1040.80
8	RADIATOR GRILLE CLOSING ELEMENT <i>smashed</i>	\$ 174.00 ✓	138.80
9	FRONT BUMPER AIR GUIDE GRILLE-LH/RH <i>new</i>	2 \$ 342.00 ✗	
10	FOAM FILLER PIECE <i>old</i>	\$ 172.00 ✓	137.60
11	FRONT BUMPER SIDE REINFORCEMENT <i>Set</i>	\$ 670.00 ✓	527.60
12	FRONT BUMPER COVER <i>smashed</i>	\$ 111.00 ✓	88.80
13	AIR CONDITIONER STICKER <i>3</i>	\$ 7.00 ✓	5.12
14	SIGN " CAUTION " <i>3</i>	\$ 13.00 ✓	9.76
15	SIGNAL HORN "HIGH TONE" <i>2 Not New</i>	\$ 182.00 ✗	
16	SIGNAL HORN "LOW TONE" <i>2 Not New Damaged</i>	\$ 182.00 ✗	145.60
17	BONNET <i>Distorted</i>	\$ 2,501.00 ✓	2000.80
18	BONNET ATTACHMENT PARTS <i>new</i>	\$ 149.00 ✓	119.20
19	BONNET LIG HINGE-LH/RH <i>Set</i>	2 \$ 112.00 ✓	88.48
20	BONNET GAS FILLED STRUT <i>Damaged Not New</i>	\$ 109.00 ? ✗	
SUB TOTAL SPARE PARTS		\$ 8,919.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLX 8692 G**

S/N	Parts Description		Damaged Parts & Prices	
			S/Nett	Remark
21	BONNET EDGE PROTECTION- FRONT <i>Lt</i>	\$	25.00 ✓	17.92
22	BONNET CATCH HOOK <i>Best</i>	\$	81.00 ✓	64.72
23	BONNET STRIKER-LH/RH <i>Dmgd</i>	2 \$	200.00 ✓	159.64
24	BONNET RUBBER SEAL <i>Lt</i>	\$	53.00 ✓	41.92
25	FRONT ADAPTER-LH/RH <i>Not Nec</i>	2 \$	24.00 ?	X
26	BONNET CATCH HOOL <i>Best.</i>	\$	58.00 ?	43.76
27	BONNET LID LOCK WITH MICRO SWITCH <i>Dmgd</i>	2 \$	367.00 ✓	293.60
28	BONNET LOCK LATCH COVER <i>me</i>	2 \$	7.00 ✓	5.12
29	BONNET BOWDEN CABLE -CENTER <i>Dmgd</i>	\$	53.00 ?	41.68
30	BONNET LOCK CABLE COVER <i>Dmgd</i>	\$	9.00 ?	7.12
31	BONNET LID LOCK CABLE <i>Damaged.</i>	\$	67.00 ?	53.36
32	BONNET SOUND ABSORBER <i>Completed</i>	\$	201.00 ✓	160.80
33	PLENUM CHAMBER COVER <i>Rehd</i>	\$	164.00 ?	130.80
34	FRONT WIPER COWL TRIM <i>Not nec</i>	\$	15.00 ?	X
35	FRONT FENDER-LH/RH <i>Buckled</i>	2 \$	1,556.00 ✓	1244
36	FRONT FENDER ATTACHMENT PARTS <i>Not nec</i>	2 \$	130.00 ?	X
37	FRONT FENDER UPPER BRACKET-LH/RH <i>Not nec</i>	2 \$	50.00 +	
38	FRONT FENDER BRACKET-LH/RH <i>Best</i>	2 \$	86.00 X	68.16 ✓
39	FRONT FENDER BRACE-LH/RH <i>Best</i>	2 \$	176.00 X	139.68 ✓
40	FRONT FENDER CLOSING ELEMENT-LH/RH <i>Not nec</i>	2 \$	112.00 X	88.48 ✓
SUB TOTAL SPARE PARTS		:	\$ 3,434.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLX 8692 G

S/N	Parts Description				Damaged Parts & Prices	
					S/Nett	Remark
41	FORNT FENDER SEAL STRIP-LH/RH	2	S	62.00	X	
42	FRONT WHEEL HOUSING LINER-LH/RH	2	S	316.00	X	
43	WHEEL HOUSIN LINER ATTACHMENT PARTS	2	S	103.00	X	
44	FRONT FENDER CLOSING ELEMENT-LH		S	66.00	X	
45	LED HEADLIGHT-LH/RH	2	S	10,058.00	✓	8046.80
46	LED HEADLIGHT POWER MODULE	2	S	1,385.00	?	1108 ✓
47	LED WITH HEAT SINK-LH/RH	2	S	1,332.00	?	1064.80 ✓
48	LED HEADLIGHT CONTROL UNIT	2	S	1,015.00	?	812 ✓
49	LED HEADLIGHT LIFT CYLINDER-LH/RH	2	S	256.00	?	X
50	WASH WATER RESERVOIR		S	186.00	X	107.40 ✓
51	HOSE FOR LED HEADLIGHT WASHER SYSTEM		S	61.00	+	
52	LOCK CARRIER WITH MOUNTING FOR COOLANT RADIATOR		S	663.00	✓	530.40
53	A/C CONDENSER WITH FLUID RESERVOIR		S	503.00	✓	402
54	REFRIGERANT LINE FOR A/C CONDENSER		S	461.00	?	368.80 ✓
55	REFRIGERANT LINE FOR A/C CONDENSER CUT OFF POINT		S	601.00	?	480.40 ✓
56	RADIATOR		S	878.00	✓	702.40
57	ADDITIONAL RADIATOR		S	837.00	✓	669.60
58	RADIATOR BUSH-LOWER	2	S	18.00	?	14.34 ✓
59	RADIATOR BRACKET UPPER		S	77.00	?	61.28 ✓
60	READY MIX COOLANT 1.5 LTR	4	S	84.00	✓	67.20
SUB TOTAL SPARE PARTS				\$ 18,962.00		

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLX 8692 G

S/N	Parts Description		Damaged Parts & Prices	
			S/Nett	Remark
61	RADIATOR FAN WITH FAN RING <i>Cracked.</i>	\$	1,483.00	? 1186.40 ✓
62	AIR GUIDE-LH/RH <i>Cracked</i>	2 \$	44.00	✓ 34.20
63	RADIATOR CORE SUPPORT SEAL <i>new</i>	\$	8.00	✓ 5.68
64	RADIATOR CORE SUPPORT AIR DUCT-UPPER CENTRE <i>new</i>	\$	11.00	✓ 8.32
65	AIR INTAKE AIR INLET <i>Cracked</i>	\$	53.00	✓ 41.54
66	AIR INTAKE AIR BOX <i>Not new</i>	\$	62.00	? X
67	INTERCOOLER GASKET <i>Not new</i>	\$	13.00	? X
68	AIR FILTER <i>Cracked.</i>	\$	252.00	? 201.70 ✓
69	INTAKE MANIFOLD <i>Not new</i>	\$	129.00	? X
70	WATER DRAINAGE HOSE <i>Damaged.</i>	\$	31.00	? 20.48 ✓
71	PETROL ACTIVE CHARCOAL CONTAINER <i>Not new</i>	\$	294.00	? X
72	FRONT DOOR-LH <i>Repair</i>	\$	2,073.00	X
73	FRONT OUTER DOOR SEAL-LH <i>new</i>	\$	146.00	X
74	BONDING AGENT <i>For use</i>	\$	45.00	X
75	CLEANING SOLUTION	\$	65.00	X
76	FRONT DOOR-RH <i>Repair</i>	\$	2,073.00	X
77	FRONT OUTER DOOR SEAL-RH <i>2</i>	\$	146.00	X
78	BONDING AGENT <i>Not new</i>	\$	45.00	X
79	CLEANING SOLUTION	\$	65.00	X
80	APPLICATOR	\$	7.00	X

SUB-TOTAL SPARE PARTS

: \$ 7,045.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLX 8692 G**

S/N	Parts Description	<u>Damaged Parts & Prices</u>		Remark
		S/Nett		
81	FRONT DOOR ATTACHMENT PARTS-LH/RH	2	S	436.00 ✓
82	FRONT DOOR CATCH	2	S	191.00 ✓
83	FRONT DOOR CATCH COVER	2	S	26.00 ✓
84	FRONT DOOR CHECK STRAP-LH/RH	2	S	82.00 ✓
85	FRONT ROOF STRIP MOLDING-LH/RH	2	S	1,074.00 ✗
86	FRONT WINDOW SLOT SEAL WITH TRIM STRIP-LH/RH	2	S	494.00 ✗
87	FRONT WINDSCREEN	1	S	988.00 ✓ 790
88	GEIL FOIL FOR RAIN SENSOR	1	S	128.00 ✓ 102.40
89	DATA PLATE FOR TYRE PRESSURE	1	S	26.00 ✗
90	AIRBAG UNIT FOR STEERING WHEEL	1	S	3,141.00 ✓ 2512.80
91	AIRBAG UNIT	1	S	4,238.00 ✓ 3396.40
92	HEAD AIR BAG UNIT	2	S	3,416.00 ✓ 2732.80
93	KNEE AIR BAG UNIT	1	S	1,708.00 ✓ 1366.40
94	AIR BAG CONTROL UNIT	1	S	1,606.00 ✓ 1289.80
95	AIR BAG CASH SENSOR	1	S	1,145.00 ✓ 915.60
96	SPORT STEERING WHEEL	1	S	2,169.00 ✗ 1735.20 ✓
97	DASH BOARD WITH AIR DUCT	1	S	3,887.00 ✓ 3109.60
98	DASH BOARD PANEL UNDERTRAY -RH	1	S	413.00 ? ✗
99	HEADLINING	1	S	1,809.00 ✓ 1447.20
100	FRONT A PILLAR COVER-LH/RH	2	S	294.00 ✗ 235.40 ✓
SUB- TOTAL SPARE PARTS			\$	27,271.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLX 8692 G

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
101	FRONT GRAB HANDLE FOLDING-LH/RH <i>2nd Damaged</i>	258.00	<i>206.40 ✓</i>
102	REAR GRAB HANDLE FOLDING-LH/RH <i>2nd</i>	258.00	<i>206.40 ✓</i>
103	THREE POINT AUTOMATIC SEAT BELT-LH/RH <i>Adjusted</i>	2,010.00	<i>1608 ✓</i>
104	FRONT SEAT BELT HEIGHT ADJUSTER <i>3 piece damaged</i>	361.00	<i>144.40 ✓</i>
105	ACRYLIC SEALANT <i>2</i>	180.00	<i>✓</i>
106	CAVITY WAX <i>men</i>	140.00	<i>✓</i>
107	STONE CHIP	180.00	<i>✓</i>
108	FRONT WINDSCREEN SEALANT <i>men</i>	200.00	<i>✓</i>
109	FRONT CAR PLATE NO. <i>Best</i>	25.00	<i>✓</i>
110	SUNDRIES <i>Nec.</i>	1,500.00	<i>148.32 ✓</i>
TOTAL SPARE PARTS		\$ 70,743.00	
TOTAL LABOUR CHARGES		\$ 32,524.00	
GRAND TOTAL		\$ 103,267.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

102844 38

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Name : Adrian Lim,
Surveyed Date : 04/03/19.
Authorised Date :
Excess Cost :
Liability :
Remarks : Not Authorised, 21 Days.

LEK Auto Consultants hence notify the Repetitor of the following:

- To survey before the repair is done
- To supply a detailed bill of material
- To provide a subject to confirmation
- To ensure the work is on a "Without Prejudice" basis
- The Repetitor must be satisfied with the work
- All components must be replaced and
- All components must be replaced and

Acknowledged by Repetitor

Signature:

Date:

Please Note : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly. For inspection of vehicle, please refer to Ms Norah Khai at Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Supplementary Estimate

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 / Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/0269/2019/GW

26-Mar-19

Kee Siang

2 of 2

SLX 8692 G

A3 SB 1.0 TFSI

Quantity	Description	Unit Price	Amount
Parts			
1	Seat Headrest X By's	\$ 648.00	X 110
2	Dashboard Air Vent Centre CAA	\$ 138.00	68.16
3	Loudspeaker Cover CAA	\$ 86.00	12.34
4	Flat Connetor Housing PRA	\$ 16.00	
GRAND TOTAL :		\$ 888.00	

For Premium Automobiles Pte Ltd

Rashid
26/03/19



Authorised Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Supplementary Estimate

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 / Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/0269/2019/GW 18-Mar-19 Kee Siang 1 of 1 SLX 8692 G A3 SB 1.0 TFSI
Quantity	Description	Unit Price	Amount
Labours			
1	To dismantle both front door panel trims. To remove and reinstall both wing mirror assys to facilitate respraying for both front doors S/N	\$ 600.00	
2	To remove and renew intake manifold and other damaged engine components. S/N	\$ 900.00	
Parts			
1	External Temperature Sensor	\$ 54.00	CRU 42.96
2	External Temperature Sensor Bracket	\$ 17.00	BR 15.04
3	Headlight Washer Hose	\$ 75.00	CRU 57.92
4	Starter	\$ 1,443.00	CRU 1154.40
5	Fiat Male Connector	\$ 43.00	CRU 34.34
6	Butt Connector	\$ 48.00	CRU 38.40
7	Return Hose	\$ 22.00	BR
8	Air Intake Duct Cover	\$ 27.00	MIS
9	Air Duct	\$ 19.00	CRU
10	Intake Manifold	\$ 588.00	CRU
11	Turbo Intercooler	\$ 692.00	BR
12	Air Cond Bracket	\$ 25.00	BR
GRAND TOTAL :		\$ 4,553.00	

For Premium Automobiles Pte Ltd



Authorised Signature

Store 2013/19
J-S/pn

Resing check item

Raman (LKR)
18/03/19

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLX 8692 G

S/N	Parts Description		Damaged Parts & Prices	
			S/Nett	Remark
61	RADIATOR FAN WITH FAN RING ?	\$	1,483.00 ?	OK /
62	AIR GUIDE-LH/RH <i>Combined</i>	2 \$	44.00 ✓	
63	RADIATOR CORE SUPPORT SEAL <i>re</i>	\$	8.00 ✓	
64	RADIATOR CORE SUPPORT AIR DUCT-UPPER CENTRE <i>re</i>	\$	11.00 ✓	
65	AIR INTAKE AIR INLET <i>Combined</i>	\$	53.00 ✓	
66	AIR INTAKE AIR BOX ?	\$	62.00 ?	
67	INTERCOOLER GASKET ?	\$	13.00 ?	
68	AIR FILTER ?	\$	252.00 ?	OK ✓
69	INTAKE MANIFOLD <i>flange ?</i>	\$	129.00 & ?	
70	WATER DRAINAGE HOSE ?	\$	31.00 ?	
71	PETROL ACTIVE CHARCOAL CONTAINER ?	\$	294.00 ?	
72	FRONT DOOR-LH <i>Repair</i>	\$	2,073.00 *	
73	FRONT OUTER DOOR SEAL-LH <i>re re</i>	\$	146.00 *	
74	BONDING AGENT <i>3 re re</i>	\$	45.00 *	
75	CLEANING SOLUTION	\$	65.00 *	
76	FRONT DOOR-RH <i>Repair</i>	\$	2,073.00 *	
77	FRONT OUTER DOOR SEAL-RH <i>2</i>	\$	146.00 *	
78	BONDING AGENT <i>2</i>	\$	45.00 *	
79	CLEANING SOLUTION <i>2</i>	\$	65.00 *	
80	APPLICATOR <i>2</i>	\$	7.00 *	
SUB-TOTAL SPARE PARTS			\$ 7,045.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLX 8692 G**

S/N	Parts Description			<u>Damaged Parts & Prices</u>	
				<u>S/Nett</u>	<u>Remark</u>
81	FRONT DOOR ATTACHMENT PARTS-LH/RH	2	\$	436.00	✓
82	FRONT DOOR CATCH	2	\$	191.00	✓
83	FRONT DOOR CATCH COVER	2	\$	26.00	✓
84	FRONT DOOR CHECK STRAP-LH/RH	2	\$	82.00	✓
85	FRONT ROOF STRIP MOLDING-LH/RH	2	\$	1,074.00	✓
86	FRONT WINDOW SLOT SEAL WITH TRIM STRIP-LH/RH	2	\$	494.00	✓
87	FRONT WINDSCREEN		\$	988.00	✓
88	GEIL FOIL FOR RAIN SENSOR		\$	128.00	✓
89	DATA PLATE FOR TYRE PRESSURE		\$	26.00	✓
90	AIRBAG UNIT FOR STEERING WHEEL		\$	3,141.00	✓
91	AIRBAG UNIT		\$	4,238.00	✓
92	HEAD AIR BAG UNIT	2	\$	3,416.00	✓
93	KNEE AIR BAG UNIT		\$	1,708.00	✓
94	AIR BAG CONTROL UNIT		\$	1,606.00	✓
95	AIR BAG CASH SENSOR		\$	1,145.00	✓
96	SPORT STEERING WHEEL		\$	2,169.00	✓*
97	DASH BOARD WITH AIR DUCT		\$	3,887.00	✓
98	DASH BOARD PANEL UNDERTRAY -RH		\$	413.00	?
99	HEADLINING		\$	1,809.00	✓
100	FRONT A PILLAR COVER-LH/RH	2	\$	294.00	✓
SUB- TOTAL SPARE PARTS				\$ 27,271.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLX 8692 G

S/N	Parts Description	Damaged Parts & Prices		Remark
		S/Nett		
101	FRONT GRAB HANDLE FOLDING-LH/RH ? part	2	S	258.00 x } aw ✓
102	REAR GRAB HANDLE FOLDING-LH/RH	2	S	258.00 x } aw ✓
103	THREE POINT AUTOMATIC SEAT BELT-LH/RH Advised	2	S	2,010.00 ✓
104	FRONT SEAT BELT HEIGHT ADJUSTER ? pc	1	S	361.00 ? ✓
105	ACRYLIC SEALANT ?	S/N	S	180.00 x
106	CAVITY WAX ?	S/N	S	140.00 x
107	STONE CHIP	S/N	S	180.00 x
108	FRONT WINDSCREEN SEALANT new	S/N	S	200.00 ✓
109	FRONT CAR PLATE NO. Best	S/N	S	25.00 ✓
110	SUNDRIES ?		S	1,500.00 ?
TOTAL SPARE PARTS		:	\$	70,743.00
TOTAL LABOUR CHARGES			\$	32,524.00
GRAND TOTAL			\$	103,267.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.