

**Lai Huat (Meng Kee) Motor Pte
Ltd
160 Sin Ming Drive, #04-01,
#04-02 & #07-03, Sin Ming
Autocity
575722**

Claim Reference:

Assessment number: 70287

Version: 1810

Date calculated: 10/05/2019 3:44 PM

Full Report

Registration: SKE 5659K

Printed: 10/05/2019 3:44 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Jenny Lim	Currency:	SGD
Claim Reference:		Date of Incident:	28/02/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES-BENZ
Model:	C-CLASS (W204)
Sub Model:	C 180 KOMPR BE
Model Sheet Number:	03 04 27
Registration:	SKE 5659K
VIN number:	WDD2040452A524229
Odometer:	

Model Specs

FR A395./F500./R131.	MODEL 2011	RAIN SENSOR	DIPPING MIRROR
FOLDING DOOR MIRRORS	AUDIO SYSTEM 20 CD	LEATHER UPHOLSTERY	ALU DESIGN PARTS
EQUIPMENT AVANTGARDE	STRG WHEEL LEATHER	LEATHER STRG WHEEL	H/DUTY ALTERNATOR
ENGINE PROTECTION	AUTO GEARBOX 5 SPEED	PARAMETER STEERING	CRUISE CONTROL
TYRES 225/45 WR 17	WHEELS 7.5J X 17 ALU	SPARE WHEEL	RIGHT HAND DRIVE
TWO COAT METALLIC	CLEAR COAT HARD		

**Lai Huat (Meng Kee) Motor Pte
Ltd**
160 Sin Ming Drive, #04-01,
#04-02 & #07-03, Sin Ming
Autocity
575722

Claim Reference:

Assessment number: 70287

Version: 1810

Date calculated: 10/05/2019 3:44 PM

Vehicle Condition

Full Report

Registration: SKE 5659K

Printed: 10/05/2019 3:44 PM


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

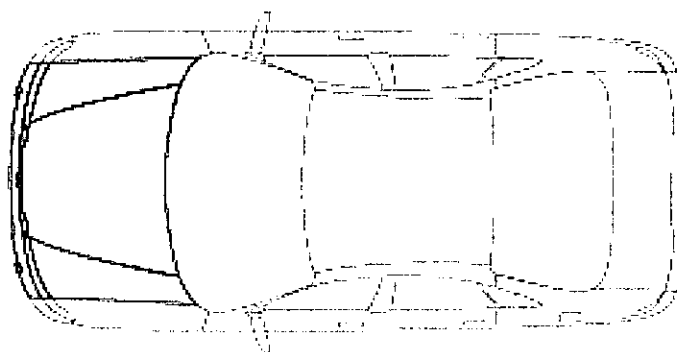

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
88-1102 01	R + R COMPLETE FRONT BUMPER INCLUDES: R + R RADIATOR COVER, DETACH + REFIT L/- AND R/PARTITION PANEL, ADJUST FRONT FOG LAMPS		9.0	37.80
88-1105 02	DIS + ASS FRONT BUMPER (BUMPER REMOVED)		6.0	25.20
88-1357 ZAX	AFTER CHECK: RENEW PARTS IF NECESSARY ADDITION TO DIS + ASS FRONT BUMPER (REMOVED)		3.0	12.60
88-2506 01	(VEHICLE WITH LUXURY EQUIPMENT) RENEW BONNET		11.0	46.20
	INCLUDES: R + R BONNET, CONVERT ALL PARTS			
82-4800 01)	RENEW R/F LAMP UNIT (DET/REFIT BUMPER)		3.0	12.60
NO NUMBER	R + R FRONT AIR GUIDE		3.0	12.60

Lai Huat (Meng Kee) Motor Pte Ltd
160 Sin Ming Drive, #04-01,
#04-02 & #07-03, Sin Ming
Autocity
575722

Claim Reference:

Assessment number: 70287

Version: 1810

Date calculated: 10/05/2019 3:44 PM

Full Report

Registration: SKE 56591

Printed: 10/05/2019 3:44 PM

		WU	Price SGI
60-1302 01	R + R ATTACHED PARTS OF THE ENG COMP	5.0	21.00
	R + R FOR RENEWAL FRONT CROSSMEMBER		
62-1315 01	R + R FRONT CENTRE REINFORCEMENT BETWEEN WHEELHOUSES	4.0	16.80
62-1263 01	R + R FRONT CROSSMEMBER CPL (STOSSFAENGER AUSGEBAUT)	13.0	54.60
0742	R/F WING REPAIR	5.0*	21.00
0930	CTR FRT REINF REPAIR	10.0*	42.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		7.20	72.0
Total of Labour			302.40

Paint

Paint Work	SYSTEM AZT	Time Basis 10WU/h
Code	Description - TWO COAT METALLIC	WU Price SGI
	BONNET NEW PART PAINTING	28.0
	FRONT BUMPER COVER NEW PART PAINT K1R	10.0
	R/F WING REPAIR PAINTING <50%	10.0

Paint Material Per Part

Code	Description	Price SGI
0471	BONNET NEW PART PAINTING	93.90
0283	FRONT BUMPER COVER NEW PART PAINT K1R	44.20
0742	R/F WING REPAIR PAINTING <50%	9.00

Labour Cost - Paint

	Hrs	WU	Price SGI
Factor			
Time Paint		48.0	
Preparation Main Work Metal	2.10	21.0	88.20
Preparation Comp. Work Plastic	0.50	5.0	21.00
Total	7.40	74.0	310.80

Lai Huat (Meng Kee) Motor Pte Ltd

160 Sin Ming Drive, #04-01,
#04-02 & #07-03, Sin Ming
Autocity
575722

Claim Reference:

Assessment number: 70287

Version: 1810

Date calculated: 10/05/2019 3:44 PM

Full Report

Registration: SKE 5659K

Printed: 10/05/2019 3:44 PM

Price SGD

New Part Painting	93.91
New Part Painting - Plastic K1R	44.28
Repair Painting	9.04
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	174.33

Spare Parts

				prices as at 2015-06-01
Code	Description	Part Number	Supplier	Price SGD
0260	FRT NO PLATE REINF	204 817 0378		65.00
0283	FRONT BUMPER COVER	\$710.00 LESS20%		568.00
0311	L/F BUMPER MOULDING	204 885 0721		45.00
0312	R/F BUMPER MOULDING	204 885 0821		45.00
0349	FRT/CTR IMPACT DAMP	204 885 0037		75.00
0405	FRONT GRILLE	204 880 0023 9744		310.00
0435	BONNET SEAL	204 881 0098		15.00
0471	BONNET	204 880 1057 64		850.00
0507	L/SPRING ELEMENT	204 880 0227		12.00
0508	R/SPRING ELEMENT	204 880 0227		12.00
0562	RIGHT HEADLAMP ASSY	204 906 5403		490.00
0578	R/HEADLAMP COVER	204 826 1424		20.00
1001	FRT LWR CROSSMEMBER	207 620 1600		155.00
7751	UPPER AIR GUIDE	204 505 0530		30.00
7753	FAN SHROUD	204 500 0155		65.00
7766	R/UPPER BEARING	169 504 0114		15.00
7768	R/FASTENING CLIP	000 991 2595		6.00
1003	AC DECAL	RENEW		20.00
1004	H/LAMP HOLLOW SCREW	001 997 0101		13.00
f: OEM Parts	Savings			0.00
n: Non-OEM Parts	Subtotal			2,811.00
u: Used parts	Fixed Sundry Parts Price			100.00
	Total			2,911.00

Extras

Code	Description	Price SGD
1000	FRONT NUMBER PLATE SN	35.00*
1002	FAULT CODES ERASE/CHECK	60.00*

**Lai Huat (Meng Kee) Motor Pte
Ltd
160 Sin Ming Drive, #04-01,
#04-02 & #07-03, Sin Ming
Autocity
575722**

Claim Reference:

Assessment number: 70287

Version: 1810

Date calculated: 10/05/2019 3:44 PM

Full Report

Registration: SKE 5659K

Printed: 10/05/2019 3:44 PM

Price SGD

Total Extras

95.00

Final Calculation

	SGD	SGD
Parts	2,811.00	
Fixed Sundry Parts Price	100.00	
Total Parts		2,911.00
Labour Time Base 10 WU/h		
Total 72.0 WU X 42.00 SGD/h	302.40	
Total of Labour		302.40
Total Of Extras		95.00
Paint Work Time Base 10 WU/h		
Labour Cost 74.0 WU X 42.00 SGD/h	310.80	
Material Cost	174.33	
Total Paint Including Material		485.13
Repair Cost Excludes GST		3,793.53
GST (+7.0%)		265.55
Repair Cost Included GST		4,059.08

Comments

* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS