

Date : 12 April 2018

To : **NTUC Income Insurance Co-operative Limited**
73 Bras Basah Road #05-01
NTUC Trade Union House
Singapore 189556

Attn : Mr Thio Tse Kiat

AJAX Inspection Services Pte Ltd

120 Lower Delta Road
#08-08, Cendex Centre
Singapore 169208
Tel: +65 6255 0808
Fax: +65 6849 9155
info@ajaxinspection.com

Invoice No – AV14118
Company Reg No -201318067R
GST Reg No - 201318067R

TAX INVOICE

YOUR REF / CLAIM NUMBER : MT/0986588-001 ✓
OUR REF : AVS2018-14760/AT
TP VEHICLE NO : SJP5354T ✓
CLAIM TYPE : THIRD PARTY SURVEY
DATE OF SURVEY : 19 March 2018

No.	Description	Amount (S\$)
1	Professional fee	300.00

Subtotal 300.00
GST 7.00% 21.00
Total 321.00

Payment Terms: 30 days from date of invoice

Please remit by electronic transfer as follows:

Payee: AJAX Inspection Services Pte Ltd
United Overseas Bank Ltd
Account No: 450-309-276-4

Email remittance advice to: accounts@ajaxadjusters.com

AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155
Email: info@ajaxinspection.com Website: www.ajaxadjusters.com Co. Reg. No.: 201318067R



INSPECTION REPORT

NTUC Income Insurance Co-operative Ltd

73 Bras Basah Road #05-01 NTUC Trade Union House Singapore 189556

Attention: Mr Thio Tse Kiat

Assign Date:	19/03/2018	Inspection Date:	19/03/2018	TP Report Date:	19/03/2018
Accident Date:	16/03/2018	TP Policy No:	5092986452	Our Ref:	AVS2018-14760/AT
Place of Inspection:	JD Motorsports 25 Kaki Bukit Road 4 #06-38 Synergy @ Kaki Bukit Singapore 417800			Your Ref:	MT/0986588-001
				Claim Type:	Third Party
				Claimant:	Vettura Leasing Pte. Ltd.

Description of Vehicle:

Veh. No:	SJP5354T	Make/Model:	Honda Civic 1.8L 5AT		
Colour:	White	Engine No:	R18A14016618	Sum Insured (S\$):	Market Value
Engine Capacity:	1,799cc	Chassis No:	JHMF16309S203138	Mkt Value (S\$):	\$23,000.00
Odometer:	219526	Reg. Date:	27/03/2009	Excess (S\$):	NA

Condition of Vehicle:

General:	Good	Modification:	No	Steering:	Serviceable
Air-Conditioner:	Good	Radio/Cassette/CD:	Good	Wing Mirror:	Serviceable
Handbrake:	Serviceable	Footbrake:	Serviceable	Paint work:	Good
Tyre Make:	Bridgestone				
Front Tyre Size:	205/55R16	Front Left Side:	6mm	Front Right Side:	6mm
Rear Tyre Size:	205/55R16	Rear Left Side:	6mm	Rear Right Side:	6mm

Description of Damage:

The damage was found on the right side portion. The front right door, rear right door, rocker panel, right side skirting, front right knuckle arm, front right lower arm, and among other parts were affected.

Point of Impact:



Adjuster: Mohamad Affandi
Motor Appraiser

COMPLETED 09 APR 2018

Date

Note: This report is confidential and solely for the use of the client. The inspection was conducted on a "Without Prejudice" basis.

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155

Email: info@ajaxinspection.com Website: www.ajaxadjusters.com Co. Reg. No.: 201318067R

Adjustment of Repair Cost for Vehicle:

SJP5354T

Our Ref: AVS2018-14760/AT

No.	Qty	Description of Parts	Condition	Repairer's Estimate S\$	Our Recommendation S\$
List Items					
1	1	Front bumper	Deformed	856.80	856.80
2	2	Front bumper side retainer (LH) (RH)	Necessary	171.00	171.00
3	10	Front bumper clips	Necessary	45.00	45.00
4	1	Front headlamp (RH)	Grazed	765.50	765.50
5	1	Front fender (RH)	Repair	--	--
6	1	Front fender inner shield (RH)	Cut	145.00	145.00
7	8	Front fender inner shield clips (RH)	Necessary	36.00	36.00
8	1	Front shock absorber (RH)	Not necessary	650.00	--
9	1	Front knuckle arm (RH)	Not necessary	460.00	--
10	1	Front knuckle bearing (RH)	Distorted	367.60	367.60
11	1	Front lower arm (RH)	Distorted	386.90	386.90
12	1	Front door (RH)	Buckled	1,205.50	1,205.50
13	1	Front door outer garnish (RH)	Cut	320.80	320.80
14	2	Front door hinges (RH)	Not Necessary	291.00	--
15	1	Front door handle (RH)	Grazed	95.00	95.00
16	1	Front door lock (RH)	Distorted	102.80	102.80
17	1	Front door regulator motor (RH)	Distorted	486.90	486.90
18	1	Front door window channel (RH)	Not Necessary	200.50	--
19	1	Front door outer moulding (RH)	Cut	155.70	155.70
20	1	Front door weatherstrip (RH)	Not Necessary	185.90	--
21	1	Rocker panel (RH)	Repair	898.70	--
22	1	Side skirt (RH)	Cracked	435.50	435.50
23	1	Rear door (RH)	Buckled	1,186.60	1,186.60
24	1	Rear door outer garnish (RH)	Cut	320.80	320.80
25	1	Rear fender (RH)	Repair	--	--
Sub Total:				9,769.50	7,083.40
Discount (less 20%):				0.00	1,416.68
				9,769.50	5,666.72

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155

Email: info@ajaxinspection.com Website: www.ajaxadjusters.com Co. Reg. No.: 201318067R

Adjustment of Repair Cost for Vehicle:		SJP5354T		Our Ref: AVS2018-14760/AT	
No.	Qty	Description of Parts	Condition	Repairer's Estimate S\$	Our Recommendation S\$
Special Nett Items					
1	1	Front rim (RH)	Grazed	450.00	300.00
2	1	Front tyre (RH)	Not Necessary	250.00	--
3	1	Front door pillar sticker (RH)	Necessary	55.00	30.00
4	1	Rear door pillar sticker (RH)	Necessary	55.00	30.00
5	1	Front door LED light (RH)	Not Necessary	100.00	--
Sub Total:				910.00	360.00
Total Parts Price:				10,679.50	6,026.72

Labour Cost				
1	To supply labour & parts to replace above mentioned parts.		2,600.00	1,200.00
2	To supply labour to putty & respray accident affected area.		2,400.00	1,200.00
3	To supply labour to re-wire electrical parts.		250.00	120.00
4	To supply labour to spray anti-rust coat.		120.00	60.00
5	To supply labour to conduct wheel alignment.		150.00	80.00
Sub Total:			5,520.00	2,660.00
Grand Total:			16,199.50	8,686.72

Recommendation and Conclusion:

We have inspected thoroughly each and every item on the repairer's estimate against the actual damage found on the vehicle and we have listed the breakdown of our findings and our recommendation as per schedule attached.

Our recommended amount for the cost of contract lumpsum is S\$6,400.00. However, the repairer had request the cost of repair at S\$6,900.00.

Estimate Period of Repair: 6 working days

Please take note that the Economical Repair Limit is \$6,400.00

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd

AJAX

Inspection Services Pte Ltd

Our Ref: AVS2018-14760/AT
Your Ref: MT/0986588-001



Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155
Email: info@ajaxinspection.com Website: www.ajaxadjusters.com Co. Reg. No.: 201318067R

AJAX

Inspection Services Pte Ltd

Our Ref: AVS2018-14760/AT
Your Ref: MT/0986588-001



Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155
Email: info@ajaxinspection.com Website: www.ajaxadjusters.com Co. Reg. No.: 201318067R

AJAX

Inspection Services Pte Ltd

Our Ref: AVS2018-14760/AT
Your Ref: MT/0986588-001



Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155
Email: info@ajaxinspection.com Website: www.ajaxadjusters.com Co. Reg. No.: 201318067R

AJAX

Inspection Services Pte Ltd

Our Ref: AVS2018-14760/AT
Your Ref: MT/0986588-001



Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155
Email: info@ajaxinspection.com Website: www.ajaxadjusters.com Co. Reg. No.: 201318067R

AJAX

Inspection Services Pte Ltd

Our Ref: AVS2018-14760/AT

Your Ref: MT/0986588-001



Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155

Email: info@ajaxinspection.com Website: www.ajaxadjusters.com Co. Reg. No.: 201318067R

AJAX

Inspection Services Pte Ltd

Our Ref: AVS2018-14760/AT
Your Ref: MT/0986588-001



Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155
Email: info@ajaxinspection.com Website: www.ajaxadjusters.com Co. Reg. No.: 201318067R

AJAX

Inspection Services Pte Ltd

Our Ref: AVS2018-14760/AT
Your Ref: MT/0986588-001



Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.


AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155
Email: info@ajaxinspection.com Website: www.ajaxadjusters.com Co. Reg. No.: 201318067R

AJAX

Inspection Services Pte Ltd

Our Ref: AVS2018-14760/AT
Your Ref: MT/0986588-001

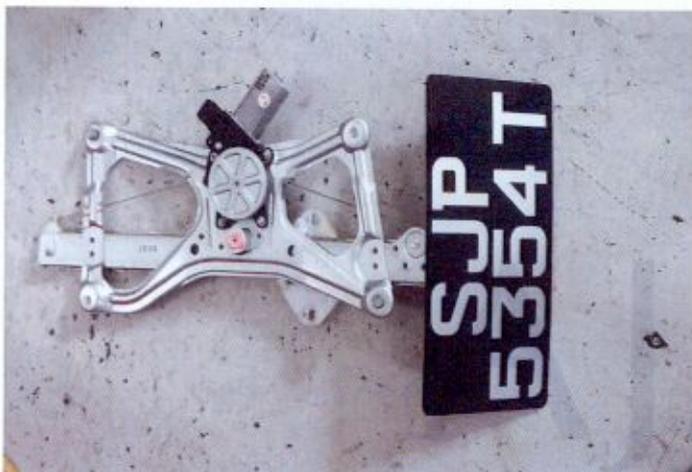

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.
AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155
Email: info@ajaxinspection.com Website: www.ajaxadjusters.com Co. Reg. No.: 201318067R

AJAX

Inspection Services Pte Ltd

Our Ref: AVS2018-14760/AT

Your Ref: MT/0986588-001



Note: This report is confidential and solely for the use of the inspection services conducted on a "Without Prejudice" basis.

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155

Email: info@ajaxinspection.com Website: www.ajaxadjusters.com Co. Reg. No.: 201318067R