



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV No. AC2004761
INV Date 07/07/2020
Reference CC6/CTI19005010/Uka3n2
Code CTI



PROFESSIONAL SERVICE FEE

Vehicle No. SLT 8996B
Insured Veh. GBE 6247R
Claim No. SNM19D201243C02/7
Policy No. DMCVSN3009291901
Accident Date 17/03/2019
Inspection Date 20/03/2019

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CC6/CTI19005010/Uka3n2

3 ANSON ROAD #16-00
SPRINGLEAF TOWERS SINGAPORE 079909

Date : 07-07-2020



Code : CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBE 6247R	Veh. Inspected	SLT 8996B
Policy No.	DMCVSN3009291901	Coverage (\$)	0.00
Claim No.	SNM19D201243C02/7	Excess (\$)	0.00
Assign From		Assign Date	20/03/2019

2. Vehicle Particulars & Condition

Make & Model	KIA CERATO K3 (A)	c.c	1591
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	KNAFX411MJ5752202	Colour	WHITE
Odometer	13546	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/55 R16	NEXEN	6 mm
L/H Front Tyre	205/55 R16	NEXEN	6 mm
R/H Rear Tyre	205/55 R16	NEXEN	6 mm
L/H Rear Tyre	205/55 R16	NEXEN	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	17/03/2019	Inspection Date	20/03/2019
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883		

5a. Remarks

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	4 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLT 8996B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	DENTED / DEFORMED	1,280.30	698.10
1	REAR BUMPER LOWER GARNISH	DEFORMED / TWISTED	845.20	315.00
2	REAR BUMPER REFLECTORS @\$105.00	NOT NECESSARY	210.00	-
1	REAR BUMPER REINFORCEMENT	CRACKED	599.20	394.00
2	REAR BUMPER SIDE RETAINERS @\$65.00	NOT NECESSARY	130.00	-
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	50.00
5	REAR BUMPER REINFORCEMENT BRACKETS @\$35.00	NOT NECESSARY	165.00	-
2	TAILAMPS @\$1205.00	CRACKED	2,410.00	1,576.00
1	REAR END PANEL	DENTED	833.20	495.00
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	312.50	-
1	BOOTLID	TO REPAIR SEE LABOUR	1,066.80	-
1	BOOTLID REAR LOGO	NOT NECESSARY	85.00	-
1	BOOTLID 'CERATO' EMBLEM	NOT NECESSARY	82.00	-
1	BOOTLID 'K3' EMBLEM	NOT NECESSARY	50.00	-
1	BOOTLID 'C & C' LOGO	NOT NECESSARY	50.00	-
1	BOOTLID WEATHERSTRIP	TWISTED	299.20	168.00
2	BOOTLID REFLECTORS @\$680.00	NOT NECESSARY	1,360.00	-
	LESS 10% DISCOUNT		-	-369.61
			9,828.40	3,326.49
<u>SPECIAL NETT ITEMS</u>				
1	SET REAR BUMPER REVERSE SENSOR (SN)	SHORTED	280.00	200.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
			330.00	250.00
<u>LABOUR</u>				
	TO CHECK WIRING.		80.00	30.00
	TO DISMANTLE & REPLACING REVERSE SENSOR.		80.00	50.00
	TO TRANSFER BOOTLID MECHANISM.	NOT NECESSARY	80.00	-
	TO DISMANTLE & REFIX SEAT, CUSHION UPHOLSTERY.		120.00	80.00

Report Ref No. CC6/CTI19005010/Uka3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO SPRAY RUST PROOFING.		100.00	50.00
	LABOUR FOR PANEL BEATING & REPLACING PARTS. INCLUSIVE OF THE REPAIR OF BOOTLID.		880.00	650.00
	TO PUTTY & SPRAY PAINTING.		1,500.00	600.00
			2,840.00	1,460.00
GRAND TOTAL			12,998.40	5,036.49
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,000.00

Report Ref No. CC6/CTI19005010/Uka3n2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No. 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLT 8996B

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

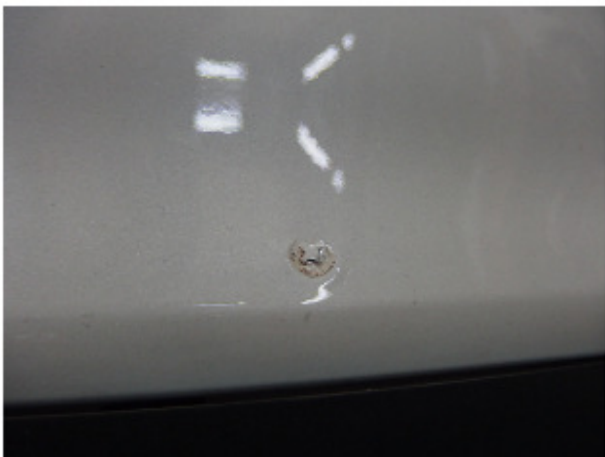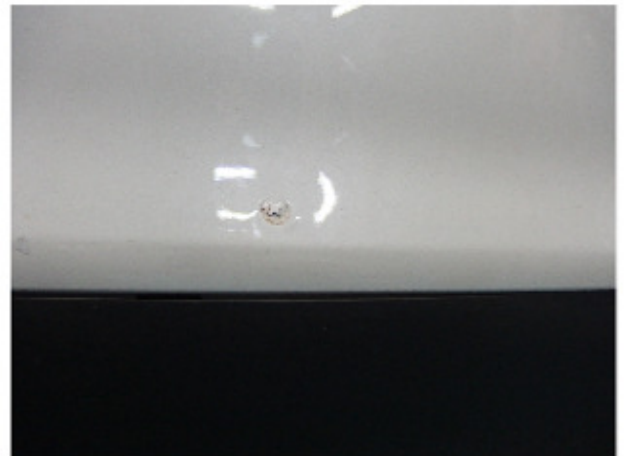




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

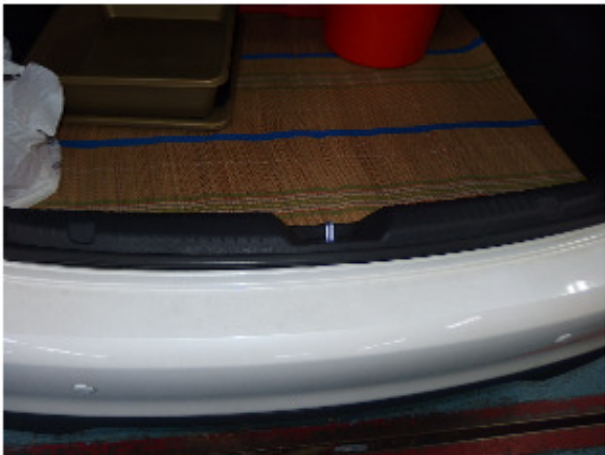



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

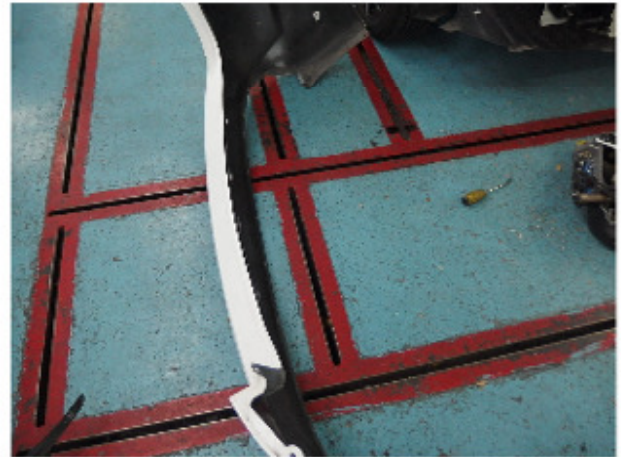



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLT 8996B

RE-INSPECTION

