

Stere

REF:

AIG C03/AIG19005108/Exd302

ASSIGNMENT

Form

Date:

Estimated Cost

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop n/s

of

Insured

Policy No 1800023129-01

Claims No

Sum Insured

Excess: 800

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs

31 25

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No

SLW9079B

Vt Regn

8/3/18

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Audi Q2

Colour White

Sp. Reading

21240

A/C Insured / Std / NI / NA

T/Rdrln Insured / Std / NI / NA

Eng/No:

CtNo: W44 2226A 2JA 067336

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

215/55R17

R:

11

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

R/Bal.

7

mm

Rear

R/Bal.

7

mm

L/Bal.

7

mm

L/Bal.

7

mm

D.O.A.

16/3/19

D.O.A.

20/3/19

Survey held at

Premium

Benoi Sector

Des. of Damages: Frt / Rear / O/S / NIS / UIC / Rooftop or

Interior

The UIC / Chassis frame / Body Structure affected due to collision

Date / Time Action / Instruction

25/3/19 Rec approved \$34,724 from Victor by email

25/3/19 Informed Nora c/A ex \$800 by email

15/7/19 @344pm Nora request 25 days

15/7/19 Check with Adrian 25 days - OK

12/11/19 Final fig \$40,682.34 confirmed by email (Rec 29,181.72, 40%)

RECEIVED 11 DEC 2019

Stene

REF:

AIG C03/AIG19005108/Exd302

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop n/s

of

Insured

Policy No

Claims No

Sum Insured

(Client's Record)

Make of Veh:

1800023129-01

Excess:

800

Veh No

SLW9079B

Yt Regn

8/3/18

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Audi Q2

Colour White

Sp. Reading

21240

Eng/No:

Ci/No:

W44 2226A2JA067336

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

A/C Insured / Std / NI / NA

T/R/rin: Insured / Std / NI / NA

RV - 51,401

NV - 47,953

SLW9079B-X

Advise repairer 1/5

repair limit.

21/03/18 @ 18:29pm received - 2A to Tang Sheng via merimen.

21/03/18 @ 18:53pm mandate requested authorize repair to ~~Ata~~ to Tang Sheng via merimen.

photo 21/3

Date/Time. File Pass to?

☐

: Prel. Report

Days Of Repair:

25

1)

☐

: Final Report

Resurvey No. of Trip:

1

Date/Time. File Return to?

4/12 - typist

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

Survey Fee:

Transportation

1 : S + R: 21

1 : Photos

1 : Collect

200

11

211

Report Format:

merimen

ump Sum / I.B. (\$

40,682.24

View Received Message

This mail is associated with :

***SLW9079B (1578404602SG)**

OD

Mar 16 2019 5:30AM

[MARTIN DANIEL GERARD]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on **12/11/2019 15:56 PM**.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$40682.24) - SLW9079B - Claim Handler: Chan, Yoke Shi

Approved:40682.24.

DOCUMENTS SUMMARY

There are no documents.

Veron Chen (LKKAUTO)

From: Koh, Victor-CK <Victor-CK.Koh@aig.com>
Sent: Tuesday, 12 November 2019 3:57 PM
To: Veron Chen (LKKAUTO)
Subject: RE: SLW9079B -(AIG REF:1578404602SG)

Done

From: Veron Chen (LKKAUTO) [mailto:veronchen@lkkauto.com]
Sent: Tuesday, November 12, 2019 2:56 PM
To: Koh, Victor-CK; SUR
Cc: Fong, Andy-SY
Subject: [EXTERNAL] RE: SLW9079B -(AIG REF:1578404602SG)

This message is from an external sender; be cautious with links and attachments.

Dear Victor,

Labour 8 & 13 has taken out.

For your approval please.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Veron Chen (LKKAUTO)
Sent: Wednesday, 6 November 2019 12:24 PM
To: Koh, Victor-CK <Victor-CK.Koh@aig.com>; SUR <sur@lkkauto.com>
Cc: Fong, Andy-SY <Andy-SY.Fong@aig.com>
Subject: RE: SLW9079B -(AIG REF:1578404602SG)

Dear Victor,

Will check and revert.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Koh, Victor-CK <Victor-CK.Koh@aig.com>
Sent: Wednesday, 6 November 2019 12:11 PM
To: Veron Chen (LKKAUTO) <veronchen@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: Fong, Andy-SY <Andy-SY.Fong@aig.com>
Subject: FW: SLW9079B -(AIG REF:1578404602SG)

Hi Veron,

I know you have photos to show front suspension removed. What I am saying is replacing side sill panel or A pillar does not require front suspension to be removed.
Also this vehicle is mount on car-o-liner by 4 base points and not through the jig points. Therefore the labour 8 & 13 is not payable just because repairer has done it for no valid reason.

Thanks & Regards

Victor Koh
AIG
Claims Technical Controller
Claims | AIG Asia Pacific Insurance Pte. Ltd

78 Shenton Way #08-16 Singapore 079120
Tel +65 6419 1785 | Fax +65 68357416
Victor-ck.koh@aig.com | www.aig.com

From: Koh, Victor-CK
Sent: Tuesday, October 22, 2019 9:33 AM
To: Veron Chen (LKKAUTO)
Cc: Fong, Andy-SY
Subject: RE: SLW9079B -(AIG REF:1578404602SG)

Hi Veron,

As per last meeting with Premium, we are still pending your explanation why labour 8 (TO REMOVE AND REINSTALL FRONT SUSPENSION FOR CAR-O-LINER REPAIRS) need to be perform?

Thanks & Regards

Victor Koh
AIG
Claims Technical Controller
Claims | AIG Asia Pacific Insurance Pte. Ltd

78 Shenton Way #08-16 Singapore 079120
Tel +65 6419 1785 | Fax +65 68357416
Victor-ck.koh@aig.com | www.aig.com

From: Veron Chen (LKKAUTO) [<mailto:veronchen@lkkauto.com>]
Sent: Monday, October 21, 2019 5:34 PM
To: Koh, Victor-CK
Cc: Fong, Andy-SY
Subject: [EXTERNAL] FW: SLW9079B -(AIG REF:1578404602SG)

This message is from an external sender; be cautious with links and attachments.

Dear Victor,

Kindly let us have your approval please.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Veron Chen (LKKAuto)
Sent: Tuesday, 3 September 2019 3:59 PM
To: Koh, Victor-CK <Victor-CK.Koh@aig.com>
Cc: Fong, Andy-SY <Andy-SY.Fong@aig.com>
Subject: FW: SLW9079B -(AIG REF:1578404602SG)

Dear Victor,

Refer to below email.

For your approval please.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Veron Chen (LKKAuto)
Sent: Wednesday, 31 July 2019 10:22 AM
To: Koh, Victor-CK <Victor-CK.Koh@aig.com>
Cc: Fong, Andy-SY <Andy-SY.Fong@aig.com>
Subject: RE: SLW9079B -(AIG REF:1578404602SG)

Dear Victor,

We have re-upload initial estimate in merimen.

Check Labour 2 and 14 kindly provide measurement reading if not to take out.

Refer attach Labour 2 and Labour 14

Labour 3 from re-inspection photo front did not even remove why allow for the labour. To take out.

Refer photo no 145

Check labour 9,10,11 to provide photos if not to take out.

Refer photo no 128 & 129

Part 32, 33 to provide diagnostic report of part failure.-

Repairer do not have diagnostic report for door control unit, window lifter motor. Will take out these items.

Why replace rear fender instead of Rear side member Rh? From photos damage are on the rocker panel. Clarify with repairer, there is typo error in the estimate should be rear side member RH instead of rear fender.

Part no 80 why need to be replace? Damage photos?-

Seat belt height adjustor was replaced - jammed by seat belt and airbag activation belt activation.

For your approval please.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk S1, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Koh, Victor-CK <Victor-CK.Koh@aig.com>

Sent: Monday, 29 July 2019 3:12 PM

To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>

Cc: Fong, Andy-SY <Andy-SY.Fong@aig.com>

Subject: RE: SLW9079B -(AIG REF:1578404602SG)

Hi Veron,

Check Labour 2 and 14 kindly provide measurement reading if not to take out.

Labour 3 from re-inspection photo front did not even remove why allow for the labour. To take out.


Check labour 9,10,11 to provide photos if not to take out.

12 To dismantle front bumper, rhs front fender, rhs front and rear doors. Inspect rhs floor pan for damages. Cut out and weld rhs B-pillar, inner reinforcements and sill panel. Renew damaged panels. Reinstall all parts removed. S=0

\$ 9,100.00

13 To respray rhs front fender, rhs front and rear doors, door handles, rhs B-pillar, sill panel, door entrances and inner reinforcements. To carry out joint sealer works and stone chip treatment. S\$

\$ 5,600.00

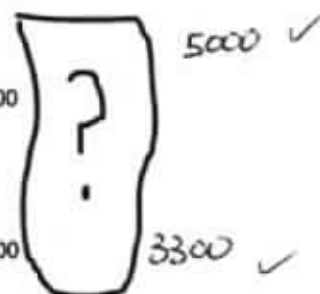

Why the initial

survey amount blank off in the finalisation?

Part 32, 33 to provide diagnostic report of part failure.

58	REAR FENDER-RH	\$	1,930.00
59	REAR B-PILLAR INNER-RH	\$	899.00
60	REAR B-PILLAR PLATE-RH	\$	17.00
61	REAR SIDE MEMBER-RH	\$	409.00
SUB-TOTAL SPARE PARTS			\$ 5,977.00

58	REAR FENDER-RH	/	OK	\$	1,930.00	1544
59	REAR B-PILLAR INNER-RH	X	NAI	\$	899.00	X
60	REAR B-PILLAR PLATE-RH	✓	NAI	\$	17.00	X
61	REAR SIDE MEMBER-RH	✓	NAI	\$	409.00	X
SUB-TOTAL SPARE PARTS				\$	5,977.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved. Remarks (X) = Not approved
Spare parts are Special Netl.

Why blank off again? Also why replace rear fender instead of Rear side member Rh? From photos damage are on the rocker panel.

Part no 80 why need to be replace? Damage photos?

Thanks & Regards

Victor Koh

AIG

Claims Technical Controller

Claims | AIG Asia Pacific Insurance Pte. Ltd

78 Shenton Way #08-16 Singapore 079120

Tel +65 6419 1785 | Fax +65 68357416

Victor-ck.koh@aig.com | www.aig.com

From: Fong, Andy-SY

Sent: Monday, July 29, 2019 2:02 PM

To: Koh, Victor-CK

Cc: Veron Chen (LKKAUTO)

Subject: RE: SLW9079B -(AIG REF:1578404602SG)

Victor, for your review.

Andy Fong

AIG

Claims Technical Control Manager

Singapore | Hong Kong

AIG Asia Pacific Insurance Pte. Ltd.

78 Shenton Way #08-16 Singapore 079120

Tel + (65) 6419 1708 | M: + (65) 9138 1785

Andy-SY.Fong@AIG.com | www.AIG.com.sg

AIG 100 | Celebrating 100 years of risk expertise, promises kept, and creating a better world. Visit 100.aig to learn more.

AIG Asia Pacific won General Insurance Company of the Year at the 22nd Asia Insurance Industry Awards. [Click here to find out more.](#)

From: Veron Chen (LKKAuto) [mailto:veronchen@lkkauto.com]
Sent: Monday, July 29, 2019 12:38 PM
To: Fong, Andy-SY
Subject: [EXTERNAL] SLW9079B -(AIG REF:1578404602SG)

This message is from an external sender; be cautious with links and attachments.

Dear Andy,

Kindly assist for mandate approval.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Chan, Yoke Shi

Date: 16 Jul 2019

Preliminary Advice

Vehicle No	: SLW9079B	Accident Date	: 16/03/2019
Make	: AUDI Q2	Policy No.	: 1800023129-01
Assignment Date	: 21/03/2019	Excess	: S\$800.00
Date of Inspection	: 20/03/2019	Est. Duration of Repair	: 25.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (BENOI) 24 BENOI SECTOR SINGAPORE 629857		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages o/s body and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	69,863.96 (incl.supplementary \$725.00)
Revised Amount	:S\$	43,865.84 (incl.supplementary \$725.00)
Check Items (Estimated)	:S\$	0.00
Total	:S\$	43,865.84
Lump Sum Repair	:S\$	

Total Loss Consideration

New for Old Value	:S\$	145,000.00
Pre-Accident Value	:S\$	105,000.00
COE / PARF Rebate	:S\$	57,947.00
Salvage Value	:S\$	
Margin for Repair (New For Old)	:S\$	87,053.00
Margin for Repair	:S\$	47,053.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

Veron Chen (LKKAUTO)

From: Koh, Victor-CK <Victor-CK.Koh@aig.com>
Sent: Wednesday, 6 November 2019 12:11 PM
To: Veron Chen (LKKAUTO); SUR
Cc: Fong, Andy-SY
Subject: FW: SLW9079B -(AIG REF:1578404602SG)

Hi Veron,

I know you have photos to show front suspension removed. What I am saying is replacing side sill panel or A pillar does not require front suspension to be removed.
Also this vehicle is mount on car-o-liner by 4 base points and not through the jig points. Therefore the labour 8 & 13 is not payable just because repairer has done it for no valid reason.

Thanks & Regards

Victor Koh
AIG
Claims Technical Controller
Claims | AIG Asia Pacific Insurance Pte. Ltd

78 Shenton Way #08-16 Singapore 079120
Tel +65 6419 1785 | Fax +65 68357416
Victor-ck.koh@aig.com | www.aig.com

11/11/19 - Call Abn advised estimate item 8 & 13 remove.

From: Koh, Victor-CK
Sent: Tuesday, October 22, 2019 9:33 AM
To: Veron Chen (LKKAUTO)
Cc: Fong, Andy-SY
Subject: RE: SLW9079B -(AIG REF:1578404602SG)

Hi Veron,

As per last meeting with Premium, we are still pending your explanation why labour 8 (TO REMOVE AND REINSTALL FRONT SUSPENSION FOR CAR-O-LINER REPAIRS) need to be perform?

Thanks & Regards

Victor Koh
AIG
Claims Technical Controller
Claims | AIG Asia Pacific Insurance Pte. Ltd

78 Shenton Way #08-16 Singapore 079120
Tel +65 6419 1785 | Fax +65 68357416
Victor-ck.koh@aig.com | www.aig.com

From: Veron Chen (LKKAUTO) [<mailto:veronchen@lkkauto.com>]
Sent: Monday, October 21, 2019 5:34 PM
To: Koh, Victor-CK
Cc: Fong, Andy-SY
Subject: [EXTERNAL] FW: SLW9079B -(AIG REF:1578404602SG)

This message is from an external sender; be cautious with links and attachments.

Dear Victor,

Kindly let us have your approval please.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Veron Chen (LKKAuto)

Sent: Tuesday, 3 September 2019 3:59 PM

To: Koh, Victor-CK <Victor-CK.Koh@aig.com>

Cc: Fong, Andy-SY <Andy-SY.Fong@aig.com>

Subject: FW: SLW90798 -(AIG REF:1578404602SG)

Dear Victor,

Refer to below email.

For your approval please.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Veron Chen (LKKAuto)

Sent: Wednesday, 31 July 2019 10:22 AM

To: Koh, Victor-CK <Victor-CK.Koh@aig.com>

Cc: Fong, Andy-SY <Andy-SY.Fong@aig.com>

Subject: RE: SLW90798 -(AIG REF:1578404602SG)

Dear Victor,

We have re-upload initial estimate in merimen.

Check Labour 2 and 14 kindly provide measurement reading if not to take out.

Refer attach Labour 2 and Labour 14

Labour 3 from re-inspection photo front did not even remove why allow for the labour. To take out.

Refer photo no 145

Check labour 9,10,11 to provide photos if not to take out.

Refer photo no 128 & 129

Part 32, 33 to provide diagnostic report of part failure.-

Repairer do not have diagnostic report for door control unit, window lifter motor. Will take out these items.

Why replace rear fender instead of Rear side member Rh? From photos damage are on the rocker panel.
Clarify with repairer, there is typo error in the estimate should be rear side member RH instead of rear fender.

Part no 80 why need to be replace? Damage photos?-

Seat belt height adjustor was replaced - jammed by seat belt and airbag activation belt activation.

For your approval please.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Koh, Victor-CK <Victor-CK.Koh@aig.com>

Sent: Monday, 29 July 2019 3:12 PM

To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>

Cc: Fong, Andy-SY <Andy-SY.Fong@aig.com>

Subject: RE: SLW9079B -(AIG REF:1578404602SG)

Hi Veron,

Check Labour 2 and 14 kindly provide measurement reading if not to take out.

Labour 3 from re-inspection photo front did not even remove why allow for the labour. To take out.


Check labour 9,10,11 to provide photos if not to take out.

12 To dismantle front bumper, rhs front fender, rhs front and rear doors. Inspect rhs floor pan for damages. Cut out and weld rhs B-pillar, inner reinforcements and sill panel. Renew damaged panels. Reinstall all parts removed. S\$

\$ 9,100.00

13 To respray rhs front fender, rhs front and rear doors, door handles, rhs B-pillar, sill panel, door entrances and inner reinforcements. To carry out joint sealer works and stone chip treatment. S\$

\$ 5,600.00

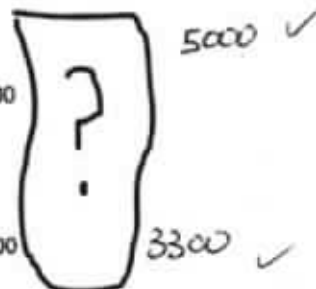

Why the initial

survey amount blank off in the finalisation?

Part 32, 33 to provide diagnostic report of part failure.

58	REAR FENDER-RH	\$	1,930.00
59	REAR B-PILLAR INNER-RH	\$	899.00
60	REAR B-PILLAR PLATE-RH	\$	17.00
61	REAR SIDE MEMBER-RH	\$	409.00
SUB-TOTAL SPARE PARTS		\$	5,977.00

58	REAR FENDER-RH	/ (H)	\$	1,930.00	1544
59	REAR B-PILLAR INNER-RH	X N/A	\$	899.00	X
60	REAR B-PILLAR PLATE-RH	✓ N/A	\$	17.00	X
61	REAR SIDE MEMBER-RH	✓ N/A	\$	409.00	X
SUB-TOTAL SPARE PARTS			\$	5,977.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved. Remarks (X) = Not approved
Spare parts are Special Netl.

Why blank off again? Also why replace rear fender instead of Rear side member Rh? From photos damage are on the rocker panel.

Part no 80 why need to be replace? Damage photos?

Thanks & Regards

Victor Koh

AIG

Claims Technical Controller

Claims | AIG Asia Pacific Insurance Pte. Ltd

78 Shenton Way #08-16 Singapore 079120

Tel +65 6419 1785 | Fax +65 68357416

Victor-ck.koh@aig.com | www.aig.com

From: Fong, Andy-SY

Sent: Monday, July 29, 2019 2:02 PM

To: Koh, Victor-CK

Cc: Veron Chen (LKKAUTO)

Subject: RE: SLW9079B -(AIG REF:1578404602SG)

Victor, for your review.

Andy Fong

AIG

Claims Technical Control Manager

Singapore | Hong Kong

AIG Asia Pacific Insurance Pte. Ltd.

78 Shenton Way #08-16 Singapore 079120

Tel + (65) 6419 1708 | M: + (65) 9138 1785

Andy-SY.Fong@AIG.com | www.AIG.com.sg

AIG 100 | Celebrating 100 years of risk expertise, promises kept, and creating a better world. Visit 100.aig to learn more.

AIG Asia Pacific won General Insurance Company of the Year at the 22nd Asia Insurance Industry Awards. [Click here to find out more.](#)

From: Veron Chen (LKKAuto) [mailto:veronchen@lkkauto.com]
Sent: Monday, July 29, 2019 12:38 PM
To: Fong, Andy-SY
Subject: [EXTERNAL] SLW9079B -(AIG REF:1578404602SG)

This message is from an external sender; be cautious with links and attachments.

Dear Andy,

Kindly assist for mandate approval.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

Veron Chen (LKKAUTO)

From: Veron Chen (LKKAUTO)
Sent: Tuesday, 3 September 2019 3:59 PM
To: Koh, Victor-CK
Cc: Fong, Andy-SY
Subject: FW: SLW9079B -(AIG REF:1578404602SG)
Attachments: LABOUR 2.pdf; LABOUR 14.pdf; photo 128.jpg; photo 129.jpg; photo 145.jpg; DIAGRAM FOR 'B' PILLAR SLW9079B.pdf

Dear Victor,

Refer to below email.

For your approval please.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Veron Chen (LKKAUTO)
Sent: Wednesday, 31 July 2019 10:22 AM
To: Koh, Victor-CK <Victor-CK.Koh@aig.com>
Cc: Fong, Andy-SY <Andy-SY.Fong@aig.com>
Subject: RE: SLW9079B -(AIG REF:1578404602SG)

Dear Victor,

We have re-upload initial estimate in merimen.

Check Labour 2 and 14 kindly provide measurement reading if not to take out.

Refer attach Labour 2 and Labour 14

Labour 3 from re-inspection photo front did not even remove why allow for the labour. To take out.

Refer photo no 145

Check labour 9,10,11 to provide photos if not to take out.

Refer photo no 128 & 129

Part 32, 33 to provide diagnostic report of part failure.-

Repairer do not have diagnostic report for door control unit, window lifter motor. Will take out these items.

Why replace rear fender instead of Rear side member Rh? From photos damage are on the rocker panel.

Clarify with repairer, there is typo error in the estimate should be rear side member RH instead of rear fender.

Part no 80 why need to be replace? Damage photos?-

Seat belt height adjustor was replaced - jammed by seat belt and airbag activation belt activation.

For your approval please.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Koh, Victor-CK <Victor-CK.Koh@aig.com>

Sent: Monday, 29 July 2019 3:12 PM

To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>

Cc: Fong, Andy-SY <Andy-SY.Fong@aig.com>

Subject: RE: SLW9079B -(AIG REF:1578404602SG)

Hi Veron,

Check Labour 2 and 14 kindly provide measurement reading if not to take out.

Labour 3 from re-inspection photo front did not even remove why allow for the labour. To take out.


Check labour 9,10,11 to provide photos if not to take out.

12 To dismantle front bumper, rhs front fender, rhs front and rear doors. Inspect rhs floor pan for damages. Cut out and weld rhs B-pillar, inner reinforcements and sill panel. Renew damaged panels. Reinstall all parts removed. S = 0

\$ 9,100.00

13 To respray rhs front fender, rhs front and rear doors, door handles, rhs B-pillar, sill panel, door entrances and inner reinforcements. To carry out joint sealer works and stone chip treatment. S = 0

\$ 5,600.00

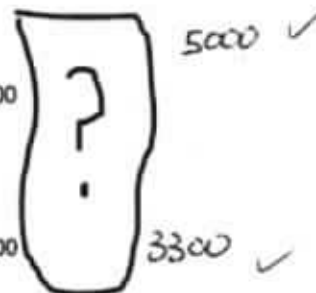

Why the initial

survey amount blank off in the finalisation?

Part 32, 33 to provide diagnostic report of part failure.

58	REAR FENDER-RH	\$	1,930.00
59	REAR B-PILLAR INNER-RH	\$	899.00
60	REAR B-PILLAR PLATE-RH	\$	17.00
61	REAR SIDE MEMBER-RH	\$	409.00
SUB-TOTAL SPARE PARTS			\$ 5,977.00

58	REAR FENDER-RH	/ 00	\$	1,930.00	1544
59	REAR B-PILLAR INNER-RH	X A/A'	\$	899.00	X
60	REAR B-PILLAR PLATE-RH	✓ A/A''	\$	17.00	X
61	REAR SIDE MEMBER-RH	✓ J/AI	\$	409.00	X
SUB-TOTAL SPARE PARTS			\$	5,977.00	

All charges are not inclusive of GST.

Legend: Remarks (OK) = Approved. Remarks (X) = Not approved
Spare parts are Special Nett.

Why blank off again? Also why replace rear fender instead of Rear side member Rh? From photos damage are on the rocker panel.

Part no 80 why need to be replace? Damage photos?

Thanks & Regards

Victor Koh

AIG

Claims Technical Controller

Claims | AIG Asia Pacific Insurance Pte. Ltd

78 Shenton Way #08-16 Singapore 079120

Tel +65 6419 1785 | Fax +65 68357416

Victor-ck.koh@aig.com | www.aig.com

From: Fong, Andy-SY

Sent: Monday, July 29, 2019 2:02 PM

To: Koh, Victor-CK

Cc: Veron Chen (LKKAuto)

Subject: RE: SLW9079B -(AIG REF:1578404602SG)

Victor, for your review.

Andy Fong

AIG

Claims Technical Control Manager

Singapore | Hong Kong

AIG Asia Pacific Insurance Pte. Ltd.

78 Shenton Way #08-16 Singapore 079120

Tel +(65) 6419 1708 | M: +(65) 9138 1785

Andy-SY.Fong@AIG.com | www.AIG.com.sg

AIG 100 | Celebrating 100 years of risk expertise, promises kept, and creating a better world. Visit 100.aig to learn more.

AIG Asia Pacific won General Insurance Company of the Year at the 22nd Asia Insurance Industry Awards. [Click here to find out more.](#)

From: Veron Chen (LKKAuto) [mailto:veronchen@lkkauto.com]
Sent: Monday, July 29, 2019 12:38 PM
To: Fong, Andy-SY
Subject: [EXTERNAL] SLW9079B -(AIG REF:1578404602SG)

This message is from an external sender; be cautious with links and attachments.

Dear Andy,

Kindly assist for mandate approval.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

Veron Chen (LKKAUTO)

From: Boo seng yak <boojohnny@gmail.com>
Sent: Tuesday, 30 July 2019 4:29 PM
To: Veron Chen (LKKAUTO)
Subject: Re: FW: FINAL REVISION - SLW9079B - OD AIG - SURVEYED 25 MAR 19 - STEVE
Attachments: DIAGRAM FOR 'B' PILLAR SLW9079B.pdf

Hi Veron

Attached diagram.

Rgds jb

On Tue, Jul 30, 2019 at 4:27 PM Boo seng yak <boojohnny@gmail.com> wrote:
Hi Veron

Attached, please find our parts diagram for 'B' pillar replaced. You may refer to B4 paint photographs.

We do not have diagnostic report for door control unit, window lifter motor.

Seat belt height adjuster was replaced - jammed by seat belt and airbag activation belt activation.

Best regards - jb

On Tue, Jul 30, 2019 at 12:11 PM Veron Chen (LKKAUTO) <veronchen@lkkauto.com> wrote:

Dear Mr Boo,

Refer to AIG enquire

- 1) To provide diagnostic report of part failure.(Surveyor's request for photos)

Part 32-FRONT WINDOW REGULATOR MOTOR-RH

Part 33- FRONT DOOR CONTROL UNIT-RH

- 2) Also why replace rear fender instead of Rear side member Rh? From photos damage are on the rocker panel.

- 3) Part 80-SEAT BELT HEIGHT ADJUSTER- why need to be replace? Damage photos?

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Boo seng yak <boojohnny@gmail.com>

Sent: Thursday, 27 June 2019 6:15 PM

To: Adrian Ling (LKKAuto) <adrianling@lkkauto.com>; Veron Chen (LKKAuto) <veronchen@lkkauto.com>; SUR <sur@lkkauto.com>; jlayee.yap@premiumauto.com.sg; Chang Chee Sing <claims@premiumauto.com.sg>; Carrine Leong <carrine.leong@premiumauto.com.sg>

Subject: FINAL REVISION - SLW9079B - OD AIG - SURVEYED 25 MAR 19 - STEVE

Hi Adrian, Steve and all,

Revised estimate and Car O Liner report is attached. Photographs can be obtained from our folder in UBI.

Please confirm repair cost of \$43,865.84 @ 31 days.

Your early closure is well appreciated.

Best regards - jb



ETKA

IPC

ACC

TOOLS

MISC

PCB

SUPERVISOR

MACHINE

AUTOMATION

CHEMICAL MATERIALS

STANDARD HARDWARE

NEW AND DISCONTINUED PARTS

REPAIR

ADDITIONAL FUNCTIONS + ADMINISTRATION

ETKA

QTY

QTY

QTY

QTY

QTY

PART NUMBER

DESCRIPTION

REMARK

QTY

QTY

QTY


QTY

QTY

QTY

QTY

840 9079 B

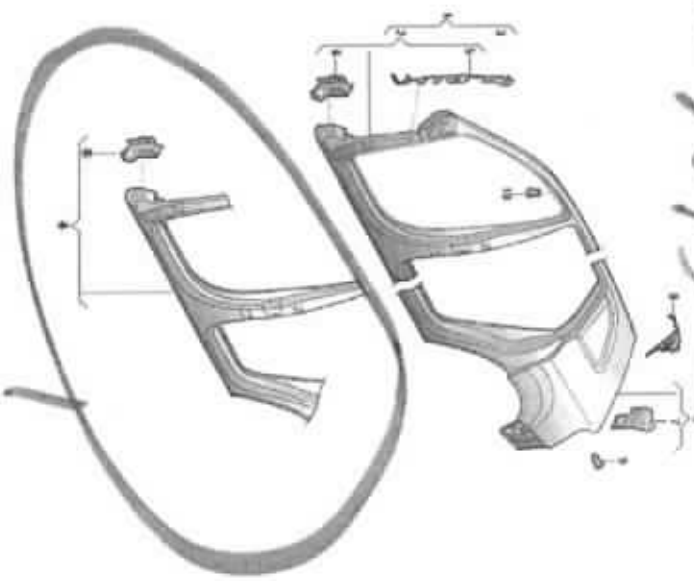

POS	PART NUMBER	DESCRIPTION	REMARK	QTY
1	81A 810 075	Side part	left	1
2	81A 810 076	Side part	right	1
3	81A 809 039	Sectional part - pillar A/B with brace member	left	1
4	81A 809 040	Sectional part - pillar A/B with brace member	right	1
5	81A 809 073	Sectional part - side panel	left	1
6	81A 809 078	Sectional part - side panel	right	1
7	81A 809 047	Sectional part - side member	left	1
8	81A 809 048	Sectional part - side member	right	1
9	81A 809 075	brace - handle	left	1
10	81A 809 076	brace - handle	right	1
11	81A 803 087	Cladding element	left front	1
12	81A 803 088	Cladding element	right front	1
13	81A 809 049	Insert plate	left rear	1
14	81A 809 050	Insert plate	right rear	1
15	81A 810 369	D pillar partition	left	1
16	81A 810 370	D pillar partition	right	1
17	81A 810 371	Insert cap nut	left	1
18	81A 810 372	Insert cap nut	right	1
19	81A 810 373	Insert cap nut	left	1
20	81A 810 374	Insert cap nut	right	1

this part
replaced.

JB

Veron Chen (LKKAuto)

From: Koh, Victor-CK <Victor-CK.Koh@aig.com>
Sent: Monday, 29 July 2019 3:12 PM
To: Veron Chen (LKKAuto)
Cc: Fong, Andy-SY
Subject: RE: SLW9079B -(AIG REF:1578404602SG)

Hi Veron,

Check Labour 2 and 14 kindly provide measurement reading if not to take out.

Labour 3 from re-inspection photo front did not even remove why allow for the labour. To take out. *photo 145*


Check labour 9,10,11 to provide photos if not to take out. *photo 128, 129*

12 To dismantle front bumper, rhs front fender, rhs front and rear doors. Inspect rhs floor pan for damages. Cut out and weld rhs B-pillar, inner reinforcements and sill panel. Renew damaged panels. Reinstall all parts removed. *\$2*

\$ 9,100.00

13 To respray rhs front fender, rhs front and rear doors, door handles, rhs B-pillar, sill panel, door entrances and inner reinforcements. To carry out joint sealer works and stone chip treatment. *\$5*

\$ 5,600.00

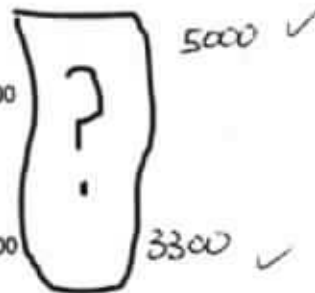

Why the initial

survey amount blank off in the finalisation?

Part 32, 33 to provide diagnostic report of part failure.

58	REAR FENDER-RH	/ DD	\$	1,930.00	1544 ✓
59	REAR B-PILLAR INNER-RH	X	\$	899.00	
60	REAR B-PILLAR PLATE-RH	X	\$	17.00	
61	REAR SIDE MEMBER-RH	X	\$	409.00	
SUB-TOTAL SPARE PARTS			\$	5,977.00	
58	REAR FENDER-RH	/ DD	\$	1,930.00	1544
59	REAR B-PILLAR INNER-RH	X A/A'	\$	899.00	X
60	REAR B-PILLAR PLATE-RH	✓ N/A'	\$	17.00	X
61	REAR SIDE MEMBER-RH	✓ J/A'	\$	409.00	X
SUB-TOTAL SPARE PARTS			\$	5,977.00	

All charges are not inclusive of GST.

Legend: Remarks (OK) = Approved. Remarks (X) = Not approved
Spare parts are Special Netl.

Why blank off again? Also why replace rear fender instead of Rear side member Rh? From photos damage are on the rocker panel. *(Come with body sink)*

Part no 80 why need to be replace? Damage photos? *is not a body part*

Thanks & Regards

Victor Koh

AIG

Claims Technical Controller
Claims | AIG Asia Pacific Insurance Pte. Ltd

78 Shenton Way #08-16 Singapore 079120
Tel +65 6419 1785 | Fax +65 68357416
Victor-ck.koh@aig.com | www.aig.com

From: Fong, Andy-SY
Sent: Monday, July 29, 2019 2:02 PM
To: Koh, Victor-CK
Cc: Veron Chen (LKKAuto)
Subject: RE: SLW9079B -(AIG REF:1578404602SG)

Victor, for your review.

Andy Fong
AIG
Claims Technical Control Manager
Singapore | Hong Kong
AIG Asia Pacific Insurance Pte. Ltd.

78 Shenton Way #08-16 Singapore 079120
Tel +(65) 6419 1708|M: +(65) 9138 1785
Andy-SY.Fong@AIG.com | www.AIG.com.sg

AIG 100 | Celebrating 100 years of risk expertise, promises kept, and creating a better world. Visit 100.aig to learn more.

AIG Asia Pacific won General Insurance Company of the Year at the 22nd Asia Insurance Industry Awards. [Click here to find out more.](#)

From: Veron Chen (LKKAuto) [<mailto:veronchen@lkkauto.com>]
Sent: Monday, July 29, 2019 12:38 PM
To: Fong, Andy-SY
Subject: [EXTERNAL] SLW9079B -(AIG REF:1578404602SG)

This message is from an external sender; be cautious with links and attachments.

Dear Andy,

Kindly assist for mandate approval.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other

- defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

Veron Chen (LKKAUTO)

From: Claims <claims@premiumauto.com.sg>
Sent: Thursday, 18 April 2019 5:06 PM
To: 'Md Ishak, Mohd Imran'
Cc: SUR; 'Loo, Tong Shing'
Subject: RE: SLW9079B OD / 1578404602SG (DOA: 16/3/2019)

Dear Imran,

As spoken, we are now waiting for parts arrival to continue the repairs.

We will need to extend the repairs till the earliest by next Thursday before we can complete the repairs.

Kindly advise if you're able to extend the replacement car period.

Thank you.

Best Regards,
George Wong
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199903271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9828 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



http://www.audi.com.sg/sea/brand/sg/audi_promotions/promotions/car_promotions/new-audi-q2-2017.html

Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.

If you have received it in error, please notify us immediately by reply email and then delete this message from your system.

Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Veron Chen (LKKAUTO) [mailto:veronchen@lkkauto.com]
Sent: Monday, 25 March 2019 9:56 AM
To: 'NORA'; 'Claims Dept'
Cc: SUR
Subject: RE: SLW9079B OD / 1578404602SG (DOA: 16/3/2019)

Dear Nora,

As instructed by our client , please proceed to repair the **insured vehicle SLW 9079B (Excess \$800/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Shirley Hiew (LKK Auto)

Sent: Friday, 22 March 2019 9:18 AM

To: 'NORA ' <nora.khai@premiumauto.com.sg>; 'Claims Dept' <claims@premiumauto.com.sg>

Cc: SUR <sur@lkkauto.com>

Subject: RE: SLW9079B OD / 1578404602SG

Hi All,

Please refer to the below email above & provide us the documents as soon as possible.

 Reply  Reply All  Forward



Thu 21/3/2019 2:19 PM

Loo, Tong Shing <TongShing.Loo@aig.com>

SLW9079B OD / 1578404602SG

To: NORA ; Claims; SUR

 This message was sent with High importance.

Hi All,

Kindly assist to submit all the relevant document in order for us to proceed further :

Undertaking Letter , Interview Form, Video Footage and Driving License.

Thank you.

Loo Tong Shing
AIG

Recovery Representative
Claims Operations | AIG Shared Services

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: NORA [<mailto:nora.khai@premiumauto.com.sg>]

Sent: Thursday, 21 March 2019 4:24 PM

To: 'Shirley Hiew (LKK Auto)' <ShirleyHiew@lkkauto.com>; 'Claims Dept' <claims@premiumauto.com.sg>

Cc: 'SUR' <sur@lkkauto.com>

Subject: RE: SLW9079B OD / 1578404602SG

Dear Shirley,

As requested.

Thank you.

Best Regards,

Norah Khai

Claims Manager

Premium Automobiles Pte Ltd (Reg No 189902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9827 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



http://www.audi.com.sg/sea/brand/sg/audi_promotions/promotions/car_promotions/new-audi-q2-2017.html

Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.

If you have received it in error, please notify us immediately by reply email and then delete this message from your system.

Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Shirley Hiew (LKK Auto) [<mailto:ShirleyHiew@lkkauto.com>]

Sent: Thursday, 21 March 2019 3:47 PM

To: 'Claims Dept'

Cc: SUR

Subject: SLW9079B OD / 1578404602SG

Dear All,

Kindly provide Driving & CI.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

View Received Message

This mail is associated with :

***SLW9079B (1578404602SG)**

OD

Mar 16 2019 5:30AM

[MARTIN DANIEL GERARD]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 29/03/2019 14:00 PM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$35169.00) - SLW9079B - Claim Handler: Loo, Tong Shing

Approved:35169.00:Kindly advise why 9 days labour required? B/F paint required. Re-inspection to be done for damage check and supplementary items / labour.

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To:	AIG Asia Pacific Insurance Pte. Ltd. AIG Building 78 Shenton Way #08-16 Singapore 079120	From:	LKK Auto Consultants Pte Ltd 51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park Singapore 408933
-----	---	-------	---

Attn: Loo, Tong Shing Date: 29 Mar 2019

Preliminary Advice

Vehicle No	: SLW9079B	Accident Date	: 16/03/2019
Make	: AUDI Q2	Policy No.	: 1800023129-01
Assignment Date	: 21/03/2019	Excess	: S\$800.00
Date of Inspection	: 20/03/2019	Est. Duration of Repair	: 18.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (BENOI) 24 BENOI SECTOR SINGAPORE 629857		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages o/s body and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	69,674.00 (incl.supplementary \$445.00)
Revised Amount	:S\$	35,169.00 (incl.supplementary \$445.00)
Check Items (Estimated)	:S\$	21,641.00
Total	:S\$	56,810.00
Lump Sum Repair	:S\$	

Total Loss Consideration

New for Old Value	:S\$	145,000.00
Pre-Accident Value	:S\$	
COE / PARF Rebate	:S\$	57,947.00
Salvage Value	:S\$	
Margin for Repair (New for Old)	:S\$	87,053.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : Kindly approved on the supplementary

View Sent Message

This mail is associated with :

***SLW9079B (1578404602SG)**

OD

Mar 16 2019 5:30AM

[MARTIN DANIEL GERARD]

Premium Automobiles Pte Ltd

[Resend](#)[View Recipients](#)[Print Message](#)[Delete Message](#)[Forward](#)

From LKK Auto Consultants Pte Ltd (LKK_HQ), sent on 25/03/2019 10:30 AM.

To AIG_SG

Subject Re: Alert - Adj Mandate Approved (S\$34724.00) - SLW9079B - Claim Handler: Loo, Tong Shing

Dear Sir/Madam,

According to surveyor, as per discussing with Premium Automobile Mr Kee Siang revised the Labour 7 days \$3500/- for hidden parts will be further additional labour days.

Best Regards,
Veron Chen

<-- Original Message -->

From: AIG_SG

To: LKK_HQ

Sent On: 25/03/2019 09:31 AM

Subject: Alert - Adj Mandate Approved (S\$34724.00) - SLW9079B - Claim Handler: Loo, Tong Shing

Approved:34724.00:Kindly advise why 9 days labour required? Re-inspection to be done for damage check and supplementary items / labour.

DOCUMENTS SUMMARY

There are no documents.

View Received Message

This mail is associated with :

***SLW9079B (1578404602SG)**

OD

Mar 16 2019 5:30AM

[MARTIN DANIEL GERARD]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 25/03/2019 09:31 AM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$34724.00) - SLW9079B - Claim Handler: Loo, Tong Shing

Approved:34724.00:Kindly advise why 9 days labour required? Re-inspection to be done for damage check and supplementary items / labour.

DOCUMENTS SUMMARY

There are no documents.

*As per discussing with Premier Service adviser Mr. ^{Mr. Sing} ~~reps~~ the Labour 7 days. \$3500
for hidden parts will be further additional labour days*

Veron Chen (LKKAuto)

From: Veron Chen (LKKAuto)
Sent: Monday, 25 March 2019 9:56 AM
To: 'NORA'; 'Claims Dept'
Cc: SUR
Subject: RE: SLW9079B OD / 1578404602SG (DOA: 16/3/2019)

Dear Nora,

As instructed by our client, please proceed to repair the **insured vehicle SLW 9079B (Excess S800/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk S1, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Shirley Hiew (LKK Auto)
Sent: Friday, 22 March 2019 9:18 AM
To: 'NORA' <nora.khai@premiumauto.com.sg>; 'Claims Dept' <claims@premiumauto.com.sg>
Cc: SUR <sur@lkkauto.com>
Subject: RE: SLW9079B OD / 1578404602SG

Hi All,

Please refer to the below email above & provide us the documents as soon as possible.

 Reply  Reply All  Forward



Thu 21/3/2019 2:19 PM

Loo, Tong Shing <TongShing.Loo@aig.com>

SLW9079B OD / 1578404602SG

To NORA ; Claims; SUR

 This message was sent with High importance.

Hi All,

Kindly assist to submit all the relevant document in order for us to proceed further :

Undertaking Letter , Interview Form, Video Footage and Driving License.

Thank you.

Loo Tong Shing
AIG

Recovery Representative
Claims Operations | AIG Shared Services

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk S1, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: NORA [<mailto:nora.khai@premiumauto.com.sg>]

Sent: Thursday, 21 March 2019 4:24 PM

To: 'Shirley Hiew (LKK Auto)' <ShirleyHiew@lkkauto.com>; 'Claims Dept' <claims@premiumauto.com.sg>

Cc: 'SUR' <sur@lkkauto.com>

Subject: RE: SLW9079B OD / 1578404602SG

Dear Shirley,

As requested.

Thank you.

Best Regards,

Norah Khai

View Received Message

This mail is associated with :

***SLW9079B (1578404602SG)**

OD

Mar 16 2019 5:30AM

[MARTIN DANIEL GERARD]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 25/03/2019 09:31 AM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$34724.00) - SLW9079B - Claim Handler: Loo, Tong Shing

Approved:34724.00:Kindly advise why 9 days labour required? Re-inspection to be done for damage check and supplementary items / labour.

DOCUMENTS SUMMARY

There are no documents.

Veron Chen (LKKAUTO)

From: Loo, Tong Shing <TongShing.Loo@aig.com>
Sent: Monday, 25 March 2019 9:38 AM
To: Claims Dept; Veron Chen (LKKAUTO); SUR
Subject: RE: SLW90798 OD / 1578404602SG

Hi Kelvin,

Duly noted.

Appreciate if your good side and submit addendum sheet on the video footage part in OI GIA?

Thank you.

Attachment(s)

Are accident photos available for attachment?

YES

Was there any video captured by Car Camera?

YES

THE SD CARD OF CAMERA HAS BEEN

Remarks/ Reasons:

Was there any audio recorded?

NO

Loo Tong Shing
AIG

Recovery Representative
Claims Operations | AIG Shared Services

TongShing.Loo@aig.com | www.aig.com

From: Claims Dept [mailto:claims@premiumauto.com.sg]
Sent: Monday, March 25, 2019 9:31 AM
To: Loo, Tong Shing; 'Veron Chen (LKKAUTO)'; 'SUR'

Cc: 'Claims Dept'
Subject: RE: SLW9079B OD / 1578404602SG

Dear Tong Shing,

We do not have any video footage.

Thank you.

Best regards,
Kelvin Khoo
Premium Automobiles Pte Ltd (Reg No. 199902271W)
55 Ubi Road 1, Road Singapore 408699
p. +65 6388 2323 d. +65 5768 9911 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged. If you have received it in error, please notify us immediately by reply email and then delete this message from your system. Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Loo, Tong Shing [<mailto:TongShing.Loo@aig.com>]
Sent: Monday, 25 March, 2019 9:11 AM
To: Veron Chen (LKKAUTO) <veronchen@lkkauto.com>; NORA <nora.khai@premiumauto.com.sg>; Claims <claims@premiumauto.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: SLW9079B OD / 1578404602SG

Hi Veron,

Received with thanks.

How about the video footage?

Thank you.

Loo Tong Shing
AIG

Recovery Representative
Claims Operations | AIG Shared Services

TongShing.Loo@aig.com | www.aig.com

From: Veron Chen (LKKAUTO) [<mailto:veronchen@lkkauto.com>]
Sent: Saturday, March 23, 2019 10:13 AM
To: Loo, Tong Shing; NORA ; Claims; SUR
Subject: RE: SLW9079B OD / 1578404602SG

Dear Tong Shing,

Relevant documents uploaded in merimen.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email : sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Loo, Tong Shing <TongShing.Loo@aig.com>
Sent: Thursday, 21 March 2019 2:19 PM
To: NORA <nora.khai@premiumauto.com.sg>; Claims <claims@premiumauto.com.sg>; SUR <sur@lkkauto.com>

Subject: SLW9079B OD / 1578404602SG

Importance: High

Hi All,

Kindly assist to submit all the relevant document in order for us to proceed further :

Undertaking Letter , Interview Form, Video Footage and Driving License.

Thank you.

Loo Tong Shing
AIG

Recovery Representative
Claims Operations | AIG Shared Services

TongShing.Loo@aig.com | www.aig.com

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: suri@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Loo, Tong Shing

Date: 21 Mar 2019

Preliminary Advice

Vehicle No	: SLW9079B	Accident Date	: 16/03/2019
Make	: AUDI Q2	Policy No.	: 1800023129-01
Assignment Date	: 21/03/2019	Excess	: S\$0.00
Date of Inspection	: 20/03/2019	Est. Duration of Repair	: 18 days
Inspection At	: Premium Automobiles Pte Ltd (Benoi) 24 Benoi Sector Singapore 629857		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages o/s body and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	69,229.00
Revised Amount	:S\$	34,724.00
Check Items (Estimated)	:S\$	21,641.00
Total	:S\$	56,365.00
Lump Sum Repair	:S\$	

Total Loss Consideration

New for Old Value	:S\$	145,000.00
Pre-Accident Value	:S\$	105,000.00
COE / PARF Rebate	:S\$	57,947.00
Salvage Value	:S\$	
Margin for Repair (New for old)	:S\$	87,053.00
Margin for Repair	:S\$	47,053.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation. (Based on new for old value)
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

Note: This document has not been finalised.**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Loo, Tong Shing

Date: 21 Mar 2019

Preliminary Advice

Vehicle No	: SLW9079B	Accident Date	: 16/03/2019
Make	: AUDI Q2	Policy No.	: 1800023129-01
Assignment Date	: 21/03/2019	Excess	: S\$0.00
Date of Inspection	: 20/03/2019	Est. Duration of Repair	: 18 days
Inspection At	: Premium Automobiles Pte Ltd (Benoi) 24 Benoi Sector Singapore 629857		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages o/s body and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	69,229.00
Revised Amount	:S\$	34,724.00
Check Items (Estimated)	:S\$	21,641.00
Total	:S\$	56,365.00

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	105,000.00
COE / PARF Rebate	:S\$	57,947.00
Salvage Value	:S\$	
Margin for Repair	:S\$	47,053.00

Remarks

- () The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : We are pending repair cost from repairer.

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	6814I
Vehicle Details	
Vehicle No.:	SLW9079B
Vehicle to be Exported:	No
Intended Deregistration Date:	20 Mar 2019
Vehicle Make:	AUDI
Vehicle Model:	Q2 1.0 TFSI S TRONIC (NAV)
Primary Colour:	White
Manufacturing Year:	2018
Engine No.:	CHZ676172
Chassis No.:	WAUZZZGA2JA067336
Maximum Power Output:	85.0 kW (113 bhp)
Open Market Value:	\$29,487.00
Original Registration Date:	08 Mar 2018
First Registration Date:	08 Mar 2018
Transfer Count:	0
Actual ARF Paid:	\$33,282.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	07 Mar 2028
PARF Rebate Amount:	\$24,961.00
Intended COE Rebate Details	
COE Expiry Date:	07 Mar 2028
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$36,810.00
COE Rebate Amount:	\$32,986.00
Total Rebate Amount:	\$57,947.00

The information contained herein is correct as at 20 Mar 2019

OK



AVIVA

Post an Advertisement
Sell it yourself! Advertise it at just
\$58 until it's SOLD!

Post an Ad

Advertiser Login

Ways of Selling

New 5 Years Coe Renewal Honda Stream 1.8A RSZ



2.88% P.A. Low Interest @ 0%
Finance 2 Years Warranty.
\$2500 Down Monthly From \$738
GV Credit Pte Ltd StarAd

• Free VICOM evaluation
• Free grooming and 8 months maintenance
• In-house workshop ensures quality service
• Member of SVTA and hire purchase association
• 100% deposit refund for unapproved loan



YONG LEE SENG MOTOR PTE LTD

Browse by Category

Sort by Date Posted





20 results/page

4 vehicles

Audi Q2

Advanced Search



Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Search Selection	Audi Q2	Any	Any	2018	Any	Any	Any	Available
	Audi Q2 1.4A TFSI S-tronic	\$119,999	\$10,760 /yr	26-Oct-2018	1,395 cc	1,500 km	SUV	Available
Latest Q2 1.4 Engine Variant In Town! Only 1 In The Market! Beautiful Orange Exterior With Black Interior! Top Notch Condition With Low Mileage! As Good As New! Agent Warranty Till October 2023! All T...								
Premium Automobiles								
Posted: 11-Mar-2019 Tags: 2018 Audi Q2, 2018 audi q2, Audi Q2, audi q2, Audi, Q2, q2, Used Audi								
	Audi Q2 1.0A TFSI S-tronic	\$108,999	\$9,830 /yr	26-Oct-2018	999 cc	1,800 km	SUV	Available
Limited Period Only Audi Approved Plus Promo FOC 2 Year Servicing, In Car Camera And Solar Film! 1.0TFSI! Lowest Mileage 1,800km! 5 Years Audi Agent Warranty Till Oct 2023! Fully Audi Agent Servicing ...								
Premium Automobiles								
Posted: 08-Mar-2019 Tags: 2018 Audi Q2, 2018 audi q2, Audi Q2, audi q2, Audi, Q2, q2, Used Audi								
	Audi Q2 1.0A TFSI S-tronic	\$107,999	\$10,040 /yr	21-Jun-2018	999 cc	13,112 km	SUV	Available
Latest Audi Q2! High Loan Available! 5 Years Audi Agent Warranty Till June 2023! Ex-Management Owner! Fully Audi Agent Servicing Since Day One! Low Mileage! Lowest Bank Interest Rate 2.48%! Showroom C...								
Premium Automobiles								
Posted: 07-Mar-2019 Tags: 2018 Audi Q2, 2018 audi q2, Audi Q2, audi q2, Audi, Q2, q2, Used Audi								
	Audi Q2 1.0A TFSI S-tronic	\$112,800	\$10,770 /yr	30-Apr-2018	999 cc	9,600 km	SUV	Available
Audi MGMT Unit, Low Mileage. WF7 Audi Drive Select And Cruise Control Option. 6H6 Blade In Matt Titanium Grey. Call Now For A Non Obligation Viewing!								
Posted: 23-Feb-2019 Tags: 2018 Audi Q2, 2018 audi q2, Audi Q2, audi q2, Audi, Q2, q2, Used Audi								

Save this search criteria, to get email alerts whenever a match is found.

Make Model Price Depreciation Reg Date Eng Cap Mileage Veh Type Status

For old advertisements, view Expired ads

20 results/page

[Home](#) | [New Cars](#) | [Used Cars](#) | [Sell My Car](#) | [Directory](#) | [Products](#) | [Insurance](#) | [Article](#) | [Forum](#) | [Resources](#)

sgCarMart is the number one car classifieds for parallel import cars, Toyota, Honda, Nissan, Mitsubishi & BMW. There are plenty of cars for sale, from vans, trucks, sedan cars, luxury cars, cars or stationwagons, SUV, MPV, hatchback, to COE cars & OPC cars. You can also buy from a car auction, look up car loans, financial services, low mileage cars, car brands, carpark rate insurance. Find here used Audi Q2, Audi Q2 Singapore, used Audi Q2 Singapore, used Audi Q2, used vehicles Singapore or even buy used Audi Q2 Singapore. We have new car dealers authorised car dealers, and used car dealers on our site. Find new car price lists, new car launches and new car promotions. Visit our partner sites for job openings in Singapore jobs, real estate properties for sale, mover, car performance parts, car discussion, forum discussion, commercial vehicle leasing & COE results.

Your Q2



Your Q2

1.0 TFSI S tronic

Basic price

SGD 145,280

Optional equipment

SGD 0



Save/Load



Print

> Request test drive

> Start new configuration

Price

SGD 145,280[Arrange a test drive](#)

Your Q2

1.0 TFSI S tronic

Acceleration
10.3 SecondsDisplacement
999Transmission
S tronicFuel
Sulphur-free super RON 95Max. Torque
200/2000 - 3500Horsepower
116 hpMax. speed
197 km/h

Engine type	Petrol
-------------	--------

Displacement	999
--------------	-----



CERTIFICATE OF INSURANCE

AUDI AUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder : MARTIN DANIEL GERARD
Period of Insurance : 08 Mar 2019 To 07 Mar 2020
Engine No. : CHZ676172
Chassis No. : WAUZZZGA2JA067336

Vehicle No. : SLW9079B
Policy No. : 1800023129-01
Endorsement No. :
Issued Date : 04 Feb 2019

ABOUT THE COVER

Make/Model : AUDI Q2/ Q2 Sport 1.0 TFSI S tronic
Engine Capacity/Tonnage : 999.00 CC Sum Insured : Market Value First Year of Registration : 2018
Driver Restriction : NA Off Peak Car : No Insuring with COE/PAF : Yes
Person or Classes of Persons Entitled to Drive* :

a) The Policyholder
b) Any other person who is driving on the Policyholder's order or with his/her permission.
This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Inexperienced Driver Excess" (IDR) if You are or Your Authorised Driver (named or unnamed) has less than 2 years' driving experience.

Age Condition : 35 years old and above

Limitation as to use* :

Use only for social, domestic and pleasure purposes and for the Policyholder's business.
This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1800cc - 2000cc Optional

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 188) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

EXCESS

Section 1
Fire - \$0 Own Damage - \$800 Theft - \$0 Flood Cover - \$0

Section 2
Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

MARTIN DANIEL GERARD - \$800 (Own Damage)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

1. Audi Customer Service Center Add: 55 Ubi Road 1 Singapore 408689 63621223

For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 8338 8200. Alternatively, you may refer to AIG website www.aig.com.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: United Overseas Bank Limited

We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 188), Part IV of the Road Transport Act, 1987 (Malaysia) and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia).

0504125258

PREMIUM LEASING - MPL

281 ALEXANDRA ROAD AUDI CUSTOMER SERVICE CENTRE
SINGAPORE 159938

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

AIG Asia Pacific Insurance Pte. Ltd.
AUTHORISED REPRESENTATIVE

552791

24-HOUR AIG AUTO HOTLINE: +65 6338 6200

IMPORTANT: KEEP THIS DOCUMENT IN YOUR CAR AT ALL TIMES.

What can the 24-hour AIG Auto Emergency Hotline provide for you?

- Immediate assistance after an accident
- Emergency breakdown service
- Towing service (accident or non-accident related)
- Advice on Motor Claims procedures
- Medical Referral Assistance

If no one is injured in the accident:

- You are not required to make any police report.
- Record vehicle number, name and address, insurance company and policy number of the other driver(s) and vehicle(s).
- Collect details (name, address and contact number) of witnesses and/or try to take photographs of the scene of the accident.
- Report the accident to us with your accident vehicle (whether damaged or not) via our approved reporting centres or authorised repairers within 24 hours or the next working day of the accident.

If the accident involves injuries or damage to government property & vehicles, foreign registered vehicles or non-injury hit & run case:

- Report the accident to the police, providing full details of the circumstances of the accident.
- Record vehicle number, name and address, insurance company and policy number of the other driver(s) and vehicle(s), if applicable.
- Collect details (name, address and contact number) of witnesses and/or try to take photographs of the scene of the accident.
- Report the accident to us with your accident vehicle (whether damaged or not) via our approved reporting centres or authorised repairers within 24 hours or the next working day of the accident.

What should I do in the event of an accident?

- Keep calm and move your car to a safe place.
- Do not admit or discuss fault or blame with the other party(ies).
- Report the accident to us with your accident vehicle (whether damaged or not) via our approved reporting centres or authorised repairers within 24 hours or the next working day of the accident.
- Submit Vek/Summons/Correspondence from third party(ies) to AIG immediately.

LOSS OF USE CAR REPLACEMENT BENEFIT

Applicable only if this benefit is included in your motor insurance. Please refer to your Policy Schedule for details. Policy terms and conditions apply. Please call our customer service hotline number (65) 6419-3000 for assistance.

The Certificate of Insurance (CI) should be produced without demand when collecting the Rental Car and the Rental Car Company reserves the right to verify the identity of the holder. The CI is the property of AIG and its use is subject to the terms and conditions contained in the Loss of Use Endorsement under the policy issued to the policyholder.

Steps to activate Loss of Use Car Replacement Benefit and Important Information

1. To activate your loss of use car replacement, please contact the Rental Car Company (listed below) after filing/reporting your accident claim.
2. Your rental car will be made available within 6 working hours of activation with the Rental Car Company.
3. At the time of collection of the Rental Car, the original insurance policy and schedule issued by AIG, a copy of the Accident Report from Audi Customer Service Centre must be produced.
4. The number of days is based on the period your vehicle is in the repair workshop unless the number of days of loss of use entitlement is stated in the Policy.
5. Rental cars are strictly for use in Singapore only.
6. Extension of rental beyond repair period approved by AIG surveyor will be chargeable by the Rental Car Company on per day basis.
7. Upgrade of Rental Car is available upon request subject to additional charges by the Rental Car Company.

Rental Car Company: Popular Rent A Car Pte. Ltd.

Activation Hotline: 67428888

601 Guillemard Road Singapore 399840

Operation Hours: Monday to Friday: 9am to 6pm Saturday (Half Day): 9am to 4pm

*The Rental Car Company's Terms & Conditions apply (i.e., refundable security deposit, excess liability for the Rental Car, Collision Damage Waiver, etc).

IMPORTANT NOTICE

If you sell your motor vehicle, this Notice is IMPORTANT and MUST be complied with. Policyholders are hereby warned that under the Motor Vehicles (Third Party Risks and Compensation) Act (Cap.99), it shall be unlawful for any person to use or cause or permit any other person to use a motor vehicle without a valid policy of insurance under the Act.

The Policyholder is further warned that on the sale of a motor vehicle, they must surrender the Certificate of Insurance and the Policy to the insurance company. If the Certificate of Insurance has been lost or destroyed, a Statutory Declaration to that effect must be made. Failure to comply with this obligation is an offence under the Motor Vehicles (Third Party Risks and Compensation) Act (Cap.88).

This Policy will cease to be valid once the motor vehicle has been sold to another person unless the transfer of interest has been duly notified to and agreed to by the insurance company concerned. If the insurance company agrees to cover the new owner, they will issue a new Certificate of Insurance in the new owner's name. The premium chargeable may vary according to the new owner's profile.

Jr Sing
978 9294 8417

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	16/03/2019 11:46
Date Of Accident	16/03/2019 05:30
Exact Location Of Accident	INFRONT OF 30 LEE KENG RD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLW9079B
Insured/Policyholder	
Name Of Registered Owner	MARTIN DANIEL GERARD
Passport No/FIN	S8026814I
Email Address	DANIELMARTIN@MEDIACORP.COM.SG
Mobile Phone No	(LOCAL) +65-81184404
Alternative Phone No	OFFICE-81184404

Vehicle Particulars

Manufacturer	AUDI
Model	Q2 SPORT 1.0 TFSI S TRONIC
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	1800023129-01
Cover Note Number	

Driver

Name of Driver	MARTIN DANIEL GERARD
Passport No/FIN	S8026814I
Date Of Birth	04/09/1980
Occupation	INDOOR
Date Of Driving Pass	16/12/2008
Driving Experience	10 YEARS AND 3 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-81184404
Fax Number	
Contact Number	OFFICE-81184404
Email Address	DANIELMARTIN@MEDIACORP.COM.SG

Address	APT BLK 221 BUKIT BATOK EAST AVENUE 3 #06-174
Postcode	650221
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - U-TURN
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	YES
Foreign Vehicle Registration Number	JGD702 (PRIVATE CAR)
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Police Station Name	BUKIT BATOK NEIGHBOURHOOD POLICE CENTRE
Police Station Address	ROAD: 21 BUKIT BATOK EAST AVE 4 , POSTCODE: 659840 , COUNTRY: SINGAPORE
Police Station Contact	TEL NO: 1800-6659999 - FAX NO: 66655793
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

PLEASE REFER TO THE POLICE REPORT NO. T/20190316/2023

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	THE SD CARD OF CAMERA HAS BEEN TAKEN BY POLICE
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	JGD702
Vehicle Make/Model/Colour	PERODUA MYVI
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	TAMIL ARASU VADAMALAI
NRIC/Passport Number	G6875451N
Contact Number	+601111128120
Address	
Postcode	

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

DETAILS OF INJURED PERSON 1

Name	MARTIN DANIEL GERARD
Approximate Age	39
Injuries Sustain	RIGHT HAND ARM
Injured person in which vehicle?	SLW9079B
Were seat belts worn?	YES
Was this injured conveyed to hospital by ambulance?	NO
Address	APT BLK 221 BUKIT BATOK EAST AVE 3
Postcode	650221

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**



I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/tan be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.



Policyholder's Signature
Date & Time:


Driver's Signature
(If driver is not the policyholder)
Date & Time:



Reporting Centre Personnel's Signature
Name: *Joseph Anthony Stanley Goye*
NRIC/FIN No: *C92457422*

Sketch Plan #2

SKETCH PLAN

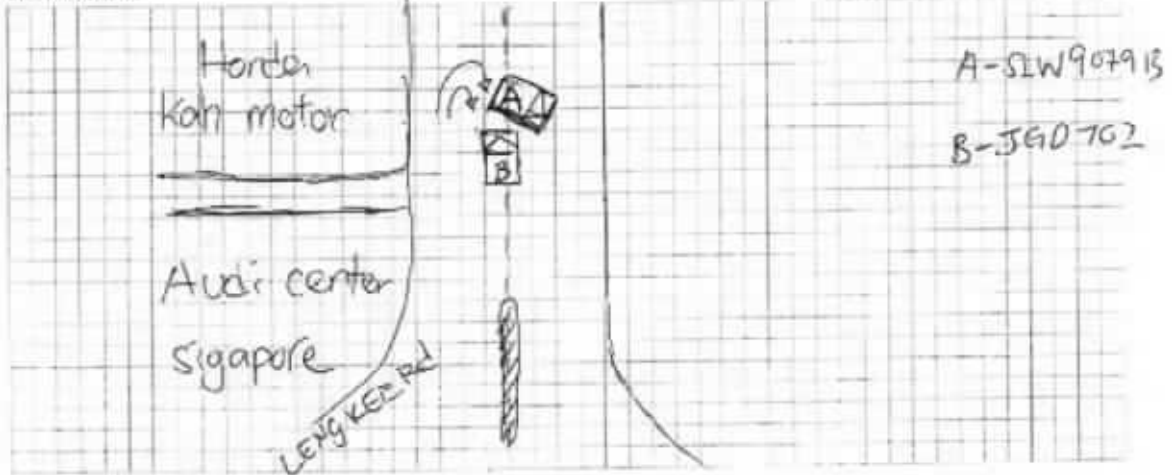

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Please refer to the police report No. T/20190316/2023

DECLARATION

I/We declare the foregoing particulars are true in every respect.

[Signature]

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

[Signature]
Reporting Centre Personnel's Signature
Name: *[Name]*
NRIC/FIN No.: *60987143x*



FORM 100 (REVISED 1/2019)

Police Report


**SINGAPORE
POLICE FORCE**


T/20190316/2023

1 of 3

Report No. T/20190316/2023

Police Station Of Origin:
Bukit Batok N.P.C
21 Bukit Batok East Avenue 4 SINGAPORE
659840
Tel No: 1800-6559999

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 16/03/2019 07:38	Video Report No.: D/20190316/0039	Station Diary No.: 12
--	--------------------------------------	--------------------------

Informant's Particulars

Name of Informant: MARTIN DANIEL GERARD			Address: APT BLK 221 BUKIT BATOK EAST AVENUE 3 #06-174 SINGAPORE 650221		
ID Type / ID No.: NRIC NO / S8026814I			Contact No.: Home/Office: Mobile: 81184404		
Nationality: SINGAPORE CITIZEN			Email:		
Sex: Male	Age: 38	Date of Birth: 04/09/1980	Type of Informant: Driver		
Race: Eurasian-Malayalee			Language: English		Institution / School Name:
Occupation: PRODUCER/PRESENTER			Driving Licence Information: Class: 3 Date of Expiry:		

General Information of the Accident

Type of Accident: Non-Injury Attended by Police	Drink Drive: No	Date/Time of Accident: 16/03/2019 05:30	Type of Location:
Location: Along Road 1 Traveling Toward Road 2 LENG KEE ROAD TIONG BAHRU ROAD			
Weather:	Road Surface:	Road Speed Limit:	
Traffic Flow: Two Way	Traffic Control:	Traffic Volume: No Traffic	
Type of Collision: Between Moving Vehicles - Head To Side			Anyone conveyed by ambulance: No

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No. of Passenger
JGD702	Car				Seriously Damaged	1
SLW6079B	Car	AUDI	Q2 1.0 TFSI S TRONIC (NAV)	White	Seriously Damaged	1

Details of Vehicle Insurance

Vehicle No.	Insurance Company	Insurance No.	Effective	Expiry Date
-------------	-------------------	---------------	-----------	-------------

Police Report



**SINGAPORE
POLICE FORCE**



T/20190316/2023

2 of 3

Police Station Of Origin:
Bukit Batok N.P.C
21 Bukit Batok East Avenue 4 SINGAPORE
659840
Tel No: 1800-6659999

Report No. T/20190316/2023

CONTINUATION OF REPORT

Details of Vehicle Insurance				
Vehicle No.	Insurance Company	Insurance No.	Effective	Expiry Date
SLW9079B	AIG ASIA PACIFIC INSURANCE PTE. LTD.	1800023129-01	08/03/2019	07/03/2020

Details of Person Involved				
Any Pedestrian Involved: No				
No. of Pedestrians Injured: NIL		Use of Pedestrian Crossing: NA		
Name	TAMIL ARASU VADAMALAI	ID No.	G5875451N	
Related Vehicle	JGD702 (Car)	Contact No.	+601111128120	
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL	
Date Treatment	NIL	Date Discharge	NIL	
No. of Days granted Medical Leave	NIL	Degree of Injury	Slight	
Name	MARTIN DANIEL GERARD	ID No.	S8026814I	
Related Vehicle	SLW9079B (Car)	Contact No.	81184404	
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: 3 Date of Expiry: NIL	
Date Treatment	NIL	Date Discharge	NIL	
No. of Days granted Medical Leave	NIL	Degree of Injury	Slight	

Brief Details.

On 16/03/2019 at about 0529hrs, I was travelling along Leng Kee road towards Tiong Bahru road. I was travelling on the left lane. I was then filtering to the right lane to make a U-turn. While I was in the middle, I had checked my blind spots on my right and there were no vehicles. When I was making a U-turn, a car on the right lane had hit on to the right centre of my vehicle. I suffered injuries on my right triceps. Ambulance and traffic police were at scene.

Police Report



**SINGAPORE
POLICE FORCE**



T/20190316/2023

3 of 3

Report No. T/20190316/2023


Police Station Of Origin:
Bukit Batok N.P.C
21 Bukit Batok East Avenue 4 SINGAPORE
656840
Tel No: 1800-6659999

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report: 
J /
Staff Sgt S VIKNESHVARAN S/O
SUBRAMANIAM

Signature Of Interpreter:
Not applicable

Officer In Charge Of Case:
TP / GIT /
SI THABAGESH JEYATHESH
Contact No.: 65478232

Authentication Stamp
NP188

Signature Of Informant:



Date/Time:
16/03/2019 07:36

Classification Of Case:

SINGAPORE POLICE FORCE ACKNOWLEDGEMENT SLIP

SINGAPORE POLICE FORCE
ACKNOWLEDGEMENT SLIPRef: Report No: D/20190316/0039

I, SSS T100353 Jheri
(Recipient's Name, Contact No. / NRIC or Passport No. / Rank and No.)
of 10 unit Ave 3 (TRAG)
(Address / Police Station / NPC / NPP)

hereby acknowledge receipt of the below mentioned items of:

1 logon 16GB MicroSD
2
3
4
5
6
7
8
9
10

from Martin Daniel Fiorard / S80268141
(Name, NRIC or Passport No. / Rank and No.)
of BUC 221 BY BATOK ONE AVE 3 406-174 S650221
(Address / Police Station / NPC / NPP)
on 16/3/19 at 0650 HRS
(Date) (Time)

Witnessed by / * Handled over by:
(* Delete if applicable)

Received by:

(Signature)
S80268141 Martin Daniel Fiorard.
(Name, NRIC or Passport No. / Rank and No.)

(Signature)
SSS T100353 Jheri
(Name, Contact No. / NRIC or Passport No. / Rank and No.)

Other Remarks:
/



AIG Asia Pacific Insurance Pte. Ltd
AIG Building
78 Shenton Way
#07-16

MOTOR ACCIDENT INTERVIEW FORM

NAME : Martin Daniel Gerard
VEHICLE NUMBER : SLW 9079 B
DATE/ TIME OF ACCIDENT : 16 March 2019 / 5.30am
PLACE OF ACCIDENT : In front of 30 Leng Kee Road.
THIRD PARTY VEHICLE (IF ANY) : JGD 702

WHERE DID YOU START YOUR JOURNEY AND WHERE WAS THE INTENDED DESTINATION BEFORE THE ACCIDENT?

Journey began at Audi Centre Singapore, 281 Alexandra Rd. I had signed up for the Audi-organised Driveaway to Desaru. We reported at 5am, the briefing ended at around 5.25am, I had just driven out of Audi Centre and was one of the first cars to depart, when the accident occurred. The rest of the convoy emerged soon after, and we were headed to Tuas Checkpoint.

DID YOU DRINK ANY ALCOHOLIC DRINKS BEFORE YOU DRIVE ON THE DAY OF THE ACCIDENT? IF YES, DID THE TRAFFIC POLICE CONDUCT ANY BREATHE-ANALYSER TEST ON YOU? IF YES, WHAT WAS THE RESULTS?

No, to all the above.

WHAT IS THE TYPE OF COLLISION AND THE EXTENSIVENESS OF THE DAMAGES TO ALL VEHICLES INVOLVED?

As stated in the police report, my car (SLW9079B) was hit on the driver's side, right-centre B-Pillar area by the vehicle JGD702. Both side airbags deployed. The assessor has inspected the damage to the car and would have a fuller report on extensiveness of the damage. This would include damage to both doors on the drivers side, B-Pillar, side skirting, and more, that I would not have full information on. The full report could be obtained from the Premium Autocare Centre and assessor.

WERE YOU OR YOUR PASSENGER/S INJURED? IF INJURED, WHICH HOSPITAL? WERE YOU TAKEN TO THE TRAFFIC POLICE FOR INVESTIGATION?

I (driver) received superficial scratches on my right arm (tricep area). My passenger (Shane Martin) & I, visited our GP on Sat 16/3 just after the accident - with body aches and pains from the accident. We were issued medication, 3-days MC, and advice to monitor for more serious conditions. The driver and passenger of the car which hit me did not seek medical aid from the ambulance that attended to us on-site. The JGD702 driver reported scratches on his leg, and his female passenger did not report any injuries on-site. We all signed forms with the medics on-site, after they attended us. I was not taken to Traffic Police for investigation; communication with them thereafter was via phone and text.

NAME: Martin Daniel Gerard


I AFFIRMED THE ABOVE INFORMATION IS GIVEN TO MY BEST KNOWLEDGE


UNDERTAKING

I, Martin Daniel Gerard, (NRIC No. S 8026814 I), hereby confirm that the Singapore Accident Statement lodged by me on Sat, 16 March 2019 at 7:36am hours pertaining to the accident involving motor car Reg. No: SLW 9079 B, in which I was the driver are true and accurate to the best of my knowledge, information and belief.

I acknowledge that my insurers are not liable under the contract of insurance if there is a breach of policy terms and conditions.

In the event that an unrelated/unreported third party property or injury claim arises or there is evidence emerges that there is a breach of policy terms and conditions, I irrevocably undertake to absolve my insurer from all liability under the contract of insurance and I undertake to re-pay any sums paid by my insurers pursuant to the contract of insurance upon receipt of written demand by my insurers.

Signature : 
Name of Insured / Driver : Martin Daniel Gerard
Nric No. : S 8026814 I
Date : 22 March 2019

Signature : 
Name of Policyholder : Martin Daniel Gerard
Nric No. : S 8026814 I
Date : 22 March 2019

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate	:	Accident Repairs
Workshop	:	Ubi Road 1
Contact No	:	6366 2323
Fax No	:	6841 1183
Reference	:	PA/OD/0349/2019/DY
Date	:	19-Mar-19

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name	:	Mr.Martin Daniel Gerard
Address	:	Blk 221 Bukit Batok East Ave 3 #06-174 Singapore 650221
Telephone	:	HP +65 81184404
Type of Claim	:	Own Damage Claims
Policy No.	:	1800023129-01
Vehicle No	:	SLW 9079 B
Model Code	:	AUDI Q2 1.0 TFSI S-TRONIC
Model / Year	:	8/3/2018
Engine No	:	CHZ 676172
Chassis No	:	WAUZZZGA2JA067336
Mileage	:	
Date In	:	
Liability	:	-
Excess Cost	:	-
Estimated By	:	Johnny Boo / Allan Wu
Accident Date	:	16-Mar-19
Place of Accident	:	INFRONT OF 30 LEE KENG RD

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLW 9079 B

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
1	To carry out towing services	S/N FOC	
2	To carry out first measurement on car-o-liner.	S/N \$ 800.00	? ✓ ✓
3	To remove and reinstall front wire harness for headlights, horns, fog lamps, outside temperature sensor and headlight washer assy.	S/N \$ 360.00	✓ <i>prim photo 145</i>
4	To remove and transfer rhs front and rear doors' multi-lock systems and power window devices. Inspect for damages and renew if necessary.	S/N \$ 720.00	✓ ✓
5	To remove and reinstall rhs front seat assy, ABCD pillar trims, sill rims, floor carpets, electronics components and fuse trays.	S/N \$ 1,400.00	✓ ✓
SUB LABOUR CHARGES		\$ 3,280.00	

[Signature]
21/3/19

EXCESS - ?

*Stew (LKK)
8322 8813*

OD - Revert

20/3/19 3:30 pm

18 days

P/P

RL bot of disassemble parts

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLW 9079 B

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
6	To dislodge and reinstall rear wire harness for lights, battery manager, fuse and relay trays, electrical and audio equipment. Inspect for damage and renew where necessary.	S/N \$ 1,400.00	? X
7	To remove and reinstall centre console, renew airbag control unit, roof liner, both curtain airbags, and both front seat belts.	S/N \$ 2,800.00	/ ✓
8	To renew driver seat air bag and leather cover.	S/N \$ 800.00	/ ✓
9	To remove and reinstall front suspension for car-o-liner repairs.	S/N \$ 2,400.00	? X ✓ photo 128, 129
10	To remove and reinstall rear exhaust silencer assy, rear suspension assy and fuel tank, for car-o-liner repairs.	S/N \$ 2,800.00	? X
SUB LABOUR CHARGES		: \$ 10,200.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLW 9079 B

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
11	To place vehicle on car-o-liner.	S/N \$ 1,800.00	✓ ✓ photo 128, 129
12	To dismantle front bumper, rhs front fender, rhs front and rear doors. Inspect rhs floor pan for damages. Cut out and weld rhs B-pillar, inner reinforcements and sill panel. Renew damaged panels. Reinstall all parts removed. S=0	\$ 9,100.00	4500 5000 ✓ 3500, 7 days 018015 1st Samy 25/3/19
13	To respray rhs front fender, rhs front and rear doors, door handles, rhs B-pillar, sill panel, door entrances and inner reinforcements. To carry out joint sealer works and stone chip treatment. S=0	\$ 5,600.00	2700 3300
14	To carry out wheel alignment.	S/N \$ 240.00	✓ ? X
15	To carry out diagnostic check.	S/N \$ 384.00	✓ ✓
TOTAL LABOUR CHARGES		\$ 30,604.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLW 9079 B

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	FRONT FENDER-RH / <i>DD</i>	\$ 1,047.00	<i>837.60</i>
2	FRONT FENDER ATTACHMENT PARTS <i>X</i> <i>NEC</i> <i>NN</i>	\$ 36.00	<i>X</i>
3	FRONT FENDER UPPER BRACKET-LH <i>PM</i> <i>NEC</i>	\$ 14.00	<i>11.04</i>
4	FRONT FENDER BRACKET-LH <i>PM</i> <i>NEC</i>	\$ 43.00	<i>34.08</i>
5	FRONT FENDER LOWER BRACKET-LH <i>PM</i> <i>NEC</i>	\$ 14.00	<i>11.04</i>
6	FRONT FENDER CLOSING ELEMENT-LH <i>PM</i> <i>?</i> <i>NEC</i>	\$ 30.00	<i>23.76</i>
7	FRONT FENDER COVER-RH <i>X</i> <i>NN</i>	\$ 37.00	
8	FRONT WHEEL HOUSING LINER-RH <i>W</i> <i>ADN</i> <i>TN</i>	\$ 183.00	<i>146.40</i>
9	WHEEL HOUSING LINER ATTACMENT PARTS <i>W</i> <i>NN</i> <i>2</i> <i>NEC</i>	\$ 52.00	<i>41.60</i>
10	FRONT WHEEL COVER-LH/RH <i>CHT</i> <i>2</i> <i>1</i> <i>2</i>	\$ 588.00	<i>469.60</i>
11	FRONT DOOR-RH <i>DD</i>	\$ 2,285.00	<i>1828</i>
12	DOOR ATTACHMENT PARTS <i>X</i> <i>NEC</i> <i>NN</i>	\$ 85.00	<i>X</i>
<i>13</i>	FRONT DOOR HINGE HALF UPPER PART-RH UPPER <i>?</i> <i>DT</i>	\$ 41.00	<i>32.82</i>
<i>14</i>	FRONT DOOR HINGE HALF LOWER PART-RH LOWER <i>?</i> <i>DT</i>	\$ 41.00	<i>32.82</i>
<i>15</i>	FRONT DOOR HINGE HALF UPPER PART-RH LOWER <i>?</i> <i>DT</i>	\$ 39.00	<i>30.60</i>
<i>16</i>	FRONT DOOR CATCH-RH <i>?</i> <i>DT</i>	\$ 109.00	<i>87.20</i>
17	FRONT DOOR SEAL INNER-RH <i>NEC</i>	\$ 146.00	<i>116.80</i>
18	FRONT DOOR HANDLE EXTERIOR-RH <i>BR</i>	\$ 331.00	<i>264.40</i>
19	FRONT DOOR HANDLE HOUSING-RH <i>BR</i>	\$ 47.00	<i>37.60</i>
<i>20</i>	FRONT DOOR SLIDE VALE -RH <i>W</i> <i>NN</i> <i>NEC</i>	\$ 12.00	<i>9.60</i>
SUB-TOTAL SPARE PARTS		\$ 5,180.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLW 9079 B

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
21	FRONT DOOR UNDERLAY-RH FRONT ? X NAI	\$ 5.00	X
22	FRONT DOOR UNDERLAY-RH REAR ? X NAI	\$ 6.00	X
23	FRONT DOOR MOUNTING BAR-RH ? / DT	\$ 149.00	118.50
24	FRONT DOOR BOWDEN CABLE-RH ? / N/A	\$ 49.00	38.46
25	FRONT DOOR HOLDER FOR BOWDEN CABLE-RH ? X NAI	\$ 4.00	X
26	FRONT DOOR LOCK-RH ? / DT	\$ 487.00	138.20
27	FRONT DOOR LOCK COVER-RH ? X NAI	\$ 13.00	X
28	FRONT WINDOW GUIDE-RH X NAI	\$ 377.00	
29	FRONT WINDOW APERTURE SEAL-RH X NAI / DT	\$ 119.00	45.30
30	FRONT TRIM FOR PILLAR B-RH X (C) (A) (P) (M) NAI	\$ 105.00	X
31	FRONT WINDOW REGULATOR WITHOUT MOTOR-RH ? / S/M	\$ 241.00	192.40
32	FRONT WINDOW REGULATOR MOTOR-RH ? X NAI	\$ 224.00	
33	FRONT DOOR CONTROL UNIT-RH ? X NAI	\$ 456.00	
34	FRONT DOOR COVER-RH ? / (C) (M) (A) (P) (M)	\$ 235.00	157.60
35	FRONT DOOR WIRING SET-RH ? / Short	\$ 453.00	136.40
36	FRONT WIRING HARNESS FOR DOOR TRIM PANEL-RH ? X NAI	\$ 227.00	X
37	REAR DOOR-RH / DT	\$ 2,285.00	1628
38	REAR DOOR OUTER DOOR SEAL-RH X N/A	\$ 119.00	94.50
39	BONDING AGENT X NAI	\$ 45.00	
40	CLEANING SOLUTION X NAI	\$ 65.00	
SUB-TOTAL SPARE PARTS		\$ 5,664.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLW 9079 B

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
41	APPLICATOR X NAI	\$ 7.00	
42	REAR DOOR HINGE HALF UPPER PART-RH UPPER / BT	\$ 41.00	33.05
43	REAR DOOR HINGE HALF LOWER PART-RH UPPER / BT	\$ 44.00	35.04
44	REAR DOOR HINGE HALF UPPER PART-RH LOWER / BT	\$ 39.00	30.50
45	REAR DOOR HINGE HALF LOWER PART-RH LOWER X BT NAI	\$ 41.00	X
X 46	REAR DOOR CATCH-RH ? / BT	\$ 109.00	87.30
47	REAR DOOR CATCH COVER-RH ? X NAI	\$ 14.00	X
48	REAR DOOR SEAL INNER-RH / AEC	\$ 256.00	24.50
49	REAR DOOR SEAL OUTER-RH X AEC / AEC	\$ 53.00	44.92
50	DOOR ATTACHMENT PARTS X NAI	\$ 85.00	
51	REAR WINDOW GUIDE-RH X NAI	\$ 377.00	
X 52	REAR WINDOW APERTURE SEAL-RH OUTER X AEC	\$ 124.00	99.90
53	REAR TRIM FOR PILLAR B-RH ? X NAI	\$ 105.00	X
54	REAR WINDOW REGULATOR WITHOUT MOTOR-RH ? X NAI	\$ 241.00	X
55	REAR WINDOW REGULATOR MOTOR-RH ? X NAI	\$ 270.00	X
56	REAR DOOR COVER-RH / AEC (not (multy))	\$ 208.00	164.80
57	REAR DOOR WIRING SET-RH ? X NAI	\$ 710.00	X
58	REAR FENDER-RH / NO Section part - Side member P1	\$ 1,930.00	1544
TBA 59	REAR B-PILLAR INNER-RH X NAI	\$ 899.00	X
60	REAR B-PILLAR PLATE-RH / NAI	\$ 17.00	X
61	REAR SIDE MEMBER-RH / NAI	\$ 409.00	X
SUB-TOTAL SPARE PARTS		\$ 5,977.00	

All charges are not inclusive of GST.

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLW 9079 B

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
61	SIDE MEMBER-RH X N/A	\$ 409.00	X
62	REAR A-PILLAR-OUTER RH X N/A	\$ 746.00	X
63	FRONT DATA TAG-RH / N/A	\$ 423.00	338 6
64	FRONT DATE PRESSURE-RH / N/A	\$ 26.00	20.56
65	SIDE MEMBER TRIM-RH / N/A	\$ 218.00	174.40
66	1 SET OF FOAM STRIPS ? / N/A	\$ 126.00	100.40
67	PLASTIC PRIMER 40ML ? X N/A	\$ 101.00	X
68	ACRYLIC SEALER / N/A	S/N \$ 360.00	360
69	CAVITY WAX / N/A	S/N \$ 280.00	280
70	STONE CHIP / N/A	S/N \$ 180.00	180
71	ROOF LINER / CRV	\$ 1,809.00	447.20
* 72	FRONT A-PILLAR TRIM-LH ? / BA CRV	2 \$ 294.00	236.40
73	HEAD AIR BAG UNIT-LH/RH LH / RH / OR	2 \$ 2,644.00	2115.20
74	AIR BAG CONTROL UNIT - N/A	\$ 1,593.00	1274.40
75	PRESSURE SENSOR / N/A	\$ 245.00	116
76	CRASH SENSOR FOR AIR BAG / N/A	4 \$ 1,526.00	1220.80
* 77	FRONT GRAB HANDLE ? / Jumper	2 \$ 258.00	206.40
78	THREE POINT AUTOMATIC SEAT (Seat belt) RH / LH / OR	2 \$ 1,904.00	1523.20
79	FELT STRIPS X N/A	\$ 22.00	
* 80	SEAT BEALT HEIGHT ADJUSTER ? / N/A	2 \$ 322.00	257.60 6
81	BACKREST COVER-RH / TN	\$ 2,533.00	2026.40
SUB-TOTAL SPARE PARTS		\$ 16,019.00	

All charges are not inclusive of GST.

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved.
Spare parts are Special Nett.