

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLW 9079 B**

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
81	BACKREST COVER-RH X RPT	\$ 2,533.00	
82	PADDING FOR BACKREST-RH ? X MV	TBC	X
83	SIDE AIR BAG UNIT-RH / OR	\$ 1,164.00	931.00
84	ADAPTER WIRING HARNESS FOR SIDE AIR BAG-FRONT / NEC	\$ 88.00	70.24
85	SUNDRIES ? / MV	\$ 2,000.00	167.76
TOTAL SPARE PARTS :		\$ 38,625.00	
TOTAL LABOUR CHARGES		\$ 30,604.00	
GRAND TOTAL		\$ 69,229.00	69,954

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

69867.96

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the
progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Supplementary Estimate

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 / Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/0349/2019/DY 26-Mar-19 Kee Siang 1 of 1 SLW 9079 B AUDI Q2 1.0 TFSI S-TRONIC
Quantity	Description	Unit Price	Amount
<u>Parts</u>			
1	Door Handle Sensor <i>Shent</i>	\$ 208.00	\$ 166.40
2	Rear Wheel Cover RH Rear <i>cut</i>	\$ 156.00	\$ 124.40
3	Rear Fender Bracket <i>GR</i>	\$ 81.00	\$ 64.16
4	METAL FILLER <i>APC</i> S/N	\$ 280.00	\$ 280.00
GRAND TOTAL :		\$ 725.00	\$ 634.96

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate	:	Accident Repairs
Workshop	:	Ubi Road 1
Contact No	:	6366 2323
Fax No	:	6841 1183
Reference	:	PA/OD/0349/2019/DY
Date	:	19-Mar-19

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name	:	Mr.Martin Daniel Gerard
Address	:	Blk 221 Bukit Batok East Ave 3 #06-174 Singapore 650221
Telephone	:	HP +65 81184404
Type of Claim	:	Own Damage Claims
Policy No.	:	1800023129-01
Vehicle No	:	SLW 9079 B
Model Code	:	AUDI Q2 1.0 TFSI S-TRONIC
Model / Year	:	8/3/2018
Engine No	:	CHZ 676172
Chassis No	:	WAUZZZGA2JA067336
Mileage	:	
Date In	:	
Liability	:	-
Excess Cost	:	-
Estimated By	:	Johnny Boo / Allan Wu
Accident Date	:	16-Mar-19
Place of Accident	:	INFRONT OF 30 LEE KENG RD

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLW 9079 B

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
1	To carry out towing services	S/N FOC	
2	To carry out first measurement on car-o-liner.	S/N \$ 800.00	?
3	To remove and reinstall front wire harness for headlights, horns, fog lamps, outside temperature sensor and headlight washer assy.	S/N \$ 360.00	X
4	To remove and transfer rhs front and rear doors' multi-lock systems and power window devices. Inspect for damages and renew if necessary.	S/N \$ 720.00	/
5	To remove and reinstall rhs front seat assy, ABCD pillar trims, sill rims, floor carpets, electronics components and fuse trays.	S/N \$ 1,400.00	/
SUB LABOUR CHARGES		: \$ 3,280.00	

Excess - ?

Stew (CLKK)
8322 8813

00 - Revert

20/3/19 3:30 pm

18 chys

Re bot of dismantle parts

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6641 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLW 9079 B

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
6	To dislodge and reinstall rear wire harness for lights, battery manager, fuse and relay trays, electrical and audio equipment. Inspect for damage and renew where necessary.	S/N \$ 1,400.00	?
7	To remove and reinstall centre console, renew airbag control unit, roof liner, both curtain airbags, and both front seat belts.	S/N \$ 2,800.00	✓
8	To renew driver seat air bag and leather cover.	S/N \$ 800.00	✓
9	To remove and reinstall front suspension for car-o-liner repairs.	S/N \$ 2,400.00	?
10	To remove and reinstall rear exhaust silencer assy, rear suspension assy and fuel tank, for car-o-liner repairs.	S/N \$ 2,800.00	?
SUB LABOUR CHARGES		: \$ 10,200.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLW 9079 B

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
11	To place vehicle on car-o-liner.	S/N \$ 1,800.00	?
12	To dismantle front bumper, rhs front fender, rhs front and rear doors. Inspect rhs floor pan for damages. Cut out and weld rhs B-pillar, inner reinforcements and sill panel. Renew damaged panels. Reinstall all parts removed. S 20	\$ 9,100.00	4500
13	To respray rhs front fender, rhs front and rear doors, door handles, rhs B-pillar, sill panel, door entrances and inner reinforcements. To carry out joint sealer works and stone chip treatment. S 50	\$ 5,600.00	2200
14	To carry out wheel alignment.	S/N \$ 240.00	4. ?
15	To carry out diagnostic check.	S/N \$ 384.00	✓
TOTAL LABOUR CHARGES		: \$ 30,604.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLW 9079 B

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	FRONT FENDER-RH / DD	\$	1,047.00
2	FRONT FENDER ATTACHMENT PARTS / NEC	\$	36.00
3	FRONT FENDER UPPER BRACKET-LH / NEC	\$	14.00
4	FRONT FENDER BRACKET-LH / NEC	\$	43.00
5	FRONT FENDER LOWER BRACKET-LH / NEC	\$	14.00
6	FRONT FENDER CLOSING ELEMENT-LH / ?	\$	30.00
7	FRONT FENDER COVER-RH / NN	\$	37.00
8	FRONT WHEEL HOUSING LINER-RH / NN	\$	183.00
9	WHEEL HOUSING LINER ATTACHMENT PARTS / NN 2	\$	52.00
10	FRONT WHEEL COVER-LH/RH / CUT 1 2	\$	588.00
11	FRONT DOOR-RH / DD	\$	2,285.00
12	DOOR ATTACHMENT PARTS / NEC	\$	85.00
13	FRONT DOOR HINGE HALF UPPER PART-RH UPPER ?	\$	41.00
14	FRONT DOOR HINGE HALF LOWER PART-RH LOWER ?	\$	41.00
15	FRONT DOOR HINGE HALF UPPER PART-RH LOWER ?	\$	39.00
16	FRONT DOOR CATCH-RH ?	\$	109.00
17	FRONT DOOR SEAL INNER-RH / NEC	\$	146.00
18	FRONT DOOR HANDLE EXTERIOR-RH / BR	\$	331.00
19	FRONT DOOR HANDLE HOUSING-RH / BR	\$	47.00
20	FRONT DOOR SLIDE VALE -RH / NN	\$	12.00
SUB-TOTAL SPARE PARTS		\$	5,180.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLW 9079 B**

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
21	FRONT DOOR UNDERLAY-RH FRONT ?	\$	5.00
22	FRONT DOOR UNDERLAY-RH REAR ?	\$	6.00
23	FRONT DOOR MOUNTING BAR-RH ?	\$	149.00
24	FRONT DOOR BOWDEN CABLE-RH ?	\$	49.00
25	FRONT DOOR HOLDER FOR BOWDEN CABLE-RH ?	\$	4.00
26	FRONT DOOR LOCK-RH ?	\$	487.00
27	FRONT DOOR LOCK COVER-RH ?	\$	13.00
28	FRONT WINDOW GUIDE-RH X <i>NN</i>	\$	377.00
29	FRONT WINDOW APERTURE SEAL-RH X <i>NN</i>	\$	119.00
30	FRONT TRIM FOR PILLAR B-RH X <i>NN</i> (long for pil)	\$	105.00
31	FRONT WINDOW REGULATOR WITHOUT MOTOR-RH ?	\$	241.00
32	FRONT WINDOW REGULATOR MOTOR-RH ?	\$	224.00
33	FRONT DOOR CONTROL UNIT-RH ?	\$	456.00
34	FRONT DOOR COVER-RH ? <i>✓</i> (NN) (NN)	\$	235.00
35	FRONT DOOR WIRING SET-RH ?	\$	453.00
36	FRONT WIRING HARNESS FOR DOOR TRIM PANEL-RH ?	\$	227.00
37	REAR DOOR-RH <i>✓</i> <i>NN</i>	\$	2,285.00
38	REAR DOOR OUTER DOOR SEAL-RH X <i>NN</i> <i>NN</i>	\$	119.00
39	BONDING AGENT X <i>NN</i>	\$	45.00
40	CLEANING SOLUTION X <i>NN</i>	\$	65.00
SUB-TOTAL SPARE PARTS		\$	5,664.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLW 9079 B

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
41	APPLICATOR X <i>NN</i>	\$ 7.00	
42	REAR DOOR HINGE HALF UPPER PART-RH UPPER ✓ <i>BT</i>	\$ 41.00	
43	REAR DOOR HINGE HALF LOWER PART-RH UPPER ✓ <i>BT</i>	\$ 44.00	
44	REAR DOOR HINGE HALF UPPER PART-RH LOWER ✓ <i>BT</i>	\$ 39.00	
45	REAR DOOR HINGE HALF LOWER PART-RH LOWER ✓ <i>BT</i>	\$ 41.00	
46	REAR DOOR CATCH-RH ?	\$ 109.00	
47	REAR DOOR CATCH COVER-RH ?	\$ 14.00	
48	REAR DOOR SEAL INNER-RH ✓ <i>ABC</i>	\$ 256.00	
49	REAR DOOR SEAL OUTER-RH X <i>RPT</i>	\$ 53.00	
50	DOOR ATTACHMENT PARTS X <i>NN</i>	\$ 85.00	
51	REAR WINDOW GUIDE-RH X <i>NN</i>	\$ 377.00	
52	REAR WINDOW APERTURE SEAL-RH OUTER X <i>NN</i>	\$ 124.00	
53	REAR TRIM FOR PILLAR B-RH ?	\$ 105.00	
54	REAR WINDOW REGULATOR WITHOUT MOTOR-RH ?	\$ 241.00	
55	REAR WINDOW REGULATOR MOTOR-RH ?	\$ 270.00	
56	REAR DOOR COVER-RH ✓ <i>ABC (int) (multy)</i>	\$ 206.00	
57	REAR DOOR WIRING SET-RH ?	2 \$ 710.00	
58	REAR FENDER-RH (<i>Side member L</i>) <i>DO</i> ✓	\$ 1,930.00	
59	REAR B-PILLAR INNER-RH (<i>inner</i>) ?	\$ 899.00	
60	REAR B-PILLAR PLATE-RH (<i>inner</i>) ?	\$ 17.00	
61	REAR SIDE MEMBER-RH (<i>inner</i>) ?	\$ 409.00	
SUB-TOTAL SPARE PARTS		\$ 5,977.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLW 9079 B

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
61	SIDE MEMBER-RH <i>X RPT</i>	\$	409.00
62	REAR A-PILLAR-OUTER RH <i>(cf PL) ?</i>	\$	746.00
63	FRONT DATA TAG-RH <i>? (charge in)</i>	\$	423.00
64	FRONT DATE PRESSURE-RH <i>/ NCC</i>	\$	26.00
65	SIDE MEMBER TRIM-RH <i>/ (Black) CUT</i>	\$	218.00
66	1 SET OF FOAM STRIPS <i>?</i>	\$	126.00
67	PLASTIC PRIMER 40ML <i>?</i>	\$	101.00
68	ACRYLIC SEALER <i>/ NCC</i>	S/N \$	360.00
69	CAVITY WAX <i>- NCC</i>	S/N \$	280.00
70	STONE CHIP <i>/ NCC</i>	S/N \$	180.00
71	ROOF LINER <i>/ CRV</i>	\$	1,809.00
72	FRONT A-PILLAR TRIM-LH <i>?</i>	2 \$	294.00
73	HEAD AIR BAG UNIT-LH/RH <i>LH / RH / OR</i>	2 \$	2,644.00
74	AIR BAG CONTROL UNIT <i>- NCC</i>	\$	1,593.00
75	PRESSURE SENSOR <i>/ NCC</i>	\$	245.00
76	CRASH SENSOR FOR AIR BAG <i>/ NCC</i>	4 \$	1,526.00
77	FRONT GRAB HANDLE <i>?</i>	2 \$	258.00
78	THREE POINT AUTOMATIC SEAT <i>(from brH) RH / LH OR</i>	2 \$	1,904.00
79	FELT STRIPS <i>X NN</i>	\$	22.00
80	SEAT BEALT HEIGHT ADJUSTER <i>?</i>	2 \$	322.00
81	BACKREST COVER-RH <i>/ TN</i>	\$	2,533.00
SUB- TOTAL SPARE PARTS		\$	16,019.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLW 9079 B**

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
81	BACKREST COVER-RH <i>X RPT</i>	\$ 2,533.00	
82	PADDING FOR BACKREST-RH <i>?</i>	TBC	
83	SIDE AIR BAG UNIT-RH <i>/ OR</i>	\$ 1,164.00	
84	ADAPTER WIRING HARNESS FOR SIDE AIR BAG-FRONT <i>/ NCC</i>	\$ 88.00	
85	SUNDRIES <i>?</i>	\$ 2,000.00	
TOTAL SPARE PARTS		\$ 38,625.00	
TOTAL LABOUR CHARGES		\$ 30,604.00	
GRAND TOTAL		\$ 69,229.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the
progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLW 9079 B

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	FRONT FENDER-RH / <i>DD</i>	\$ 1,047.00	
2	FRONT FENDER ATTACHMENT PARTS / <i>NET</i>	\$ 36.00	
3	FRONT FENDER UPPER BRACKET-LH / <i>PM</i> / <i>NET</i>	\$ 14.00	
4	FRONT FENDER BRACKET-LH / <i>PM</i> / <i>NET</i>	\$ 43.00	} N/S-Ger
5	FRONT FENDER LOWER BRACKET-LH / <i>PM</i> / <i>NET</i>	\$ 14.00	
6	FRONT FENDER CLOSING ELEMENT-LH / <i>PM</i> / <i>CEA</i>	\$ 30.00	
7	FRONT FENDER COVER-RH / <i>X</i> / <i>NN</i>	\$ 37.00	
8	FRONT WHEEL HOUSING LINER-RH / <i>X</i> / <i>NN</i>	\$ 183.00	→ N/S-SK
9	WHEEL HOUSING LINER ATTACHMENT PARTS / <i>X</i> / <i>NN</i>	\$ 52.00	
10	FRONT WHEEL COVER-LH/RH / <i>CDT</i>	\$ 588.00	→ N/S-SK
11	FRONT DOOR-RH / <i>DI</i> → N/S-Ger	\$ 2,285.00	
12	DOOR ATTACHMENT PARTS / <i>NET</i>	\$ 85.00	
13	FRONT DOOR HINGE HALF UPPER PART-RH UPPER	\$ 41.00	
14	FRONT DOOR HINGE HALF LOWER PART-RH LOWER	\$ 41.00	
15	FRONT DOOR HINGE HALF UPPER PART-RH LOWER	\$ 39.00	
16	FRONT DOOR CATCH-RH / <i>PM</i>	\$ 109.00	
17	FRONT DOOR SEAL INNER-RH / <i>NET</i> → N/S-Ger	\$ 146.00	
18	FRONT DOOR HANDLE EXTERIOR-RH / <i>GR</i>	\$ 331.00	
19	FRONT DOOR HANDLE HOUSING-RH / <i>NN</i>	\$ 47.00	
20	FRONT DOOR SLIDE VALE -RH / <i>X</i> / <i>NN</i> / <i>MS</i>	\$ 12.00	
SUB-TOTAL SPARE PARTS		\$ 5,180.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

+ 1mer.
825833403

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLW 9079 B

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
21	FRONT DOOR UNDERLAY-RH FRONT	\$ 5.00	
22	FRONT DOOR UNDERLAY-RH REAR	\$ 6.00	
23	FRONT DOOR MOUNTING BAR-RH ? → N/s-Ger CM ✓	\$ 149.00	
24	FRONT DOOR BOWDEN CABLE-RH ? → N/s-SK	\$ 49.00	
25	FRONT DOOR HOLDER FOR BOWDEN CABLE-RH ?	\$ 4.00	
26	FRONT DOOR LOCK-RH ? H ✓	\$ 487.00	
27	FRONT DOOR LOCK COVER-RH ?	\$ 13.00	
28	FRONT WINDOW GUIDE-RH X RH	\$ 377.00	
29	FRONT WINDOW APERTURE SEAL-RH X H ✓	\$ 119.00 → N/s-SK	
30	FRONT TRIM FOR PILLAR B-RH X H ✓	\$ 105.00	
31	FRONT WINDOW REGULATOR WITHOUT MOTOR-RH ? H ✓	\$ 241.00	
32	FRONT WINDOW REGULATOR MOTOR-RH ?	\$ 224.00 → N/s-SK	
33	FRONT DOOR CONTROL UNIT-RH ?	\$ 456.00	
34	FRONT DOOR COVER-RH ? ✓ for (padding)	\$ 235.00	} N/s-Ger
35	FRONT DOOR WIRING SET-RH ?	\$ 453.00	
36	FRONT WIRING HARNESS FOR DOOR TRIM PANEL-RH ?	\$ 227.00	
37	REAR DOOR-RH ✓ 90 → N/s-Ger	\$ 2,285.00	
38	REAR DOOR OUTER DOOR SEAL-RH X H ✓	\$ 119.00	
39	BONDING AGENT X H	\$ 45.00	
40	CLEANING SOLUTION ✓ H	\$ 65.00	
SUB-TOTAL SPARE PARTS		\$ 5,664.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLW 9079 B

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
41	APPLICATOR X <i>HN</i>	\$ 7.00	
42	REAR DOOR HINGE HALF UPPER PART-RH UPPER ✓ <i>RT</i>	\$ 41.00	→ N/S-SK
43	REAR DOOR HINGE HALF LOWER PART-RH UPPER ✓ <i>RT</i>	\$ 44.00	→ N/S-Ger
44	REAR DOOR HINGE HALF UPPER PART-RH LOWER ✓ <i>RT</i>	\$ 39.00	→ N/S-SK
45	REAR DOOR HINGE HALF LOWER PART-RH LOWER ✓ <i>RT</i>	\$ 41.00	→ N/S-Ger
46	REAR DOOR CATCH-RH ?	\$ 109.00	
47	REAR DOOR CATCH COVER-RH ?	\$ 14.00	
48	REAR DOOR SEAL INNER-RH ✓ <i>ABC</i>	\$ 256.00	
49	REAR DOOR SEAL OUTER-RH X <i>RPT</i>	\$ 53.00	
50	DOOR ATTACHMENT PARTS ✓ <i>HN</i>	\$ 85.00	
51	REAR WINDOW GUIDE-RH X <i>HN</i>	\$ 377.00	
52	REAR WINDOW APERTURE SEAL-RH OUTER ✓ <i>HN new</i>	\$ 124.00	
53	REAR TRIM FOR PILLAR B-RH ?	\$ 105.00	
54	REAR WINDOW REGULATOR WITHOUT MOTOR-RH ?	\$ 241.00	
55	REAR WINDOW REGULATOR MOTOR-RH ?	\$ 270.00	
56	REAR DOOR COVER-RH ✓ <i>ABC (not mucky)</i>	\$ 206.00	→ N/S-Ger
57	REAR DOOR WIRING SET-RH ?	2 \$ 710.00	
58	REAR FENDER-RH (Side member L) <i>DO</i> ✓	\$ 1,930.00	→ N/S-Ger
59	REAR B-PILLAR INNER-RH (inner) ?	\$ 899.00	
60	REAR B-PILLAR PLATE-RH (inner) ?	\$ 17.00	
61	REAR SIDE MEMBER-RH (outer) ?	\$ 409.00	
SUB-TOTAL SPARE PARTS		\$ 5,977.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Net.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLW 9079 B

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
81	SIDE MEMBER-RH X RFT	\$	409.00
82	REAR A-PILLAR-OUTER RH (R-PL) ?	\$	746.00
83	FRONT DATA TAG-RH ? (char) neu	\$	423.00
84	FRONT DATE PRESSURE-RH / NE	\$	26.00
85	SIDE MEMBER TRIM-RH / (BARK) cut → N/s Ger	\$	218.00
86	1 SET OF FOAM STRIPS ? neu	\$	126.00
87	PLASTIC PRIMER 40ML ?	\$	101.00
88	ACRYLIC SEALER / NE	S/N \$	360.00
89	CAVITY WAX / NE	S/N \$	280.00
90	STONE CHIP / NE	S/N \$	180.00
91	ROOF LINER / (RV)	\$	1,809.00
92	FRONT A-PILLAR TRIM-LH cut / LH/RH	2 \$	294.00
93	HEAD AIR BAG UNIT-LH/RH LH / RH / OR	2 \$	2,644.00
94	AIR BAG CONTROL UNIT - NE	\$	1,593.00
95	PRESSURE SENSOR / NE	\$	245.00
96	CRASH SENSOR FOR AIR BAG / NE	4 \$	1,526.00
97	FRONT GRAB HANDLE ? LH cut	\$	258.00
98	THREE POINT AUTOMATIC SEAT (Front be H) RH / LH OR	2 \$	1,904.00
99	FELT STRIPS X NM	\$	22.00
80	SEAT BEALT HEIGHT ADJUSTER ?	2 \$	322.00
81	BACKREST COVER-RH / TN → Ger (N/s)	\$	2,533.00
SUB-TOTAL SPARE PARTS		\$	16,019.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLW 9079 B**

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
81	BACKREST COVER-RH X RPT	\$ 2,533.00	
82	PADDING FOR BACKREST-RH	TBC	
83	SIDE AIR BAG UNIT-RH / DE	\$ 1,164.00	} N/S-Ger
84	ADAPTER WIRING HARNESS FOR SIDE AIR BAG-FRONT / NEC	\$ 88.00	
85	SUNDRIES	\$ 2,000.00	
TOTAL SPARE PARTS		\$ 38,625.00	
TOTAL LABOUR CHARGES		\$ 30,604.00	
GRAND TOTAL		\$ 69,229.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Supplementary Estimate

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 / Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/00/0349/2019/DY 26-Mar-19 Kee Siang 1 of 1 SLW 9079 B AUDI Q2 1.0 TFSI S-TRONIC
Quantity	Description	Unit Price	Amount
Parts			
1	* Door Handle Sensor <i>cut</i>	\$ 208.00	
2	* Rear Wheel Cover RH Rear <i>new</i>	\$ 156.00	
3	* Rear Fender Bracket <i>AX</i>	\$ 81.00	
GRAND TOTAL :		\$ 445.00	

For Premium Automobiles Pte Ltd

Handwritten signature
26/03/19



Authorised Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0349/2019/DY
Date : 19-Mar-19

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Hi Adrian/Steve

We took 31 days - jb - 27 Jun 19

24 days

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr.Martin Daniel Gerard
Address : Blk 221 Bukit Batok East Ave 3
#06-174
Singapore 650221
Telephone : HP +65 81184404
Type of Claim : Own Damage Claims
Policy No. : 1800023129-01
Vehicle No : **SLW 9079 B**
Model Code : AUDI Q2 1.0 TFSI S-TRONIC
Model / Year : 8/3/2018
Engine No : CHZ 676172
Chassis No : WAUZZZGA2JA067336
Mileage :
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 16-Mar-19
Place of Accident : INFRONT OF 30 LEE KENG RD

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLW 9079 B

S/n	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To carry out towing services	S/N FOC		
2	To carry out first measurement on car-o-liner.	S/N \$	800.00	\$ 800.00
3	To remove and reinstall front wire harness for headlights, horns, fog lamps, outside temperature sensor and headlight washer assy.	S/N \$	360.00	\$ 360.00
4	To remove and transfer rhs front and rear doors' multi-lock systems and power window devices. Inspect for damages and renew if necessary.	S/N \$	720.00	\$ 720.00
5	To remove and reinstall rhs front seat assy, ABCD pillar trims, sill rims, floor carpets, electronics components and fuse trays.	S/N \$	1,400.00	\$ 1,400.00
SUB LABOUR CHARGES		:	<u>\$ 3,280.00</u>	<u>\$ 3,280.00</u>

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLW 9079 B

S/n	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
		<i>c/f</i>		\$ 3,280.00
6	To dislodge and reinstall rear wire harness for lights, battery manager, fuse and relay trays, electrical and audio equipment. Inspect for damage and renew where necessary.	S/N	\$ 1,400.00	na
7	To remove and reinstall centre console, renew airbag control unit, roof liner, both curtain airbags, and both front seat belts.	S/N	\$ 2,800.00	\$ 2,800.00
8	To renew driver seat air bag and leather cover.	S/N	\$ 800.00	\$ 800.00
9	To remove and reinstall front suspension for car-o-liner repairs.	S/N	\$ 2,400.00	\$ 2,400.00
10	To remove and reinstall rear exhaust silencer assy, rear suspension assy and fuel tank, for car-o-liner repairs.	S/N	\$ 2,800.00	na
SUB LABOUR CHARGES		:	<u>\$ 10,200.00</u>	<u>\$ 9,280.00</u>

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLW 9079 B

S/n	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
		c/f		\$ 9,280.00
11	To place vehicle on car-o-liner.	S/N	\$ 1,800.00	\$ 1,800.00
12	To dismantle front bumper, rhs front fender, rhs front and rear doors. Inspect rhs floor pan for damages. Cut out and weld rhs B-pillar, inner reinforcements and sill panel. Renew damaged panels. Reinstall all parts removed. (Added 1 day \$500.00 for repair and align 'B' pillar, sill inner structure) See photos.		\$ 9,100.00	\$ 5,000.00 /
13	To respray rhs front fender, rhs front and rear doors, door handles, rhs B-pillar, sill panel, door entrances and inner reinforcements. To carry out joint sealer works and stone chip treatment. (Added \$1100.00 for sill panel, 'B' pillar, entrance and stonechip work)		\$ 5,600.00	\$ 3,300.00 /
14	To carry out wheel alignment.	S/N	\$ 240.00	\$ 240.00
15	To carry out diagnostic check.	S/N	\$ 384.00	\$ 384.00
TOTAL LABOUR CHARGES		:	<u>\$ 30,604.00</u>	<u>\$ 20,004.00</u>

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLW 9079 B**

S/N	Parts Description	<u>Damaged Parts & Prices</u>	
		<u>S/Nett</u>	<u>Remark</u>
1	FRONT FENDER-RH	\$ 1,047.00	\$ 837.60
2	FRONT FENDER ATTACHMENT PARTS	\$ 36.00	
3	FRONT FENDER UPPER BRACKET-RH	\$ 14.00	\$ 11.04
4	FRONT FENDER BRACKET-RH	\$ 43.00	\$ 34.08
5	FRONT FENDER LOWER BRACKET-RH	\$ 14.00	\$ 11.04
6	FRONT FENDER CLOSING ELEMENT-RH	\$ 30.00	\$ 23.76
7	FRONT FENDER COVER-RH	\$ 37.00	
8	FRONT WHEEL HOUSING LINER-RH	\$ 183.00	\$ 146.00
9	WHEEL HOUSING LINER ATTACHMENT PARTS	\$ 52.00	\$ 41.20
10	FRONT WHEEL COVER-LH/RH	2 \$ 588.00	\$ 469.60
11	FRONT DOOR-RH	\$ 2,285.00	\$ 1,828.00
12	DOOR ATTACHMENT PARTS	\$ 85.00	
13	FRONT DOOR HINGE HALF UPPER PART-RH UPPER	\$ 41.00	\$ 32.32
14	FRONT DOOR HINGE HALF LOWER PART-RH LOWER	\$ 41.00	\$ 32.32
15	FRONT DOOR HINGE HALF UPPER PART-RH LOWER	\$ 39.00	\$ 30.80
16	FRONT DOOR CATCH-RH	\$ 109.00	\$ 87.20
17	FRONT DOOR SEAL INNER-RH	\$ 146.00	\$ 116.80
18	FRONT DOOR HANDLE EXTERIOR-RH	\$ 331.00	\$ 264.40
19	FRONT DOOR HANDLE HOUSING-RH	\$ 47.00	\$ 37.28
20	FRONT DOOR SLIDE VALE -RH	\$ 12.00	\$ 8.96
SUB-TOTAL SPARE PARTS		\$ 5,180.00	\$ 4,012.40

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLW 9079 B**

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
			\$	4,012.40
21	FRONT DOOR UNDERLAY-RH FRONT	\$	5.00	
22	FRONT DOOR UNDERLAY-RH REAR	\$	6.00	
23	FRONT DOOR MOUNTING BAR-RH	\$	149.00	\$ 118.80
24	FRONT DOOR BOWDEN CABLE-RH	\$	49.00	\$ 38.48
25	FRONT DOOR HOLDER FOR BOWDEN CABLE-RH	\$	4.00	
26	FRONT DOOR LOCK-RH	\$	487.00	\$ 389.20
27	FRONT DOOR LOCK COVER-RH	\$	13.00	
28	FRONT WINDOW GUIDE-RH	\$	377.00	
29	FRONT WINDOW APERTURE SEAL-RH	\$	119.00	\$ 95.20
30	FRONT TRIM FOR PILLAR B-RH	\$	105.00	
31	FRONT WINDOW REGULATOR WITHOUT MOTOR-RH	\$	241.00	\$ 192.40
32	FRONT WINDOW REGULATOR MOTOR-RH	\$	224.00	\$ 178.80 X
33	FRONT DOOR CONTROL UNIT-RH	\$	456.00	\$ 364.80 X
34	FRONT DOOR COVER-RH	\$	235.00	\$ 187.60
35	FRONT DOOR WIRING SET-RH	\$	453.00	\$ 362.40
36	FRONT WIRING HARNESS FOR DOOR TRIM PANEL-RH	\$	227.00	
37	REAR DOOR-RH	\$	2,285.00	\$ 1,828.00
38	REAR DOOR OUTER DOOR SEAL-RH	\$	119.00	\$ 94.80
39	BONDING AGENT	\$	45.00	
40	CLEANING SOLUTION	\$	65.00	
SUB-TOTAL SPARE PARTS			\$ 5,664.00	\$ 7,862.88

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLW 9079 B**

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
			\$	7,862.88
41	APPLICATOR		\$ 7.00	
42	REAR DOOR HINGE HALF UPPER PART-RH UPPER		\$ 41.00	\$ 32.08
43	REAR DOOR HINGE HALF LOWER PART-RH UPPER		\$ 44.00	\$ 35.04
44	REAR DOOR HINGE HALF UPPER PART-RH LOWER		\$ 39.00	\$ 30.80
45	REAR DOOR HINGE HALF LOWER PART-RH LOWER		\$ 41.00	
46	REAR DOOR CATCH-RH		\$ 109.00	\$ 87.20
47	REAR DOOR CATCH COVER-RH		\$ 14.00	
48	REAR DOOR SEAL INNER-RH		\$ 256.00	\$ 204.80
49	REAR DOOR SEAL OUTER-RH		\$ 53.00	\$ 41.92
50	DOOR ATTACHMENT PARTS		\$ 85.00	
51	REAR WINDOW GUIDE-RH		\$ 377.00	
52	REAR WINDOW APERTURE SEAL-RH OUTER		\$ 124.00	\$ 99.20
53	REAR TRIM FOR PILLAR B-RH		\$ 105.00	
54	REAR WINDOW REGULATOR WITHOUT MOTOR-RH		\$ 241.00	
55	REAR WINDOW REGULATOR MOTOR-RH		\$ 270.00	
56	REAR DOOR COVER-RH		\$ 206.00	\$ 164.80
57	REAR DOOR WIRING SET-RH	2	\$ 710.00	
58	SECTIONA PART - SIDE MEMBER -RH		\$ 1,930.00	\$ 1,544.00
59	REAR B-PILLAR INNER-RH		\$ 899.00	
60	REAR B-PILLAR PLATE-RH		\$ 17.00	
61	REAR SIDE MEMBER-RH		\$ 409.00	
SUB-TOTAL SPARE PARTS			\$ 5,977.00	\$ 10,102.72

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLW 9079 B**

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 10,102.72
61	SIDE MEMBER-RH		\$ 409.00	
62	REAR A-PILLAR-OUTER RH		\$ 746.00	
63	FRONT DATA TAG-RH		\$ 423.00	\$ 338.00
64	FRONT DATE PRESSURE-RH		\$ 26.00	\$ 20.56
65	SIDE MEMBER TRIM-RH		\$ 218.00	\$ 174.40
66	1 SET OF FOAM STRIPS		\$ 126.00	\$ 100.40
67	PLASTIC PRIMER 40ML		\$ 101.00	
68	ACRYLIC SEALER	S/N	\$ 360.00	\$ 360.00
69	CAVITY WAX	S/N	\$ 280.00	\$ 280.00
70	STONE CHIP	S/N	\$ 180.00	\$ 180.00
71	ROOF LINER		\$ 1,809.00	\$ 1,447.20
72	FRONT A-PILLAR TRIM-LH	2	\$ 294.00	\$ 234.40
73	HEAD AIR BAG UNIT-LH/RH	2	\$ 2,644.00	\$ 2,115.20
74	AIR BAG CONTROL UNIT		\$ 1,593.00	\$ 1,274.40
75	PRESSURE SENSOR		\$ 245.00	\$ 196.00
76	CRASH SENSOR FOR AIR BAG	4	\$ 1,526.00	\$ 1,220.80
77	FRONT GRAB HANDLE	2	\$ 258.00	\$ 206.40
78	THREE POINT AUTOMATIC SEAT	2	\$ 1,904.00	\$ 1,523.20
79	FELT STRIPS		\$ 22.00	
80	SEAT BEALT HEIGHT ADJUSTER	2	\$ 322.00	\$ 257.60
SUB- TOTAL SPARE PARTS			\$ 13,486.00	\$ 20,031.28

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLW 9079 B**

S/N	Parts Description		Damaged Parts & Prices	
			S/Nett	Remark
		<i>c/f</i>		\$ 20,031.28
81	BACKREST COVER-RH		\$ 2,533.00	\$ 2,026.40
82	PADDING FOR BACKREST-RH		TBC	
83	SIDE AIR BAG UNIT-RH		\$ 1,164.00	\$ 931.20
84	ADAPTER WIRING HARNESS FOR SIDE AIR BAG-FRONT		\$ 88.00	\$ 70.24
86	SUPPLEMENTARY		\$ 725.00	\$ 634.96
87	SUNDRIES		\$ 2,000.00	\$ 167.76
	TOTAL SPARE PARTS	:	\$ 36,817.00	\$ 23,861.84
	TOTAL LABOUR CHARGES		\$ 30,604.00	\$ 20,004.00
	GRAND TOTAL		\$ 67,421.00	\$ 43,865.84

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager


Allan Wu
Claims Consultant

Car-O-Liner Vision2 X3

Upper body Diagnose Report

1.26.18010.2 1:3
2019-04-03

Customer		Vehicle	
Name		DataSheet 21:348	Issue 2017-11-01
Address		Make Audi	
City	Zip	Model Q2	Type 5D/FWD
State	Phone	Year 2016-	VIN WAUZZZGA2JA067336
E-mail		License No SLW9079B	Miles 21240KM
Insurance		Job	
Insurance Co	Claim No	Workorder 2019-04-03-1	Start Date 2019-04-03
Adjuster	Phone	Technician DNS	End Date 2019-04-03
E-mail		Sign _____	

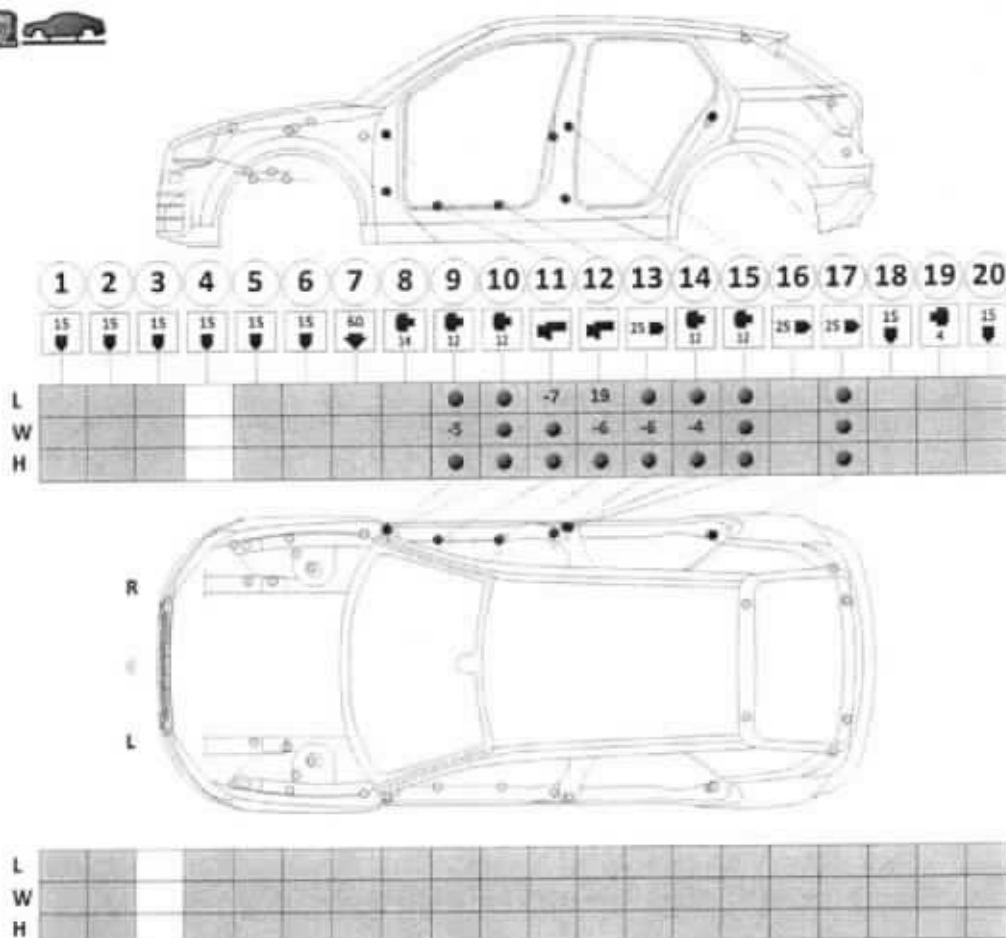

BodyShop	Notes
Company PREMIUM AUTOMOBILES PTE LTD Address 55 UBI ROAD City SINGAPORE Zip 408699 State Phone 63662323 E-mail falcoe.lee@premiumauto.com.sg	

Car-O-Liner Vision2 X3


Lower body Diagnose Report

1.26.18010.21:3
2019-04-03

Customer		DataSheet 21:348	Vehicle
Name		Make Audi	Issue 2017-11-01
Address		Model Q2	Type 5D/FWD
City	Zip	Year 2016-	VIN WAUZZZGA2JA067336
State	Phone	License No SLW90798	Miles 21240KM
E-mail			
Insurance		Workorder 2019-04-03-1	Job
Insurance Co	Claim No	Technician DNS	Start Date 2019-04-03
Adjuster	Phone	Sign _____	End Date 2019-04-03
E-mail			



L																											
W																											
H																											

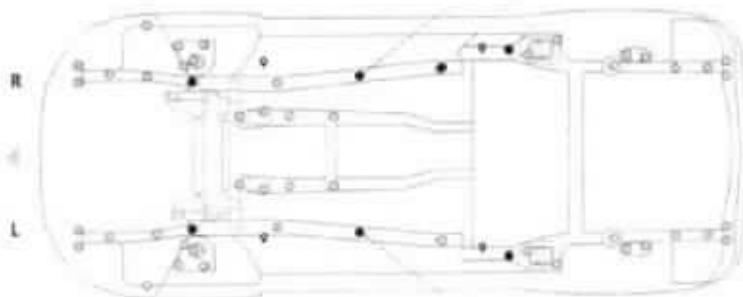

L																											
W																											
H																											


BodyShop	Notes
Company PREMIUM AUTOMOBILES PTE LTD Address 55 UBI ROAD City SINGAPORE Zip 408699 State Phone 63662323 E-mail falcoe.lee@premiumauto.com.sg	

Car-O-Liner Vision2 X3


Upper body Repair Report

1.26.18010.2 t:3
2019-04-10

Name	Customer	DataSheet 21:348	Vehicle
Address		Make Audi	Issue 2017-11-01
City	Zip	Model Q2	Type 5D/FWD
State	Phone	Year 2016-	VIN WAUZZZGA2JA067336
E-mail		License No 5LW9079B	Miles 21240KM
Insurance Co	Insurance	Workorder 2019-04-03-1	Job
Adjuster	Claim No	Technician DNS	Start Date 2019-04-03
E-mail	Phone	Sign _____	End Date 2019-04-10

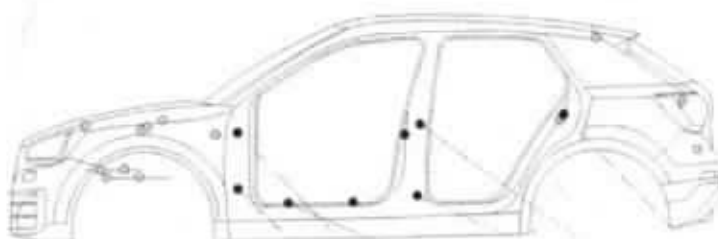

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20
	15	15	15	15	15	15	60	14	12	12	12	25	12	12	25	25	15	4	15	
L																				
W																				
H																				

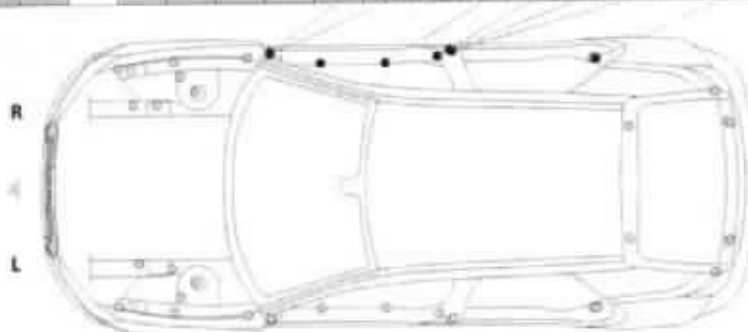

L																				
W																				
H																				


BodyShop

Company PREMIUM AUTOMOBILES PTE LTD
Address 55 UBI ROAD
City SINGAPORE **Zip** 408699
State **Phone** 63662323
E-mail falcoe.lee@premiumauto.com.sg

Notes

1.26.18010.2 t3
2019-04-10


Customer		Vehicle	
Name		DataSheet 21:348	Issue 2017-11-01
Address		Make Audi	
City	Zip	Model Q2	Type SD/FWD
State	Phone	Year 2016-	VIN WAUZZZGA2JA067336
E-mail		License No SLW9079B	Miles 21240KM
Insurance		Job	
Insurance Co	Claim No	Workorder 2019-04-03-1	Start Date 2019-04-03
Adjuster	Phone	Technician DNS	End Date 2019-04-10
E-mail		Sign _____	

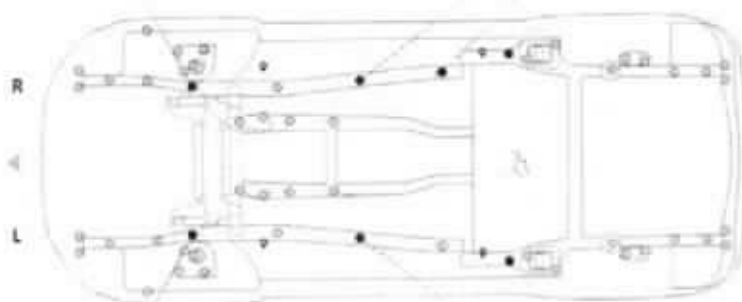[illegible]

BodyShop	Notes
Company PREMIUM AUTOMOBILES PTE LTD Address 55 UBI ROAD City SINGAPORE State E-mail falcoe.lee@premiumauto.com.sg	Zip 408699 Phone 63662323

Work Order: 46502-1
 N: WAUZZZGA2JA067336
 Technician: BENG
 License: SLW9079B
 Odometer: 21240
 Date: 18.4.19 12:24

Audi 2016- Q2 4X2

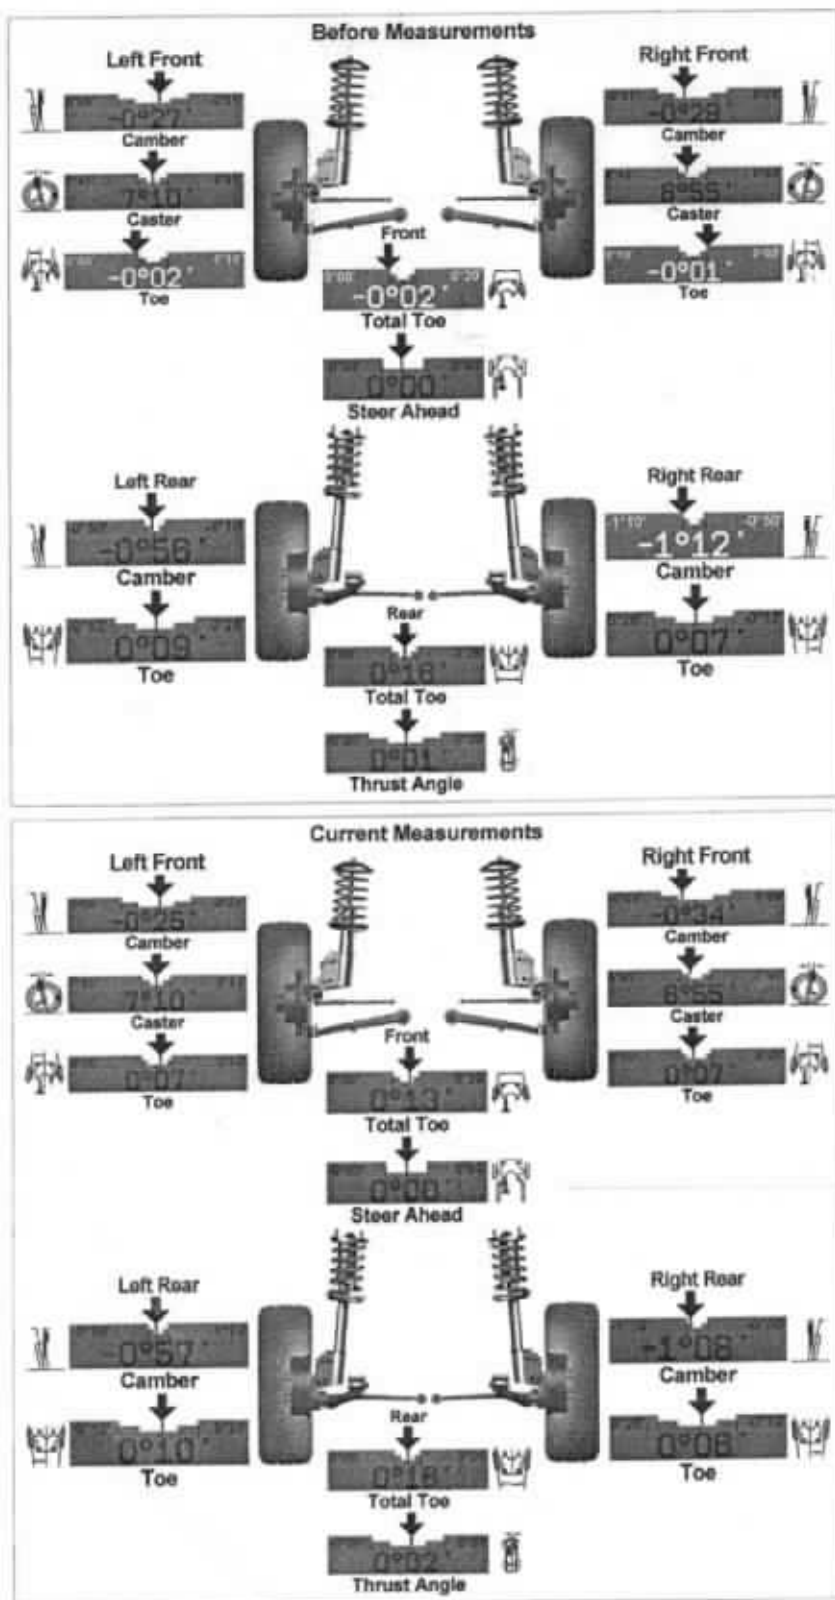

• One or more values are not within specification. Tire wear, handling and safety problems may result.

Veron Chen (LKKAUTO)

From: Veron Chen (LKKAUTO)
Sent: Tuesday, 12 November 2019 4:22 PM
To: Boo seng yak; jiajee.yap@premiumauto.com.sg; Chang Chee Sing; Carrine Leong; SUR
Subject: RE: FINAL REVISION - SLW9079B - OD AIG - SURVEYED 25 MAR 19 - STEVE

Dear Carrine,

Finalize amount \$40,682.24 before excess \$800 and GST @ 25 days.

Items taken out

- 1) FRONT WINDOW REGULATOR MOTOR RH-\$178.80
- 2) FRONT DOOR CONTROL UNIT RH-\$364.80

Labour taken out No.9 and No.14

Kindly send us invoice and discharge voucher for us to close file.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Boo seng yak <boojohnny@gmail.com>

Sent: Thursday, 27 June 2019 6:15 PM

To: Adrian Ling (LKKAUTO) <adrianling@lkkauto.com>; Veron Chen (LKKAUTO) <veronchen@lkkauto.com>; SUR <sur@lkkauto.com>; jiajee.yap@premiumauto.com.sg; Chang Chee Sing <claims@premiumauto.com.sg>; Carrine Leong <carrine.leong@premiumauto.com.sg>

Subject: FINAL REVISION - SLW9079B - OD AIG - SURVEYED 25 MAR 19 - STEVE

Hi Adrian, Steve and all,

Revised estimate and Car O Liner report is attached. Photographs can be obtained from our folder in UBI.

Please confirm repair cost of \$43,865.84 @ 31 days.

Your early closure is well appreciated.

Best regards - jb

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SLW 9079 B

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/0349/2019/NH

3 DEC 2019

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

total pages

RE: INSURANCE CLAIM FOR SLW 9079 B, Audi Q2 1.0 TFSI S-TRONIC.

With reference to the above-mentioned vehicle, no. **SLW 9079 B**, claimant, **Mr. Martin Daniel Gerard**, please find the related document per attached.

1. A copy of the Original invoice no. 85014520 – S\$ 42,674.00
2. A copy of the Discharge Voucher duly signed by client.

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept

Encl
AIG – SLW 9079 B

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6388 2323
Main Telefax 6841 1153

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 1 11:38

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120		Invoice No: 85014520	Account: A0006 (T 0)	
		Date : 02/12/2019	AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120	
		Order : SLW9079B		
		Term : 30		

Regn No: SLW9079B (V 37170)	Regn Date: 08/03/2018	Mileage: 29468	WIP No.: 46502
Model: Q2 1.0 TFSI S tronic GABANG	Chassis: WAUZZZGA2JA067336	Engine: CHZ 676172	Dept: U
You have been assisted by :- UB-Kelvin Khoo (138)			

		Details	Qty	Unit Price	Amount
Q	EXC	M: 8888 Insurance Excess/Liability	-800.00	1.00	-800.00
S	SUBLET	M: TO RENEW DRIVER SEAT AIRBAG AND LEATHER COVER.	800.00	1.00	800.00
S	BODYWORK	M: TO CARRY OUT FIRST MEASUREMENT ON CAR-Q-LINER.	800.00	1.00	800.00
S	BODYWORK	M: TO REMOVE AND REINSTALL FRONT WIRE HARNESS FOR HEADLIGHT, HORNS, FOG LAMPS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY.	360.00	1.00	360.00
S	BODYWORK	M: TO REMOVE AND TRANSFER RHS FRONT AND REAR DOOR'S MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPEC FOR DAMAGES AND RENEW IF NECESSARY.	720.00	1.00	720.00
S	BODYWORK	M: TO REMOVE AND REINSTALL RHS FRONT SEAT ASSY, ABCD PILLAR TRIMS, SILL TRIM, FLOOR CARPETS. ELECTRONIC COMPONENTS AND FUSE TRAYS.	1400.00	1.00	1,400.00
S	BODYWORK	M: TO REMOVE AND REINSTALL CENTRE CONSOLE, RENEW AIRB CONTROL UNIT, ROOF LINER, BOTH CURTAIN AIRBAG AND BOTH FRONT SEAT BELTS.	2800.00	1.00	2,800.00
S	BODYWORK	M: TO PLACE VEHICLE ON CAR-Q-LINER.	1800.00	1.00	1,800.00
S	BODYWORK	M: TO DISMANTLE FRONT BUMPER, RHS FRONT FENDER, RHS FRONT AND REAR DOORS. INSPECT RHS FLOOR PAN FOR FAMAGES. CUT OUT AND WELD RHS B-PILLAR INNER REINFORCEMENTS AND SILL PANEL. RENEW DAMAGED PANEL REINSTALL ALL PARTS REMOVED.	5000.00	1.00	5,000.00
S	BODYWORK	M: TO RESPRAY RHS FRONT FENDER, RHS FRONT AND REAR DO OR HANDLE, RHS B-PILLAR, SILL PANEL, DOOR ENTRA AND INNER REINFORCEMENTS. TO CARRY OUT JOINT SEALE	3300.00	1.00	3,300.00

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6386 2323
Main Telefax 6541 1153

Customer Service
Service Appointment 6386 2323
24-hour Breakdown Service 9826 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 2 11:38

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120		Invoice No: 85014520	Account: A0006 (T 0)		
		Date : 02/12/2019	AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120		
		Order : SLW9079B			
		Term : 30			
Regn No: SLW9079B (V 37170)		Regn Date: 08/03/2018	Mileage: 29468	WIP No.: 46502	
Model: Q2 1.0 TFSI S tronic GABANG		Chassis: WAUZZZGA2JA067336	Engine: CH2 676172	Dept: U	
You have been assisted by :- UB-Kelvin Khoo (138)					
		Details	Qty	Unit Price	Amount
S	BODYWORK	WORKS AND STONE CHIP TREATMENT. M:	384.00	1.00	384.00
S	BODYWORK	TO CARRY OUT DIAGNOSTIC CHECK. M:	1100.00	1.00	1,100.00
		TO SUPPLY ACRYLIC SEALER, STONE CHIP, CAVITY WAX A METAL FILLER.			
X	A81A821172B	(A) (SK)WHEEL HOUS 25	Less 020%	1.00	182.50
X	A5N0837017D	(A) (SK)BOWD CABLE 25	Less 020%	1.00	48.10
X	A81A83747B	(A) (SK)SEAL 25/3/19	Less 020%	1.00	119.00
X	A8X0831404E	(A) (Ger)HINGE 25/3/1	Less 020%	1.00	43.80
X	A81A809848	(A) (Ger)SECTION 25/3	Less 020%	1.00	1930.00
X	A81A867505C WA9	(A) (Ger)ROOFLINING 2	Less 020%	1.00	1809.00
X	A81A880741D	(A) (Ger)AIRBAG 25/3/	Less 020%	1.00	1322.00
X	A81A880742D	(A) (Ger)AIRBAG 25/3/	Less 020%	1.00	1322.00
X	A81A857705A V04	(A) (Ger)SEAT BELT 25	Less 020%	1.00	952.00
X	A81A857706A V04	(A) (Ger)SEAT BELT 25	Less 020%	1.00	952.00
X	A81A880242D	(A) (Ger)SIDEAIRBAG 2	Less 020%	1.00	1164.00
X	A8X4833406A	(A) (SK)HINGE 25/3/19	Less 020%	1.00	38.50
X	A8V0837110A	(A) (SK)ADJUSTER 26/3	Less 020%	1.00	11.20
X	A81A83947B	(A) (SK)SEAL 26/3/19	Less 020%	1.00	124.00
X	A81A839119	007184/(V) (GER) DOOR	Less 020%	1.00	52.40
X	A8W1971581	(V) (GER)HOUSING 201/	Less 020%	2.00	76.70
X	A81A881806F KGL	COVER	Less 020%	1.00	2533.00
X	A81A837462	REGULATOR	Less 020%	1.00	240.50
X	A81A821106	FENDER	Less 020%	1.00	1047.00
X	A81A853818 4W3	COVER	Less 020%	1.00	155.50
X	A81A853718 4W3	(A) (SK)COVER 25/3/19	Less 020%	1.00	293.50
X	A81A831052C	(A) (Ger)DOOR 25/3/19	Less 020%	1.00	2285.00
X	A81A833052C	(A) (Ger)DOOR 25/3/19	Less 020%	1.00	2285.00
X	A4L0000279	(V) (Ger)IDENTPLATE 2	Less 020%	1.00	422.50
X	A5Q0959354	PRESSSENS	Less 020%	1.00	245.00
X	A81A098629	PARTS KIT	Less 020%	1.00	51.50
X	A8K0837199	CLIP	Less 020%	6.00	0.70
X	A8X4833406A	(A) (SK)HINGE 25/3/19	Less 020%	1.00	38.50

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6386 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6386 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 3 11:38

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120		Invoice No: 85014520	Account: A0006 (T 0)
		Date : 02/12/2019	AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
		Order : SLW90798	
		Term : 30	

Regn No: SLW90798 (V 37170)	Regn Date: 08/03/2018	Mileage: 29468	WIP No.: 46502
Model: Q2 1.0 TFSI S tronic GABANG	Chassis: WAUZZZGA2JA067336	Engine: CHZ 676172	Dept: U
You have been assisted by :- UB-Kelvin Khoo (138)			

		Details		Qty	Unit Price	Amount
X	A81A809076B	007153/(V) (Ger) BRACK	Less 020%	1.00	80.20	80.20
X	A4M0857819	Adjuster	Less 020%	2.00	161.00	322.00
X	A81A821468	(A) (Ger) BRACKET 25/3	Less 020%	1.00	42.60	42.60
X	A81A821472	(A) (Ger) BRACKET 25/3	Less 020%	1.00	13.80	13.80
X	A81A821470	(A) (Ger) BRACKET 25/3	Less 020%	1.00	13.80	13.80
X	A81A837249	CHECK ROD	Less 020%	1.00	109.00	109.00
X	A81A867234A DT4	(A) (Ger) LINING 25/3/	Less 020%	1.00	146.50	146.50
X	A8R0857607H DT4	(A) (Ger) HANDLE 25/3/	Less 020%	2.00	129.00	258.00
X	A8H0831701	BOLT	Less 020%	2.00	3.30	6.60
X	ABX2837016C	LATCH	Less 020%	1.00	486.50	486.50
X	A81A839912A	SEAL	Less 020%	1.00	118.50	118.50
X	ABV0837885	(A) (Ger) SUPPORT 25/3	Less 020%	1.00	148.50	148.50
X	A81A867233A DT4	(A) (Ger) LINING 25/3/	Less 020%	1.00	146.50	146.50
X	ABV5833404C	(A) (Ger) HINGE 25/3/1	Less 020%	1.00	40.40	40.40
X	ABV5833404C	(A) (Ger) HINGE 25/3/1	Less 020%	1.00	40.40	40.40
X	A81A839249	CHECK ROD	Less 020%	1.00	109.00	109.00
X	ABX4833408A	(A) (SK) HINGE 25/3/19	Less 020%	1.00	40.10	40.10
X	ABV0837206A GRU	HANDLE	Less 020%	1.00	330.50	330.50
X	ABV0837168B GRU	HOUSING	Less 020%	1.00	46.60	46.60
X	A81A821112	(A) (Ger) PLATE 25/3/1	Less 020%	1.00	29.70	29.70
X	A81A853970 4W3	(A) (Ger) COVER 25/3/1	Less 020%	1.00	206.00	206.00
X	ABV0927753	(A) (SK) SENSOR 26/3/1	Less 020%	1.00	208.00	208.00
X	A5Q0959651B	SENSOR	Less 020%	4.00	381.50	1,526.00
X	A81A898946	REPAIR KIT	Less 020%	1.00	125.50	125.50
X	A81A010502D	LABEL	Less 020%	1.00	25.70	25.70
X	A81A971030AE	007153/(V) (Ger) HARNE	Less 020%	1.00	453.00	453.00
X	A81A971553	(A) (Ger) HARNESS 25/3	Less 020%	1.00	87.80	87.80
X	A81A833721B	(A) (Ger) DOOR SEAL 25	Less 020%	1.00	256.00	256.00
X	A81A831721C	(A) (Ger) DOOR SEAL 25	Less 020%	1.00	146.00	146.00
X	A5Q0959655BD	(A) (Ger) MODULE 25/3/	Less 020%	1.00	1593.00	1,593.00
X	AWHT003497	BOLT	Less 020%	2.00	2.10	4.20
X	AWHT003237	BOLT	Less 020%	4.00	1.00	4.00
X	AWHT001234	BOLT	Less 020%	2.00	2.20	4.40
X	AWHT001235	BOLT	Less 020%	2.00	2.20	4.40

Premium Automobiles

Telefax

to **AIG Asia Pacific Insurance Pte Ltd**
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SLW 9079 B

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/0349/2019/GW
7TH May 2019

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

1 total pages

RE: CLAIM – OWNER'S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi Q2 1.0 TFSI S TRONIC
Vehicle Chassis No. : WAUZZZGA2JA067336
Vehicle Regn No. : **SLW 9079 B**
Vehicle Mileage : 21240 KM
Vehicle Owner : Mr. Martin Daniel Gerard
Certificate No : 1800023129-01
Own Damage Excess : \$856.00 (Inclusive 7% GST)
Accident Date : 16/3/2019
Place : Infront of 30 Leng Kee Road
Repair Cost : \$ 42,674.00
WIP No. : 46502
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature :



Time :

3 pm

Date :

7/5/2019

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	21 Mar 2019		21 Mar 2019 10:47 Edit Adj Rpt	\$540,682.24 Edit Estimates	\$540,682.24 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured:	MARTIN DANIEL GERARD, ID: S80268141, Tel: +6581184404, Email: DANIELMARTIN@MEDIACORP.COM.SG								
Vehicle Reg. No.:	SLW9079B	Date of Loss:	16/03/2019 05:00 - :59 [12 Months and 8 Days From LTA Reg Date (Man Yr)]						
Claim Type:	OD / 1578404602SG	Policy/Cover Note No.:	1800023129-01 (Comprehensive)						
		Excess:	S\$800.00						
Repairer:	Premium Automobiles Pte Ltd (Benoi) 24 Benoi Sector, 629857 Pioneer - Tel: 67689911 / 63882323								
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Chan, Yoke Shi] yokeshi.chan@aig.com								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by CHEN TSUE YEE] ... [Final Rpt due 01/04/2019]								
Driver/Custodian:	MARTIN DANIEL GERARD (38 / Male), NRIC: S80268141, Tel: +6581184404 Email: DANIELMARTIN@MEDIACORP.COM.SG								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
- AIG_SG (12/11/2019): Alert - Adj Mandate Approved (\$540682.24) - SLW9079B - Claim Handler: Chan, Yoke... - AIG_SG (06/11/2019): Alert - Adj Mandate Maintained - SLW9079B - Claim Handler: Chan, Yoke Shi - AIG_SG (05/11/2019): Alert - Adj Mandate Maintained - SLW9079B - Claim Handler: Chan, Yoke Shi - AIG_SG (04/11/2019): Alert - Adj Mandate Maintained - SLW9079B - Claim Handler: Chan, Yoke Shi - AIG_SG (29/07/2019): Alert - Adj Mandate Maintained - SLW9079B - Claim Handler: Chan, Yoke Shi - AIG_SG (29/03/2019): Alert - Adj Mandate Approved (\$335169.00) - SLW9079B - Claim Handler: Loo, Tong ... - AIG_SG (25/03/2019): Alert - Adj Mandate Approved (\$34724.00) - SLW9079B - Claim Handler: Loo, Tong ... - AIG_SG (25/03/2019): SLW9079B / OD / 16/03/2019 / Coverage & Excess update									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SLW9079B (1578404602SG)
OD
Mar 16 2019 5:30AM
[MARTIN DANIEL GERARD]
Premium Automobiles Pte Ltd

Upload Documents

Upload Photos

Compose New Letter

Upload Video

Upload Audio

View

View in Browser

Assessment Reports

1 per page

No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	21/03/19 18:29	Adjuster Immediate Advice		Load HTM	
2	21/03/19 18:52	Adjuster Immediate Advice		Load HTM	
3	29/03/19 10:06	Adjuster Immediate Advice		Load HTM	
4	23/07/19 14:13	Adjuster Immediate Advice		Load HTM	

Photos/Images

3 per page

No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	21/03/19 15:28	General View		Load JPG	
2	21/03/19 15:28	General View		Load JPG	
3	21/03/19 15:28	General View		Load JPG	
4	21/03/19 15:28	General View		Load JPG	
5	21/03/19 15:28	General View		Load JPG	
6	21/03/19 15:28	General View		Load JPG	
7	21/03/19 15:28	General View		Load JPG	
8	21/03/19 15:28	General View		Load JPG	
9	21/03/19 15:28	General View		Load JPG	
10	21/03/19 15:28	General View		Load JPG	
11	21/03/19 15:28	General View		Load JPG	
12	21/03/19 15:28	General View		Load JPG	
13	21/03/19 15:28	General View		Load JPG	
14	21/03/19 15:28	General View		Load JPG	
15	21/03/19 15:28	General View		Load JPG	
16	21/03/19 15:28	General View		Load JPG	
17	21/03/19 15:28	General View		Load JPG	
18	21/03/19 15:28	General View		Load JPG	
19	21/03/19 15:28	General View		Load JPG	
20	21/03/19 15:28	General View		Load JPG	
21	21/03/19 15:29	General View		Load JPG	
22	21/03/19 15:29	General View		Load JPG	
23	21/03/19 15:29	General View		Load JPG	
24	21/03/19 15:29	General View		Load JPG	
25	21/03/19 15:29	General View		Load JPG	
26	21/03/19 15:29	General View		Load JPG	
27	21/03/19 15:29	General View		Load JPG	
28	21/03/19 15:29	General View		Load JPG	
29	21/03/19 15:29	General View		Load JPG	
30	21/03/19 15:29	General View		Load JPG	
31	21/03/19 15:29	General View		Load JPG	
32	21/03/19 15:29	General View		Load JPG	
33	21/03/19 15:29	General View		Load JPG	
34	21/03/19 15:29	Odometer Reading		Load JPG	
35	21/03/19 15:29	Chassis Number		Load JPG	
36	21/03/19 15:29	General View		Load JPG	
37	21/03/19 15:29	General View		Load JPG	
38	21/03/19 15:29	General View		Load JPG	
39	21/03/19 15:29	General View		Load JPG	

Assessment Reports			1 per page	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
				☒
40	21/03/19 15:29	General View		☒
41	21/03/19 15:29	General View		☒
42	21/03/19 15:29	General View		☒
43	21/03/19 15:29	General View		☒
44	29/03/19 09:47	Reinspection Photo		☒
45	29/03/19 09:47	Reinspection Photo		☒
46	29/03/19 09:47	Reinspection Photo		☒
47	29/03/19 09:47	Reinspection Photo		☒
48	29/03/19 09:47	Reinspection Photo		☒
49	29/03/19 09:47	Reinspection Photo		☒
50	29/03/19 09:47	Reinspection Photo		☒
51	29/03/19 09:47	Reinspection Photo		☒
52	29/03/19 09:47	Reinspection Photo		☒
53	29/03/19 09:47	Reinspection Photo		☒
54	29/03/19 09:47	Reinspection Photo		☒
55	29/03/19 09:47	Reinspection Photo		☒
56	29/03/19 09:47	Reinspection Photo		☒
57	29/03/19 09:47	Reinspection Photo		☒
58	29/03/19 09:47	Reinspection Photo		☒
59	29/03/19 09:47	Reinspection Photo		☒
60	29/03/19 09:47	Reinspection Photo		☒
61	29/03/19 09:47	Reinspection Photo		☒
62	29/03/19 09:47	Reinspection Photo		☒
63	29/03/19 09:47	Reinspection Photo		☒
64	29/03/19 09:47	Reinspection Photo		☒
65	29/03/19 09:47	Reinspection Photo		☒
66	29/03/19 09:47	Reinspection Photo		☒
67	29/03/19 09:47	Reinspection Photo		☒
68	29/03/19 09:47	Reinspection Photo		☒
69	29/03/19 09:47	Reinspection Photo		☒
70	29/03/19 09:47	Reinspection Photo		☒
71	29/03/19 09:47	Reinspection Photo		☒
72	29/03/19 09:47	Reinspection Photo		☒
73	29/03/19 09:47	Reinspection Photo		☒
74	29/03/19 09:47	Reinspection Photo		☒
75	29/03/19 09:47	Reinspection Photo		☒
76	29/03/19 09:47	Reinspection Photo		☒
77	29/03/19 09:47	Reinspection Photo		☒
78	29/03/19 09:47	Reinspection Photo		☒
79	29/03/19 09:47	Reinspection Photo		☒
80	29/03/19 09:47	Reinspection Photo		☒
81	29/03/19 09:47	Reinspection Photo		☒
82	29/03/19 09:47	Reinspection Photo		☒
83	29/03/19 09:47	Reinspection Photo		☒
84	29/03/19 09:47	Reinspection Photo		☒
85	29/03/19 09:47	Reinspection Photo		☒
86	29/03/19 09:47	Reinspection Photo		☒
87	29/03/19 09:47	Reinspection Photo		☒
88	29/03/19 09:47	Reinspection Photo		☒
89	29/03/19 09:47	Reinspection Photo		☒
90	29/03/19 09:47	Reinspection Photo		☒
91	29/03/19 09:47	Reinspection Photo		☒
92	29/03/19 09:47	Reinspection Photo		☒
93	29/03/19 09:47	Reinspection Photo		☒
94	29/03/19 09:47	Reinspection Photo		☒

Assessment Reports			1 per page	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
95	30/07/19 09:45	Photographs of Damaged Items		☒
96	30/07/19 09:45	Photographs of Damaged Items		☒
97	30/07/19 09:45	Photographs of Damaged Items		☒
98	30/07/19 09:45	Photographs of Damaged Items		☒
99	30/07/19 09:45	Photographs of Damaged Items		☒
100	30/07/19 09:45	Photographs of Damaged Items		☒
101	30/07/19 09:45	Photographs of Damaged Items		☒
102	30/07/19 09:45	Photographs of Damaged Items		☒
103	30/07/19 09:45	Photographs of Damaged Items		☒
104	30/07/19 09:45	Photographs of Damaged Items		☒
105	30/07/19 09:45	Photographs of Damaged Items		☒
106	30/07/19 09:45	Photographs of Damaged Items		☒
107	30/07/19 09:45	Photographs of Damaged Items		☒
108	30/07/19 09:45	Photographs of Damaged Items		☒
109	30/07/19 09:45	Photographs of Damaged Items		☒
110	30/07/19 09:45	Photographs of Damaged Items		☒
111	30/07/19 09:45	Photographs of Damaged Items		☒
112	30/07/19 09:45	Photographs of Damaged Items		☒
113	30/07/19 09:45	Photographs of Damaged Items		☒
114	30/07/19 09:45	Photographs of Damaged Items		☒
115	30/07/19 09:45	Photographs of Damaged Items		☒
116	30/07/19 09:45	Photographs of Damaged Items		☒
117	30/07/19 09:45	Photographs of Damaged Items		☒
118	30/07/19 09:45	Photographs of Damaged Items		☒
119	30/07/19 09:45	Photographs of Damaged Items		☒
120	30/07/19 09:45	Photographs of Damaged Items		☒
121	30/07/19 09:45	Photographs of Damaged Items		☒
122	30/07/19 09:45	Photographs of Damaged Items		☒
123	30/07/19 09:45	Photographs of Damaged Items		☒
124	30/07/19 09:45	Photographs of Damaged Items		☒
125	30/07/19 09:45	Photographs of Damaged Items		☒
126	30/07/19 09:45	Photographs of Damaged Items		☒
127	30/07/19 09:45	Photographs of Damaged Items		☒
128	30/07/19 09:45	Photographs of Damaged Items		☒
129	30/07/19 09:45	Photographs of Damaged Items		☒
130	30/07/19 09:45	Photographs of Damaged Items		☒
131	30/07/19 09:45	Photographs of Damaged Items		☒
132	30/07/19 09:45	Photographs of Damaged Items		☒
133	30/07/19 09:45	Photographs of Damaged Items		☒
134	30/07/19 09:45	Photographs of Damaged Items		☒
135	30/07/19 09:45	Photographs of Damaged Items		☒
136	30/07/19 09:45	Photographs of Damaged Items		☒
137	30/07/19 09:45	Photographs of Damaged Items		☒
138	30/07/19 09:45	Photographs of Damaged Items		☒
139	30/07/19 09:45	Photographs of Damaged Items		☒
140	30/07/19 09:45	Photographs of Damaged Items		☒
141	30/07/19 09:45	Photographs of Damaged Items		☒
142	30/07/19 09:45	Photographs of Damaged Items		☒
143	30/07/19 09:45	Photographs of Damaged Items		☒
144	30/07/19 09:45	Photographs of Damaged Items		☒
145	30/07/19 09:45	Photographs of Damaged Items		☒
146	30/07/19 09:45	Photographs of Damaged Items		☒
147	30/07/19 09:45	Photographs of Damaged Items		☒
148	30/07/19 09:45	Photographs of Damaged Items		☒
Documentation			1 per page	☒

Assessment Reports			1 per page	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	21/03/19 15:25	POLICE REPORT.pdf	 Load PDF	
2	21/03/19 15:25	SLW 9079B GIA.pdf	 Load PDF	
3	21/03/19 15:26	ESTIMATE.pdf	 Load PDF	
4	21/03/19 16:34	CI & DRIVING.pdf	 Load PDF	
5	22/03/19 16:14	INTERVIEW FORM.pdf	 Load PDF	
6	22/03/19 16:14	UNDERTAKING LETTER.pdf	 Load PDF	
7	29/03/19 09:49	SUPPLEMENTARY	 Load PDF	
8	29/03/19 09:54	Log card (if available)	 Load PDF	
9	16/07/19 10:18	SURVEYOR'S MARKING	 Load PDF	
10	16/07/19 10:19	SUPPLEMENTARY MARKING	 Load PDF	
11	03/09/19 15:54	SURVEYOR'S MARKING	 Load PDF	
12	04/12/19 17:28	Workshop Invoice	 Load PDF	
13	04/12/19 17:29	Discharge Voucher	 Load PDF	

Linked Accident Report Documents

Assessment Reports			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	16/03/19 12:59	Accident Statement	 Load HTM	
2	22/03/19 15:56	Accident Statement Addm. #1	 Load HTM	
3	22/03/19 16:09	Addendum Sheet	 Load JPG	☒
4	22/03/19 16:09	Accident Statement Addm. #2	 Load HTM	
Photos/Images			3 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	16/03/19 12:21	Police Report	 Load JPG	☒
2	16/03/19 12:21	Police Report	 Load JPG	☒
3	16/03/19 12:21	Police Report	 Load JPG	☒
4	16/03/19 12:22	SINGAPORE POLICE FORCE ACKNOWLEDGEMENT SLIP	 Load JPG	☒
5	16/03/19 12:58	Accident Photo	 Load JPG	☒
6	16/03/19 12:58	Accident Photo	 Load JPG	☒
7	16/03/19 12:58	Accident Photo	 Load JPG	☒
8	16/03/19 12:58	Accident Photo	 Load JPG	☒
9	16/03/19 12:58	Accident Photo	 Load JPG	☒
10	16/03/19 12:58	Accident Photo	 Load JPG	☒
11	16/03/19 12:58	Accident Photo	 Load JPG	☒
12	16/03/19 12:58	Accident Photo	 Load JPG	☒
13	16/03/19 12:58	Accident Photo	 Load JPG	☒
14	16/03/19 12:58	Accident Photo	 Load JPG	☒
15	22/03/19 15:38	TRAFFIC POLICE REPORT	 Load JPG	☒
Documentation			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	16/03/19 12:20	Sketch Plan	 Load JPG	☒
2	16/03/19 12:20	Sketch Plan #2	 Load JPG	☒

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) 			
Show Remarks To: ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.			

LKK Auto Consultants Pte Ltd

(Co.Reg.No.199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #08-16
Singapore 079120

Our File No: CC3/AIG19005108/EVD3E2

Date: 05/12/2019

REFERENCE

Insured/Claimant: MARTIN DANIEL GERARD Policy No: 1800023129-01
Date of Loss: 16/03/2019 Nature of Claim: OD Claim No: 1578404602SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLW9079B**
Make & Model: AUDI Q2, 999cc TFSI S-TRONIC (A) Engine No: CHZ676172
Reg. Date: 08/03/2018 (Man. Year: 2018) Chassis No: WAUZZZGA2JA067336
Colour: White Odometer: 21240 km
Engine Capacity: 999 cc
Market Value/New Car Price: S\$105,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/55 R17 Rear Tyre Size: 215/55 R17
Front Left Side: Bridgestone 7 mm Rear Left Side: Bridgestone 7 mm
Front Right Side: Bridgestone 7 mm Rear Right Side: Bridgestone 7 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	39,259.96	23,318.24	15,941.72	40.61
Miscellaneous Items	0.00	0.00	0.00	
Labour	30,604.00	17,364.00	13,240.00	43.26
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	69,863.96	40,682.24	29,181.72	41.77
- Excess (S\$)	800.00	800.00	0.00	0.00
(S\$)	69,063.96	39,882.24	29,181.72	42.25
+ GST 7.00/7.00% (S\$)	4,834.48	2,791.76	2,042.72	42.25
Nett Amount (S\$)	73,898.44	42,674.00	31,224.44	42.25

INSPECTION

Date of Assignment: 21/03/2019
Date Inspected: 20/03/2019 Inspected At: Premium Automobiles Pte Ltd (Benoi)
24 Benoi Sector
Singapore 629857
Estimated Period of Repair: 25.0 days

Adjuster: CHEN TSUE YEE

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT FENDER - RH	Dented	1,047.00 FS	*837.60 FS
2	1		*FRONT FENDER ATTACHMENT PARTS	Not Necessary	36.00 FS	*- FS
3	1		*FRONT FENDER UPPER BRACKET - RH	Necessary	14.00 FS	*11.04 FS
4	1		*FRONT FENDER BRACKET - RH	Necessary	43.00 FS	*34.08 FS
5	1		*FRONT FENDER LOWER BRACKET - RH	Necessary	14.00 FS	*11.04 FS
6	1		*FRONT FENDER CLOSING ELEMENT - RH	Necessary	30.00 FS	*23.76 FS
7	1		*FRONT FENDER COVER - RH	Not Necessary	37.00 FS	*- FS
8	1		*FRONT WHEEL HOUSING LINER - RH	Torn	183.00 FS	*146.00 FS
9	2		*WHEEL HOUSING LINER ATTACHMENT PARTS	Necessary	52.00 FS	*41.20 FS
10	2		*FRONT WHEEL COVER- LH / RH	Cut	588.00 FS	*469.60 FS
11	1		*FRONT DOOR - RH	Dented	2,285.00 FS	*1,828.00 FS
12	1		*DOOR ATTACHMENT PARTS	Not Necessary	85.00 FS	*- FS
13	1		*FRONT DOOR HINGE HALF UPPER PART - RH UPPER	Bent	41.00 FS	*32.32 FS
14	1		*FRONT DOOR HINGE HALF LOWER PART - RH LOWER	Bent	41.00 FS	*32.32 FS
15	1		*FRONT DOOR HINGE HALF UPPER PART - RH LOWER	Bent	39.00 FS	*30.80 FS
16	1		*FRONT DOOR CATCH - RH	Bent	109.00 FS	*87.20 FS
17	1		*FRONT DOOR SEAL INNER - RH	Necessary	146.00 FS	*116.80 FS
18	1		*FRONT DOOR HANDLE EXTERIOR - RH	Broken	331.00 FS	*264.40 FS
19	1		*FRONT DOOR HANDLE HOUSING - RH	Broken	47.00 FS	*37.28 FS
20	1		*FRONT DOOR SLIDE VALE - RH	Necessary	12.00 FS	*8.96 FS
21	1		*FRONT DOOR UNDERLAY - RH FRONT	Not Necessary	5.00 FS	*- FS
22	1		*FRONT DOOR UNDERLAY - RH REAR	Not Necessary	6.00 FS	*- FS
23	1		*FRONT DOOR MOUNTING BAR - RH	Bent	149.00 FS	*118.80 FS
24	1		*FRONT DOOR BOWDEN CABLE - RH	Necessary	49.00 FS	*38.48 FS
25	1		*FRONT DOOR HOLDER FOR BOWDEN CABLE - RH	Not Necessary	4.00 FS	*- FS
26	1		*FRONT DOOR LOCK - RH	Bent	487.00 FS	*389.20 FS
27	1		*FRONT DOOR LOCK COVER - RH	Not Necessary	13.00 FS	*- FS
28	1		*FRONT WINDOW GUIDE - RH	Not Necessary	377.00 FS	*- FS
29	1		*FRONT WINDOW APERTURE SEAL - RH	Bent	119.00 FS	*95.20 FS
30	1		*FRONT TRIM FOR PILLAR B - RH	Not Necessary	105.00 FS	*- FS
31	1		*FRONT WINDOW REGULATOR WITHOUT MOTOR - RH	Shorted	241.00 FS	*192.40 FS
32	1		*FRONT WINDOW REGULATOR MOTOR - RH	Not Necessary	224.00 FS	*- FS
33	1		*FRONT DOOR CONTROL UNIT - RH	Not Necessary	456.00 FS	*- FS
34	1		*FRONT DOOR COVER - RH	Moulding Cut	235.00 FS	*187.60 FS
35	1		*FRONT DOOR WIRING SET - RH	Shorted	453.00 FS	*362.40 FS
36	1		*FRONT WIRING HARNESS FOR DOOR TRIM PANEL - RH	Not Necessary	227.00 FS	*- FS
37	1		*REAR DOOR - RH	Dented	2,285.00 FS	*1,828.00 FS
38	1		*REAR DOOR OUTER DOOR SEAL - RH	Necessary	119.00 FS	*94.80 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
39	1		*BONDING AGENT	Not Necessary	45.00 FS	*- FS
40	1		*CLEANING SOLUTION	Not Necessary	65.00 FS	*- FS
41	1		*APPLICATOR	Not Necessary	7.00 FS	*- FS
42	1		*REAR DOOR HINGE HALF UPPER PART - RH UPPER	Bent	41.00 FS	*32.08 FS
43	1		*REAR DOOR HINGE HALF LOWER PART - RH UPPER	Bent	44.00 FS	*35.04 FS
44	1		*REAR DOOR HINGE HALF UPPER PART - RH LOWER	Bent	39.00 FS	*30.80 FS
45	1		*REAR DOOR HINGE HALF LOWER PART - RH LOWER	Not Necessary	41.00 FS	*- FS
46	1		*REAR DOOR CATCH - RH	Bent	109.00 FS	*87.20 FS
47	1		*REAR DOOR CATCH COVER - RH	Not Necessary	14.00 FS	*- FS
48	1		*REAR DOOR SEAL INNER - RH	Necessary	256.00 FS	*204.80 FS
49	1		*REAR DOOR SEAL OUTER - RH	Necessary	53.00 FS	*41.92 FS
50	1		*DOOR ATTACHMENT PARTS	Not Necessary	85.00 FS	*- FS
51	1		*REAR WINDOW GUIDE - RH	Not Necessary	377.00 FS	*- FS
52	1		*REAR WINDOW APERTURE SEAL - RH OUTER	Necessary	124.00 FS	*99.20 FS
53	1		*REAR TRIM FOR PILLAR B - RH	Not Necessary	105.00 FS	*- FS
54	1		*REAR WINDOW REGULATOR WITHOUT MOTOR - RH	Not Necessary	241.00 FS	*- FS
55	1		*REAR WINDOW REGULATOR MOTOR - RH	Not Necessary	270.00 FS	*- FS
56	1		*REAR DOOR COVER - RH	Moulding Cut	206.00 FS	*164.80 FS
57	2		*REAR DOOR WIRING SET - RH	Not Necessary	710.00 FS	*- FS
58	1		*REAR B-PILLAR INNER - RH	Not Necessary	899.00 FS	*- FS
59	1		*REAR B-PILLAR PLATE - RH	Not Necessary	17.00 FS	*- FS
60	1		*REAR SIDE MEMBER - RH	Not Necessary	409.00 FS	*- FS
61	1		*SIDE MEMBER - RH	Not Necessary	409.00 FS	*- FS
62	1		*REAR A-PILLAR-OUTER RH	Not Necessary	746.00 FS	*- FS
63	1		*FRONT DATA TAG - RH	Necessary	423.00 FS	*338.00 FS
64	1		*FRONT DATE PRESSURE - RH	Necessary	26.00 FS	*20.56 FS
65	1		*SIDE MEMBER TRIM - RH	Necessary	218.00 FS	*174.40 FS
66	1		*SET OF FOAM STRIPS	Necessary	126.00 FS	*100.40 FS
67	1		*PLASTIC PRIMER 40ML	Not Necessary	101.00 FS	*- FS
68	1		*ACRYLIC SEALER	Necessary	360.00 FS	*360.00 FS
69	1		*CAVITY WAX	Necessary	280.00 FS	*280.00 FS
70	1		*STONE CHIP	Necessary	180.00 FS	*180.00 FS
71	1		*ROOF LINER	Crushed	1,809.00 FS	*1,447.20 FS
72	2		*FRONT A-PILLAR TRIM - LH	Crushed	294.00 FS	*234.40 FS
73	2		*HEAD AIR BAG UNIT - LH / RH	Broken	2,644.00 FS	*2,115.20 FS
74	1		*AIR BAG CONTROL UNIT	Necessary	1,593.00 FS	*1,274.40 FS
75	1		*PRESSURE SENSOR	Necessary	245.00 FS	*196.00 FS
76	4		*CRASH SENSOR FOR AIR BAG	Necessary	1,526.00 FS	*1,220.80 FS
77	2		*FRONT GRAB HANDLE	Jammed	258.00 FS	*206.40 FS
78	2		*THREE POINT AUTOMATIC SEAT (SEAT BELT)	Broken	1,904.00 FS	*1,523.20 FS
79	1		*FELT STRIPS	Not Necessary	22.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
80	2		*SEAT BELTS HEIGHT ADJUSTER	Necessary	322.00 FS	*257.60 FS
81	1		*BACKREST COVER - RH	Torn	2,533.00 FS	*2,026.40 FS
82	1		*BACKREST COVER - RH	Repeated	2,533.00 FS	*- FS
83	1		*PADDING FOR BACKREST - RH (NPA)	Not Necessary	0.00 FS	*- FS
84	1		*SIDE AIR BAG UNIT - RH	Broken	1,164.00 FS	*931.20 FS
85	1		*ADAPTER WIRING HARNESS FOR SIDE AIR BAG - FRONT	Necessary	88.00 FS	*70.24 FS
86	1		*SUNDRIES	Necessary	2,000.00 FS	*167.76 FS
87	1		*DOOR HANDLE SENSOR	Shorted	166.40 FS	*166.40 FS
88	1		*REAR WHEEL COVER RH REAR	Cut	124.40 FS	*124.40 FS
89	1		*REAR FENDER BRACKET	Broken	64.16 FS	*64.16 FS
90	1		*METAL FILLER	Necessary	280.00 FS	*280.00 FS
91	1		*SECTIONA PART-SIDE MEMBER-RH	Dented	1,930.00 FS	*1,544.00 FS
					Total Parts (\$\$)	39,259.96 23,318.24

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CARRY OUT FIRST MEASUREMENT ON CAR-O-LINER	New	800.00	800.00
2	TO REMOVE AND REINSTALL FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, FOG LAMPS, OUTSIDE TEMPARATURE SENSOR AND HEADLIGHT WASHER ASSY	New	360.00	360.00
3	TO REMOVE AND TRANSFER RHS FRONT AND REAR DOORS MULTI-LOCK SYSTEMS AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES AND RENEW IF NECESSARY	New	720.00	720.00
4	TO REMOVE AND REINSTALL RHS FRONT SEAR ASSY, ABCD PILLAR TRIMS, SILL TRIMS, FLOOR CARPETS, ELECTRONICS COMPONENTS AND FUSE TRAYS	New	1,400.00	1,400.00
5	TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT. INSPECT FOR DAMAGE AND RENEW WHERE NECESSARY	New	1,400.00	0.00
6	TO REMOVE AND REINSTALL CENTRE CONSOLE, RENEW AIRBAG CONTROL UNIT, ROOF LINER, BOTH CURTAIN AIRBAGS, AND BOTH FRONT SEAT BELTS	New	2,800.00	2,800.00
7	TO RENEW DRIVER SEAT AIR BAG AND LEATHER COVER	New	800.00	800.00
8	TO REMOVE AND REINSTALL FRONT SUSPENSION FOR CAR-O-LINER REPAIRS	New	2,400.00	-
9	TO REMOVE AND REINSTALL REAR EXHAUST SILENCER ASSY, REAR SUSPENSION ASSY AND FUEL TANK, FOR CAR-O-LINER REPAIRS	New	2,800.00	0.00
10	TO PLACE VEHICLE ON CAR-O-LINER	New	1,800.00	1,800.00
11	TO DISMANTLE FRONT BUMPER, RHS FRONT FENDER, RHS FRONT AND REAR DOORS. INSPECT RHS FLOOR PANFOR DAMAGES. CUT OUT AND WELD RHS B-PILLAR, INNER REINFORCEMENTS AND SILL PANEL. RENEW DAMAGED PANELS. REINSTALL ALL PARTS REMOVED	New	9,100.00	5,000.00
12	TO RESPRAY RHS FRONT FENDER, RHS FRONT AND REAR DOORS, DOOR HANDLES, RHS B-PILLAR, SILL PANEL, DOOR ENTRANCES AND INNER REINFORCEMENTS. TO CARRY OUT JOINT SEALER WORKS AND STONE CHIP TREATMENT	New	5,600.00	3,300.00
13	TO CARRY OUT WHEEL ALIGNMENT	New	240.00	-
14	TO CARRY OUT DIAGNOSTIC CHECK	New	384.00	384.00
Gross Labour Cost (S\$)			30,604.00	17,364.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >