
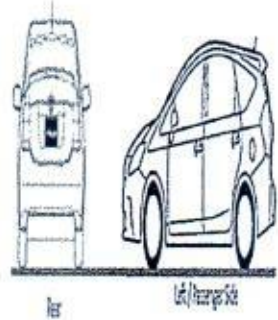


Vic

Section A - Accident Details

Registration Number	SHC4558X
Case Reference Number	TAX/03/19/2111
Registration Date	5/3/2014
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS
Name of Driver	LOW KHEE HONG
Type of Accident	Others
Accident Date and Time	22/3/2019 4:20 PM
Accident Reported Date and Time	23/3/2019 9:23 AM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24100725
Special Instruction to ARC, if any	TP/DROVE IN
Prepared Date and Time	23/3/2019 10:53 AM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

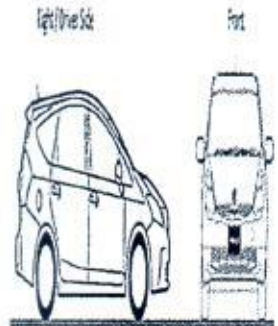

Section B - Summary of Repair Estimates

Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$1,014.00	\$800.00
Total Spray Cost	\$2,052.00	\$550.00
Total Spare Part Cost	\$6,475.44	\$2,306.99
Total Other Cost	\$1,555.32	\$718.44
TOTAL COST	\$11,096.76	\$4,375.43
Lump Sum Total	\$11,100.00	\$4,400.00 (L/S)
Number of Repair Days	7.0	5.0
Prepared / Adjusted By	Tuck Foo Kok	Hwee Jie (LKK) / China Taiping
ARC / Surveyor Sign Off Date	25/03/2019 2:22 PM	25/03/2019 2:08 PM
Signature		
Remarks	L/S REPAIR, PHOTO AFTER PAINT.	

Section C - Quotation and Accident Invoice Details

Quotation Number	QN-1904-0073	Invoice Number	
Quotation Date	05.04.2019	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR FRONT PORTION	\$1,014.00	\$800.00
Total Labour	\$1,014.00	\$800.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY FRONT BUMPER	\$378.00	\$200.00
TO SPRAY FRONT BUMPER LOWER SUB GRILLE	\$180.00	\$0.00
TO REPSRAY FRONT HOOD	\$378.00	\$200.00
TO RESPRAY FRONT FENDER LH	\$378.00	\$0.00
TO RESPRAY FRONT DOOR LH	\$378.00	\$0.00
TO RESPRAY VIEW MIRROR	\$180.00	\$50.00
TO RESPRAY FRONT PILLAR LH	\$180.00	\$100.00
Total Spray Painting & Panel Beating	\$2,052.00	\$550.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$20.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$100.00	\$0.00
TO REMOVE / REFIT WINDSCREEN	\$120.00	\$100.00
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	\$450.00	\$450.00
TO PROVIDE LABOUR & MATERIAL FOR ADVERTISEMENT STICKER(NET)	\$445.32	\$148.44
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
TO WASH AND VACUUM	\$60.00	\$0.00
TO REMOVE AND REFIT WIRE HARDESS	\$200.00	\$0.00
Total Other Costs	\$1,555.32	\$718.44

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		52119-47930	BUMPER FRT	1.00	\$482.00	100.00	\$0.00	Replace	Repair
		52161-16010	BUMPER CLIPS	10.00	\$1.61	25.00	\$12.08	Replace	Replace
		52611-47080	BUMPER ENERGY ABSORBER FRT	0.00	\$78.80	0.00	\$0.00	Replace	Check
		52021-47023	BUMPER REINFORCEMENT FRT	0.00	\$498.40	0.00	\$0.00	Replace	Check
		57014-47030	ARM SUB-ASSY, FR BUMPER LH	0.00	\$250.40	0.00	\$0.00	Replace	Check
		57013-47030	ARM SUB-ASSY, FR BUMPER RH	0.00	\$250.40	0.00	\$0.00	Replace	Check
		52114-47140	BRACKET, FR BUMPER	0.00	\$110.40	0.00	\$0.00	Replace	Check

		NUMBER PLATE	1.00	\$15.00	0.00	\$15.00	Replace	Replace	✓
		NUMBER PLATE FRAME	1.00	\$12.00	0.00	\$12.00	Replace	Replace	✓
	52116-47040	BUMPER SUPPORT F/LH	0.00	\$76.40	0.00	\$0.00	Replace	Check	X
	52115-47040	BUMPER SUPPORT F/RH	0.00	\$76.40	0.00	\$0.00	Replace	Check	X
	53102-47020	BUMPER GRILLE SUB-ASSY, LOWER	0.00	\$311.10	0.00	\$0.00	Replace	Not Given	X
	53111-47040	GRILLE, RADIATOR	0.00	\$310.60	0.00	\$0.00	Replace	Check	✓
	75310-47010	EMBLEM FRONT	1.00	\$66.50	25.00	\$64.88	Replace	Replace	✓
	75922-47020	TAPE OUT WIN FRAME LHF, DOOR	1.00	\$45.60	25.00	\$34.20	Replace	Replace	✓
	53801-47050	FENDER FRT/RH	0.00	\$723.40	0.00	\$0.00	Replace	Not Given	X
	75374-47051	NAME PLATE (HYBRID)	0.00	\$51.90	0.00	\$0.00	Replace	Not Given	X
	53301-47060	HOOD PANEL	1.00	\$748.10	25.00	\$561.08	Replace	Replace	✓
	53395-47020	HOOD END PANEL SEAL	0.00	\$35.50	0.00	\$0.00	Replace	Check	X
	53420-47070	HOOD HINGE LH	0.00	\$55.90	0.00	\$0.00	Replace	Not Given	X
	53410-47070	HOOD HINGE RH	0.00	\$55.90	0.00	\$0.00	Replace	Not Given	X
	53510-47102	HOOD LOCK	0.00	\$128.90	0.00	\$0.00	Replace	Check	X
	53614-47030	CLAMP, HOOD LOCK	0.00	\$5.90	0.00	\$0.00	Replace	Not Given	X
	75533-47050	WINDSCREEN MOULDING FRT	1.00	\$57.60	25.00	\$43.20	Replace	Replace	✓
	561014E909	WINDSCREEN FRT	1.00	\$1,543.80	25.00	\$1,157.85	Replace	Replace	✓
		SEALANT W/SCREEN	2.00	\$37.00	0.00	\$74.00	Replace	Replace	✓
	61132-47030	PILLAR, FR BODY, LH	1.00	\$363.10	100.00	\$0.00	Replace	Repair	✓
	61170-47500	HEAD LAMP LH	1.00	\$945.20	10.00	\$850.68	Replace	Replace	✓
	53802-47050	FENDER FRT/LH	0.00	\$723.40	0.00	\$0.00	Replace	Check	X
	75374-47051	NAME PLATE (HYBRID)	0.00	\$51.90	0.00	\$0.00	Replace	Check	X
	67002-47070	DOOR FRT/LH	0.00	\$894.40	0.00	\$0.00	Replace	Not Given	X
		STICKER DECAL SMRT (DOOR)	0.00	\$60.00	0.00	\$0.00	Replace	Not Given	X
	87940-47310	MIRROR ASSY, LH	1.00	\$1,224.90	100.00	\$0.00	Replace	Repair	✓
	81740-52040	MIRROR LAMP LH	1.00	\$65.30	10.00	\$58.77	Replace	Replace	✓
	87945-74010	COVER, OUTER MIRROR, LH	1.00	\$107.40	100.00	\$0.00	Replace	Repair	✓
Total				\$10,485.11		\$2,883.74			

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
Total									

2883.74
 - 20%
 2306.99
 + 800.00
 + 1268.44
 4375.43

4/5 \$4400/-