


Vic

Section A - Accident Details

Registration Number	SHB226E
Case Reference Number	TAX/04/19/2001
Registration Date	30/10/2013
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS
Name of Driver	LEE CHIN NGEE
Type of Accident	Head to Rear
Accident Date and Time	1/4/2019 7:30 AM
Accident Reported Date and Time	1/4/2019 10:35 AM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	Yes
Towed Back Date and Time	1/4/2019 7:53 AM
Replacement Vehicle issued?	No
Job Card Number	24100850
Special Instruction to ARC, if any	TP/TSS
Prepared Date and Time	2/4/2019 8:39 AM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

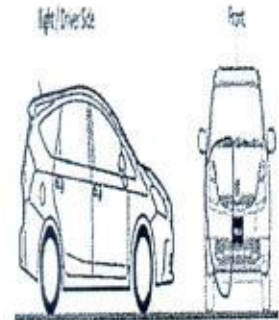

by

Section B - Summary of Repair Estimates

Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$2,459.00	\$1,000.00
Total Spray Cost	\$3,132.00	\$950.00
Total Spare Part Cost	\$16,298.37	\$4,638.74
Total Other Cost	\$1,796.00	\$420.00
TOTAL COST	\$23,685.37	\$7,008.74
Lump Sum Total	\$23,700.00	\$7,000.00 (L/S)
Number of Repair Days	16.0	9.0
Prepared / Adjusted By	Tuck Foo Kok	Hwee Jie (LKK) / China Taiping
ARC / Surveyor Sign Off Date	10/04/2019 11:46 AM	10/04/2019 11:36 AM
Signature		
Remarks	Initial estimates = 12 Request number of days to extend 4 days	L/S REPAIR, PHOTO AFTER PAINT.

Section C - Quotation and Accident Invoice Details

Quotation Number	QN-1904-0180	Invoice Number	
Quotation Date	12.04.2019	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR FRONT PORTION	\$676.00	\$200.00
TO REPAIR REAR PORTION	\$1,183.00	\$600.00
TO REPAIR RR END PANEL	\$300.00	\$100.00
TO REPAIR REAR SPARE TYRE PANEL	\$300.00	\$100.00
Total Labour	\$2,459.00	\$1,000.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY FRONT BUMPER	\$378.00	\$200.00
TO SPRAY FRONT BUMPER LOWER SUB GRILLE	\$180.00	\$0.00
TO RESPRAY FRONT FENDER LH	\$378.00	\$0.00
TO RESPRAY FRONT SUPPORT PANEL	\$180.00	\$0.00
TO RESPRAY RIM	\$180.00	\$50.00
TO RESPRAY REAR BUMPER	\$378.00	\$200.00
TO RESPRAY BUMPER BEAM	\$180.00	\$0.00
TO RESPRAY TAIL GATE	\$378.00	\$200.00
TO RESPRAY TAILGATE OUTSIDE GARNISH	\$180.00	\$100.00
TO RESPRAY REAR PANEL	\$180.00	\$0.00
TO RESPRAY REAR SPARE TYRE PANEL	\$180.00	\$0.00
TO RESPRAY REAR PANEL	\$180.00	\$100.00
TO RESPRAY REAR SPARE TYRE PANEL	\$180.00	\$100.00
Total Spray Painting & Panel Beating	\$3,132.00	\$950.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	\$126.00	\$90.00
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$20.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$100.00	\$0.00
TO DO WHEEL ALIGNMENT / TYRE BALANCING	\$120.00	\$0.00
TO TOP UP A/C GAS	\$120.00	\$0.00
TO TRANSFER REAR TAILGATE MECHANISM	\$120.00	\$50.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00	\$20.00
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	\$120.00	\$30.00
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	\$120.00	\$30.00
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	\$120.00	\$30.00



SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
80 Woodlands Industrial Park E4, Singapore 757706
FAX Number : 63685592
Estimator Telephone Number : 66662623
Accident Reporting Number : 66662672

Date Generated : 24/04/2018
User ID : PohSuan

TO REMOVE AND REFIX REAR WINDSCREEN	\$240.00	\$150.00
TO REMOVE AND REFIT WIRE HARDESS	\$250.00	\$0.00
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
TO WASH AND VACUUM	\$60.00	\$0.00
Total Other Costs	\$1,796.00	\$420.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		52592-47021	BUMPER SEAL, RR LH	1.00	\$88.90	25.00	\$66.68	Replace	Replace
		52591-47021	BUMPER SEAL, RR RH	1.00	\$65.70	25.00	\$49.28	Replace	Replace
		52576-47020	BUMPER SIDE RETAINER RR/LH	0.00	\$94.80	0.00	\$0.00	Replace	Check
		52575-47020	BUMPER SIDE RETAINER RR/RH	0.00	\$94.80	0.00	\$0.00	Replace	Check
		58308-47011	UNDER COVER SUBASSY, RR FLOOR	0.00	\$514.50	0.00	\$0.00	Replace	Check
		58327-47020	EXHAUST HEAT SHIELD, REAR	0.00	\$107.40	0.00	\$0.00	Replace	Check
		17430-37380	EXHAUST TAIL PIPE	0.00	\$656.20	0.00	\$0.00	Replace	Check
		67005-47241	TAILGATE ASY	1.00	\$1,007.90	25.00	\$755.93	Replace	Replace
		75574-47020	TAIL GATE DOOR GLASS MOULDING, LH	1.00	\$29.40	25.00	\$22.05	Replace	Replace
		75573-47080	TAIL GATE DOOR GLASS MOULDING, RH	1.00	\$29.40	25.00	\$22.05	Replace	Replace
		75575-47030	MOULDING BACK WINDOW, LOWER NO.1	1.00	\$29.40	25.00	\$22.05	Replace	Replace
		56117-50140	DAM, BACK DOOR GLASS ADHESIVE, NO.1	1.00	\$27.30	25.00	\$20.48	Replace	Replace
		68294-47050	DAM, BACK DOOR GLASS ADHESIVE, NO.2	1.00	\$17.40	25.00	\$13.05	Replace	Replace
		75575-47020	MOULDING, BACK WINDOW, LOWER NO.2	1.00	\$29.40	25.00	\$22.05	Replace	Replace
		75574-47010	MOULDING, BACK WINDOW, OUTSIDE LH	1.00	\$29.40	25.00	\$22.05	Replace	Replace
		75573-47090	MOULDING, BACK WINDOW, OUTSIDE RH	1.00	\$29.40	25.00	\$22.05	Replace	Replace
			SEALANT W/SCREEN	3.00	\$37.00	0.00	\$111.00	Replace	Replace
		68810-47010	TAILGATE DOOR HINGE LH/RH	0.00	\$58.30	0.00	\$0.00	Replace	Check
		69350-47030	TAILGATE DOOR LOCK	0.00	\$444.10	0.00	\$0.00	Replace	Check
		68960-0W532	TAILGATE DOOR STAY LH	0.00	\$241.50	0.00	\$0.00	Replace	Check
		68950-0W542	TAILGATE DOOR STAY RH	0.00	\$241.50	0.00	\$0.00	Replace	Check
		67881-47022	TAILGATE DOOR WEATHER STRIP	0.00	\$353.40	0.00	\$0.00	Replace	Check
		69415-47020	TAILGATE LOCK, COVER	0.00	\$15.70	0.00	\$0.00	Replace	Check
		76801-47070-B0	TAILGATE OUTSIDE GARNISH	1.00	\$504.90	25.00	\$378.68	Replace	Replace
		69431-47010	STRIKER, BACK DOOR	0.00	\$48.90	0.00	\$0.00	Replace	Check
		67750-47071C0	TAILGATE, BOARD ASSY	0.00	\$246.90	0.00	\$0.00	Replace	Check
		84840-28040	SWITCH ASSY, BACK DOOR OPENER	0.00	\$146.10	0.00	\$0.00	Replace	Check
		75310-47020	EMBLEM REAR	1.00	\$60.30	25.00	\$45.23	Replace	Replace
		81271-53011	LICENSE PLATE LAMP	2.00	\$35.70	10.00	\$64.26	Replace	Replace
			NUMBER PLATE	1.00	\$15.00	0.00	\$15.00	Replace	Replace
			NUMBER PLATE FRAME	1.00	\$12.00	0.00	\$12.00	Replace	Replace
		75374-47051	NAME PLATE (HYBRID)	1.00	\$51.90	25.00	\$38.93	Replace	Replace
		75442-47030	NAME PLATE (PRIUS)	1.00	\$60.80	25.00	\$45.60	Replace	Replace

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
60 Woodlands Industrial Park E4, Singapore 757706
FAX Number : 83085592
Estimator Telephone Number : 86662632
Accident Reporting Number : 86662672

Date Generated : 24/04/2019

User ID : PohSuan

	75443-47030	NAME PLATE (TOYOTA)	1.00	\$51.90	25.00	\$38.93	Replace	Replace	✓
	76085-47910	SPOILER REAR	1.00	\$953.70	25.00	\$715.28	Replace	Replace	✓
	81006-47011	3RD BRAKE LAMP	0.00	\$231.30	0.00	\$0.00	Replace	Check	X
		SMRT LOGO	1.00	\$7.80	0.00	\$7.80	Replace	Replace	✓
		STICKER DECAL 6555 8888	1.00	\$21.60	0.00	\$21.60	Replace	Replace	✓
	58307-47060	END PANEL	0.00	\$602.10	0.00	\$0.00	Replace	Check	X
	64718-47031B0	END PANEL COVER, DECK TRIM HOLE	0.00	\$46.10	0.00	\$0.00	Replace	Check	X
	64716-47031B0	END PANEL COVER, DECK TRIM, RR	0.00	\$121.10	0.00	\$0.00	Replace	Check	X
	58336-12090	REINFORCEMENT, RR	0.00	\$34.60	0.00	\$0.00	Replace	Check	X
4006314		SEALANT SIKAFLEX	0.00	\$37.00	0.00	\$0.00	Replace	Check	X
	58311-47071	SPARE TYRE PANEL	0.00	\$667.70	0.00	\$0.00	Replace	Check	X
	64993-47020	BOX, DECK FLOOR, RR	0.00	\$649.70	0.00	\$0.00	Replace	Not Given	X
	58416-47030B3	BOX, RR FLOOR, BOARD	0.00	\$679.60	0.00	\$0.00	Replace	Not Given	X
	52563-47010	TAIL LAMP BRACKET, LH	0.00	\$30.70	0.00	\$0.00	Replace	Check	X
	52562-47010	TAIL LAMP BRACKET, RH	0.00	\$30.70	0.00	\$0.00	Replace	Check	X
	64821-47030	TAILGATE LOWER WINDOW GLASS	0.00	\$721.30	0.00	\$0.00	Replace	Not Given	X
	52119-47930	BUMPER FRT	1.00	\$482.00	25.00	\$361.50	Replace	Replace	✓
	52161-16010	BUMPER CLIPS	10.00	\$1.61	25.00	\$12.08	Replace	Replace	✓
	52611-47080	BUMPER ENERGY ABSORBER FRT	0.00	\$78.80	0.00	\$0.00	Replace	Check	X
	52021-47023	BUMPER REINFORCEMENT FRT	0.00	\$498.40	0.00	\$0.00	Replace	Check	X
	57014-47030	ARM SUB-ASSY, FR BUMPER LH	0.00	\$250.40	0.00	\$0.00	Replace	Check	X
	52116-47040	BUMPER SUPPORT F/LH	0.00	\$76.40	0.00	\$0.00	Replace	Check	X
	53102-47020	BUMPER GRILLE SUB-ASSY, LOWER	0.00	\$311.10	0.00	\$0.00	Replace	Not Given	X
	81220-12230	FOG LAMP LH	0.00	\$280.10	0.00	\$0.00	Replace	Not Given	X
	81529-47050	BRACKET, FR TURN CENTER LH	0.00	\$58.20	0.00	\$0.00	Replace	Not Given	X
	81529-47050	BRACKET, FR TURN LOWER LH	0.00	\$26.00	0.00	\$0.00	Replace	Not Given	X
	81529-47040	BRACKET, FR TURN UPPER LH	0.00	\$24.40	0.00	\$0.00	Replace	Not Given	X
	81521-47050	LENS & BODY, FR TURN LH	1.00	\$511.80	10.00	\$460.62	Replace	Replace	✓
	52618-47050	BUMPER FRT ABSORBER LOWER	0.00	\$127.70	0.00	\$0.00	Replace	Check	X
	53201-47902	SUPPORT SUB-ASSY	0.00	\$1,460.40	0.00	\$0.00	Replace	Check	X
	81170-47500	HEAD LAMP LH	1.00	\$945.20	10.00	\$850.68	Replace	Replace	✓
	53802-47050	FENDER FRT/LH	0.00	\$723.40	0.00	\$0.00	Replace	Not Given	X
	75374-47051	NAME PLATE (HYBRID)	0.00	\$51.90	0.00	\$0.00	Replace	Not Given	✓
	53876-47030	FENDER LINER FRT/LH	0.00	\$171.70	0.00	\$0.00	Replace	Check	X
	53852-47020	FENDER LINER PAD, FR WHEEL, LH	0.00	\$49.30	0.00	\$0.00	Replace	Not Given	X
	42611-47140 (Frt)	WHEEL DISC, FRONT	1.00	\$1,484.20	100.00	\$0.00	Replace	Repair	✓
	52159-47905	BUMPER REAR	1.00	\$458.60	25.00	\$343.95	Replace	Replace	✓
	52161-16010	BUMPER CLIPS	10.00	\$1.61	25.00	\$12.08	Replace	Replace	✓
	52023-12240	BUMPER REINFORCEMENT REAR	0.00	\$205.70	0.00	\$0.00	Replace	Check	X
	52016-47030	ARM SUB-ASSY, RR BUMPER LH	0.00	\$139.60	0.00	\$0.00	Replace	Check	X
	52015-47050	ARM SUB-ASSY, RR BUMPER RH	0.00	\$139.60	0.00	\$0.00	Replace	Check	X

	89997-30070	ANTENNA, ELECTRICAL LOWER REAR	0.00	\$157.40	0.00	\$0.00	Replace	Check	X
		SENSOR REVERSE	1.00	\$180.00	0.00	\$180.00	Replace	Replace	✓
		PIXEL STICKER	2.00	\$50.00	0.00	\$120.00	Replace	Replace	✓
	76088-47020	BUMPER LIP COVER RR/LH	0.00	\$72.20	0.00	\$0.00	Replace	Not Given	X
	76087-47020	BUMPER LIP COVER RR/RH	1.00	\$118.10	25.00	\$88.58	Replace	Replace	✓
	76891-47020	BUMPER LIP REAR	0.00	\$228.90	0.00	\$0.00	Replace	Not Given	X
Total				\$19,686.92		\$4,961.52			

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
		67881-47022	TAILGATE DOOR WEATHER STRIP	1.00	\$353.40	25.00	\$265.05	Replace	Replace
		81006-47011	3RD BRAKE LAMP	1.00	\$231.30	10.00	\$208.17	Replace	Replace
		52023-12240	BUMPER REINFORCEMENT REAR	1.00	\$205.70	25.00	\$154.28	Replace	Replace
		52016-47030	ARM SUB-ASSY, RR BUMPER LH	1.00	\$139.60	25.00	\$104.70	Replace	Replace
		52015-47050	ARM SUB-ASSY, RR BUMPER RH	1.00	\$139.60	25.00	\$104.70	Replace	Replace
Total					1,069.60		836.90		

5798.42
- 20%

4638.74
+ 1000.00
+ 1370.00

7008.74

45 \$7000/-

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Contractor	WEGA ENGINEERING PTE LTD		
Accident Case Number	TAX/04.119/2001	Date of Collection	3/4/19
Vehicle No	SHB 228 E	Date of Request	5/4/19
Vehicle Model	TOYOTA PRIUS	Number of Days to Extend	3 1 DAYS

REQUEST FOR SUPPLYMENT PARTS

S/N	Number photos	Part Description	Quantity	Unit Price	
1	9115,16,17	Tail Gate Door weatherstrip		\$ 353.40	/ CUT
2	9118,19	3 RD Brake Lamp		\$ 231.30	/ CRA
3	9124,25,26,31,32	Bumper Reinforcement Rear		\$ 205.70	/ DD
4	9127,28,9134,35	Arm Sub Assy RR Bumper RH		\$ 139.60	/ BT
5	9129,30,9136,37	Arm Sub Assy RR Bumper LH		\$ 139.60	/ BT
6	9120,21,22,23	To Repair End Panel		\$ 306.00	\$100
7	9138,39,40,41	To Repair Spare Tyre Panel		\$ 306.00	\$100
8		To Respray End Panel & Spare Tyre Panel		\$ 366.00	\$200


<<<Please submit photographs for damaged parts>>>

8/4/19

I. (Name) CHIA

(Position) ADVISOR

I do solemnly and sincerely declare that:- Supplementary Parts are raised for replacement for the aforesaid vehicle.



Signature of person making this declaration

[To be signed in front of an authorised witness]

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form22 / PO / WOC/ Reservation / Number
Photo Submitted		Date of submission

For SMRT Staff