

(08/11/13) wef

ASS. REC. BY: Marcus

REF:

CS/TP 19006309/Uvd3n2

## ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: Ru 6828Mat Workshop m/s MPH

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: 7 days Res.: Yes or NoLum Sum: 13.6 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

9663E

Vehicle: IN / OUT

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Veh No: Ru 6828M Yr Regn: 4, 18

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or CAMake: Toyota Hiace Commuter 2882Colour: white A/C: Insured / Std / NI / NASp. Reading: 68281 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: KDH 22300 35040

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195-15

R: \_\_\_\_\_

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front 6 mm Rear 6 mmR/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 3/4/19 D.O.I. 8/4/19

Survey held at \_\_\_\_\_

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

1/4/19 Confirmed find by 88425-82 with Ray (Red 3975.45, 309)

RECEIVED 15 APR 2019

Date/Time, File Pass to?

☐ : Preli. Report

1)

☐ : Final Report

Date/Time, File Return to?

2) 5/4 - typistDays Of Repair: 7Resurvey No. of Trip: 2Add Fee: ☐ : Site Insp (\$)☐ : Interview (\$)☐ : Tech. Invs (\$)☐ : Weekend (\$)

Survey Fee:

Transportation:

☐ S + RS, ☐ SI

Photos

Others

TOTAL

2x15-30

170+30

50

50+50

107

80

537

Report Format : TPLump Sum / I.B.I. (\$) 8425.82

Ref. No :	CS/ TP19006309/uv <sup>d3n2</sup>		Res. Date: 10/4/19	Date Received:
Veh. No :	Ru 6829a	SP:		WKSP: <i>[Signature]</i>
C/No :				
Action/Instruction:				
1.File	2.Submit Photo?	YES / NO		
3.Indicate Res. Date On Photo Page?	YES / NO			Message:
If No, due to	a) No authorisation	b) Days of repair		
others:				
Final Re-inspection or Progress Photos				Inspected By: <i>[Signature]</i>

> Back to OneMotoring

## Enquire PARF/COE Rebate for Registered Vehicle

### Vehicle Owner Particulars

Owner ID Type:	Company
Owner ID:	9663E

### Vehicle Details

Vehicle No.:	RU6829M
Vehicle to be Exported:	No
Intended Deregistration Date:	09 Apr 2019
Vehicle Make:	TOYOTA
Vehicle Model:	HIACE COMMUTER GL 3.0 AUTO
Primary Colour:	White
Manufacturing Year:	2017
Engine No.:	1KD2772574
Chassis No.:	KDH2230035040
Maximum Power Output:	-
Open Market Value:	\$40,756.00
Original Registration Date:	26 Apr 2018
First Registration Date:	26 Apr 2018
Transfer Count:	0
Actual ARF Paid:	\$0.00
<b>Intended PARF Rebate Details</b>	
PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
<b>Intended COE Rebate Details</b>	
COE Rebate Amount:	\$0.00
<b>Total Rebate Amount:</b>	<b>\$0.00</b>

The information contained herein is correct as at 09 Apr 2019

OK

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	05/04/2019 13:07
Date Of Accident	03/04/2019 00:00
Exact Location Of Accident	CHANGI AIRPORT
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	RU6829M
-----------------------------	---------

### Insured/Policyholder

Name Of Registered Owner	GREENMARK CONSTRUCTION PTE LTD
Co Reg No	OO
Email Address	SAN@GREENMARK.COM.SG
Mobile Phone No	(LOCAL) +65-83212920
Alternative Phone No	OFFICE-62970388

### Vehicle Particulars

Manufacturer	TOYOTA
Model	HIACE-3.0 (A)

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? NO

If No, Please state action to be taken THIRD PARTY

Vehicle Category COMMERCIAL VEHICLE

### Insurance Company

Name of Insurance Company	ETIQA INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	M0010054
Cover Note Number	

### Driver

Name of Driver	ABDUL RAZAK BIN ABDUL RAHMAN
NRIC No	S1774051B
Date Of Birth	07/07/1966
Occupation	OUTDOOR
Date Of Driving Pass	07/01/1999
Driving Experience	20 YEARS AND 2 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-81053548
Fax Number	
Contact Number	
EMail Address	NOEMAIL

Address	BLK 802C PUNGGOL CENTRAL #12-654
Postcode	823802
Was driver an employee of the Insured's Company	YES
If No, Relationship of the Driver with the Insured	
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

#### General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

#### Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

#### Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

WHEN I AM GOING TO PICKUP PASSENGER FROM A1 TO A5 AREA THAT TIME SATS VAN RU5656B HIT MY REAR OF MY BACK.

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	RU5656B
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

**IMPORTANT NOTICE**

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

**8. Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
  - (ii) for complying with requirements under any regulations, laws or court orders.




Policyholder's Signature  
Date & Time:

Driver's Signature  
(If driver is not the policyholder)  
Date & Time:

Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:

Changir Airport.

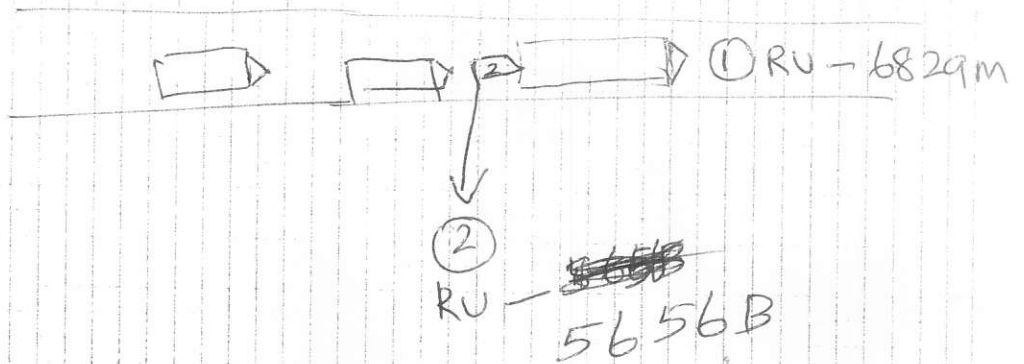

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

3/04/2019 12:00 Am.

When I am going to pick up passenger from AI to A5 Area That time Sats van RU 5656B hit my RU Van 6829m Back side, was damage

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's  
Date & Time:



Driver's Signature  
(If driver is not the policyholder)  
Date & Time:

05/04/19

Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:





# NPH AUTO SERVICE



Your Ref : Block 9005 Tampines Street 93 #01-246/254 Singapore 528839 Tel: 67840663 (8 Lines) Fax: 67840692 1/3  
 Our Ref : TP00276419 GST Reg No: MX-0869103-NO Business Reg No: 394773400D : 08/04/2019  
 Email: nphauto@pacific.net.sg

## THIRD PARTY CLAIM

M/S : GREENMARK CONSTRUCTION PTE LTD  
 175A BENCOOLEN STREET  
 #08-12 BURLINGTON SQUARE SINGAPORE 189650

Attn :

Dear Sir/Madam

RE: ACCIDENT REPAIR ON : RU6829M - TOYOTA HIACE  
 INSURED : GREENMARK CONSTRUCTION PTE LTD  
 DATE OF ACCIDENT : 03/04/2019  
 POLICY NO :

ENGINE# :  
 CHASSIS# :

APPENDED BELOW ARE THE ESTIMATED COST OF REPAIR & TO BE REPLACED:

		Qty	U/Cost \$	U/Price \$	Total \$	
<b>Replacement of Parts</b>						
1	rear windscreen	17	1150.00	1150.00	1,150.00	X
2	rear boot	Sad/son	11	2450.00	2450.00	—
3	rear boot center logo	rec	11	72.20	72.20	—
4	rear boot HIACE emblem	rec	11	58.40	58.40	—
5	rear boot GL emblem	rec	11	55.00	55.00	—
6	rear boot damper L&R	11	21	355.00	355.00	710.00 X
7	rear number plate lamp outer chrome garnish	cu	11	176.80	176.80	—
8	rear number plate lamp L&R	11	21	160.90	160.90	321.80 X
9	rear boot lock top	mi/son	11	275.00	275.00	—
10	rear boot lower catch	11	11	86.00	86.00	X
11	rear lamp assy L&R	cu	21	300.80	300.80	601.60 —
12	rear lamp lower garnish L&R	cu/son	21	145.00	145.00	290.00 —
13	rear boot inner finisher	rec/son	11	461.20	461.20	461.20 —
14	rear boot inner hardenness wire	daye	11	170.90	170.90	—
15	rear boot lock side catch L&R	11	21	52.80	52.80	105.60 X
16	rear boot lock side catch rubber L&R	11	21	43.60	43.60	87.20 X
17	rear bumper	715	11	475.00	475.00	—
18	rear bumper clips	rec	61	5.00	5.00	30.00 —
19	rear bumper side retainer L&R	cu	21	50.00	50.00	100.00 —
20	rear boot rubber	mi	11	455.00	455.00	455.00 —
21	rear bumper inner center panel outer	Sad/son	11	450.00	450.00	450.00 —
22	rear bumper inner center panel inner	11	11	980.00	980.00	980.00 X
23	rear panel top garnish	mi	11	175.00	175.00	—
24	rear exhaust pipe	11	11	300.00	300.00	300.00 X
25	rear spare tyre bracket assy	311	11	325.00	325.00	325.00 —
					10,361.70	
Less 25%					-2,590.43	

4 pcs rear bumper lower brackets @ 30 x 4 = 120 Bud ✓

6741.1

252

5011.82

6741.1

5055.82

2425.82





# NPH AUTO SERVICE



Your Ref: Block 9005 Tampines Street 93 #01-246/254 Singapore 528839 Tel: 67840663 (8 Lines) Fax: 67840692 2/3  
 Our Ref: : TP002731 Reg No: MX-0869103-NO Business Reg No: 39475360D : 08/04/2010  
 E-mail: nphauto@pacific.net.sg

## THIRD PARTY CLAIM

APPENDED BELOW ARE THE ESTIMATED COST OF REPAIR & TO BE REPLACED:

	Qty	U/Cost	U/Price	Total	
		\$	\$	\$	
<b>Total Material</b>				<b>\$7,771.28</b>	
<b>Special Nett Items</b>					<b>S. Net</b>
26 rear windscreen sealant	10	45.00	45.00	45.00	40
27 rear boot GREEN sticker	10	15.00	15.00	15.00	10
28 rear boot 70KM sticker	10	15.00	15.00	15.00	10
29 rear boot EMERGENCY DOOR sticker	10	15.00	15.00	15.00	✓
30 rear boot PULL & OPEN sticker	10	15.00	15.00	15.00	✓
31 rear number plate w/casing	10	45.00	45.00	45.00	✓
32 rear number plate seal	10	60.00	60.00	60.00	25
33 rear reverse camera	10	500.00	500.00	500.00	300
				<b>710.00</b>	

## Total S/Nett

\$710.00

## Labour & Misc

1 Remove & install rear windscreen.	@	150.00	120
2 Remove & install r/boot assy, r/lamp, r/bumper, side garnish, cut out & renew rear lamp center panel inner & outer, knock floorboard panel and restraigthen body & chassis.		1,800.00	1500
3 Car-O-Liner.		350.00	X
4 Spray painting.		950.00	900
5 Check wiring system & re-wiring.		40.00	30
6 Remove & install rear exhaust box.		100.00	80
7 Remove & install rear spare tyre board.		80.00	X
8 Remove & install r/seat and carpet.		180.00	100
9 Towing fee <del>three times</del> <sup>Two</sup> trips		100.00	✓
10 Send for inspection fee.		80.00	✓
		<b>3,830.00</b>	

## Total Labour

\$3,830.00

## Nett Total Before Gst

10,401.27

\$12,311.27

L&K Auto Consultants hence notify the Repairer of the following:

- To return to resurvey spray painting
- To remove damaged part(s) during resurvey
- Parts must be subject to confirmation
- Third Party survey on "Without Prejudice" basis
- No direct payment is allowed
- Supplementary survey must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

S.N-460  
 16m-2960



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

NPH AUTO SERVICE

Ref : CS/TP19006309/Uvd3n2

BLK 9005 TAMPINES ST 93  
#01-246/254 SINGAPORE 528839

Date : 18-04-2019



ON BEHALF OF GREENMARK CONSTRUCTION  
PTE LTD

Code : TP311

## 1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	Veh. Inspected	RU 6829M
Policy No.	Coverage (\$)	0.00
Claim No.	Excess (\$)	0.00
Assign From	Assign Date	08/04/2019

## 2. Vehicle Particulars & Condition

Make & Model	TOYOTA HIACE COMMUTER (A)	c.c	2982
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	KDH2230035040	Colour	WHITE
Odometer	68281	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

## 3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195 R15	BRIDGESTONE	6 mm
L/H Front Tyre	195 R15	BRIDGESTONE	6 mm
R/H Rear Tyre	195 R15	BRIDGESTONE	6 mm
L/H Rear Tyre	195 R15	BRIDGESTONE	6 mm

## 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--

## 5. General Information

Accident Date	03/04/2019	Inspection Date	08/04/2019
Survey held at	NPH AUTO SERVICE BLK 9005 TAMPINES STREET 93 #01-246/254 SINGAPORE 528839		

## 5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
---

## 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	7 Working Days
-------------------------------------	----------------



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. RU 6829M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	REAR WINDSCREEN	NOT NECESSARY	1,150.00	-
1	REAR BOOT	BADLY DENTED	2,450.00	2,450.00
1	REAR BOOT CENTER LOGO	NECESSARY	72.20	72.20
1	REAR BOOT HIACE EMBLEM	NECESSARY	58.40	58.40
1	REAR BOOT GL EMBLEM	NECESSARY	55.00	55.00
2	REAR BOOT DAMPER L&R @\$355.00	NOT NECESSARY	710.00	-
1	REAR NUMBER PLATE LAMP OUTER CHROME GARNISH	CRACKED	176.80	176.80
2	REAR NUMBER PLATE LAMP L&R @\$160.90	NOT NECESSARY	321.80	-
1	REAR BOOT LOCK TOP	TWISTED / JAMMED	275.00	275.00
1	REAR BOOT LOWER CATCH	NOT NECESSARY	86.00	-
2	REAR LAMP ASSY L& @\$300.80	CRACKED	601.60	601.60
2	REAR LAMP LOWER GARNISH L&R @\$145.00	CUT / TWISTED	290.00	290.00
1	REAR BOOT INNER FINISHER	DEFORMED / TORN	461.20	461.20
1	REAR BOOT INNER HARDNESS WIRE	DAMAGED	170.90	170.90
2	REAR BOOT LOCK SIDE CATCH L&R @\$52.80	NOT NECESSARY	105.60	-
2	REAR BOOT LOCK SIDE CATCH RUBBER L&R @\$43.60	NOT NECESSARY	87.20	-
1	REAR BUMPER	DISTORTED	475.00	475.00
6	REAR BUMPER CLIPS @\$5.00	NECESSARY	30.00	30.00
2	REAR BUMPER SIDE RETAINER L&R @\$50.00	CRACKED	100.00	100.00
1	REAR BOOT RUBBER	TWISTED	455.00	455.00
1	REAR BUMPER INNER CENTER PANEL OUTER	BADLY DENTED	450.00	450.00
1	REAR BUMPER INNER CENTER PANEL INNER	TO REPAIR SEE LABOUR	980.00	-
1	REAR PANEL TOP GARNISH	TWISTED	175.00	175.00
1	REAR EXHAUST PIPE	TO REPAIR SEE LABOUR	300.00	-
1	REAR SPARE TYRE BRACKET ASSY	BENT	325.00	325.00
4	REAR BUMPER LOWER BRACKETS @\$30.00	BENT	120.00	120.00
	LESS 25% DISCOUNT		-2,620.43	-1,685.28
			7,861.27	5,055.82
<b><u>SPECIAL NETT ITEMS</u></b>				
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	45.00	40.00
1	REAR BOOT GREEN STICKER (SN)	NECESSARY	15.00	10.00
1	REAR BOOT 70KM STICKER (SN)	NECESSARY	15.00	10.00

Report Ref No. CS/TP19006309/Uvd3n2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR BOOT EMERGENCY DOOR STICKER (SN)	NECESSARY	15.00	15.00
1	REAR BOOT PULL & OPEN STICKER (SN)	NECESSARY	15.00	15.00
1	REAR NUMBER PLATE W/CASING (SN)	NECESSARY	45.00	45.00
1	REAR NUMBER PLATE SEAL (SN)	NECESSARY	60.00	25.00
1	SET REAR REVERSE CAMERA (SN)	SHORTED	500.00	300.00
			710.00	460.00
	<b>LABOUR</b>			
	REMOVE & INSTALL REAR WINDSCREEN.		150.00	120.00
	REMOVE & INSTALL R/BOOT ASSY,R/LAMP,R/BUMPER,SIDE GARNISH,CUT OUT & RENEW REAR LAMP CENTER PANEL INNER & OUTER,KNOCK & FLOORBOARD PANEL AND RESTRAIGHTEN BODY & CHASSIS.INCLUSIVE OF THE REPAIR OF REAR BUMPER INNER CENTER PANEL INNER AND REAR EXHAUST PIPE.		1,800.00	1,500.00
	CAR-O-LINER.	NOT NECESSARY	350.00	-
	SPRAY PAINTING.		950.00	900.00
	CHECK WIRING SYSTEM & RE-WIRING.		40.00	30.00
	REMOVE & INSTALL REAR EXHAUST BOX.		100.00	80.00
	REMOVE & INSTALL REAR SPARE TYRE BOARD.	NOT NECESSARY	80.00	-
	REMOVE & INSTALL R/SEAT AND CARPET.		180.00	100.00
	TOWING FEE TWO TRIPS.		100.00	100.00
	SEND FOR INSPECTION FEE.		80.00	80.00
			3,830.00	2,910.00
<b>GRAND TOTAL</b>			<b>12,401.27</b>	<b>8,425.82</b>
<b>RECOMMENDED COST OF REPAIRS</b>				<b>8,425.82</b>

Report Ref No. CS/TP19006309/Uvd3n2

CHUA KANG SENG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.