

Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North,
#01-18,
628457

Claim Reference:

Assessment number: YN3199X - OD MSIG

Version: 1810

Date calculated: 04/22/2019 03:19 PM

Full Report

Registration: YN3199X

Printed: 22/04/2019 3:19 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	MSIG Insurance (Singapore) Pte Ltd
Printed by:	SNG AH TEE	Currency:	SGD
Claim Reference:		Date of Incident:	2019-04-16
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	FUSO
Model:	CANTER
Sub Model:	FB83S
Model Sheet Number:	32 67 24
Registration:	YN3199X
VIN number:	
Odometer:	

Model Specs

FROM 11/2010	AIR CONDITIONING	3.0 LTR 92KW	DRIVER/PASS AIRBAG
SINGLE CAB	PREPARE OFF VEHICLE	BASECOAT CLEAR	

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Tanpin 97495744
x 9700 Not Ant/wise.
23/4/19 R 1645.
09 days
Lumpsum
Resurvey after repair.
sue lkkauto.com

Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North,
#01-18,
628457

Claim Reference:

Assessment number: YN3199X - OD MSIG

Version: 1810

Date calculated: 04/22/2019 03:19 PM

Full Report

Registration: YN3199X

Printed: 22/04/2019 3:19 PM

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

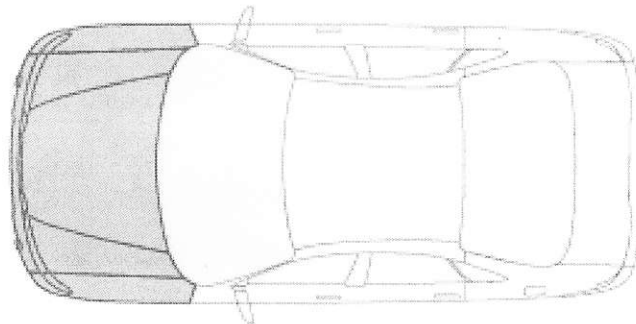

Labour

Code	Description	Time Base 10 WU/h	Price = 50.00 SGD/h	
			WU	Price SGD
NO NUMBER	ADJUST HEADLAMPS		2.0	10.00
NO NUMBER	RENEW FRONT PANEL (FRONT SCREEN AND INSTRUMENT PANEL REMOVED) INCLUDES: R + R FRONT GRILLE, HEADLAMPS AND CORNER PANEL		67.0	335.00
NO NUMBER	R + R LEFT HEADLAMP		7.0	35.00
NO NUMBER	R + R RIGHT HEADLAMP		7.0	35.00
411011 10)	R + R FRONT BUMPER		7.0	35.00
411011 10)	RENEW FRONT BUMPER INCLUDES: R + R NECESSARY ATTACHED PARTS		4.0	20.00
423121 10	R + R WINDSCREEN		25.0	125.00
524260 10	R + R RIGHT DOOR TRIM		3.0	15.00
513010 10	R + R RIGHT MIRROR		4.0	20.00
523112 10ZAX	R + R INSTRUMENT PANEL CPL INCLUDES: R + R COMBINATION INSTRUMENT		45.0	225.00

Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North,
#01-18,
628457

Claim Reference:

Assessment number: YN3199X - OD MSIG

Version: 1810

Date calculated: 04/22/2019 03:19 PM

Full Report

Registration: YN3199X

Printed: 22/04/2019 3:19 PM

Code	Description	WU	Price SGD
528511 10	R + R AIRBAG CONTROL UNIT	4.0	20.00
551110 10	R + R COMPLETE HEATER (INSTRUMENT PANEL AND FRONT GRILLE REMOVED)	13.0	65.00
552012 10)	R + R DEFROSTER VENTS (INSTRUMENT PANEL AND HEATER REMOVED)	32.0	160.00
525010 10	R + R DRIVER AIRBAG	5.0	25.00
0904	CTR FRT PANEL STRUT REPAIR	10.0*	50.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		23.50	235.0
Total of Labour			1,175.00

Paint

Paint Work	SYSTEM AZT	Time Basis 10WU/h
Code	Description - BASECOAT CLEAR	WU Price SGD
	FRONT BUMPER NEW PART PAINTING	11.0
	R/F CORNER PANEL NEW PART PAINTING	7.0
	FRONT PANEL NEW PART PAINTING	30.0
	FRONT GRILLE NEW PART PAINT K1R	8.0
	GRILLE NEW PART PAINT K1R	7.0
	CTR FRT PANEL STRUT SURFACE PAINT	5.0

Paint Material Per Part

Code	Description	Price SGD
0281	FRONT BUMPER NEW PART PAINTING	24.77
0888	R/F CORNER PANEL NEW PART PAINTING	6.19
0900	FRONT PANEL NEW PART PAINTING	41.80
0410	FRONT GRILLE NEW PART PAINT K1R	30.50
0415	GRILLE NEW PART PAINT K1R	27.06
0904	CTR FRT PANEL STRUT SURFACE PAINT	5.48

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor			
Time Paint		68.0	
Preparation Main Work Metal	2.50	25.0	125.00
Preparation Comp. Work Plastic	0.50	5.0	25.00
Total	10 WU/h	98.0	490.00

Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North,
#01-18,
628457

Claim Reference:

Assessment number: YN3199X - OD MSIG

Version: 1810

Date calculated: 04/22/2019 03:19 PM

Full Report

Registration: YN3199X

Printed: 22/04/2019 3:19 PM

Material Cost - Paint

New Part Painting	72.76
New Part Painting - Plastic K1R	57.56
Surface-/Blend Paint	5.48
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	173.40

Spare Parts

				prices as at 2015-06-01
Code	Description	Part Number	Supplier	Price SGD
0257	FRONT NUMBER PLATE	NO NUMBER	bt	0.00
0281	FRONT BUMPER	MK487405	Ry	550.00
0410	FRONT GRILLE	MK614810	cva	330.00
0561	LEFT HEADLAMP ASSY	MK486505	cva	350.00
0562	RIGHT HEADLAMP ASSY	MK486506	?	350.00
0677	L/F INDICATOR	MK486509	?	135.00
0678	R/F INDICATOR	MK486510	cva	135.00
0888	R/F CORNER PANEL	MK997198	bt	250.00
0900	FRONT PANEL	MK997155	bt	750.00
1392	FRONT PANEL TRIM	MK487201	cva	260.00
1401	WINDSCREEN	MK488920	cva	750.00
1410	WINDSCREEN SEAL	MK548236	ne	200.00
1411	BONDING KIT	Z2156507	ne	0.00
1453	L/WIPER ARM/BLADE	MK484674	?	75.00
1712	R/F DOOR TRIM	MK545403	x	380.00
1714	R/F DOOR SWITCH	MK421115	x	430.00
1738	R/MIRROR HEAD	MK486109	cva	65.00
4344	R/INSTR PANEL COVER	MK447178	?	290.00
4421	L/OUTER CONNECTION	MK405305	?	190.00
4445	HEATER BLOWER	MK447885	?	750.00
4446	HEATER CPL	MK513194	?	1,500.00
7411	DRIVER AIRBAG	MK569058	aut	2,400.00
7443	AIRBAG CONTROL UNIT	MK387908	aut	1,900.00
1001	FRT HEADLAMP	LOWER SEAL(RH)	?	9.00
1002	SIDE MIRROR(LH)	ROUND	cva	35.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	12,084.00
Addition(+10.00%)	1,208.40
Total	13,292.40

Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North,
#01-18,
628457

Claim Reference:

Assessment number: YN3199X - OD MSIG

Version: 1810

Date calculated: 04/22/2019 03:19 PM

Full Report

Registration: YN3199X

Printed: 22/04/2019 3:19 PM

Extras

Code	Description	Price SGD
1000	FRT NUMBER PLATE	20.00*
1003	ERP BRACKET -	26.00*
1004	DIAGNOSE & RESET FAULT CODE	180.00*
	Total Extras	226.00

Final Calculation

	SGD	SGD
Parts		
Addition(+10.00%)	12,084.00	
Total Parts	1,208.40	13,292.40
Labour Time Base 10 WU/h		
Total 235.0 WU X 50.00 SGD/h	1,175.00	
Total of Labour		1,175.00
Total Of Extras		226.00
Paint Work Time Base 10 WU/h		
Labour Cost 98.0 WU X 50.00 SGD/h	490.00	
Material Cost	173.40	
Total Paint Including Material		663.40
Repair Cost Excludes GST		15,356.80
GST (+7.0%)		1,074.98
Repair Cost Included GST		16,431.78

Comments

* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS