
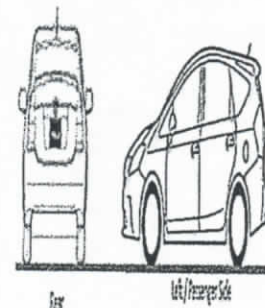


Section A - Accident Details

Registration Number	SHB1046G
Case Reference Number	TAX/04/19/2114
Registration Date	10/10/2017
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS4
Name of Driver	THINGARAN S/O THANGARAJOO
Type of Accident	Head To Side
Accident Date and Time	26/4/2019 12:35 PM
Accident Reported Date and Time	29/4/2019 10:11 AM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	Yes
Towed Back Date and Time	26/4/2019 12:36 PM
Replacement Vehicle issued?	No
Job Card Number	24101273
Special Instruction to ARC, if any	TOWED \$90
Prepared Date and Time	29/4/2019 3:27 PM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

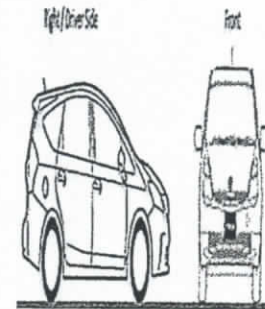

Toyota

Section B - Summary of Repair Estimates

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$3,887.00	\$2,200.00
Total Spray Cost	\$7,938.00	\$1,950.00
Total Spare Part Cost	\$121,777.95	\$32,012.43
Total Other Cost	\$3,426.00	\$420.00
TOTAL COST	\$137,028.95	\$36,582.43 (P/P)
Lump Sum Total	\$0.00	\$0.00
Number of Repair Days	29.0	17.0
Prepared / Adjusted By	Tuck Foo Kok	Hwee Jie (LKK) / AIG
ARC / Surveyor Sign Off Date	30/04/2019 6:10 PM	30/04/2019 1:29 PM
Signature		
Remarks	Supp = 5 days	p/p repair, photo before paint.

Section C - Quotation and Accident Invoice Details

Quotation Number	QN-1910-0556	Invoice Number	
Quotation Date	30.10.2019	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
ADDITIONAL JOB TO REPAIR RH PROTION	\$676.00	\$400.00
TO REPAIR FRONT PORTION	\$1,859.00	\$800.00
TO REPAIR RH PORTION	\$338.00	\$200.00
TO REPAIR LH PORTION	\$1,014.00	\$800.00
Total Labour	\$3,887.00	\$2,200.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY FRONT BUMPER	\$378.00	\$200.00
TO REPSRAY FRONT HOOD	\$378.00	\$200.00
TO RESPRAY FRONT SUPPORT PANEL	\$180.00	\$0.00
TO RESPRAY RADIATOR SUPPORT LOWER	\$180.00	\$0.00
TO RESPRAY FRONT FENDER RH	\$378.00	\$200.00
TO RESPRAY FRONT FENDER LH	\$378.00	\$200.00
TO RESPRAY APRON PANEL RH	\$180.00	\$0.00
TO RESPRAY APRON PANEL LH	\$180.00	\$0.00
TO RESPRAY FRT MEMBER,RH	\$180.00	\$0.00
TO RESPRAY FRT MEMBER,LH	\$180.00	\$0.00
TO RESPRAY FRONT PILLAR LH	\$180.00	\$0.00
RESPRAY WHEEL CAP	\$720.00	\$0.00
TO RESPRAY RIM	\$720.00	\$200.00
TO RESPRAY FRONT DOOR RH	\$378.00	\$200.00
TO RESPRAY FRONT DOOR LH	\$378.00	\$200.00
TO RESPRAY VIEW MIRROR	\$360.00	\$50.00
TO RESPRAY ROCKER PANEL MOULDING	\$360.00	\$100.00
TO RESPRAY RH REAR DOOR	\$378.00	\$0.00
TO RESRAY REAR DOOR LH	\$378.00	\$200.00
TO RESPRAY REAR FENDER LH	\$378.00	\$200.00
TO RESPRAY REAR FENDER RH	\$378.00	\$0.00
TO RESPRAY REAR BUMPER	\$378.00	\$0.00
TO RESPRAY FILLER RR BUMPER LH	\$180.00	\$0.00
TO RESPRAY FILLER RR BUMPER RH	\$180.00	\$0.00
Total Spray Painting & Panel Beating	\$7,938.00	\$1,950.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	\$126.00	\$90.00
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$30.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$300.00	\$40.00
TO DO WHEEL ALIGNMENT / TYRE BALANCING	\$120.00	\$60.00
TO TOP UP A/C GAS	\$120.00	\$0.00
TO REMOVE / REFIT SEAT	\$120.00	\$0.00
TO ALIGN CHASSIS	\$350.00	\$0.00
TO REMOVE & REFIT FUEL TANK	\$120.00	\$0.00
TO REMOVE & REFIT EXHAUST	\$120.00	\$0.00
TO TRANSFER DOOR MECHANISM	\$240.00	\$50.00
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	\$250.00	\$0.00
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	\$480.00	\$50.00
TO CHECK & RESET SYSTEM FUNCTION	\$350.00	\$100.00
TO REMOVE AND REFIT WIRE HARDESS	\$250.00	\$0.00
TO REMOVE AND REFIT INVERTER CONVERTER	\$120.00	\$0.00
TO REMOVE & REFIT FAN ENGINE & RADIATOR ASSY & INNER COOLER & AIR CON CONDENSER	\$120.00	\$0.00
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
TO WASH AND VACUUM	\$60.00	\$0.00
Total Other Costs	\$3,426.00	\$420.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		4852080492	ABSORBER SET, SHOCK, FRONT LH	0.00	\$398.10	0.00	\$0.00	Replace	Check X
		4882047040	LINK ASSY, FRONT STABILIZER, RH & LH	0.00	\$196.70	0.00	\$0.00	Replace	Check X
		4806947060	LOWER ARM SUBASSY, FRONT LH	0.00	\$631.60	0.00	\$0.00	Replace	Check X
		4333019115	JOINT ASSY, LWR BALL, RH & LH	0.00	\$200.10	0.00	\$0.00	Replace	Check X
		4504749195	END SET, TIE ROD, LH	0.00	\$155.90	0.00	\$0.00	Replace	Check X
		7586047900	MOULDING ASSY, BODY ROCKER PANEL, LH	1.00	\$576.00	25.00	\$432.00	Replace	Replace DR
		6563247080	PLATE, REAR WHEEL HOUSE, FRONT LH	0.00	\$26.80	0.00	\$0.00	Replace	Check X
		6700247162	PANEL SUB-ASSY, FRONT DOOR LH	1.00	\$1,249.60	100.00	\$0.00	Replace	Repair R
			STICKER DECAL SMRT (DOOR)	1.00	\$60.00	0.00	\$60.00	Replace	Replace nee
		6872012151	HINGE ASSY, FRONT DOOR, UPPER LH	0.00	\$82.10	0.00	\$0.00	Replace	Not Given X
		6874012120	HINGE ASSY, FRONT DOOR, LOWER LH	0.00	\$92.10	0.00	\$0.00	Replace	Not Given X
		6861047040	CHECK ASSY, FRONT DOOR	0.00	\$153.50	0.00	\$0.00	Replace	Check X
		6904047100	LOCK ASSY, FRONT DOOR LH	0.00	\$544.70	0.00	\$0.00	Replace	Check X
		6786247050	WEATHERSTRIP, FRONT DOOR LH	0.00	\$223.80	0.00	\$0.00	Replace	Check X
		6941020110	DOOR LOCK STRIKER	0.00	\$38.00	0.00	\$0.00	Replace	Check X
		6821647010	WEATHERSTRIP, FRONT DOOR FIX WINDOW, LH	0.00	\$74.30	0.00	\$0.00	Replace	Check X
		6812647030	GLASS, FRONT DOOR FIX WINDOW, LH	0.00	\$309.90	0.00	\$0.00	Replace	Check X

67402470 10	FRAME SUB-ASSY, FRONT DOOR, FRONT LOWER LH	0.00	\$140.50	0.00	\$0.00	Replace	Check	X	N/A
75752470 10	MOULDING, FRONT DOOR WINDOW FRAME, FRONT	0.00	\$37.40	0.00	\$0.00	Replace	Check	X	N/A
75720470 40	MOULDING ASSY, FRONT DOOR BELT, LH	0.00	\$88.60	0.00	\$0.00	Replace	Check	X	N/A
68102472 30	GLASS SUB-ASSY, FRONT DOOR, LH	0.00	\$796.70	0.00	\$0.00	Replace	Check	X	N/A
69802210 10	DOOR FRONT WINDOW REGULATOR SUBASSY, LH	0.00	\$230.80	0.00	\$0.00	Replace	Check	X	N/A
85720471 40	DOOR FRONT MOTOR ASSY, POWER WINDOW	0.00	\$768.60	0.00	\$0.00	Replace	Check	X	N/A
87940474 40	MIRROR ASSY, OUTER REAR VIEW, LH	1.00	\$1,283.90	10.00	\$1,155.51	Replace	Replace		BR
87945470 60A1	COVER, OUTER MIRROR, LH	1.00	\$89.50	25.00	\$67.13	Replace	Replace		BR
67004472 10	PANEL SUB-ASSY, REAR DOOR, LH	1.00	\$1,243.90	25.00	\$932.93	Replace	Replace		DD
67896470 10	WEATHERSTRIP, REAR DOOR, NO.2, LH	0.00	\$33.20	0.00	\$0.00	Replace	Check	X	N/A
68780520 31	HINGE ASSY, REAR DOOR, LOWER LH	0.00	\$73.30	0.00	\$0.00	Replace	Check	X	N/A
68760201 22	HINGE ASSY, REAR DOOR, UPPER LH	0.00	\$83.30	0.00	\$0.00	Replace	Check	X	N/A
68630470 50	CHECK ASSY, REAR DOOR	0.00	\$153.50	0.00	\$0.00	Replace	Check	X	N/A
67872470 51	WEATHERSTRIP, REAR DOOR LH	0.00	\$174.40	0.00	\$0.00	Replace	Check	X	N/A
69060522 80	DOOR LOCK REAR, LH	0.00	\$544.70	0.00	\$0.00	Replace	Check	X	N/A
69410201 10	DOOR LOCK STRIKER	0.00	\$38.00	0.00	\$0.00	Replace	Check	X	N/A
85710471 50	DOOR REAR MOTOR ASSY, POWER WINDOW	0.00	\$768.60	0.00	\$0.00	Replace	Check	X	N/A
69804470 20	DOOR REAR WINDOW REGULATOR SUBASSY, LH	0.00	\$200.70	0.00	\$0.00	Replace	Check	X	N/A
	PIXEL STICKER	1.00	\$60.00	0.00	\$60.00	Replace	Replace		DR
61602471 60	PANEL SUB-ASSY, FENDER REAR LH	1.00	\$824.80	25.00	\$618.60	Replace	Replace		DD
65638470 60	LINER, REAR FENDER, LH	1.00	\$135.80	25.00	\$101.85	Replace	Replace		TA
	TYRE	0.00	\$126.74	0.00	\$0.00	Replace	Not Given	X	N/A
42611474 50	WHEEL, DISC	1.00	\$1,555.10	100.00	\$0.00	Replace	Repair	R	X
42602471 80	CAP SUB-ASSY, WHEEL	0.00	\$175.80	0.00	\$0.00	Replace	Not Given	X	N/A
16592370 20	GUIDE, RADIATOR AIR,	0.00	\$93.90	0.00	\$0.00	Replace	Check	X	N/A
16594370 10	GUIDE, RADIATOR AIR, UPPER	0.00	\$44.70	0.00	\$0.00	Replace	Check	X	N/A
16595370 50	GUIDE, RADIATOR AIR, LH	0.00	\$58.80	0.00	\$0.00	Replace	Check	X	N/A
16593370 40	GUIDE, RADIATOR AIR, RH	0.00	\$54.60	0.00	\$0.00	Replace	Check	X	N/A
16400373 10	RADIATOR ASSY	0.00	\$1,841.10	0.00	\$0.00	Replace	Check	X	N/A
90480400 21	GROMMET (FOR RADIATOR LOWER	0.00	\$12.70	0.00	\$0.00	Replace	Check	X	N/A
16523370 10	CUSHION, (FOR RADIATOR UPPER SUPPORT)	0.00	\$9.80	0.00	\$0.00	Replace	Check	X	N/A
16361370 60	FAN RADIATOR, LH	0.00	\$181.80	0.00	\$0.00	Replace	Check	X	N/A
16361370 70	FAN RADIATOR, RH	0.00	\$233.00	0.00	\$0.00	Replace	Check	X	N/A
16711371 60	FAN SHROUD RADIATOR	0.00	\$219.30	0.00	\$0.00	Replace	Check	X	N/A
16363370 60	MOTOR, COOLING FAN, LH	0.00	\$543.50	0.00	\$0.00	Replace	Check	X	N/A
16363361 60	MOTOR, COOLING FAN, RH	0.00	\$443.40	0.00	\$0.00	Replace	Check	X	N/A
16571372 10	HOSE, RADIATOR, NO.1	0.00	\$42.60	0.00	\$0.00	Replace	Check	X	N/A
16572372 10	HOSE, RADIATOR, NO.2	0.00	\$40.20	0.00	\$0.00	Replace	Check	X	N/A
164A237 012	TANK, RESERVE SEALED W/O CAP	0.00	\$127.00	0.00	\$0.00	Replace	Check	X	N/A
16261371 50	HOSE, WATER BYPASS, NO.1	0.00	\$37.40	0.00	\$0.00	Replace	Check	X	N/A
16264371 20	HOSE, WATER BYPASS, NO.2	0.00	\$37.40	0.00	\$0.00	Replace	Check	X	N/A

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
80 Woodlands Industrial Park E4, Singapore 757705
FAX Number : 63685592
Estimator Telephone Number : 65652623
Accident Reporting Number : 65662672

Date Generated : 30/10/2019
User ID : PohSuan

16267370 90	HOSE, WATER BYPASS , NO.3	0.00	\$20.10	0.00	\$0.00	Replace	Check	X	N/A
16281371 00	HOSE, WATER BYPASS , NO.4	0.00	\$13.20	0.00	\$0.00	Replace	Check	X	N/A
16296370 10	HOSE, WATER BYPASS , NO.8	0.00	\$37.90	0.00	\$0.00	Replace	Check	X	N/A
16268371 00	PIPE, WATER BYPASS , NO.1	0.00	\$11.00	0.00	\$0.00	Replace	Check	X	N/A
16268371 20	PIPE, WATER BYPASS , NO.2	0.00	\$11.00	0.00	\$0.00	Replace	Check	X	N/A
16279370 20	PIPE, WATER BYPASS , NO.3	0.00	\$56.40	0.00	\$0.00	Replace	Check	X	N/A
16577370 90	PIPE, RADIATOR	0.00	\$32.90	0.00	\$0.00	Replace	Check	X	N/A
16573370 20	HOSE, RADIATOR , NO.3	0.00	\$29.60	0.00	\$0.00	Replace	Check	X	N/A
16282370 90	HOSE, WATER BYPASS , NO.5	0.00	\$13.20	0.00	\$0.00	Replace	Check	X	N/A
16278370 20	PIPE, WATER BYPASS , NO.5	0.00	\$51.80	0.00	\$0.00	Replace	Check	X	N/A
16283370 21	HOSE, WATER BYPASS , NO.6	0.00	\$13.20	0.00	\$0.00	Replace	Check	X	N/A
25601370 30	PIPE SUB-ASSY, EGR W/COOLER	0.00	\$1,168.70	0.00	\$0.00	Replace	Check	X	N/A
25620371 50	VALVE ASSY, EGR	0.00	\$685.20	0.00	\$0.00	Replace	Check	X	N/A
90910122 76	VALVE, DUTY VACUUM SWITCHING	0.00	\$115.10	0.00	\$0.00	Replace	Check	X	N/A
16031370 10	INLET SUB-ASSY, WATER THERMOSTAT	0.00	\$91.20	0.00	\$0.00	Replace	Check	X	N/A
16267371 00	HOSE, WATER BYPASS , NO.14	0.00	\$37.40	0.00	\$0.00	Replace	Check	X	N/A
G904047 040	INVERTER WATER PUMP ASSY	0.00	\$432.00	0.00	\$0.00	Replace	Check	X	N/A
G922E47 010	HOSE, HV WATER PUMP INLET	0.00	\$37.90	0.00	\$0.00	Replace	Check	X	N/A
G922F47 010	HOSE, HV WATER PUMP OUTLET	0.00	\$29.60	0.00	\$0.00	Replace	Check	X	N/A
G91H047 011	TANK ASSY, INVERTER RESERVE	0.00	\$371.30	0.00	\$0.00	Replace	Check	X	N/A
G922A47 010	HOSE, INVERTER COOLING INLET	0.00	\$43.10	0.00	\$0.00	Replace	Check	X	N/A
G922C47 010	HOSE, INVERTER COOLING OUTLET	0.00	\$29.60	0.00	\$0.00	Replace	Check	X	N/A
G922H47 010	HOSE, INVERTER RADIATOR INLET	0.00	\$40.70	0.00	\$0.00	Replace	Check	X	N/A
G125A47 010	COOLER, MOTOR COOLING	0.00	\$249.10	0.00	\$0.00	Replace	Check	X	N/A
G920049 115	INVERTER ASSY	0.00	\$4,843.10	0.00	\$0.00	Replace	Check	X	N/A
G921E47 010	PROTECTOR, INVERTER	0.00	\$26.30	0.00	\$0.00	Replace	Check	X	N/A
G921447 070	BRACKET, INVERTER, NO.1	0.00	\$206.00	0.00	\$0.00	Replace	Check	X	N/A
G921547 050	BRACKET, INVERTER, NO.2	0.00	\$174.80	0.00	\$0.00	Replace	Check	X	N/A
G902247 050	COVER SUB-ASSY, INVERTER	0.00	\$90.40	0.00	\$0.00	Replace	Check	X	N/A
G114847 070	CABLE, MOTOR	0.00	\$203.20	0.00	\$0.00	Replace	Check	X	N/A
8211147J 21	WIRE, ENGINE ROOM MAIN	0.00	\$6,138.00	0.00	\$0.00	Replace	Check	X	N/A
821H2470 10	WIRE, AIR CONDITIONER	0.00	\$445.70	0.00	\$0.00	Replace	Check	X	N/A
82121472 22	WIRE, ENGINE	0.00	\$2,154.30	0.00	\$0.00	Replace	Check	X	N/A
82123470 60	WIRE, ENGINE, NO.3	0.00	\$260.40	0.00	\$0.00	Replace	Check	X	N/A
82124121 60	WIRE, ENGINE, NO.4	0.00	\$51.20	0.00	\$0.00	Replace	Check	X	N/A
28800371 30	BATTERY	0.00	\$1,584.90	0.00	\$0.00	Replace	Check	X	N/A
74404470 30	CLAMP SUB-ASSY, BATTERY	0.00	\$41.40	0.00	\$0.00	Replace	Check	X	N/A
74482470 10	CLAMP, BATTERY, NO.2	0.00	\$43.30	0.00	\$0.00	Replace	Check	X	N/A
82621470 20	COVER, FUSIBLE LINK	0.00	\$28.30	0.00	\$0.00	Replace	Check	X	N/A
82620470 90	BLOCK ASSY, FUSIBLE LINK	0.00	\$99.80	0.00	\$0.00	Replace	Check	X	N/A
82671470 40	BLOCK, JUNCTION	0.00	\$15.80	0.00	\$0.00	Replace	Check	X	N/A

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
60 Woodlands Industrial Park E4, Singapore 757705
FAX Number : 63855592
Estimator Telephone Number : 68582623
Accident Reporting Number : 68662672

Date Generated : 30/10/2019

User ID : PohSuan

2885037070	SENSOR ASSY, BATTERY STATE	0.00	\$256.80	0.00	\$0.00	Replace	Check	X	N/A
2885937030	HOLDER, BATTERY CURRENT SENSOR	0.00	\$11.70	0.00	\$0.00	Replace	Check	X	N/A
8966747100	BRACKET, ENGINE CONTROL COMPUTER,	0.00	\$18.50	0.00	\$0.00	Replace	Check	X	N/A
8966847050	BRACKET, ENGINE CONTROL COMPUTER,	0.00	\$16.90	0.00	\$0.00	Replace	Check	X	N/A
8966147701	COMPUTER, ENGINE CONTROL	0.00	\$3,009.10	0.00	\$0.00	Replace	Check	X	N/A
1775137110	INLET, AIR CLEANER, NO 1	0.00	\$130.50	0.00	\$0.00	Replace	Check	X	N/A
1775237121	INLET, AIR CLEANER, NO 2	0.00	\$93.90	0.00	\$0.00	Replace	Check	X	N/A
1775337010	INLET, AIR CLEANER, NO 3	0.00	\$35.30	0.00	\$0.00	Replace	Check	X	N/A
9611110750	CLAMP (FOR AIR CLEANER HOSE , NO.2)	0.00	\$9.00	0.00	\$0.00	Replace	Check	X	N/A
9611110650	CLAMP (FOR AIR CLEANER INLET , NO.1)	0.00	\$7.10	0.00	\$0.00	Replace	Check	X	N/A
9611110430	CLAMP (FOR RESONATOR INTAKE AIR)	0.00	\$7.10	0.00	\$0.00	Replace	Check	X	N/A
1788137330	HOSE, AIR CLEANER , NO.1	0.00	\$62.10	0.00	\$0.00	Replace	Check	X	N/A
1789337130	RESONATOR, INTAKE AIR	0.00	\$14.90	0.00	\$0.00	Replace	Check	X	N/A
1777137020	BRACKET, AIR CLEANER	0.00	\$26.90	0.00	\$0.00	Replace	Check	X	N/A
1770037330	AIR CLEANER ASSY	0.00	\$956.20	0.00	\$0.00	Replace	Check	X	N/A
9090406008	TUBE, UNION (FOR AIR CLEANER HOSE)	0.00	\$19.40	0.00	\$0.00	Replace	Check	X	N/A
2203037060	BODY ASSY, THROTTLE	0.00	\$1,942.40	0.00	\$0.00	Replace	Check	X	N/A
1712037110	MANIFOLD, INTAKE	0.00	\$867.70	0.00	\$0.00	Replace	Check	X	N/A
8942126030	SENSOR ASSY, VACUUM (FOR E.F.I.)	0.00	\$601.90	0.00	\$0.00	Replace	Check	X	N/A
1260137010	COVER SUB-ASSY, ENGINE	0.00	\$262.70	0.00	\$0.00	Replace	Check	X	N/A
1263137010	BRACKET, ENGINE COVER	0.00	\$17.90	0.00	\$0.00	Replace	Check	X	N/A
1900037800	ENGINE ASSY	0.00	\$25,615.20	0.00	\$0.00	Replace	Check	X	N/A
1230537340	INSULATOR SUB-ASSY, ENGINE MOUNTING, RH	0.00	\$382.60	0.00	\$0.00	Replace	Check	X	N/A
1231537060	BRACKET, ENGINE MOUNTING, RH	0.00	\$171.10	0.00	\$0.00	Replace	Check	X	N/A
1236437040	ROD, ENGINE MOVING CONTROL , NO.2	0.00	\$155.30	0.00	\$0.00	Replace	Check	X	N/A
1236337030	ROD, ENGINE MOVING CONTROL	0.00	\$174.80	0.00	\$0.00	Replace	Check	X	N/A
1237237311	INSULATOR, ENGINE MOUNTING, LH	0.00	\$258.00	0.00	\$0.00	Replace	Check	X	N/A
5110747020	FRONT REINFORCEMENT SIDE RH	0.00	\$128.20	0.00	\$0.00	Replace	Check	X	N/A
5110847020	FRONT REINFORCEMENT SIDE LH	0.00	\$129.30	0.00	\$0.00	Replace	Check	X	N/A
5141047020	COVER ASSY, ENGINE UNDER CENTER SET	1.00	\$452.80	25.00	\$339.60	Replace	Replace		BR
5144347020	COVER, ENGINE UNDER SIDE RH	0.00	\$76.90	0.00	\$0.00	Replace	Check	X	N/A
5144447010	COVER, ENGINE UNDER SIDE LH	0.00	\$76.90	0.00	\$0.00	Replace	Check	X	N/A
5144247030	COVER, ENGINE UNDER, REAR	0.00	\$36.50	0.00	\$0.00	Replace	Check	X	N/A
5881647060C0	INSERT, CONSOLE BOX, FRONT NO.1	0.00	\$93.90	0.00	\$0.00	Replace	Check	X	N/A
5881747060C0	INSERT, CONSOLE BOX, FRONT NO.2	0.00	\$89.20	0.00	\$0.00	Replace	Check	X	N/A
5540647060C0	PANEL SUB-ASSY, INSTRUMENT CLUSTER	0.00	\$144.80	0.00	\$0.00	Replace	Check	X	N/A
5211947962	COVER, FR BUMPER	1.00	\$495.50	25.00	\$371.63	Replace	Replace		BR
5212847906	COVER, FR BUMPER LH	1.00	\$28.10	25.00	\$21.08	Replace	Replace		BR
5212747907	COVER, FR BUMPER RH	1.00	\$28.10	25.00	\$21.08	Replace	Replace		BR
5216116010	CLIPS PIECE, FRT & RR BUMPER	10.00	\$1.50	25.00	\$11.25	Replace	Replace		MC
5310147080	GRILLE SUB-ASSY	1.00	\$335.60	25.00	\$251.70	Replace	Replace		BR

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
60 Woodlands Industrial Park E4, Singapore 757705
FAX Number : 63685592
Estimator Telephone Number : 68662623
Accident Reporting Number : 68662672

Date Generated : 30/10/2019

User ID : PohSuan

75310470	EMBLEM ASSY FRONT	1.00	\$87.10	25.00	\$65.33	Replace	Replace	✓	APC
53112472	GRILLE, RADIATOR	1.00	\$165.00	25.00	\$123.75	Replace	Replace	✓	BR
52114471	BRACKET, FR BUMPER	0.00	\$99.80	0.00	\$0.00	Replace	Check	✓	N/A
	NUMBER PLATE	1.00	\$35.00	0.00	\$35.00	Replace	Replace	✓	BR
	NUMBER PLATE FRAME	1.00	\$25.00	0.00	\$25.00	Replace	Replace	✓	BR
53395470	SEAL, HOOD TO FR END	0.00	\$24.40	0.00	\$0.00	Replace	Check	✓	N/A
52116470	SUPPORT, FR BUMPER LH	1.00	\$82.30	25.00	\$61.73	Replace	Replace	✓	BR
52115470	SUPPORT, FR BUMPER RH	1.00	\$76.90	25.00	\$57.68	Replace	Replace	✓	BR
52611471	ABSORBER, FR BUMPER	0.00	\$70.30	0.00	\$0.00	Replace	Check	✓	N/A
52021471	REINFORCEMENT FRONT UPPER	1.00	\$691.10	25.00	\$518.33	Replace	Replace	✓	DO
52618470	ABSORBER, FR BUMPER LOWER	0.00	\$117.00	0.00	\$0.00	Replace	Check	✓	N/A
52132470	REINFORCEMENT FRONT LOWER	1.00	\$238.50	25.00	\$178.88	Replace	Replace	✓	DO
52103470	EXTENSION SUBASSY, LH	0.00	\$116.30	0.00	\$0.00	Replace	Check	✓	N/A
52102470	EXTENSION SUBASSY, RH	0.00	\$116.30	0.00	\$0.00	Replace	Check	✓	N/A
81220470	LAMP ASSY, FOG, LH	0.00	\$910.20	0.00	\$0.00	Replace	Check	✓	N/A
81210470	LAMP ASSY, FOG, RH	0.00	\$910.20	0.00	\$0.00	Replace	Check	✓	N/A
51420470	COVER ASSY, ENGINE	0.00	\$180.10	0.00	\$0.00	Replace	Check	✓	N/A
53301471	HOOD SUB-ASSY	1.00	\$938.40	25.00	\$703.80	Replace	Replace	✓	DO
53341470	INSULATOR, HOOD	1.00	\$393.90	25.00	\$295.43	Replace	Replace	✓	CR4
90467090	INSULATOR, HOOD CLIP	6.00	\$2.30	25.00	\$10.35	Replace	Replace	✓	APC
53420471	HINGE ASSY, HOOD, LH	1.00	\$57.00	25.00	\$42.75	Replace	Replace	✓	BT
53410471	HINGE ASSY, HOOD, RH	1.00	\$57.00	25.00	\$42.75	Replace	Replace	✓	BT
53336470	BRACKET, HOOD STAY,	0.00	\$11.60	0.00	\$0.00	Replace	Check	✓	N/A
53440470	SUPPORT ASSY, HOOD	0.00	\$41.80	0.00	\$0.00	Replace	Check	✓	N/A
53452470	HOLDER, HOOD STAY	0.00	\$16.60	0.00	\$0.00	Replace	Check	✓	N/A
90959013	CLAMP (FOR HOOD LOCK CONTROL CABLE)	0.00	\$4.20	0.00	\$0.00	Replace	Check	✓	N/A
53510471	LOCK ASSY, HOOD	0.00	\$131.10	0.00	\$0.00	Replace	Check	✓	N/A
53630470	CABLE ASSY, HOOD	0.00	\$53.20	0.00	\$0.00	Replace	Check	✓	N/A
85381470	NOZZLE, FRONT WASHER	0.00	\$34.10	0.00	\$0.00	Replace	Check	✓	N/A
75536470	MOULDING LH	1.00	\$83.30	25.00	\$62.48	Replace	Replace	✓	BR
75535470	MOULDING RH	0.00	\$83.30	0.00	\$0.00	Replace	Check	✓	N/A
55708472	WIPER GARNISH LOUVER SUB-ASSY	0.00	\$666.90	0.00	\$0.00	Replace	Check	✓	N/A
90467092	WIPER GARNISH LOUVER SUB-ASSY, CLIP	0.00	\$3.20	0.00	\$0.00	Replace	Check	✓	N/A
55754470	WIPER GARNISH SHIELD, COWL WATER, LH	0.00	\$18.90	0.00	\$0.00	Replace	Check	✓	N/A
55753470	WIPER GARNISH SHIELD, COWL WATER, RH	0.00	\$18.90	0.00	\$0.00	Replace	Check	✓	N/A
61014470	PILLAR, FRONT BODY, LH	0.00	\$339.40	0.00	\$0.00	Replace	Check	✓	N/A
60118470	COVER SUB-ASSY, FRONT PILLAR, UPR LH	0.00	\$96.90	0.00	\$0.00	Replace	Check	✓	N/A
88790281	THERMISTOR ASSY	0.00	\$68.00	0.00	\$0.00	Replace	Check	✓	N/A
53289470	COVER, RADIATOR	0.00	\$227.80	0.00	\$0.00	Replace	Check	✓	N/A
53205479	SUPPORT S/A UPPER	0.00	\$364.90	0.00	\$0.00	Replace	Check	✓	N/A
53028470	SUPPORT SUB-ASSY LOWER	0.00	\$397.40	0.00	\$0.00	Replace	Check	✓	N/A

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
60 Woodlands Industrial Park E4, Singapore 757705
FAX Number : 63655592
Estimator Telephone Number: 68662523
Accident Reporting Number : 68662572

Date Generated : 30/10/2019

User ID : PehSuan

53203479 01	SUPPORT S/A LH	0.00	\$237.00	0.00	\$0.00	Replace	Check	X	NAI
53202479 01	SUPPORT S/A RH	0.00	\$237.00	0.00	\$0.00	Replace	Check	X	NAI
53217470 30	BRACE, HOOD LOCK SUPPORT	0.00	\$76.20	0.00	\$0.00	Replace	Check	X	NAI
53214470 50	SUPPORT, RADIATOR UPPER LH	0.00	\$76.70	0.00	\$0.00	Replace	Check	X	NAI
53213470 50	SUPPORT, RADIATOR UPPER RH	0.00	\$76.70	0.00	\$0.00	Replace	Check	X	NAI
81185476 91	UNIT, HEADLAMP, LH	1.00	\$2,558.90	10.00	\$2,303.01	Replace	Replace	X	BR
81145476 91	UNIT, HEADLAMP, RH	1.00	\$2,558.90	10.00	\$2,303.01	Replace	Replace	X	BR
81056476 90	COMPUTER SUBASSY, HEADLAMP, LH NO.1	0.00	\$486.40	0.00	\$0.00	Replace	Check	X	NAI
81016476 90	COMPUTER SUB-ASSY, HEADLAMP, RH NO.1	0.00	\$486.40	0.00	\$0.00	Replace	Check	X	NAI
53807470 20	SEAL SUB-ASSY, RH	0.00	\$50.20	0.00	\$0.00	Replace	Check	X	NAI
53808470 20	SEAL SUB-ASSY, LH	0.00	\$50.20	0.00	\$0.00	Replace	Check	X	NAI
86510470 50	HORN ASSY, HIGH	0.00	\$112.80	0.00	\$0.00	Replace	Check	X	NAI
86520470 30	HORN ASSY, LOW	0.00	\$112.80	0.00	\$0.00	Replace	Check	X	NAI
88460103 20	AIR CON CONDENSER ASSY	0.00	\$1,317.70	0.00	\$0.00	Replace	Check	X	NAI
88710471 60	TUBE & ACCESSORY	0.00	\$574.40	0.00	\$0.00	Replace	Check	X	NAI
88703470 80	HOSE SUB-ASSY, DISCHARGE	0.00	\$337.10	0.00	\$0.00	Replace	Check	X	NAI
88704471 00	HOSE SUB-ASSY, SUCTION	0.00	\$541.90	0.00	\$0.00	Replace	Check	X	NAI
88707470 90	PIPE SUB-ASSY, SUCTION	0.00	\$389.60	0.00	\$0.00	Replace	Check	X	NAI
88688477 10	BRACKET, COOLER REFRIGERANT HOSE,	0.00	\$13.20	0.00	\$0.00	Replace	Check	X	NAI
88688477 00	BRACKET, COOLER REFRIGERANT HOSE,	0.00	\$18.70	0.00	\$0.00	Replace	Check	X	NAI
	COOLANT	0.00	\$12.30	0.00	\$0.00	Replace	Check	X	NAI
53801470 80	FENDER SUB-ASSY, FR, RH	1.00	\$933.10	25.00	\$699.83	Replace	Replace	X	NAI
75374471 40	EMBLEM, SIDE PANEL (HYBRID)	1.00	\$52.90	25.00	\$39.68	Replace	Replace	X	NAI
53827470 50	PROTECTOR, FR FENDER RH	0.00	\$90.40	0.00	\$0.00	Replace	Check	X	NAI
53875470 70	LINER, FR FENDER, RH	0.00	\$198.40	0.00	\$0.00	Replace	Check	X	NAI
53851470 61	PAD, FR WHEEL RH	0.00	\$57.70	0.00	\$0.00	Replace	Check	X	NAI
53701471 11	APRON SUB-ASSY, FRONT FENDER, RH	0.00	\$944.20	0.00	\$0.00	Replace	Check	X	NAI
57101470 70	MEMBER SUB-ASSY, FR RH	0.00	\$2,012.70	0.00	\$0.00	Replace	Check	X	NAI
57102470 90	MEMBER SUB-ASSY, FR LH	0.00	\$1,959.50	0.00	\$0.00	Replace	Check	X	NAI
	TYRE	1.00	\$126.74	0.00	\$126.74	Replace	Replace	X	NAI
42611- 47450	WHEEL, DISC FRONT	1.00	\$1,555.10	100.00	\$0.00	Replace	Repair	X	NAI
42602471 80	CAP SUB-ASSY, WHEEL	0.00	\$175.80	0.00	\$0.00	Replace	Not Given	X	NAI
48510808 15	ABSORBER SET, SHOCK, FRONT RH	0.00	\$398.10	0.00	\$0.00	Replace	Check	X	NAI
43211470 40	KNUCKLE, STEERING, RH	0.00	\$555.20	0.00	\$0.00	Replace	Check	X	NAI
43550470 20	HUB & BEARING ASSY, RH & LH	0.00	\$554.20	0.00	\$0.00	Replace	Check	X	NAI
48820470 40	LINK ASSY, FRONT STABILIZER, RH & LH	0.00	\$196.70	0.00	\$0.00	Replace	Check	X	NAI
48068470 60	LOWER ARM SUBASSY, FRONT RH	0.00	\$631.60	0.00	\$0.00	Replace	Check	X	NAI
43330191 15	JOINT ASSY, LWR BALL, RH & LH	0.00	\$200.10	0.00	\$0.00	Replace	Check	X	NAI
43410470 40	SHAFT ASSY, FRONT DRIVE, RH	0.00	\$1,295.70	0.00	\$0.00	Replace	Check	X	NAI
45046492 55	END SET, TIE ROD, RH	0.00	\$155.90	0.00	\$0.00	Replace	Check	X	NAI
45510471 40	GEAR ASSY, STEERING	0.00	\$1,620.70	0.00	\$0.00	Replace	Check	X	NAI

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
50 Woodlands Industrial Park E4, Singapore 757705
FAX Number : 03685562
Estimator Telephone Number : 68662622
Accident Reporting Number : 68662672

Date Generated : 30/10/2019

User ID : PehSuan

7585047910	MOULDING ASSY, BODY ROCKER PANEL, RH	0.00	\$576.00	0.00	\$0.00	Replace	Check	X	NAI
5816547030	COVER, FRONT FLOOR UNDER, RH	0.00	\$427.30	0.00	\$0.00	Replace	Check	X	NAI
5816647030	COVER, FRONT FLOOR UNDER, LH	0.00	\$425.50	0.00	\$0.00	Replace	Check	X	NAI
5839047010	COVER ASSY, CENTER FLOOR UNDER, RH	0.00	\$306.90	0.00	\$0.00	Replace	Check	X	NAI
5762847020	COVER ASSY, CENTER FLOOR UNDER, LH	0.00	\$390.20	0.00	\$0.00	Replace	Check	X	NAI
6563147080	PLATE, REAR WHEEL HOUSE, FRONT RH	0.00	\$26.80	0.00	\$0.00	Replace	Check	X	NAI
6700147152	PANEL SUB-ASSY, FRONT DOOR RH	1.00	\$1,249.60	100.00	\$0.00	Replace	Repair	X	X
	STICKER DECAL SMRT (DOOR)	1.00	\$60.00	0.00	\$60.00	Replace	Replace	X	APC
6700347210	PANEL SUB-ASSY, REAR DOOR, RH	0.00	\$1,243.90	0.00	\$0.00	Replace	Not Given	X	NAI
	PIXEL STICKER	0.00	\$60.00	0.00	\$0.00	Replace	Not Given	X	NAI
6160147150	PANEL SUB-ASSY, FENDER REAR RH	0.00	\$824.80	0.00	\$0.00	Replace	Check	X	NAI
6563747060	LINER, REAR FENDER, RH	0.00	\$135.80	0.00	\$0.00	Replace	Check	X	NAI
	TYRE	0.00	\$126.74	0.00	\$0.00	Replace	Not Given	X	XIAI
4261147450	WHEEL, DISC	0.00	\$1,555.10	0.00	\$0.00	Replace	Check	X	NAI
4260247180	CAP SUB-ASSY, WHEEL	0.00	\$175.80	0.00	\$0.00	Replace	Not Given	X	NAI
4853080791	ABSORBER SET, SHOCK, REAR RH & LH	0.00	\$116.80	0.00	\$0.00	Replace	Check	X	NAI
4877047010	ARM ASSY, UPPER CONTROL, REAR RH	0.00	\$352.40	0.00	\$0.00	Replace	Check	X	NAI
4873047010	ARM ASSY, REAR SUSPENSION, NO.2 RH &	0.00	\$497.50	0.00	\$0.00	Replace	Check	X	NAI
4230447050	CARRIER SUB-ASSY, REAR AXLE, RH	0.00	\$802.70	0.00	\$0.00	Replace	Check	X	NAI
4871047010	ARM ASSY, REAR SUSPENSION, NO.1 RH &	0.00	\$200.80	0.00	\$0.00	Replace	Check	X	NAI
4876047010	ARM ASSY, TRAILING, REAR RH	0.00	\$239.70	0.00	\$0.00	Replace	Check	X	NAI
4883047010	LINK ASSY, REAR STABILIZER, RH & LH	0.00	\$149.40	0.00	\$0.00	Replace	Check	X	NAI
5215947913	COVER, RR BUMPER ASSY	0.00	\$423.90	0.00	\$0.00	Replace	Check	X	NAI
5256647900	FILLER, RR BUMPER, LH	0.00	\$119.90	0.00	\$0.00	Replace	Check	X	NAI
5256547900	FILLER, RR BUMPER, RH	0.00	\$119.90	0.00	\$0.00	Replace	Not Given	X	NAI
5257647040	RETAINER, RR BUMPER, LH	0.00	\$111.50	0.00	\$0.00	Replace	Check	X	NAI
5257547040	RETAINER, RR BUMPER, RH	0.00	\$112.70	0.00	\$0.00	Replace	Not Given	X	NAI
5380247100	FENDER SUB-ASSY, FR, LH	1.00	\$933.10	25.00	\$699.83	Replace	Replace	X	DD
7537447140	EMBLEM, SIDE PANEL (HYBRID)	1.00	\$52.90	25.00	\$39.68	Replace	Replace	X	APC
5382847070	PROTECTOR, FR FENDER LH	1.00	\$90.40	25.00	\$67.80	Replace	Replace	X	BR
5387647110	LINER, FR FENDER, LH	1.00	\$194.30	25.00	\$145.73	Replace	Replace	X	TNI
5385247041	PAD, FR WHEEL LH	1.00	\$57.70	25.00	\$43.28	Replace	Replace	X	CNT
5370247101	APRON SUB-ASSY, FRONT FENDER, LH	0.00	\$944.20	0.00	\$0.00	Replace	Check	X	NAI
	TYRE	0.00	\$126.74	0.00	\$0.00	Replace	Not Given	X	NAI
42611-47450	WHEEL, DISC FRONT	1.00	\$1,555.10	100.00	\$0.00	Replace	Repair	X	X
4260247180	CAP SUB-ASSY, WHEEL	0.00	\$175.80	0.00	\$0.00	Replace	Not Given	X	NAI
Total			\$122,989.96		\$13,196.21				

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
		7440447030	CLAMP SUB-ASSY, BATTERY	1.00	\$41.40	25.00	\$31.05	Replace	Replace

7448247010	CLAMP, BATTERY, NO.2	1.00	\$43.30	25.00	\$32.48	Replace	Replace	BT
1775137110	INLET, AIR CLEANER, NO 1	1.00	\$130.50	25.00	\$97.88	Replace	Replace	BR
1775237121	INLET, AIR CLEANER, NO 2	1.00	\$93.90	25.00	\$70.43	Replace	Replace	BR
1775337010	INLET, AIR CLEANER, NO 3	1.00	\$35.30	25.00	\$26.48	Replace	Replace	BR
1788137330	HOSE, AIR CLEANER, NO.1	1.00	\$62.10	25.00	\$46.58	Replace	Replace	BR
1770037330	AIR CLEANER ASSY	1.00	\$956.20	25.00	\$717.15	Replace	Replace	BR
8942126030	SENSOR ASSY, VACUUM (FOR E.F.I.)	1.00	\$601.90	25.00	\$451.43	Replace	Replace	BR
5211447190	BRACKET, FR BUMPER	1.00	\$99.80	25.00	\$74.85	Replace	Replace	BR
5261147140	ABSORBER, FR BUMPER	1.00	\$70.30	25.00	\$52.73	Replace	Replace	BR
5261847090	ABSORBER, FR BUMPER LOWER	1.00	\$117.00	25.00	\$87.75	Replace	Replace	BR
5210347010	EXTENSION SUBASSY, LH	1.00	\$116.30	25.00	\$87.23	Replace	Replace	BR
5210247020	EXTENSION SUBASSY, RH	1.00	\$116.30	25.00	\$87.23	Replace	Replace	BR
5142047030	COVER ASSY, ENGINE	1.00	\$180.10	25.00	\$135.08	Replace	Replace	BR
5351047140	LOCK ASSY, HOOD	1.00	\$131.10	25.00	\$98.33	Replace	Replace	BT
9046709242	WIPER GARNISH LOUVER SUB-ASSY, CLIP	1.00	\$3.20	25.00	\$2.40	Replace	Replace	CRU
5328947072	COVER, RADIATOR	1.00	\$227.80	25.00	\$170.85	Replace	Replace	BR
5320547900	SUPPORT S/A UPPER	1.00	\$364.90	25.00	\$273.68	Replace	Replace	DD
5302847010	SUPPORT SUB-ASSY LOWER	1.00	\$397.40	25.00	\$298.05	Replace	Replace	DD
5320347901	SUPPORT S/A LH	1.00	\$237.00	25.00	\$177.75	Replace	Replace	DD
5320247901	SUPPORT S/A RH	1.00	\$237.00	25.00	\$177.75	Replace	Replace	DD
5321747030	BRACE, HOOD LOCK SUPPORT	1.00	\$76.20	25.00	\$57.15	Replace	Replace	DD
5321447050	SUPPORT, RADIATOR UPPER LH	1.00	\$76.70	25.00	\$57.53	Replace	Replace	DD
5321347050	SUPPORT, RADIATOR UPPER RH	1.00	\$76.70	25.00	\$57.53	Replace	Replace	DD
8105647690	COMPUTER SUBASSY, HEADLAMP, LH NO.1	1.00	\$486.40	10.00	\$437.76	Replace	Replace	BR
8101647690	COMPUTER SUB-ASSY, HEADLAMP, RH NO.1	1.00	\$486.40	10.00	\$437.76	Replace	Replace	BR
8846010320	AIR CON CONDENSER ASSY	1.00	\$1,317.70	25.00	\$988.28	Replace	Replace	DD
8871047160	TUBE & ACCESSORY	1.00	\$574.40	25.00	\$430.80	Replace	Replace	BT
8870447100	HOSE SUB-ASSY, SUCTION	1.00	\$541.90	25.00	\$406.43	Replace	Replace	BT
	COOLANT	1.00	\$12.32	0.00	\$12.32	Replace	Replace	ALC
5710147070	MEMBER SUB-ASSY, FR RH	1.00	\$2,012.70	100.00	\$0.00	Replace	Repair	X
5710247090	MEMBER SUB-ASSY, FR LH	1.00	\$1,959.50	100.00	\$0.00	Replace	Repair	X
4261147450	WHEEL, DISC	1.00	\$1,555.10	100.00	\$0.00	Replace	Repair	X
5370247101	APRON SUB-ASSY, FRONT FENDER, LH	1.00	\$944.20	100.00	\$0.00	Replace	Repair	X
5215947913	COVER, RR BUMPER ASSY	1.00	\$423.90	100.00	\$0.00	Replace	Repair	X
5256647900	FILLER, RR BUMPER, LH	1.00	\$119.90	100.00	\$0.00	Replace	Repair	X
1640037310	RADIATOR ASSY	1.00	\$1,841.10	25.00	\$1,380.83	Replace	Replace	DD
9048040021	GROMMET (FOR RADIATOR LOWER	2.00	\$12.70	25.00	\$19.05	Replace	Replace	ALC
1652337010	CUSHION, (FOR RADIATOR UPPER SUPPORT)	1.00	\$9.80	25.00	\$7.35	Replace	Replace	ALC
1636137060	FAN RADIATOR, LH	1.00	\$181.80	25.00	\$136.35	Replace	Replace	BR
1636137070	FAN RADIATOR, RH	1.00	\$233.00	25.00	\$174.75	Replace	Replace	BR
1671137160	FAN SHROUD RADIATOR	1.00	\$219.30	25.00	\$164.48	Replace	Replace	BR

	16363370 60	MOTOR, COOLING FAN , LH	1.00	\$543.50	10.00	\$489.15	Replace	Replace	✓	DD
	16363361 60	MOTOR, COOLING FAN , RH	1.00	\$443.40	10.00	\$399.06	Replace	Replace	✓	DD
	164A237 012	TANK, RESERVE SEALED W/O CAP	1.00	\$127.00	25.00	\$95.25	Replace	Replace	✓	BR
	G904047 040	INVERTER WATER PUMP ASSY	1.00	\$432.00	25.00	\$324.00	Replace	Replace	✓	BR
	G922E47 010	HOSE, HV WATER PUMP INLET	1.00	\$37.90	25.00	\$28.43	Replace	Replace	✓	BR
	G125A47 010	COOLER, MOTOR COOLING	1.00	\$249.10	10.00	\$224.19	Replace	Replace	✓	DD
	8211147J 21	WIRE, ENGINE ROOM MAIN	1.00	\$6,138.00	10.00	\$5,524.20	Replace	Replace	✓	BR
	821H247 010	WIRE, AIR CONDITIONER	1.00	\$445.70	10.00	\$401.13	Replace	Replace	✓	BR
	82121472 22	WIRE, ENGINE	1.00	\$2,154.30	10.00	\$1,938.87	Replace	Replace	✓	BR
	28800371 30	BATTERY	1.00	\$1,584.90	10.00	\$1,426.41	Replace	Replace	✓	CRU
Total				29,580.32		18,816.22				

$$\begin{array}{r}
 32,012.43 \\
 + \quad 2,200.00 \\
 + \quad 2,370.00 \\
 \hline
 36,582.43
 \end{array}$$

Steve Chen (LKK Auto)

From: Yeo Poh Suan (Auto Svcs/ARC/ARC/Taxis) <YeoPohsuan@smrt.com.sg>
Sent: Friday, December 06, 2019 9:43 AM
To: Steve Chen (LKK Auto)
Subject: FW: SHB 1046G

Hi Steve,

As per your request.

Regards
Poh Suan

-----Original Message-----

From: Sam Kwok Kok Meng (TPHS/Ops&Maint/Fleet Svr)
Sent: Friday, 6 December 2019 9:39 AM
To: Yeo Poh Suan (Auto Svcs/ARC/ARC/Taxis)
Cc: Lynn Gan Peh Ling (TPHS/Ops&Maint/Fleet Svr); Timothy Yap Thian Woon (TPHS/Ops&Maint/Fleet Svr)
Subject: RE: SHB 1046G

Hi Tuck Foo,

The purchase value for SHB1046G will be \$86,678.91

Thank you.

Best regards,
Sam Kwok
DID : 68662752

-----Original Message-----

From: Yeo Poh Suan (Auto Svcs/ARC/ARC/Taxis)
Sent: 06 December 2019 08:27
To: Sam Kwok Kok Meng (TPHS/Ops&Maint/Fleet Svr) <samkwok@smrt.com.sg>
Cc: Lynn Gan Peh Ling (TPHS/Ops&Maint/Fleet Svr) <LynnGanPehLingYanPeiling@smrt.com.sg>; Timothy Yap Thian Woon (TPHS/Ops&Maint/Fleet Svr) <YapTimothy@smrt.com.sg>
Subject: FW: SHB 1046G

Hi Sam,

Surveyor Mr. Steve from LKK request for the purchase value of SHB1046G (TAX/04/19/2114). Are you able to provide?

Thanks & Regards
Poh Suan

-----Original Message-----

From: Steve Chen (LKK Auto) [mailto:SteveChen@lkkauto.com]

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	5369K
Vehicle Details	
Vehicle No.:	SHB1046G
Vehicle to be Exported:	No
Intended Deregistration Date:	02 May 2019
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS HYBRID 1.8 CVT
Primary Colour:	Maroon
Manufacturing Year:	2017
Engine No.:	2ZRS094855
Chassis No.:	JTDKB3FU303572306
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$29,007.00
Original Registration Date:	10 Oct 2017
First Registration Date:	10 Oct 2017
Transfer Count:	0
Actual ARF Paid:	\$5,000.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	09 Oct 2025
PARF Rebate Amount:	\$3,750.00
Intended COE Rebate Details	
COE Expiry Date:	09 Oct 2025
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$34,052.00
COE Rebate Amount:	\$27,392.00
Total Rebate Amount:	\$31,142.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 02 May 2019

OK