
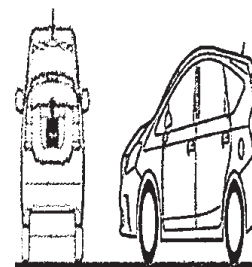


Section A - Accident Details

Registration Number	SHB5999E
Case Reference Number	TAX/05/19/2005
Registration Date	30/10/2013
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS
Name of Driver	AHMAD ZAMANI BIN DAHLAN
Type of Accident	Head to Rear
Accident Date and Time	1/5/2019 4:15 AM
Accident Reported Date and Time	2/5/2019 1:22 PM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	Yes
Towed Back Date and Time	1/5/2019 11:31 AM
Replacement Vehicle issued?	No
Job Card Number	24101316
Special Instruction to ARC, if any	TOWED \$60
Prepared Date and Time	2/5/2019 3:16 PM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

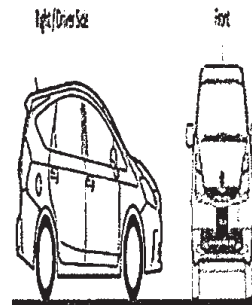

Section B - Summary of Repair Estimates

Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$1,414.00	\$400.00
Total Spray Cost	\$1,694.00	\$500.00
Total Spare Part Cost	\$3,784.25	\$976.31
Total Other Cost	\$1,244.00	\$150.00
TOTAL COST	\$8,136.25	\$2,026.31
Lump Sum Total	\$8,150.00	\$2,050.00 (L/S)
Number of Repair Days	8.0	5.0
Prepared / Adjusted By	Kim Ming Chin	Naz (LKK) / LONPAC
ARC / Surveyor Sign Off Date	06/05/2019 5:05 PM	06/05/2019 3:29 PM
Signature		
Remarks	Supplementary = 2 days	LUMP SUM REPAIR 3 DAYS CHECK ITEMS PHOTOS AFTER REPAIR PHOTOS

Khanchana

Finalized.

- Naz.

24/9/19

Section C - Quotation and Accident Invoice Details

Quotation Number	QN-1909-0229	Invoice Number	
Quotation Date	16.09.2019	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR RR END PANEL	\$200.00	\$100.00
TO REPAIR REAR TAILGATE	\$200.00	\$100.00
TO REPAIR REAR PORTION	\$1,014.00	\$200.00
Total Labour	\$1,414.00	\$400.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY REAR PANEL	\$200.00	\$100.00
TO RESPRAY TAIL GATE	\$378.00	\$200.00
TO RESPRAY REAR BUMPER	\$378.00	\$200.00
TO RESPRAY REAR PANEL	\$180.00	\$0.00
TO RESPRAY TAIL GATE	\$378.00	\$0.00
TO RESPRAY TAILGATE OUTSIDE GARNISH	\$180.00	\$0.00
Total Spray Painting & Panel Beating	\$1,694.00	\$500.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	\$84.00	\$60.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00	\$30.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$200.00	\$0.00
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$30.00
TO TRANSFER REAR TAILGATE MECHANISM	\$120.00	\$0.00
TO REMOVE / REFIT WINDSCREEN	\$240.00	\$0.00
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR	\$120.00	\$0.00
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	\$120.00	\$30.00
TO WASH AND VACUUM	\$60.00	\$0.00
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
Total Other Costs	\$1,244.00	\$150.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		52159-47905	BUMPER REAR	1.00	\$458.60	25.00	\$343.95	Replace	Replace
		52023-12240	BUMPER REINFORCEMENT REAR	0.00	\$205.70	0.00	\$0.00	Replace	Check X
		52576-47020	BUMPER SIDE RETAINER RR/LH	0.00	\$94.80	0.00	\$0.00	Replace	Check X
		52575-47020	BUMPER SIDE RETAINER RR/RH	0.00	\$94.80	0.00	\$0.00	Replace	Not Given X



SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
60 Woodlands Industrial Park E4, Singapore 757705
FAX Number : 63685592
Estimator Telephone Number : 68662623
Accident Reporting Number : 68662672

Date Generated : 23/08/2019

User ID : PohSuan

76087-47020	BUMPER LIP COVER RR/RH	0.00	\$118.10	0.00	\$0.00	Replace	Not Given	X	SVC
76088-47020	BUMPER LIP COVER RR/LH	0.00	\$72.20	0.00	\$0.00	Replace	Not Given	X	SVC
76891-47020	BUMPER LIP REAR	0.00	\$228.90	0.00	\$0.00	Replace	Not Given	X	SVC
	SENSOR REVERSE	0.00	\$180.00	0.00	\$0.00	Replace	Not Given	X	SVC
	PIXEL STICKER	2.00	\$60.00	0.00	\$120.00	Replace	Replace	✓	NK
52016-47030	ARM SUB-ASSY, RR BUMPER LH	0.00	\$139.60	0.00	\$0.00	Replace	Not Given	X	SVC
52015-47050	ARM SUB-ASSY, RR BUMPER RH	0.00	\$139.60	0.00	\$0.00	Replace	Not Given	X	SVC
58308-47011	UNDER COVER SUB-ASSY, RR FLOOR	0.00	\$514.50	0.00	\$0.00	Replace	Not Given	X	SVC
58307-47060	END PANEL	0.00	\$602.10	0.00	\$0.00	Replace	Not Given	X	SVC
	SEALANT SIKAFLEX	0.00	\$37.00	0.00	\$0.00	Replace	Not Given	X	NN
67005-47241	TAILGATE ASY	0.00	\$1,007.90	0.00	\$0.00	Replace	Not Given	X	SVC
76801-47070-B0	TAILGATE OUTSIDE GARNISH	0.00	\$504.90	0.00	\$0.00	Replace	Not Given	X	SVC
75310-47020	EMBLEM REAR	0.00	\$60.30	0.00	\$0.00	Replace	Not Given	X	NN
75374-47051	NAME PLATE (HYBRID)	0.00	\$51.90	0.00	\$0.00	Replace	Not Given	X	NN
75442-47030	NAME PLATE (PRIUS)	0.00	\$60.80	0.00	\$0.00	Replace	Not Given	X	NN
75443-47030	NAME PLATE (TOYOTA)	0.00	\$51.90	0.00	\$0.00	Replace	Not Given	X	NN
	STICKER SMRT LOGO	0.00	\$7.80	0.00	\$0.00	Replace	Not Given	X	NN
	STICKER DECAL 6555 8888	0.00	\$21.60	0.00	\$0.00	Replace	Not Given	X	NN
75574-47020	TAIL GATE DOOR GLASS MOULDING, LH	0.00	\$29.40	0.00	\$0.00	Replace	Not Given	X	NN
75573-47080	TAIL GATE DOOR GLASS MOULDING, RH	0.00	\$29.40	0.00	\$0.00	Replace	Not Given	X	NN
75575-47030	MOULDING BACK WINDOW, LOWER NO.1	0.00	\$29.40	0.00	\$0.00	Replace	Not Given	X	NN
	SEALANT W/SCREEN	0.00	\$37.00	0.00	\$0.00	Replace	Not Given	X	NN
64718-47031B0	END PANEL COVER, DECK TRIM HOLE	0.00	\$46.10	0.00	\$0.00	Replace	Check	X	SVC
64716-47031B0	END PANEL COVER, DECK TRIM, RR	0.00	\$121.10	0.00	\$0.00	Replace	Check	X	SVC
Total			\$5,005.40		\$463.95				

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
		52023-12240	BUMPER REINFORCEMENT REAR	1.00	\$205.70	25.00	\$154.28	Replace	Replace
		52575-47020	BUMPER SIDE RETAINER RR/RH	1.00	\$94.80	25.00	\$71.10	Replace	Replace
			SENSOR REVERSE	1.00	\$180.00	0.00	\$180.00	Replace	Replace
		52016-47030	ARM SUB-ASSY, RR BUMPER LH	1.00	\$139.60	25.00	\$104.70	Replace	Replace
		52015-47050	ARM SUB-ASSY, RR BUMPER RH	1.00	\$139.60	25.00	\$104.70	Replace	Replace
			ANTENNA, ELECTRICAL LOWER REAR	1.00	\$157.40	10.00	\$141.66	Replace	Replace
Total					917.10		756.44		

supplementary

BT
CRK
B&F
BT
BT
CRK

1220.39
- 207

2/5 \$20.00 / 5 DAYS

976.31
+ 400.00
+ 650.00
2026.31

FINALIZED LUMP SUM REPAIR \$2,050.00 / 5 REPAIR DAYS

REQUEST FOR SUPPLYMENT PARTS

Contractor:			
Accident Case Number	TAX/05/19/2005	Date of Collection	1 / 1
Vehicle No	SUB 5999 E	Date of Request	07/05/2019
Vehicle Model	TOYOTA PRIUS	Number of Days to Extend (If any)	3 X 2

S/N	Part Number	Part Description	Quantity	Unit Price
		REAR BUMPER REINFORCEMENT	1m	/ BT
		REAR BUMPER RETAINER RH	1pc	/ CRK
		REVERSE SENSOR	1 SET	/ DEF
		ARM SUB ASSY, REAR BUMPER LH	1pc	/ BT
		ARM SUB ASSY, REAR BUMPER RH	1pc	/ BT
		Labour to repair rear end panel		\$ 200

100

<<<Please submit photographs for damaged parts>>>

I, (Name) _____

(Position) _____

NH

8/5/19

do solemnly and sincerely declare that:- Supplementary Parts are raised for replacement for the aforesaid vehicle.

.....
Signature of person making this declaration
[to be signed in front of an authorised witness]

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff

Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form 22 / PO / WOC / Reservation / Number
Photo Submitted	YES / NO	Date of submission

REQUEST FOR SUPPLYMENT PARTS

Contractor:			
Accident Case Number	TAX/05/19/2005	Date of Collection	/ /
Vehicle No	SHB 5999 E	Date of Request	07/05/2019
Vehicle Model	TOYOTA PRIUS	Number of Days to Extend (If any)	32

S/N	Part Number	Part Description	Quantity	Unit Price
		Labour to SPRAY REAR END PANEL		\$ 200
		Labour to REPAIR TRUNK		\$ 200
		Labour to SPRAY TRUNK		\$ 200
		ANTENNA ELECTRICAL LOWER REAR	1	CRK

100
100
200

<<<Please submit photographs for damaged parts>>>

I, (Name) _____

(Position) _____

do solemnly and sincerely declare that:- Supplementary Parts are raised for replacement for the aforesaid vehicle.

Signature of person making this declaration
[to be signed in front of an authorised witness]

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff

Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form 22 / PO / WOC / Reservation / Number
Photo Submitted	YES / NO	Date of submission

Pg 2/2



Case Details

Case Reference Number : TAX/05/19/2005
 Type of Repair : Accident Repair
 Vehicle Registration Number : S1B5999E

Company Type : SMRT Taxis Pte Ltd
 Estimation ID : EST-6709-ID
 Assigned By : Taxi Claims Manager Team

Insurance Company Name : Longac Insurance Bhd
 Accident Date and Time : 30/04/2019 08:15 PM
 Vehicle Age(In Months) : 67

Documents / Photographs

View Documents / Photographs

Total Documents: 1

Estimation Details

Spares Part's Cost Detail

BOM Type	Coating Type	Portion	Material Number	SMRT Recommendation							Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Surveyor Approval	
				Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)					Repair/Replace	Remarks
One Time Key In	Main			BUMPER REAR	1	464.80	464.80	25.00	343.86		Replace	1	343.86	Replace	cek
One Time Key In	Main			BUMPER REINFORCEMENT REAR	1	266.70	266.70	25.00	154.37		Replace	0	0	Check	? Br
One Time Key In	Main			BUMPER SIDE RETAINER R/L/H	1	94.80	94.80	25.00	71.10		Replace	0	0	Check	? -cek
One Time Key In	Main			BUMPER SIDE RETAINER R/R/H	1	94.80	94.80	25.00	71.10		Replace	0	0	Not Given	} SVL
One Time Key In	Main			BUMPER LIP COVER R/R/H	1	118.10	118.10	25.00	88.57		Replace	0	0	Not Given	
One Time Key In	Main			BUMPER LIP COVER R/L/H	1	72.30	72.30	25.00	54.15		Replace	0	0	Not Given	
One Time Key In	Main			BUMPER LIP REAR	1	226.90	226.90	25.00	171.68		Replace	0	0	Not Given	
One Time Key In	Main			SENSOR REVERSE	1	180.00	180.00	0.00	180.00		Replace	0	0	Not Given	
One Time Key In	Main			PIXEL STICKER	2	60.00	120.00	0.00	120.00		Replace	2	120.00	Replace	~ Fc
One Time Key In	Main			ARM SUB-ASSY, RR BUMPER LH	1	136.80	136.80	25.00	104.70		Replace	0	0	Not Given	} JUL
One Time Key In	Main			ARM SUB-ASSY, RR BUMPER RH	1	136.80	136.80	25.00	104.70		Replace	0	0	Not Given	
One Time Key In	Main			UNDER COVER SUB-ASSY, RR FLOOR	1	514.50	514.50	25.00	386.88		Replace	0	0	Not Given	
One Time Key In	Main			END PANEL	1	602.10	602.10	25.00	451.58		Replace	0	0	Not Given	
One Time Key In	Main			SEALANT SHAKFLEX	1	27.00	27.00	0.00	27.00		Replace	0	0	Not Given	~ N
One Time Key In	Main			TAILGATE ASY	1	1,007.00	1,007.00	25.00	756.92		Replace	0	0	Not Given	} SVL
One Time Key In	Main			TAILGATE OUTSIDE CLARNISH	1	804.93	804.90	25.00	376.87		Replace	0	0	Not Given	
One Time Key In	Main			EMBLEM REAR	1	60.30	60.30	25.00	45.22		Replace	0	0	Not Given	XNN
One Time Key In	Main			NAME PLATE (HYBRID)	1	51.80	51.80	25.00	38.82		Replace	0	0	Not Given	XNN

Total Spares Part Cost 3,973.86

Surveyor Total 463.96

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spares Part Cost 3,179.10

Final Sur Total 371.16

5/6/2019

<https://vacswb.smrt.com.sg/Estimation.aspx>

SMART Recommendation												Surveyor Approval		
BOM Type	Coating Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Disa(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
One Time Key In	Main			NAME PLATE (PRUJ)	1	80.80	80.80	25.00	45.60	Replace	0	0	Not Given	NN
One Time Key In	Main			NAME PLATE (TOYOTA)	1	51.30	51.30	25.00	28.92	Replace	0	0	Not Given	NN
One Time Key In	Main			STICKER SMRT LOGO	1	7.80	7.80	0.00	7.80	Replace	0	0	Not Given	NN
One Time Key In	Main			STICKER DECAL 6658 6658	1	21.80	21.80	0.00	21.80	Replace	0	0	Not Given	NN
One Time Key In	Main			TAIL GATE DOOR GLASS MOULDING, LH	1	25.40	25.40	25.00	22.06	Replace	0	0	Not Given	NN
One Time Key In	Main			TAIL GATE DOOR GLASS MOULDING, RH	1	25.40	25.40	25.00	22.86	Replace	0	0	Not Given	NN
One Time Key In	Main			MOULDING BACK WINDOW, LOWER NO.1	1	25.40	25.40	25.00	22.06	Replace	0	0	Not Given	NN
One Time Key In	Main			SEALANT W/SCREEN	3	37.00	111.00	0.00	111.00	Replace	0	0	Not Given	NN
One Time Key In	Main			END PANEL COVER, DECK TRIM HOLE	1	46.10	46.10	25.00	34.58	Replace	0	0	Check	? X SVL
One Time Key In	Main			END PANEL COVER, DECK TRIM, RR	1	121.10	121.10	25.00	90.82	Replace	0	0	Check	? X SVL
						Total Spare Part Cost	3,873.80			Surveyor Total		463.86		
						Lump Sum Discount (%)	36.00			Lump Sum Dis (%)		20		
						Final Spare Part Cost	3,179.10			Final Sur Total		371.10		

Labour's Cost Detail

S.No.	Coating Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Man	TO REPAIR REAR PORTION	1,014.00	NOT DO	200
Total:			1,014.00	1,014.00	

Body Cost Detail

S.No.	Coating Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Man	TO RESPRAY REAR BUMPER	378.00	200	
2	Man	TO RESPRAY REAR PANEL	180.00	0	CHECK
3	Man	TO RESPRAY TAIL GATE	378.00	0	NN
4	Man	TO RESPRAY TAIL GATE OUTSIDE GARNISH	180.00	0	NN
Total:			1,116.00	200.00	

Other Cost Detail

S.No.	Coating Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TOWING CHARGE	84.00	0	
2	Man	TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	30	
3	Main	TO APPLY RUST-PROOFING ON AFFECTED AREA	200.00	0	NN
Total:			1,244.00	60.00	

<https://vacswb.smrt.com.sg/Estimation.aspx>

5/6/2019

<https://vacswb.smrt.com.sg/Estimation.aspx>

E.No.	Coating Type	Job Scope	SMRT Recommendation(S)	Surveyor Adjustment(S)	Remarks
4	Main	TO CHECK WIRING AND SYSTEM FUNCTION	80.00	30	
6	Main	TO TRANSFER REAR TAILGATE MECHANISM	120.00	0	NN
8	Main	TO REMOVE / REFIT WINDSCREEN	240.00	0	NN
7	Main	TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	0	NN
8	Main	TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	120.00	30	
9	Main	TO WASH AND VACUUM	80.00	0	NN
10	Main	TO REPLACE SUNDRY PARTS	100.00	0	NN
Total:			1,344.00	90.00	

Summary

	Estimator Assessment(S)	Surveyor Assessment(S)
Total Spare Part Detail	3,179.10	371.16
Total Labour Cost	1,014.00	1,014.00
Total Spray Painting	1,116.00	200.00
Other	1,244.00	90.00
Overall Total	6,553.10	1,675.16
Lump Sum Repair Option		✓
Lump Sum Total	6,550.00	1,700.00
Surveyor Approved Amount		1,700.00
No of Repair Days	6	3
Remarks		LUMP SUM REPAIR 3 DAYS CHECK ITEMS PHOTOS AFTER REPAIR PHOTOS
Surveyor Name		Max
Signature		
Survey Date	06/06/2019	

NA 2 LKK
3 DMG,
LIS
CHECK ITEMS PHOTOS
AFTER REPAIR PHOTOS

<https://vacswb.smrt.com.sg/Estimation.aspx>

LIX Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Authorised by Repairer
Signature:
Date: