

ASSIGNMENT BY:

REF:

CC3/A1619008293/Avd322

ASSIGNMENT

From: Adrian P. Menin

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No. 2100510352-01

Claims No.

Sum Insured:

Excess: 0

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value:

IDAC / Accident Report: 26 Consistent? : Yes or No

GIA / PR Seen: 24 Consistent? : Yes or No

Est. Repairs: 30 days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: Person Contacted:

Veh No: SPY6818?

Yr Regn: 2017 June

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Audi A5 SB.

c.c. 1984

Colour: Grey.

A/C: Insured / Std / Nil / NA

Sp. Reading: 149234 T/Radio: Insured / Std / Nil / NA

Eng/No:

C/No: WAU222 F55HA 033826.

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / SR / STD A/Rim or

Tyre Size: F: 245/40R18.

R: 245/40R18.

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU (PIR) SUMI / TOYO / YOKO or

Front

Rear

R/Bal. 06 mm R/Bal. 06 mm

L/Bal. 06 mm L/Bal. 06 mm

D.O.A. 7/5/19 D.O.I. 09/05/19.

Sunray held at: Premium.

Des. of Damages: (Frt) / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1/11/19

Check with Adrian. 26 days get approval first

16/11/19

Final fig \$56,728.72 (Red 51,786.77, 48%) confirmed by email

RECEIVED 08 JAN 2020

View Received Message

This mail is associated with :

***SDY6818P (3703182905SG)**

OD

May 7 2019 9:55AM

[LEONG TUCK FOOK]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 13/11/2019 21:04 PM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$56728.72) - SDY6818P - Claim Handler: Chan, Yoke Shi

Approved:56728.72.

DOCUMENTS SUMMARY

There are no documents.

Veron Chen (LKKAUTO)

From: Veron Chen (LKKAUTO)
Sent: Friday, 21 June 2019 4:00 PM
To: Claims Dept; SUR
Cc: (nora.khai@premiumauto.com.sg)
Subject: RE: OD CLAIMS FOR SDY 6818 P-DOA: 7/5/2019
Attachments: SUPP.pdf

Dear George,

Refer attach.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Veron Chen (LKKAUTO)
Sent: Monday, 13 May 2019 10:04 AM
To: Claims Dept <claims@premiumauto.com.sg>; SUR <sur@lkkauto.com>
Cc: (nora.khai@premiumauto.com.sg) <nora.khai@premiumauto.com.sg>
Subject: RE: OD CLAIMS FOR SDY 6818 P-DOA: 7/5/2019

Dear George,

As instructed by our client , please proceed to repair the insured vehicle **SDY 6818P (Excess S0/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

NOTE: Repair Cost Not exceeding part by part S75,000/-.

All awarded items are to be backed with clear photographs

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims Dept <claims@premiumauto.com.sg>
Sent: Thursday, 9 May 2019 4:52 PM
To: assignments <assignments@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: 'Claims' <claims@premiumauto.com.sg>
Subject: OD CLAIMS FOR SDY 6818 P (VEHICLE IS IN WORKSHOP)

Dear all,

Kindly assist in OD approval for above mentioned vehicle.

Attached is the necessary documentation for your kind reference.

Do take note, video footage were uploaded in merimen.

Thank You.

Best Regards,
George Wong
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

View Received Message

This mail is associated with :

***SDY6818P (3703182905SG)**

OD

May 7 2019 9:55AM

[LEONG TUCK FOOK]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 21/06/2019 14:55 PM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$82616.00) - SDY6818P - Claim Handler: Chan, Yoke Shi

Approved:82616.00.

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To:	AIG Asia Pacific Insurance Pte. Ltd. AIG Building 78 Shenton Way #08-16 Singapore 079120	From:	LKK Auto Consultants Pte Ltd 51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park Singapore 408933
-----	---	-------	---

Attn: Chan, Yoke Shi Date: 17 Jun 2019

Preliminary Advice

Vehicle No	: SDY6818P	Accident Date	: 07/05/2019
Make	: AUDI A5	Policy No.	: 2100510352-01
Assignment Date	: 10/05/2019	Excess	: S\$0.00
Date of Inspection	: 09/05/2019	Est. Duration of Repair	: 21.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (UBI) 55 UBI ROAD 1 SINGAPORE 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	107,682.00	(incl.supplementary \$1083.00)
Revised Amount	:S\$	59,772.00	(incl.supplementary \$1083.00)
Check Items (Estimated)	:S\$	23,927.00	
Total	:S\$	83,699.00	
Lump Sum Repair	:S\$		

Total Loss Consideration

New for Old Value	:S\$	200,000.00	
Pre-Accident Value	:S\$	150,000.00	
COE / PARF Rebate	:S\$	70,257.00	
Salvage Value	:S\$		
Margin for Repair (New for Old Value)	:S\$	129,000.00	
Margin for Repair (Pre-Accident Value)	:S\$	79,743.00	

Remarks

☐	The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
☐	The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
☒	Other comments :Repair limit at \$82,616.00.Kindly approved on the supplementary.

Veron Chen (LKKAUTO)

From: Veron Chen (LKKAUTO)
Sent: Monday, 13 May 2019 10:04 AM
To: Claims Dept; SUR
Cc: (nora.khai@premiumauto.com.sg)
Subject: RE: OD CLAIMS FOR SDY 6818 P-DOA: 7/5/2019

Dear George,

As instructed by our client , please proceed to repair the insured vehicle **SDY 6818P (Excess S0/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

NOTE: Repair Cost Not exceeding part by part \$75,000/-.

All awarded items are to be backed with clear photographs

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims Dept <claims@premiumauto.com.sg>
Sent: Thursday, 9 May 2019 4:52 PM
To: assignments <assignments@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: 'Claims' <claims@premiumauto.com.sg>
Subject: OD CLAIMS FOR SDY 6818 P (VEHICLE IS IN WORKSHOP)

Dear all,

Kindly assist in OD approval for above mentioned vehicle.

Attached is the necessary documentation for your kind reference.

Do take note, video footage were uploaded in merimen.

Thank You.

Best Regards,
George Wong
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.

If you have received it in error, please notify us immediately by reply email and then delete this message from your system.

Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you.

View Received Message

This mail is associated with :

***SDY6818P (3703182905SG)**

OD

May 7 2019 9:55AM

[LEONG TUCK FOOK]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 10/05/2019 16:39 PM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$82616.00) - SDY6818P - Claim Handler: Chan, Yoke Shi

Approved:82616.00:To commence repairs once policy coverage is in force. Not to exceed repair limit and all awarded items are to be backed with clear photographs

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To:	AIG Asia Pacific Insurance Pte. Ltd. AIG Building 78 Shenton Way #08-16 Singapore 079120	From:	LKK Auto Consultants Pte Ltd 51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park Singapore 408933
-----	---	-------	---

Attn: Loo, Tong Shing

Date: 10 May 2019

Preliminary Advice

Vehicle No	: SDY6818P	Accident Date	: 07/05/2019
Make	: AUDI A5	Policy No.	: 2100510352-01
Assignment Date	: 10/05/2019	Excess	: S\$0.00
Date of Inspection	: 09/05/2019	Est. Duration of Repair	: 21.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (UBI) 55 UBI ROAD 1 SINGAPORE 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	106,599.00
Revised Amount	:S\$	58,689.00
Check Items (Estimated)	:S\$	23,927.00
Total	:S\$	82,616.00

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	200,000.00
Pre-Accident Value	:S\$	150,000.00
COE / PARF Rebate	:S\$	70,257.00
Salvage Value	:S\$	
Margin for Repair (New for Old Value)	:S\$	129,743.00
Margin for Repair (Pre-Accident Value)	:S\$	79,743.00

Remarks

☐ The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.

☐ The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.

☒ Other comments : Please take note on the margin for Repair New for Old and Pre-Accident Value. Kindly advised.

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	6803Z
Vehicle Details	
Vehicle No.:	SDY6818P
Vehicle to be Exported:	No
Intended Deregistration Date:	10 May 2019
Vehicle Make:	AUDI
Vehicle Model:	A5 SB 2.0 TFSI S TRONIC (DESIGN)
Primary Colour:	Grey
Manufacturing Year:	2017
Engine No.:	CVK034720
Chassis No.:	WALJZZF55HA033826
Maximum Power Output:	140.0 kW (187 bhp)
Open Market Value:	\$39,466.00
Original Registration Date:	24 Jun 2017
First Registration Date:	24 Jun 2017
Transfer Count:	0
Actual ARF Paid:	\$42,253.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	23 Jun 2027
PARF Rebate Amount:	\$31,689.00
Intended COE Rebate Details	
COE Expiry Date:	23 Jun 2027
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$47,501.00
COE Rebate Amount:	\$38,568.00
Total Rebate Amount:	\$70,257.00

The information contained herein is correct as at 10 May 2019

OK

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	6803Z
Vehicle Particulars	
Vehicle No.:	SDY6818P
Vehicle to be Exported:	Yes
Intended Deregistration Date:	09 May 2019
Vehicle Make:	AUDI
Vehicle Model:	A5 SB 2.0 TFSI S TRONIC (DESIGN)
Primary Colour:	Grey
Manufacturing Year:	2017
Engine No.:	CVK034720
Chassis No.:	WAUZZZF55HA033826
Maximum Power Output:	140.0 kW (187 bhp)
Open Market Value:	\$39,466.00
Original Registration Date:	24 Jun 2017
First Registration Date:	24 Jun 2017
Transfer Count:	0
Actual ARF Paid:	\$42,253.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	23 Jun 2027
PARF Rebate Amount:	\$31,689.00
Intended COE Rebate Details	
COE Expiry Date:	23 Jun 2027
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$47,501.00
COE Rebate Amount:	\$38,000.00
Total Rebate Amount:	\$69,689.00

The information contained herein is correct as at 09 May 2019

OK

500+ dealers
competed to
buy my car!



- Sell ur Car for More Cash
- Highest Price or Get \$100 Free
- Get Paid Now, Handover Later

SELL YOUR CAR



► **SEARCH** Audi A5 Sportback Min Price to No Max Depreciation Vehicle Type Category  **Search** [View All](#) [Advanced Search](#)

Home > New Cars > Audi A5 Sportback Search Results:

► Audi A5 Sportback Search Results (1 vehicles)

Sort by [Model \(Ascending\)](#)

15 results/page

Car Model	Price	Dealer	Built in	User Rating
Audi A5 Sportback		Premium Automobiles	Germany	★★★★☆ 1 User Review
 ☐ 2.0 TFSI S tronic Design (A)	\$204,900 \$18,100 /yr	• 17.8km/l 188hp 7-speed (A) S tronic		Editor's Review
☐ 2.0 TFSI qu S tronic Sport (A)	\$271,251 \$23,700 /yr	• 15.6km/l 248hp 7-speed (A) S tronic		

Car Model	Price	Dealer	Built in	User Rating
				15 results/page

2 result(s) for Audi A5 Sportback models no longer being sold by local distributors

[View all past Audi cars](#)



Audi A5 Sportback
(2012-2016)



Audi A5 Sportback
(2010-2012)

[Home](#) | [New Cars](#) | [Used Cars](#) | [Sell My Car](#) | [Directory](#) | [Products](#) | [Insurance](#) | [Article](#) | [Forum](#) | [Resources](#)

sgCarMart is the number one car site for buying Singapore cars, including new cars, parallel import cars & used cars. View all new cars, such as Toyota, Honda, Nissan, Volkswagen, Mitsubishi & more. We have new car dealers comprising parallel importers, authorized car distributors, and used car dealers. Find new car models, new car launches, new car promotions, new car reviews, latest car news & car advice. Also join our car discussion and forum discussions for car reviews, motor news & motoring guides. Meet our partner sites who have job openings for Singapore jobs, Singapore classifieds, motor and real estate properties for sale.

All prices and other information displayed on sgCarMart.com are gathered from sources and based on algorithms that are believed by sgCarMart.com to be reliable, but no assurance can be given that this information is accurate, complete or current. sgCarMart.com does not assume any responsibility for errors or omissions or warrant the accuracy of this information.

Follow sgCarMart.com



[About Us](#) | [Careers](#) | [Contact Us](#) | [Sitemap](#) | [Terms of Service](#) | [Privacy Policy](#) | [Personal Data Protection Statement](#)

©2004-2019 sgCarMart. All rights reserved.

CHEAPEST CAR INSURANCE RENEWAL

Compare
10+ Insurers

GET A CHEAPER QUOTE NOW!



Post an Advertisement
Sell it yourself! Advertise it at just
\$58 until it's SOLD!

[Post an Ad](#) | [Advertiser Login](#) | [Ways of Selling](#)

New 10 Years Coe Renewal Toyota Wish 1.8A



2.98% P.A. \$0 Admin Fees @ Gv
Finance. 2 Years Warranty.
Monthly From \$788
Gv Credit. Hb Ltd. - StarAd



ABWIN

ONE-STOP


[Browse by Category](#) | [Save Search](#) | [Print](#) | [Back \(1 2 3 4 \) Next >](#) | [Sort by Date Posted](#) | [20 results/page](#)

65 vehicles

Search

audi a5

[Advanced Search](#)[Search](#)[View All](#)
[Make](#) | [Model](#) | [Price](#) | [Depreciation](#) | [Reg Date](#) | [Eng Cap](#) | [Mileage](#) | [Veh Type](#) | [Status](#)

Search Selection	audi a5	Any	Any	Any	Any	Any	Any	Available
------------------	---------	-----	-----	-----	-----	-----	-----	-----------



☐ Audi A5 Sportback 2.0A TFSI
S-tronic Design

\$160,800

\$15,690 /yr

02-Feb-2018

1,984 cc

30,000 km

Luxury

Available

5 Years Agent Warranty. Upgraded 20" Sports Rims With Pirelli P-Zero Tyres In Mar 2019, Else Stock Condition. Like New, 100% Accident Free. Sheltered Park. Highest Trade-In. Std Bank Loan, Balloon Loa...

[Posters: 18-Apr-2019](#) | [Tags: 2018 Audi A5, 2018 audi a5, Audi A5, audi a5, Audi A5, a5, Used A-a5](#)



☐ Audi A5 Coupe 2.0A TFSI S-
tronic Design

\$165,999

\$16,080 /yr

26-Feb-2018

1,984 cc

5,000 km

Sports

Available

Audi Warranty Till Feb 2023. Come And Check Out This Smart Looking Brown On Interior A5 Before It Is Sold. Call Our Friendly Sales Consultant Now!

Premium Automobiles

[Posters: 14-Apr-2019](#) | [Tags: 2018 Audi A5, 2018 audi a5, Audi A5, audi a5, Audi A5, a5, Used Audi](#)



☐ Audi A5 Coupe 2.0A TFSI S-
tronic Design

\$168,999

\$16,260 /yr

27-Mar-2018

1,984 cc

2,218 km

Sports

Available

Car Used For Audi Events! Extremely Low Mileage! 5 Years Audi Agent Warranty Till March 2023! Fully Audi Agent Servicing Since Day One! Lowest Bank Interest Rate 2.48%! Showroom Condition! Superb Tip ...

Premium Automobiles

[Posters: 26-Apr-2019](#) | [Tags: 2018 Audi A5, 2018 audi a5, Audi A5, audi a5, Audi A5, a5, Used Audi](#)



☐ Audi A5 Coupe 2.0A TFSI
Quattro S-tronic

\$209,999

\$19,910 /yr

28-Mar-2018

1,984 cc

4,000 km

Sports

Available

Audi Agent Warranty Till March 2023! Full Agent Serviced! Please Contact Our Friendly Sales Consultant Now!

Premium Automobiles

[Posters: 26-Apr-2019](#) | [Tags: 2018 Audi A5, 2018 audi a5, Audi A5, audi a5, Audi A5, a5, Used Audi](#)

[Car Buying](#)[Car Selling](#)[Car Ownership](#)[Car Aftermarket](#)[On The Move](#)[Lifestyle](#)

SGC
Buying a pre-owned car, but
Unsure of its Condition?
Get...



☐ Audi A5 Sportback 2.0A TFSI
S-tronic Design

\$170,000

\$15,520 /yr

22-Oct-2018

1,984 cc

8,200 km

Luxury

Available

5 Years Warranty By Agent, 3 Years Free Servicing By Agent. Accident Free. Flexible Loan Available If Needed, Fully Serviced At Agent. Brand New Condition. Features Include Virtual Cockpit, Electric/M...

[Posters: 30-Apr-2019](#) | [Tags: 2018 Audi A5, 2018 audi a5, Audi A5, audi a5, Audi A5, a5, Used Audi](#)

Save this search criteria, to get email alerts whenever a match is found.

[Save Search](#)
[Make](#) | [Model](#) | [Price](#) | [Depreciation](#) | [Reg Date](#) | [Eng Cap](#) | [Mileage](#) | [Veh Type](#) | [Status](#)
For old advertisements, view [Expired ads](#)[Back \(1 2 3 4 \) Next >](#)[20](#) results/page

AUDI AUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder : LEONG TUCK FOOK
Period of Insurance : 24 Jun 2018 To 23 Jun 2019
Engine No. : CVK034720
Chassis No. : WAUZZZF55HA033826

Vehicle No. : SDY6818P
Policy No. : 2100510352-01
Endorsement No. :
Issued Date : 22 May 2018

ABOUT THE COVER

Make/Model : AUDI A5 Sportback 2.0TFSI S Tronic (Design)
Engine Capacity/Tonnage : 1,984.00 CC **Sum Insured** : Market Value **First Year of Registration** : 2017
Driver Restriction : NA **Off Peak Car** : No **Insuring with COE/PAF** : Yes

Person or Classes of Persons Entitled to Drive* :

a) The Policyholder
 b) Any other person who is driving on the Policyholder's order or with his/her permission.
 This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDR") if You are or Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition

Limitation as to use* :

Use only for social, domestic and pleasure purposes and for the Policyholder's business. This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1800cc - 2000cc Optional

* Limitations rendered imperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

EXCESS

Section 1
 Fire - \$0 Own Damage - \$1600 Theft - \$0 Flood Cover - \$0

Section 2
 Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

LEONG TUCK FOOK - \$1600 (Own Damage)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

1. Audi Customer Service Center Add: 55 Ubi Road 1 Singapore 408599 63552323

For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.com.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: DBS BANK LTD

We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles(Third Party Risks and Compensation) Act (Cap. 189), Part IV of the Road Transport Act, 1987 (Malaysia) and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia).

0504125201

PREMIUM LEASING - DL
 281 ALEXANDRA ROAD AUDI CUSTOMER SERVICE CENTRE
 SINGAPORE 159938

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

Signature

AIG Asia Pacific Insurance Pte. Ltd.
 AUTHORISED REPRESENTATIVE

SSR/US

What can the 24-hour AIG Auto Emergency Hotline provide for you?

- Immediate assistance after an accident
- Emergency breakdown service
- Towing service (accident or non-accident related)
- Advice on Motor Claims procedures
- Medical Referral Assistance

If no one is injured in the accident:

- You are not required to make any police report.
- Record vehicle number, name and address, insurance company and policy number of the other driver(s) and vehicle(s).
- Collect details (name, address and contact number) of witnesses and/or try to take photographs of the scene of the accident.
- Report the accident to us with your accident vehicle (whether damaged or not) via our approved reporting centres or authorised repairers within 24 hours or the next working day of the accident.

If the accident involves injuries or damage to government property & vehicles, foreign registered vehicles or non-injury hit & run case:

- Report the accident to the police, providing full details of the circumstances of the accident.
- Record vehicle number, name and address, insurance company and policy number of the other driver(s) and vehicle(s), if applicable.
- Collect details (name, address and contact number) of witnesses and/or try to take photographs of the scene of the accident.
- Report the accident to us with your accident vehicle (whether damaged or not) via our approved reporting centres or authorised repairers within 24 hours or the next working day of the accident.

What should I do in the event of an accident?

- Keep calm and move your car to a safe place.
- Do not admit or discuss fault or blame with the other party(ies).
- Report the accident to us with your accident vehicle (whether damaged or not) via our approved reporting centres or authorised repairers within 24 hours or the next working day of the accident.
- Submit Writ/Summons/Correspondences from third party(ies) to AIG immediately.

LOSS OF USE CAR REPLACEMENT BENEFIT

Applicable only if this benefit is included in your motor insurance. Please refer to your Policy Schedule for details. Policy terms and conditions apply. Please call our customer service hotline number **(65) 6419-3000** for assistance.

The Certificate of Insurance (CI) should be produced without demand when collecting the Rental Car and the Rental Car Company reserves the right to verify the identity of the holder. The CI is the property of AIG and its use is subject to the terms and conditions contained in the Loss of Use Endorsement under the policy issued to the policyholder.

Steps to activate Loss of Use Car Replacement Benefit and Important Information

1. To activate your loss of use car replacement, please contact the Rental Car Company (listed below) after filing/reporting your accident claim.
2. Your rental car will be made available within **5** working hours of activation with the Rental Car Company.
3. At the time of collection of the Rental Car, the **original** insurance policy and schedule issued by AIG, a copy of the Accident Report from **Audi Customer Service Centre** must be produced.
4. The number of days is based on the period your vehicle is in the repair workshop unless the number of days of loss of use entitlement is stated in the Policy.
5. Rental cars are strictly for use in Singapore only.
6. Extension of rental beyond repair period approved by AIG surveyor will be chargeable by the Rental Car Company on per day basis.
7. Upgrade of Rental Car is available upon request subject to additional charges by the Rental Car Company.

Rental Car Company: Popular Rent A Car Pte. Ltd.

Activation Hotline: 67428888

501 Guillemard Road Singapore 399840

Operation Hours: Monday to Friday: 9am to 6pm Saturday (Half Day): 9am to 4pm

*The Rental Car Company's Terms & Conditions apply (i.e., refundable security deposit, excess liability for the Rental Car, Collision Damage Waiver, etc.).

IMPORTANT NOTICE

If you sell your motor vehicle, this Notice is **IMPORTANT** and **MUST** be complied with. Policyholders are hereby warned that under the Motor Vehicles (Third Party Risks and Compensation) Act (Cap.99), it shall be unlawful for any person to use or cause or permit any other person to use a motor vehicle without a valid policy of insurance under the Act.

The Policyholder is further warned that on the sale of a motor vehicle, they must surrender the Certificate of Insurance and the Policy to the insurance company. If the Certificate of Insurance has been lost or destroyed, a Statutory Declaration to that effect must be made. Failure to comply with this obligation is an offence under the Motor Vehicles (Third Party Risks and Compensation) Act (Cap.88).

This Policy will cease to be valid once the motor vehicle has been sold to another person unless the transfer of interest has been duly notified to and agreed to by the insurance company concerned. If the insurance company agrees to cover the new owner, they will issue a new Certificate of Insurance in the new owner's name. The premium chargeable may vary according to the new owner's profile.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	07/05/2019 16:37
Date Of Accident	07/05/2019 09:55
Exact Location Of Accident	ALONG CLEMENCEAU AVE NORTH ROAD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SDY6818P
Insured/Policyholder	
Name Of Registered Owner	LEONG TUCK FOOK
NRIC No	S2586803Z
Email Address	LEONGEDWIN@YAHOO.COM.SG
Mobile Phone No	(LOCAL) +65-90186818
Alternative Phone No	OTHERS-90186818

Vehicle Particulars

Manufacturer	AUDI
Model	A5 SPORTBACK 2.0 TFSI
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	2100510352-01
Cover Note Number	

Driver

Name of Driver	LEONG TUCK FOOK
NRIC No	S2586803Z
Date Of Birth	14/07/1964
Occupation	INDOOR
Date Of Driving Pass	19/03/1990
Driving Experience	29 YEARS AND 1 MONTH
Gender	MALE
Mobile Number	(LOCAL) +65-90186818
Fax Number	
Contact Number	OTHERS-90186818
EMail Address	LEONGEDWIN@YAHOO.COM.SG

Address	BLK 332 TAMPINES STREET 32 #09-548
Postcode	520332
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - MAJOR/MINOR RD
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

AS I WAS TRAVELLING DOWN CLEMENCEAU AVE NORTH. DRY ROAD, CLEAR DAY, TRAFFIC MEDIUM. SPEED APPROXIMATE 20-30 KM/HR. A CAR (TOYOTA CAMRY) SLG2109D, CAME OUT FROM THE SIDE MINOR ROAD (WINDSTEDT ROAD) MAKE CONTACT WITH THE FRONT LEFT SIDE OF MY VEHICLE (SDY6818P). DAMAGE WERE SEVERE, BOTH CARS WERE TOWED AWAY.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SLG2109D
Vehicle Make/Model/Colour	TOYOTA CAMRY
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	TAN SHENG YANG
NRIC/Passport Number	S8850704E
Contact Number	
Address	
Postcode	
Insurance Company Name	AXA INSURANCE PTE LTD
Nature Of Damage	
No. Of Passenger (Including Driver)	

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all Insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated; or
 - (ii) for complying with requirements under any regulations, laws or court orders.



Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:




Reporting Centre Personnel's Signature

Name: Wahid R. Khan 25/05/2024
NIC/ID No: 97727195X

Sketch Plan #2

SKETCH PLAN

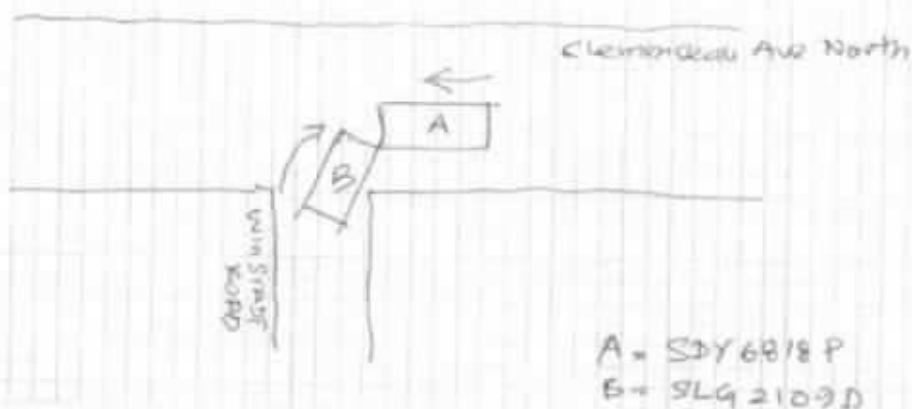

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

As I was travelling down Clemence Ave North, Dry Road clear day, traffic medium, speed approximate 20-30 km/h.

Acar (Toyota Camry) SLG 2109D, came out from the side minor road (Winstead Road) and make contact with the front left side of my vehicle (SPY 6818P)

Damage were severe, both car were towed away.

DECLARATION

I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature
Date & Time:

Driver's Signature
(if driver is not the policyholder)
Date & Time:


Reporting Centre Personnel's Signature

Name: VANDU KAMATH Sankar, Sany
NRECTION No: 6098745A

Accident Photo



Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0585/2019/DY/TF
Date : 7-May-19

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr. Leong Tuck Fook
Address : Blk 332 Tampines Street 32
#09-548
Singapore 520332
Telephone : HP +65 90186818
Type of Claim : Own Damage Claims
Policy No. : 2100510352-01
Vehicle No : **SDY 6818 P**
Model Code : Audi A5 SportBack 2.0 TFS
Model / Year : Jun-17
Engine No : CVK 034720
Chassis No : WAUZZZF55HA033826
Mileage : -
Date In : 7-May-19
Liability : -
Excess Cost : -
Estimated By : Allan Wu
Accident Date : 7-May-19
Place of Accident : Along Clemenceau Ave North Rd

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SDY 6818 P

S/N	Nature of Jobs			Estimated Charges		
1	To tow and recover vehicle from scene of accident.	S/N	AIG			
2	To carry out first measurement test on car o-liner	S/N	\$	800.00	?	X
3	To remove, check and reinstall front wire harness for headlights, horns, outside temperature sensor, headlight washer assy and front parking aid.	S/N	\$	480.00	✓	✓
4	To remove and renew aircon condenser, charged air cooler, radiator. Check electrical fans and control unit. Pressurise cooling system. To carry out vacuum and regas.	S/N	\$	1,200.00	✓	✓
5	To remove centre console, instrument panels and clusters. Renew dashboard, both frontal airbags, slip ring. Transfer old fittings. Renew seat belts and control unit, pillar trims, roof lining and both curtain air bags.	S/N	\$	3,600.00	✓	✓
SUB-TOTAL LABOUR CHARGES			:	\$	6,080.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

SDY 6818P

Estimated Labour Charges for Accident Vehicle SMD-8483-L

S/N	Nature of Jobs	Estimated Charges
6	To remove and reinstall engine assy with gearbox assy to facilitate car o-liner repairs.	S/N \$ 2,800.00 ? X
7	To remove and reinstall front suspension assy with subframe to facilitate car o-liner repairs. Inspect for damages and renew if necessary.	S/N \$ 2,400.00 ? X
8	To place vehicle on car o-liner.	S/N \$ 1,800.00 ? X
9	To dismantle both front door panel trims. To remove and and reinstall both wing mirror assy.	S/N \$ 600.00 X
10	To dismantle and renew front bumper, bonnet, lhs front fender, both headlights. To repair lhs upper A-pillar. Cut out and reweld lhs fender support and closing element. Align both front chassis frames to specification of origin. Renew front lock carrier and align to position. Re-organise front crash management components. Reinstall all parts removed.	\$ 11,600.00 4750 4000. without chassis Repairs.
SUB-TOTAL LABOUR CHARGES		: \$ 25,280.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SDY 6818 P

S/N	Nature of Jobs	Estimated Charges
11	To respray front bumper, both front fenders, bonnet, both upper A-pillar, hinges, engine compartment, lhs front fender top support and both front doors. To carry out joint sealant work and stone chip treatment.	\$ 9,500.00
12	To carry out wheel alignment.	S/N \$ 240.00
13	To carry out diagnostic check.	S/N \$ 384.00
TOTAL LABOUR CHARGES		: \$ 35,404.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDY 6818 P

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	FRONT BUMPER <i>Distorted</i>	\$ 2,073.00	✓ 1658.40
2	FRONT BUMPER FIXING PARTS <i>Not Nec.</i>	\$ 368.00	✓ X
3	FRONT BUMPER GRILLE - CENTER <i>new</i>	\$ 178.00	✓
4	FRONT BUMPER SECURING STRIP <i>new</i>	\$ 64.00	✓
5	FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE <i>could</i>	\$ 207.00	✓ 165.60
6	FRONT BUMPER SPOILER <i>new</i>	\$ 489.00	✓
7	FRONT BUMPER AIR GUIDE - LH <i>Distorted</i>	\$ 56.00	✓ 44.40
8	RADIATOR GRILLE <i>could</i>	\$ 2,131.00	✓ 1704.80
9	RADIATOR GRILLE SENSOR SUPPORT <i>new</i>	2 \$ 96.00	✓ 75.52
10	RADIATOR GRILLE COVER - UPPER <i>new</i>	\$ 174.00	✓ 138.80
11	FRONT BUMPER AIR GUIDE GRILLE - LH / RH <i>LH Distorted</i>	\$ 862.00	✓ 344.40
12	FRONT BUMPER CARRIER <i>new</i>	\$ 733.00	✓ 586
13	FRONT BUMPER BRACKET - LH <i>new</i>	\$ 195.00	✓ 156
14	FRONT BUMPER GUIDE SECTION - LH <i>new</i>	\$ 33.00	✓ 26.08
15	FOAM FILLER PIECE - LH / CENTRE <i>Distorted</i>	2 \$ 129.00	✓ 103.12
16	FRONT BUMPER TOP COVER <i>new</i>	\$ 116.00	✓ 92.40
17	CAUTION STICKER <i>3 new</i>	\$ 13.00	✓ 9.76
18	A/C STICKER	\$ 7.00	✓ 5.12
19	LOCK CARRIER BRACKET <i>new</i>	\$ 125.00	✓ 100
20	FRONT BUMPER SUPPORT - LH / RH <i>new</i>	\$ 52.00	✓ 40.64
SUB-TOTAL SPARE PARTS		\$ 8,101.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDY 6818 P

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
21	FRONT BUMPER SENSOR <i>engd</i>	2 \$	462.00 ✓ 365.60
22	FRONT BUMPER SENSOR SEAL RING <i>new</i>	\$	12.00 ✓ 10.24
23	FRONT BUMPER WIRING SET <i>Not Nec</i>	\$	470.00 ? X
24	HORN - HIGH TONE <i>engd</i>	\$	37.00 ✓ 29.30
25	HORN BRACKET <i>Not Nec</i>	\$	26.00 ✓ X
26	FRONT FENDER - LH <i>Distorted</i>	\$	968.00 ✓ 774.40
27	FRONT FENDER ATTACHMENT PART <i>not Nec</i>	\$	48.00 ✓ X
28	FRONT FENDER CLOSING ELEMENT - LH	\$	68.00 ✓ 52.76
29	FRONT FENDER BRACKET - LH <i>engd</i>	\$	32.00 ✓ 25.30
30	FRONT FENDER BRACE - LH	\$	107.00 ✓ 85.60
31	FRONT FENDER DEFORMATION BRACKET - LH <i>engd</i>	\$	45.00 ✓ 35.60
32	FRONT WHEEL HOUSING LINER - LH <i>engd</i>	\$	256.00 ✓ 204.80
33	FRONT WHEEL HOUSING LINER ATTACHMENT <i>Not Nec</i>	\$	82.00 ? X
34	FRONT WHEEL SPOILER - LH <i>engd</i>	\$	66.00 ✓ 52.32
35	FRONT WHEEL SPOILER TRIM - LH <i>engd</i>	\$	32.00 ✓ 25.24
36	FRONT FENDER STONE CHIP GUARD - LH <i>new</i>	\$	46.00 ✓ 36.64
37	BONNET <i>Distorted</i>	\$	2,602.00 ✓ 2081.60
38	BONNET ATTACHMENT PARTS <i>Not Nec</i>	\$	111.00 ? X
39	BONNET IMPACT PROTECTION <i>new</i>	3 \$	75.00 ✓ 59.44
40	BONNET SOUND ABSORBER <i>crumpled</i>	\$	311.00 ? 248.80
SUB-TOTAL SPARE PARTS		\$	5,856.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDY 6818 P

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
41	FRONT FENDER TOP COVER - LH <i>new</i>	\$ 32.00	✓ 25.44
42	FRONT HEADLIGHT TOP COVER - LH <i>new</i>	\$ 14.00	✓ 11.04
43	FRONT FENDER COVER - LH <i>new Not New</i>	\$ 66.00	? X
44	BONNET GAS FILLED STRUT <i>3 the new</i>	2 \$ 217.00	? X
45	BONNET STRIKER - LH / RH <i>Best.</i>	\$ 92.00	? 72.48
46	BONNET HINGE - LH / RH <i>Best</i>	\$ 762.00	? 1649.60
47	BONNET LOCK <i>Turned</i>	2 \$ 391.00	✓ 312.80
48	BONNET BOWDEN CABLE <i>Turned</i>	2 \$ 106.00	✓ 83.36
49	BONNET BOWDEN CABLE COVER <i>Not New</i>	\$ 9.00	? X
50	BONNET RELEASE LEVER <i>Not New</i>	\$ 12.00	? X
51	BONNET LOCK CABLE <i>Not New</i>	\$ 67.00	? X
52	PLENUM CHAMBER COVER <i>new</i>	\$ 89.00	✓
53	HEADLIGHT - LH / RH <i>LH Smashed</i>	1 \$ 14,408.00	7204. 5763.20
54	HEADLIGHT POWER MODULE - LH <i>Replaced</i>	\$ 693.00	? 554
55	HEADLIGHT CONTROL UNIT - LH <i>Replaced</i>	\$ 685.00	? 548
56	HEADLIGHT HEAT SINK - LH <i>Replaced</i>	\$ 1,053.00	? 842.40
57	HEADLIGHT VENTILATION HOSE - LH <i>Int.</i>	\$ 32.00	? 25.36
58	HEADLIGHT LIFT CYLINDER - LH <i>Smashed</i>	\$ 181.00	✓ 144.80
59	HEADLIGHT LIFT CYLINDER HOSE <i>Int</i>	2 \$ 113.00	✓ 59.12
60	HEADLIGHT LIFT CYLINDER BRACKET - LH <i>Best</i>	\$ 13.00	✓ 10.40
SUB-TOTAL SPARE PARTS		\$ 19,035.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved.

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDY 6818 P

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
61	WATER RESERVOIR <i>Not Nec</i>	\$ 130.00	? X
62	WATER RESERVOIR PUMP <i>Not Nec</i>	2 \$ 265.00	? X
63	LOCK CARRIER <i>Bent</i>	\$ 928.00	? 742
64	A/C CONDENSER <i>Bent</i>	TBC	? 454
65	REFRIGERANT LINE <i>Not Nec</i>	3 \$ 688.00	? X
66	RADIATOR <i>Bent</i>	\$ 676.00	? 571.60
67	COOLANT <i>all</i>	\$ 84.00	? 67.00
68	INTERCOOLER <i>Not Nec</i>	\$ 535.00	? ?
69	INTER COOLAR PRESSURE PIPE <i>Not Nec</i>	TBC	? ?
70	RADIATOR FAN <i>Not Nec</i>	\$ 242.00	? ?
71	RADIATOR FAN CONTROL UNIT <i>Not Nec</i>	\$ 2,107.00	? ?
72	LOCK CARRIER AIR GUIDE - LH / UPPER / LOWER <i>Not Nec</i>	4 \$ 77.00	? X
73	INTAKE AIR DUCT <i>Not Nec</i>	\$ 19.00	? ?
74	INTAKE AIR DUCT GUIDE <i>Not Nec</i>	\$ 48.00	? ?
75	INTAKE AIR DUCT HOSE <i>Not Nec</i>	\$ 85.00	? ?
76	AIR MASS METER <i>Not Nec</i>	\$ 533.00	? ?
77	AIR FILTER <i>Not Nec</i>	\$ 339.00	? ?
78	FRONT CONNECTING PLATE - LH <i>Buckled</i>	\$ 337.00	? 269.60
79	FRONT FENDER CORNER CHROME TRIM - LH / RH <i>all</i>	2 \$ 290.00	? 231.00
80	FRONT DOOR CORNER CHROME TRIM - LH / RH <i>all</i>	2 \$ 290.00	? 145 231.00
SUB-TOTAL SPARE PARTS		\$ 7,673.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDY 6818 P

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
81	ROOF MOLDING CHROME - LH / RH <i>all in</i>	\$ 1,148.00	<i>+</i>
82	FRONT DOOR WINDOW SLOW SEAL CHROME - LH / RH <i>all in</i>	\$ 728.00	<i>+</i>
83	STEERING WHEEL AIR BAG	\$ 3,384.00	<i>2707.20</i>
84	AIRBAG - PASSENGER SIDE	\$ 4,019.00	<i>3215.00</i>
85	HEAD AIRBAG - LH / RH	\$ 3,416.00	<i>2732.80</i>
86	AIRBAG CONTROL UNIT	\$ 1,927.00	<i>1541.60</i>
87	AIR BAG CRASH SENSOR - FRONT	\$ 1,145.00	<i>915.60</i>
88	BATTERY CENTRAL FUSE PROTECTION	\$ 485.00	<i>388</i>
89	FRONT SEAL BELT - LH / RH	\$ 2,010.00	<i>1608</i>
90	FRONT SEAL BELT HEAD ADJUSTER <i>2 damaged</i>	2 \$ 322.00	<i>257.60</i>
91	STEERING WHEEL <i>Not Nec</i>	\$ 2,169.00	<i>X</i>
92	DASHBOARD <i>to be</i>	\$ 4,838.00	<i>3876.40</i>
* 93	AIRCOND AIR VENT <i>Not Nec</i>	\$ 153.00	<i>X</i>
* 94	AIRCOND AIR VENT FOR WINDSCREEN <i>Not Nec</i>	\$ 113.00	<i>X</i>
95	ROOF LINER <i>crumpled</i>	\$ 1,872.00	<i>1497.60</i>
96	A PILLAR TRIM <i>Reh d</i>	2 \$ 374.00	<i>298.40</i>
97	LH HANDLE - FRONT / REAR <i>Front damaged</i>	\$ 258.00	<i>1103.20</i>
98	RH HANDLE - REAR <i>Not Nec</i>	\$ 129.00	<i>X</i>
99	FRONT NO. PLATE <i>Nec</i>	\$ 40.00	<i>40</i>
100	ACYLIC SEALANT <i>Not Nec</i>	\$ 180.00	<i>X</i>
101	CRAVITY WAX <i>Not Nec</i>	\$ 140.00	<i>X</i>
102	STONE CHIP TREATMENT <i>Not Nec</i>	\$ 180.00	<i>X</i>
103	SUNDRIES <i>Nec</i>	\$ 1,500.00	<i>135.55</i>
TOTAL SPARE PARTS		\$ 71,195.00	
TOTAL LABOUR CHARGES		\$ 35,404.00	
GRAND TOTAL		\$ 106,599.00	<i>(S) 1537</i>

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

108,136

108,515.49

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Name : Adrian Lim
Surveyed Date : 05/05/190
Authorised Date :
Excess Cost :
Liability :
Remarks : Not Authorized, 21 Days.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDY 6818 P

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	FRONT BUMPER <i>Distorted</i>	\$ 2,073.00	✓
2	FRONT BUMPER FIXING PARTS <i>New</i>	\$ 368.00	✓
3	FRONT BUMPER GRILLE - CENTER <i>New</i>	\$ 178.00	✓
4	FRONT BUMPER SECURING STRIP <i>New</i>	\$ 64.00	✓
5	FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE <i>New</i>	\$ 207.00	✓ <i>de</i>
6	FRONT BUMPER SPOILER <i>New</i>	\$ 489.00	✓
7	FRONT BUMPER AIR GUIDE - LH <i>Distorted</i>	\$ 56.00	✓
8	RADIATOR GRILLE <i>crushed</i>	\$ 2,131.00	✓
9	RADIATOR GRILLE SENSOR SUPPORT <i>New</i>	2 \$ 96.00	✓
10	RADIATOR GRILLE COVER - UPPER <i>New</i>	\$ 174.00	✓
11	FRONT BUMPER AIR GUIDE GRILLE - LH / RH <i>LH Distorted</i>	\$ 862.00 831	✓
12	FRONT BUMPER CARRIER <i>Best</i>	\$ 733.00	✓
13	FRONT BUMPER BRACKET - LH <i>New</i>	\$ 195.00	✓
14	FRONT BUMPER GUIDE SECTION - LH <i>New</i>	\$ 33.00	✓
15	FOAM FILLER PIECE - LH / CENTRE <i>Distorted</i>	2 \$ 129.00	✓
16	FRONT BUMPER TOP COVER <i>Distorted</i>	\$ 116.00	✓
17	CAUTION STICKER <i>3</i>	\$ 13.00	✓
18	A/C STICKER <i>3</i>	\$ 7.00	✓
19	LOCK CARRIER BRACKET <i>New</i>	\$ 125.00	✓
20	FRONT BUMPER SUPPORT - LH / RH <i>New</i>	\$ 52.00 52	✓ <i>52</i>
SUB-TOTAL SPARE PARTS		\$ 8,101.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDY 6818 P

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
21	FRONT BUMPER SENSOR <i>Engd</i>	2 \$	462.00 ✓
22	FRONT BUMPER SENSOR SEAL RING <i>re</i>	\$	12.00 ✓
23	FRONT BUMPER WIRING SET <i>?</i>	\$	470.00 ?
24	HORN - HIGH TONE <i>Engd</i>	\$	37.00 ✓
25	HORN BRACKET <i>Bent</i>	\$	26.00 ✓
26	FRONT FENDER - LH <i>Distorted</i>	\$	968.00 ✓
27	FRONT FENDER ATTACHMENT PART <i>re</i>	\$	48.00 ✓
28	FRONT FENDER CLOSING ELEMENT - LH <i>?</i>	\$	68.00 ✓
29	FRONT FENDER BRACKET - LH <i>re</i>	\$	32.00 ✓
30	FRONT FENDER BRACE - LH	\$	107.00 ✓
31	FRONT FENDER DEFORMATION BRACKET - LH <i>Engd</i>	\$	45.00 ✓
32	FRONT WHEEL HOUSING LINER - LH <i>re</i>	\$	256.00 ✓
33	FRONT WHEEL HOUSING LINER ATTACHMENT <i>?</i>	\$	82.00 ?
34	FRONT WHEEL SPOILER - LH <i>could</i>	\$	66.00 ✓
35	FRONT WHEEL SPOILER TRIM - LH <i>could</i>	\$	32.00 ✓
36	FRONT FENDER STONE CHIP GUARD - LH <i>re</i>	\$	46.00 ✓
37	BONNET <i>Distorted</i>	\$	2,602.00 ✓
38	BONNET ATTACHMENT PARTS <i>?</i>	\$	111.00 ?
39	BONNET IMPACT PROTECTION <i>re</i>	3 \$	75.00 ✓
40	BONNET SOUND ABSORBER <i>?</i>	\$	311.00 ?
SUB-TOTAL SPARE PARTS		\$	5,856.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDY 6818 P

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
41	FRONT FENDER TOP COVER - LH <i>he</i>	\$ 32.00	✓
42	FRONT HEADLIGHT TOP COVER - LH <i>he</i>	\$ 14.00	✓
43	FRONT FENDER COVER - LH <i>he</i> ?	\$ 66.00	?
44	BONNET GAS FILLED STRUT ?	2 \$ 217.00	?
45	BONNET STRIKER - LH / RH <i>2 b1</i> ✓	\$ 92.00	?
46	BONNET HINGE - LH / RH <i>2 b1</i> ✓	\$ 762.00	?
47	BONNET LOCK <i>Turned</i>	2 \$ 391.00	✓
48	BONNET BOWDEN CABLE <i>Turned</i>	2 \$ 106.00	✓
49	BONNET BOWDEN CABLE COVER ?	\$ 9.00	?
50	BONNET RELEASE LEVER ?	\$ 12.00	?
51	BONNET LOCK CABLE ?	\$ 67.00	?
52	PLENUM CHAMBER COVER <i>he</i>	\$ 89.00	✓
53	HEADLIGHT - LH / RH <i>LH Smashed</i>	\$ 14,408.00 7204.	?
54	HEADLIGHT POWER MODULE - LH <i>dis</i> ✓	\$ 693.00	?
55	HEADLIGHT CONTROL UNIT - LH <i>dis</i> ✓	\$ 685.00	?
56	HEADLIGHT HEAT SINK - LH <i>dis</i> ✓	\$ 1,053.00	?
57	HEADLIGHT VENTILATION HOSE - LH ?	\$ 32.00	?
58	HEADLIGHT LIFT CYLINDER - LH <i>Smashed</i>	\$ 181.00	✓
59	HEADLIGHT LIFT CYLINDER HOSE <i>cut</i>	2 \$ 113.00	✓
60	HEADLIGHT LIFT CYLINDER BRACKET - LH <i>Best</i>	\$ 13.00	✓
SUB-TOTAL SPARE PARTS		\$ 19,035.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Net.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6365 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDY 6818 P

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
61	WATER RESERVOIR ?	\$	130.00 ?
62	WATER RESERVOIR PUMP ?	2 \$	265.00 ?
63	LOCK CARRIER <i>cracked</i>	\$	928.00 ✓
64	A/C CONDENSER ? <i>bt</i>	TBC	?
65	REFRIGERANT LINE ?	3 \$	688.00 ?
66	RADIATOR ? <i>bt</i>	\$	676.00 ?
67	COOLANT <i>me</i>	\$	84.00 ✓
68	INTERCOOLER ?	\$	535.00 ?
69	INTER COOLAR PRESSURE PIPE ?	TBC	?
70	RADIATOR FAN ?	\$	242.00 ?
71	RADIATOR FAN CONTROL UNIT ?	\$	2,107.00 ?
72	LOCK CARRIER AIR GUIDE - LH / UPPER / LOWER ?	4 \$	77.00 ?
73	INTAKE AIR DUCT ?	\$	19.00 ?
74	INTAKE AIR DUCT GUIDE ?	\$	48.00 ?
75	INTAKE AIR DUCT HOSE ?	\$	85.00 ?
76	AIR MASS METER ?	\$	533.00 ?
77	AIR FILTER ?	\$	339.00 ?
78	FRONT CONNECTING PLATE - LH ? <i>bt</i>	\$	337.00 ?
79	FRONT FENDER CORNER CHROME TRIM - LH / RH <i>me</i>	\$	290.00 ✓
80	FRONT DOOR CORNER CHROME TRIM - LH / RH <i>me</i>	\$	290.00 145
SUB-TOTAL SPARE PARTS		\$	7,673.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDY 6818 P

		Damage Parts & Prices	
S/N	Parts Description	S/NETT	REMARKS
81	ROOF MOLDING CHROME - LH / RH <i>see in</i>	\$	1,148.00 <i>X</i>
82	FRONT DOOR WINDOW SLOW SEAL CHROME - LH / RH <i>see in</i>	\$	728.00 <i>X</i>
83	STEERING WHEEL AIR BAG	\$	3,384.00 <i>✓</i>
84	AIRBAG - PASSENGER SIDE	\$	4,019.00 <i>✓</i>
85	HEAD AIRBAG - LH / RH	\$	3,416.00 <i>✓</i>
86	AIRBAG CONTROL UNIT	\$	1,927.00 <i>✓</i>
87	AIR BAG CRASH SENSOR - FRONT	\$	1,145.00 <i>✓</i>
88	BATTERY CENTRAL FUSE PROTECTION	\$	485.00 <i>✓</i>
89	FRONT SEAL BELT - LH / RH	\$	2,010.00 <i>✓</i>
90	FRONT SEAL BELT HEAD ADJUSTER ?	2 \$	322.00 ?
91	STEERING WHEEL ?	\$	2,169.00 ?
92	DASHBOARD <i>tom</i>	\$	4,838.00 <i>✓</i>
93	AIRCOND AIR VENT ?	\$	153.00 ?
94	AIRCOND AIR VENT FOR WINDSCREEN ?	\$	113.00 ?
95	ROOF LINER <i>crumpled.</i>	\$	1,872.00 <i>✓</i>
96	A PILLAR TRIM <i>replaced</i>	2 \$	374.00 <i>✓</i>
97	LH HANDLE (FRONT / REAR) ?	\$	258.00 ?
98	RH HANDLE - REAR ?	\$	129.00 ?
99	FRONT NO. PLATE <i>new</i>	\$	40.00 <i>✓</i>
100	ACYLIC SEALANT ?	\$	180.00 ?
101	CRAVITY WAX ?	\$	140.00 ?
102	STONE CHIP TREATMENT ?	\$	180.00 ?
103	SUNDRIES ?	\$	1,500.00 ?
TOTAL SPARE PARTS		\$	71,195.00
TOTAL LABOUR CHARGES		\$	35,404.00
GRAND TOTAL		\$	106,599.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Net.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name : Adrian Lim
Surveyed Date : 05/05/1990
Authorised Date :
Excess Cost :
Liability :
Remarks : Not Authorized, 21 Days.

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/0585/2019/DY/TF

17-May-19

Glory Tan

1 of 1

SDY 6818 P

Audi A5 SportBack 2.0 TFS

Quantity	Description	Unit Price	Amount
Parts			
* 1	D-pillar inner trim LH <i>3 the new</i>	\$ 187.00	\$ 149.20
e 2	D-pillar inner trim RH	\$ 187.00	\$ 149.20
3	Flat contact housing with cable <i>Dongle</i>	\$ 174.00	\$ 138.80
		\$ 548.00	\$ 437.20
LABORS			
TOTAL		\$ 548.00	

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315		Estimate No. PA/OD/0585/2019/DY/TF Date 27-May-19 Service Advisor Chang Pages 1 of 1 Regn No SDY 6818 P Model No Audi AS SportBack 2.0 TFSI	
Quantity	Description	Unit Price	Amount
Parts			
1	* FRONT LOCK CARRIER AIR GUIDE - LH OUTER	\$ 15.00	de ✓ 1125
2	* FAN RING	\$ 242.00	de ✓ 1533
3	* RADIATOR RUBBER BUSH SET	\$ 41.00	de ✓ 32
4	* FRONT FENDER BRACKET - LH REAR	\$ 53.00	de ✓ 41168
5	* BONNET BUNGS	\$ 37.00	de ✓ 22m
6	* RADIATOR SUPPORT - LH/RH	\$ 69.00	de ✓ 54672
7	* OUTER TEMP. SENSOR BRACKET	\$ 17.00	de ✓ 13104
8	* FRONT LOCK CARRIER AIR GUIDE - LH INNER	\$ 28.00	de ✓ 22
9	* HEADLIGHT WASHER CYLINDER - RH	\$ 181.00	de ✓ 144450
Total parts :		\$ 683.00	
LABORS			
Total labours :		\$ -	
Grand total :		\$ 683.00	

For Premium Automobiles Pte Ltd



Authorised Signature

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/0585/2019/DY/TF 14-Jun-19 George Wong 1 of 1 SDY 6818 P Audi A5 SportBack 2.0 TFSI
Quantity	Description	Unit Price	Amount
LABORS	TO SUPPLY& INSTALL FRONT WINDSCREEN SOLAR FILM (3M) <i>scr 2</i>	\$ 400.00	✓
	Total labours :	\$ 400.00	
	Grand total :	\$ 400.00	

For Premium Automobiles Pte Ltd



Authorised Signature

[Handwritten Signature]
14/06/19

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0585/2019/DY/TF
Date : 7-May-19

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way
#07-16 AIG Building
Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Hi Adrian
You recommended 21 days.
We took 30 days exclude 2 PH and 4 Sun
Jb - 15 Oct 19
Andy approved extension to Nora

Owner's Name : Mr. Leong Tuck Fook
Address : Blk 332 Tampines Street 32
#09-548
Singapore 520332
Telephone : HP +65 90186818
Type of Claim : Own Damage Claims
Policy No. : 2100510352-01
Vehicle No : **SDY 6818 P**
Model Code : Audi A5 SportBack 2.0 TFS
Model / Year : Jun-17
Engine No : CVK 034720
Chassis No : WAUZZZF55HA033826
Mileage : -
Date In : 7-May-19
Liability : -
Excess Cost : -
Estimated By : Allan Wu
Accident Date : 7-May-19
Place of Accident : Along Clemenceau Ave North Rd

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SDY 6818 P

S/N	Nature of Jobs	Estimated Charges			
1	To tow and recover vehicle from scene of accident.	S/N	AIG		
2	To carry out first measurement test on car o-liner	S/N	\$	800.00	na
3	To remove, check and reinstall front wire harness for headlights, horns, outside temperature sensor, headlight washer assy and front parking aid.	S/N	\$	480.00	\$ 480.00
4	To remove and renew aircon condenser, charged air cooler, radiator. Check electrical fans and control unit. Pressurise cooling system. To carry out vacuum and regas.	S/N	\$	1,200.00	\$ 1,200.00
5	To remove centre console, instrument panels and clusters. Renew dashboard, both frontal airbags, slip ring. Transfer old fittings. Renew seat belts and control unit, pillar trims, roof lining and both curtain air bags.	S/N	\$	3,600.00	\$ 3,600.00
SUB-TOTAL LABOUR CHARGES		:	\$	6,080.00	\$ 5,280.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SMD 8483 L

S/N	Nature of Jobs		Estimated Charges		
		<i>c/f</i>		\$	5,280.00
6	To remove and reinstall engine assy with gearbox assy to facilitate car o-liner repairs.	S/N	\$ 2,800.00	na	
7	To remove and reinstall front suspension assy with subframe to facilitate car o-liner repairs. Inspect for damages and renew if necessary.	S/N	\$ 2,400.00	na	
8	To place vehicle on car o-liner.	S/N	\$ 1,800.00	na	
9	To dismantle both front door panel trims. To remove and and reinstall both wing mirror assy.	S/N	\$ 600.00	na	
10	To dismantle and renew front bumper, bonnet, lhs front fender, both headlights. To repair lhs upper A-pillar. Cut out and reweld lhs fender support and closing element. Align both front chassis frames to specification of origin. Renew front lock carrier and align to position. Re-organise front crash management components. Reinstall all parts removed. (\$750/- added for fender top support replaced)		\$ 11,600.00	\$	4,750.00
SUB-TOTAL LABOUR CHARGES			:	\$ 25,280.00	\$ 10,030.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SDY 6818 P

S/N	Nature of Jobs	Estimated Charges		
			\$	10,300.00
11	To respray front bumper, both front fenders, bonnet, both upper A-pillar, hinges, engine compartment, lhs front fender top support and both front doors. To carry out joint sealant work and stone chip treatment. (Added \$550/- for fender support)	\$ 9,500.00	\$	4,950.00
12	To carry out wheel alignment.	S/N \$ 240.00	na	
5	Added labour - see attached	\$ 400.00	\$	400.00
13	To carry out diagnostic check.	S/N \$ 384.00	\$	384.00
TOTAL LABOUR CHARGES		: \$ 35,804.00	\$	10,034.00 15,764

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDY 6818 P

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	FRONT BUMPER	\$ 2,073.00	\$ 1,658.40
2	FRONT BUMPER FIXING PARTS	\$ 368.00	
3	FRONT BUMPER GRILLE - CENTER	\$ 178.00	
4	FRONT BUMPER SECURING STRIP	\$ 64.00	
5	FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE	\$ 207.00	\$ 165.60
6	FRONT BUMPER SPOILER	\$ 489.00	
7	FRONT BUMPER AIR GUIDE - LH	\$ 56.00	\$ 44.40
8	RADIATOR GRILLE	\$ 2,131.00	\$ 1,704.80
9	RADIATOR GRILLE SENSOR SUPPORT	2 \$ 96.00	\$ 75.52
10	RADIATOR GRILLE COVER - UPPER	\$ 174.00	\$ 138.80
11	FRONT BUMPER AIR GUIDE GRILLE - LH / RH	\$ 862.00	\$ 344.40
12	FRONT BUMPER CARRIER	\$ 733.00	\$ 586.00
13	FRONT BUMPER BRACKET - LH	\$ 195.00	\$ 156.00
14	FRONT BUMPER GUIDE SECTION - LH	\$ 33.00	\$ 26.08
15	FOAM FILLER PIECE - LH / CENTRE	2 \$ 129.00	\$ 103.12
16	FRONT BUMPER TOP COVER	\$ 116.00	\$ 92.40
17	CAUTION STICKER	\$ 13.00	\$ 9.76
18	A/C STICKER	\$ 7.00	\$ 5.12
19	LOCK CARRIER BRACKET	\$ 125.00	\$ 100.00
20	FRONT BUMPER SUPPORT - LH / RH	\$ 52.00	\$ 40.64
SUB-TOTAL SPARE PARTS		\$ 8,101.00	\$ 5,251.04

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDY 6818 P

S/N	Parts Description	c/f	Damage Parts & Prices	
			S/NETT	REMARKS
			\$	5,251.04
21	FRONT BUMPER SENSOR	2	\$ 462.00	\$ 369.60
22	FRONT BUMPER SENSOR SEAL RING		\$ 12.00	\$ 10.24
23	FRONT BUMPER WIRING SET		\$ 470.00	
24	HORN - HIGH TONE		\$ 37.00	\$ 29.20
25	HORN BRACKET		\$ 26.00	
26	FRONT FENDER - LH		\$ 968.00	\$ 774.40
27	FRONT FENDER ATTACHMENT PART		\$ 48.00	
28	FRONT FENDER CLOSING ELEMENT - LH		\$ 68.00	\$ 53.76
29	FRONT FENDER BRACKET - LH		\$ 32.00	\$ 25.20
30	FRONT FENDER BRACE - LH		\$ 107.00	\$ 85.60
31	FRONT FENDER DEFORMATION BRACKET - LH		\$ 45.00	\$ 35.60
32	FRONT WHEEL HOUSING LINER - LH		\$ 256.00	\$ 204.80
33	FRONT WHEEL HOUSING LINER ATTACHMENT		\$ 82.00	
34	FRONT WHEEL SPOILER - LH		\$ 66.00	\$ 52.32
35	FRONT WHEEL SPOILER TRIM - LH		\$ 32.00	\$ 25.04
36	FRONT FENDER STONE CHIP GUARD - LH		\$ 46.00	\$ 36.64
37	BONNET		\$ 2,602.00	\$ 2,081.60
38	BONNET ATTACHMENT PARTS		\$ 111.00	
39	BONNET IMPACT PROTECTION	3	\$ 75.00	\$ 59.44
40	BONNET SOUND ABSORBER		\$ 311.00	\$ 248.80
	SUB-TOTAL SPARE PARTS		\$ 5,856.00	\$ 9,343.28

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Net.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDY 6818 P

S/N	Parts Description	c/f	Damage Parts & Prices	
			S/NETT	REMARKS
			\$	9,343.28
41	FRONT FENDER TOP COVER - LH		\$ 32.00	\$ 25.44
42	FRONT HEADLIGHT TOP COVER - LH		\$ 14.00	\$ 11.04
43	FRONT FENDER COVER - LH		\$ 66.00	
44	BONNET GAS FILLED STRUT	2	\$ 217.00	
45	BONNET STRIKER - LH / RH		\$ 92.00	\$ 72.48
46	BONNET HINGE - LH / RH		\$ 762.00	\$ 609.60
47	BONNET LOCK	2	\$ 391.00	\$ 312.80
48	BONNET BOWDEN CABLE	2	\$ 106.00	\$ 83.36
49	BONNET BOWDEN CABLE COVER		\$ 9.00	
50	BONNET RELEASE LEVER		\$ 12.00	
51	BONNET LOCK CABLE		\$ 67.00	
52	PLENUM CHAMBER COVER		\$ 89.00	
53	HEADLIGHT - LH / RH		\$ 14,408.00	\$ 5,763.20
54	HEADLIGHT POWER MODULE - LH		\$ 693.00	\$ 554.00
55	HEADLIGHT CONTROL UNIT - LH		\$ 685.00	\$ 548.00
56	HEADLIGHT HEAT SINK - LH		\$ 1,053.00	\$ 842.40
57	HEADLIGHT VENTILATION HOSE - LH		\$ 32.00	\$ 25.36
58	HEADLIGHT LIFT CYLINDER - LH		\$ 181.00	\$ 144.80
59	HEADLIGHT LIFT CYLINDER HOSE	2	\$ 113.00	\$ 89.12
60	HEADLIGHT LIFT CYLINDER BRACKET - LH		\$ 13.00	\$ 10.40
SUB-TOTAL SPARE PARTS			\$ 19,035.00	\$ 18,435.28

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDY 6818 P

S/N	Parts Description	c/f	Damage Parts & Prices	
			S/NETT	REMARKS
			\$	18,435.28
61	WATER RESERVOIR		\$ 130.00	
62	WATER RESERVOIR PUMP	2	\$ 265.00	
63	LOCK CARRIER		\$ 928.00	\$ 742.00
64	A/C CONDENSER		\$ 567.50	\$ 454.00
65	REFRIGERANT LINE	3	\$ 688.00	
66	RADIATOR		\$ 676.00	\$ 571.60
67	COOLANT		\$ 84.00	\$ 67.20
68	INTERCOOLER		\$ 535.00	
69	INTER COOLAR PRESSURE PIPE	TBC		
70	RADIATOR FAN		\$ 242.00	
71	RADIATOR FAN CONTROL UNIT		\$ 2,107.00	
72	LOCK CARRIER AIR GUIDE - LH / UPPER / LOWER	4	\$ 77.00	
73	INTAKE AIR DUCT		\$ 19.00	
74	INTAKE AIR DUCT GUIDE		\$ 48.00	
75	INTAKE AIR DUCT HOSE		\$ 85.00	
76	AIR MASS METER		\$ 533.00	
77	AIR FILTER		\$ 339.00	
78	FRONT CONNECTING PLATE - LH		\$ 337.00	\$ 269.60
79	FRONT FENDER CORNER CHROME TRIM - LH / RH		\$ 290.00	\$ 231.20
80	FRONT DOOR CORNER CHROME TRIM - LH / RH		\$ 290.00	\$ 231.20
SUB-TOTAL SPARE PARTS			\$ 8,240.50	\$ 21,002.08

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SDY 6818 P

S/N	Parts Description	c/f	Damage Parts & Prices		REMARKS
			S/NETT	\$	
					21,002.08
81	ROOF MOLDING CHROME - LH / RH		\$	1,148.00	
82	FRONT DOOR WINDOW SLOW SEAL CHROME - LH / RH		\$	728.00	
83	STEERING WHEEL AIR BAG		\$	3,384.00	\$ 2,707.20
84	AIRBAG - PASSENGER SIDE		\$	4,019.00	\$ 3,215.20
85	HEAD AIRBAG - LH / RH		\$	3,416.00	\$ 2,732.80
86	AIRBAG CONTROL UNIT		\$	1,927.00	\$ 1,541.60
87	AIR BAG CRASH SENSOR - FRONT		\$	1,145.00	\$ 915.60
88	BATTERY CENTRAL FUSE PROTECTION		\$	485.00	\$ 388.00
89	FRONT SEAL BELT - LH / RH		\$	2,010.00	\$ 1,608.00
90	FRONT SEAL BELT HEAD ADJUSTER	2	\$	322.00	\$ 257.60
91	STEERING WHEEL		\$	2,169.00	
92	DASHBOARD		\$	4,838.00	\$ 3,870.40
93	AIRCOND AIR VENT		\$	153.00	\$ 122.40
94	AIRCOND AIR VENT FOR WINDSCREEN		\$	113.00	\$ 90.00
95	ROOF LINER		\$	1,872.00	\$ 1,497.60
96	A PILLAR TRIM	2	\$	374.00	\$ 298.40
97	LH HANDLE - FRONT / REAR		\$	258.00	\$ 103.20
98	RH HANDLE - REAR		\$	129.00	
99	FRONT NO. PLATE		\$	40.00	\$ 40.00
100	ACYLIC SEALANT		\$	180.00	
101	CRAVITY WAX		\$	140.00	
102	STONE CHIP TREATMENT		\$	180.00	
103	Added parts - see attached		\$	683.00	\$ 512.69
104	Added parts - see attached		\$	548.00	\$ 437.20
105	SUNDRIES		\$	1,500.00	\$ 135.55
TOTAL SPARE PARTS		:	\$	72,993.50	\$ 41,475.52
TOTAL LABOUR CHARGES		:	\$	35,804.00	\$ 16,034.00
GRAND TOTAL		:	\$	108,797.50	\$ 57,509.52

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

57, 239.52

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PAJODI0585/2019/DY/TF 27-May-19 Chang 1 of 1 SDY 6818 P Audi A5 SportBack 2.0 TFSI
Quantity	Description	Unit Price	Amount
<u>Parts</u>			
1	FRONT LOCK CARRIER AIR GUIDE - LH OUTER	\$ 15.00	\$ 11.25
2	FAN RING	\$ 242.00	\$ 193.20
3	RADIATOR RUBBER BUSH SET	\$ 41.00	\$ 32.00
4	FRONT FENDER BRACKET - LH REAR	\$ 53.00	\$ 41.68
5	BONNET BUNGS	\$ 37.00	
6	RADIATOR SUPPORT - LH/RH	\$ 69.00	\$ 54.72
7	OUTER TEMP. SENSOR BRACKET	\$ 17.00	\$ 13.04
8	FRONT LOCK CARRIER AIR GUIDE - LH INNER	\$ 28.00	\$ 22.00
9	HEADLIGHT WASHER CYLINDER - RH	\$ 181.00	\$ 144.80
Total parts :		\$ 683.00	\$ 512.69
<u>LABORS</u>			
Total labours :		\$ -	
Grand total :		\$ 683.00	

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/0585/2019/DY/TF 14-Jun-19 George Wong 1 of 1 SDY 6816 P Audi A5 SportBack 2.0 TFSI
Quantity	Description	Unit Price	Amount
<u>LABORS</u>	TO SUPPLY& INSTALL FRONT WINDSCREEN SOLAR FILM (3M)	\$ 400.00	\$ 400.00
	Total labours :	\$ 400.00	\$ 400.00
	Grand total :	\$ 400.00	\$ 400.00

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Veron Chen (LKKAUTO)

From: Veron Chen (LKKAUTO)
Sent: Saturday, 16 November 2019 12:21 PM
To: Carrine Leong; SUR
Cc: boojohnny@gmail.com; claims@premiumauto.com.sg;
nora.khai@premiumauto.com.sg; jiayee.yap@premiumauto.com.sg
Subject: RE: FINAL REVISION - SDY6818P - OD AIG - SURVEYED 9 MAY 19

Dear Carrine,

Finalise amount \$56,728.72 before GST @ 26 working days.

Kindly send us invoice and discharge voucher for us to close file.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Carrine Leong <carrine.leong@premiumauto.com.sg>
Sent: Friday, 1 November 2019 2:04 PM
To: Veron Chen (LKKAUTO) <veronchen@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: boojohnny@gmail.com; claims@premiumauto.com.sg; nora.khai@premiumauto.com.sg;
jiayee.yap@premiumauto.com.sg
Subject: RE: FINAL REVISION - SDY6818P - OD AIG - SURVEYED 9 MAY 19

Hi Veron,

Ok, Please get approval from AIG to close case.

Thanks & Best Regard

Carrine Leong

Claims Administrator


Premium Automobiles Pte Ltd (Reg No 199902273W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9925 f. +65 6841 1183

e. carrine.leong@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223

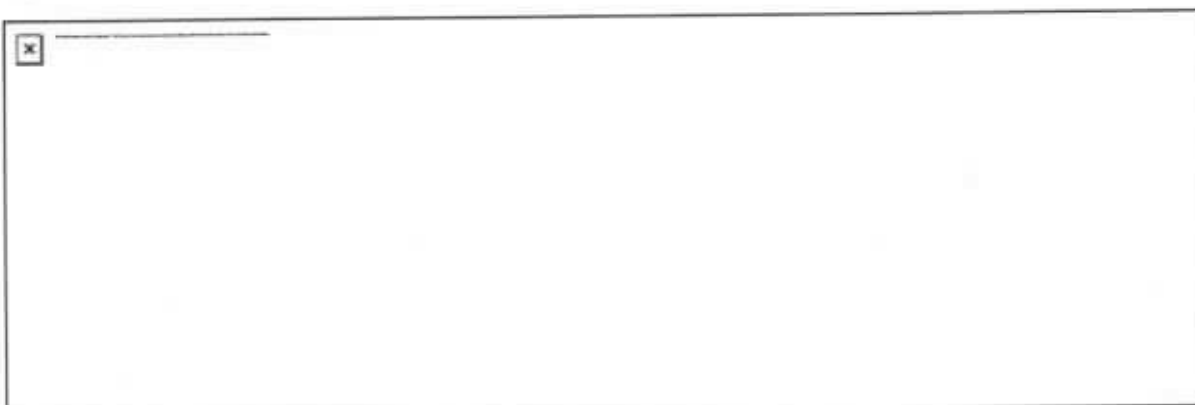

Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.

If you have received it in error, please notify us immediately by reply email and then delete this message from your system. Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Veron Chen (LKKAuto) [mailto:veronchen@lkkauto.com]
Sent: Friday, 1 November, 2019 2:01 PM
To: 'Carrine Leong' <carrine.leong@premiumauto.com.sg>; SUR <sur@lkkauto.com>
Cc: (boojohnny@gmail.com) <boojohnny@gmail.com>; claims@premiumauto.com.sg; nora.khai@premiumauto.com.sg
Subject: FW: FINAL REVISION - SDY6818P - OD AIG - SURVEYED 9 MAY 19

Dear Carrine

After surveyor's review.

Kindly take out the items below-

- 1) AIRCOND AIR VENT-\$122.40
- 2) AIRCOND AIR VENT FOR WINDSCREEN-\$90
- 3) D-PILLAR INNER TRIM LH-\$149.20
- 4) D-PILLAR INNER TRIM RH-\$149.20

Finalise amount \$56,728.72 before GST @ 26 workings instead of 30 days.

Please check and confirmed.

We need to get approval from AIG.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Veron Chen (LKKAuto)
Sent: Friday, 25 October 2019 12:20 PM
To: jiayee.yap@premiumauto.com.sg; SUR <sur@lkkauto.com>
Cc: 'Boo seng yak' <boojohnny@gmail.com>; 'Carrine Leong' <carrine.leong@premiumauto.com.sg>; 'Chang Chee Sing' <claims@premiumauto.com.sg>; (nora.khai@premiumauto.com.sg) <nora.khai@premiumauto.com.sg>
Subject: RE: FINAL REVISION - SDY6818P - OD AIG - SURVEYED 9 MAY 19

Dear Jia Yee,

After surveyor's review.

Kindly take out the items below-

- 1) AIRCOND AIR VENT-\$122.40
- 2) AIRCOND AIR VENT FOR WINDSCREEN-\$90
- 3) D-PILLAR INNER TRIM LH-\$149.20
- 4) D-PILLAR INNER TRIM RH-\$149.20

Finalise amount \$56,728.72 before GST @ 24 workings instead of 30 days.

Please check and confirmed.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: jiajee.yap@premiumauto.com.sg <jiajee.yap@premiumauto.com.sg>

Sent: Wednesday, 16 October 2019 2:54 PM

To: Adrian Ling (LKKAuto) <adrianling@lkkauto.com>; Veron Chen (LKKAuto) <veronchen@lkkauto.com>; SUR <sur@lkkauto.com>

Cc: 'Boo seng yak' <boojohnny@gmail.com>; 'Carrine Leong' <carrine.leong@premiumauto.com.sg>; 'Chang Chee Sing' <claims@premiumauto.com.sg>

Subject: FINAL REVISION - SDY6818P - OD AIG - SURVEYED 9 MAY 19

Hi Adrian/Veron and all,

Revised estimate, photo file, re-survey docs is attached.

Please confirm repair cost of \$57,239.52 @ 30 days of repairs exclude 2 PH and 4 Sundays. Extension of days was approved by Andy - AIG with Miiss Nora.

Your early closure is well appreciated.

Thanks & Best Regard

JiaYee Yap

Claims Administrator

Premium Automobiles Pte Ltd (Reg No 199801271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9925 f. +65 6841 1183

e. jiajee.yap@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Boo seng yak <boojohnny@gmail.com>

Sent: Tuesday, 15 October 2019 5:15 PM

To: Adrian Ling <adrianling@lkkauto.com>; Veron Chen <veronchen@lkkauto.com>; SUR <sur@lkkauto.com>;
Carrine Leong <carrine.leong@premiumauto.com.sg>; Chang Chee Sing <claims@premiumauto.com.sg>;
jiayee.yap@premiumauto.com.sg

Subject: FINAL REVISION - SDY6818P - OD AIG - SURVEYED 9 MAY 19

Hi Adrian and all,

Revised estimate, photo file, re-survey docs is attached.

Please confirm repair cost of \$57,509.52 @ 30 days of repairs exclude 2 PH and 4 Sundays. Extension of days was approved by Andy - AIG with Miiss Nora.

Your early closure is well appreciated.

Best regards - jb

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SDY 6818 P

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/0585/2019/NH

3RD JAN 2020

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

total pages

RE: INSURANCE CLAIM FOR SDY 6818 P, Audi A5 SB 2.0 TFSI S-TRONIC.

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

With reference to the above-mentioned vehicle, no. **SDY 6818 P**, claimant, **Mr. Leong Tuck Fook**, please find the related document per attached.

1. A copy of the Original invoice no. 85014669 – S\$ 60,699.73.
2. A copy of the Discharge Voucher duly signed by client.

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept

Encl
AIG – SDY 6818 P

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6388 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9628 1233
Email: customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 1 11:47

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014669 Date : 03/01/2020 Order : SDY6818P Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	--	--

Regn No: SDY6818P (V 34002)	Regn Date: 24/06/2017	Mileage: 44238	WIP No.: 52728
Model: A5 SPORTBACK 2.0 TFSI S tronic	Chassis: WAUZZZF55HA033826	Engine: CVK 034720	Dept: U
You have been assisted by :- UB-Nora (11)			

		Details	Qty	Unit Price	Amount
S	SUBLET	M: TO SUPPLY VEHICLE NUMBER PLATE	40.00	1.00	40.00
S	SUBLET	M: TO SUPPLY AND INSTALL FRONT WINDSCREEN SOLAR FILM	400.00	1.00	400.00
S	BODYWORK	M: TO REMOVE,CHECK AND REINSTALL FRONT WIRE HARNESS FOR HEADLIGHTS,HORNS,OUTSIDE TEMPERATURE SENSOR,HEADLIGHT WASHER ASSY AND FRONT PARKING AID	480.00	1.00	480.00
S	BODYWORK	M: TO REMOVE AND RENEW AIRCON CONDENSER,CHARGED AIR COOLER AND RADIATOR,CHECK ELECTRICAL FANS AND CONTROL UNIT,PRESSURISE COOLING SYSTEM.TO CARRY OUT VACUUM AND REGAS	1200.00	1.00	1,200.00
S	BODYWORK	M: TO REMOVE CENTRE CONSOLE,INSTRUMENT PANEL AND CLUSTER.RENEW DASHBOARD,BOTH FRONTAL AIRBAG,SLIP RING.TRANSFER OLD FITTINGS. RENEW SEAT BELTS AND CONTROL UNIT,PILLAR TRIMS,ROOF LINING AND BOTH CURTAIN AIRBAG.	3600.00	1.00	3,600.00
S	BODYWORK	M: TO DISMANTLE AND RENEW BUMPER,BONNET,LHS FRONT FENDER AND HEADLIGHTS.TO REPAIR LHS A PILLAR.CUT OUT AND REWELD LHS FENDER SUPPORT AND CLOSING ELEMENT.ALIGN FRONT CHASSIS FRAMES TO SPECIFICATIO OF ORIGIN.RENEW LOCK CARRIER AND ALIGN TO POSITION REORGANISE CRASH MANAGEMENT.REINSTALL PARTS REMOVE	4750.00	1.00	4,750.00
S	BODYWORK	M: TO RESPRAY FRONT BUMPER,BOTH FRONT FENDER, BONNET,BOTH UPPER A PILLAR,LHS FRONT FENDER TOP SUPPORT AND BOTH FRONT DOORS.TO CARRY OUT JOINT SEALANT WORK AND STONE CHIP TREATMENT	4950.00	1.00	4,950.00
S	BODYWORK	M: TO CARRY OUT DIAGNOSTIC CHECK	384.00	1.00	384.00

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6386 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 2 11:47

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014669	Account: A0006 (T 0)
	Date : 03/01/2020	AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
	Order : SDY6818P	
	Term : 30	

Regn No: SDY6818P (V 34002)	Regn Date: 24/06/2017	Mileage: 44238	WIP No.: 52728
Model: A5 SPORTBACK 2.0 TFSI S tronic	Chassis: WAU22ZF55HA033826	Engine: CVK 034720	Dept: U
You have been assisted by :- UB-Nora (11)			

		Details		Qty	Unit Price	Amount
X	A8W6807065D GRU	COVER	Less 020%	1.00	2073.00	1,658.40
X	A8W6121763	AIR DUCT	Less 020%	1.00	55.50	44.40
X	A8W6853651R RN4	GRILLE	Less 020%	1.00	2131.00	1,704.80
X	A8W6919267D RN4	007233/(V) (GER) MOUNT	Less 020%	1.00	47.20	37.76
X	A8W6919268D RN4	MOUNTING	Less 020%	1.00	47.20	37.76
X	A8W6853037	COVER (LAST)	Less 020%	1.00	173.50	138.80
X	A8W6807681M RN4	GRILL (LAST)	Less 020%	1.00	430.50	344.40
X	A8W0807113	(SK) BRACKET	Less 020%	1.00	732.50	586.00
X	A8W6807133	BRACKET (LAST)	Less 020%	1.00	195.00	156.00
X	A8W6807283	(A) (SK) GUIDE 14/5/19	Less 020%	1.00	32.60	26.08
X	A8W0807251A	FOAM INSER (LAST)	Less 020%	1.00	15.90	12.72
X	A8W6807081B	COVER	Less 020%	1.00	115.50	92.40
X	A8W6807550J	FOAM INSER	Less 020%	1.00	113.00	90.40
X	A8K0010520A	PLATE	Less 020%	1.00	12.20	9.76
X	A8W0010515A	STICKER	Less 020%	1.00	6.40	5.12
X	A8W6807771	BRACKET (LAST)	Less 020%	1.00	125.00	100.00
X	A8W0807333	SUPPORT (LAST)	Less 020%	1.00	25.40	20.32
X	A8W0807334	(SK) SUPPORT	Less 020%	1.00	25.40	20.32
X	A5Q0919275B GRU	(SK) SENSOR	Less 020%	1.00	231.00	184.80
X	A5Q0919275C GRU	(A) (SK) Sensor 14/5/1	Less 020%	1.00	231.00	184.80
X	A8W0951223	(SK) HORN	Less 020%	1.00	36.50	29.20
X	A8W6951229	CLIP (LAST)	Less 020%	1.00	26.00	20.80
X	A8W6821105B	FENDER (LAST)	Less 020%	1.00	968.00	774.40
X	A8W6821091	(A) (SK) PLATE 14/5/19	Less 020%	1.00	67.20	53.76
X	A8W6821467	BRACKET	Less 020%	1.00	31.50	25.20
X	A8W6821131B	SUPPORT (LAST)	Less 020%	1.00	107.00	85.60
X	A8W0821469	BRACKET	Less 020%	1.00	44.50	35.60
X	A8W6821171C	(A) (SK) WHEEL HOUS 14	Less 020%	1.00	256.00	204.80
X	A8W6853887	SPOILER (LAST)	Less 020%	1.00	65.40	52.32
X	A8W0853833	SPOILER (LAST)	Less 020%	1.00	31.30	25.04
X	A8W6853823B 9B9	STONEGUARD (LAST)	Less 020%	1.00	45.80	36.64
X	A8W6823029	HOOD (LAST)	Less 020%	1.00	2602.00	2,081.60
X	A8W6823124	PROTECTION	Less 020%	1.00	24.70	19.76
X	A8W6823125	PROTECTION	Less 020%	1.00	24.90	19.92

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408999
Main Telephone 6388 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 3 11:47

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014669 Date : 03/01/2020 Order : SDY6818P Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	--	--

Regn No: SDY6818P (V 34002) Regn Date: 24/06/2017 Mileage: 44238 WIP No.: 52728

Model: A5 SPORTBACK 2.0 TFSI S tronic Chassis: WAUZZZF55HA033826 Engine: CVK 034720 Dept: 0

You have been assisted by :- UB-Nora (11)

		Details	Qty	Unit Price	Amount
X	A8W6823126	PROTECTION	Less 020%	1.00	24.70
X	A8W6863825B	(A) (SK) SILENCER 27/5	Less 020%	1.00	311.00
X	A8W6820581E	COVER	Less 020%	1.00	31.80
X	A8W6823745	COVER (LAST)	Less 020%	1.00	13.80
X	A8W0823185D	CATCH	Less 020%	1.00	45.30
X	A8W0823186D	CATCH	Less 020%	1.00	45.30
X	A8W6823301D	007249/(V) (GER) HINGE	Less 020%	1.00	381.00
X	A8W6823302D	(A) (SK) HINGE 27/5/19	Less 020%	1.00	381.00
X	A8W0823509C	LATCH (LAST)	Less 020%	2.00	195.50
X	A8W0823531C	BOWD CABLE	Less 020%	1.00	52.10
X	A8W6823529	BOWD CABLE (LAST)	Less 020%	1.00	52.10
X	A8W6941773E	HEADLIGHT (LAST)	Less 020%	1.00	7204.00
X	A7PP941572AC	POWER MOD (LAST)	Less 020%	1.00	692.50
X	A4M0907397AD	(A) (SK) CTRL UNIT 27/	Less 020%	1.00	685.00
X	A8W6998473A	(A) (SK) LED 27/5/19	Less 020%	1.00	1053.00
X	A8W0941717A	HOSE	Less 020%	1.00	31.70
X	A8W6955101A	CYLINDER	Less 020%	1.00	181.00
X	A8W6955970	(A) (SK) TUBING 14/5/1	Less 020%	1.00	77.10
X	A8W6955775A	BRACKET (LAST)	Less 020%	1.00	13.00
X	A8W0955667A	TUBING	Less 020%	1.00	34.30
X	A8W0805594	(SK) CARRIER	Less 020%	1.00	927.50
X	A8W0121251AK	RADIATOR (LAST)	Less 020%	1.00	714.50
X	AG A13040M2	PREMIX-COOLANT	Less 020%	4.00	21.00
X	A8W0121207B	COWL (LAST)	Less 020%	1.00	241.50
X	A8W6121283AF	AIR DUCT (LAST)	Less 020%	1.00	27.50
X	A8W6121673B	(A) (SK) AIR DUCT 27/5	Less 020%	1.00	14.10
X	A8W0805303B	(V) (GER) PLATE 27/5/1	Less 020%	1.00	337.00
X	A8W6853601A PUZ	TRIM (LAST)	Less 020%	1.00	144.50
X	A8W6853602A PUZ	(A) (SK) TRIM 14/5/19	Less 020%	1.00	144.50
X	A8W6853603A PUZ	(SK) TRIM	Less 020%	1.00	144.50
X	A8W6853604A PUZ	(SK) TRIM	Less 020%	1.00	144.50
X	A8W0880201AR6PS	(A) (GER) AIRBAG 14/5/	Less 020%	1.00	3384.00
X	A8W0880204G	(A) (GER) AIRBAG 14/5/	Less 020%	1.00	4019.00
X	A8W0880741F	(A) (GER) AIRBAG 14/5/	Less 020%	1.00	1708.00

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408599
Main Telephone 6386 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9829 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 4 11:47

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014669 Date: 03/01/2020 Order: SDY6818P Term: 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	--

Regn No: SDY6818P (V 34002) Regn Date: 24/06/2017 Mileage: 44238 WIP No.: 52728
Model: A5 SPORTBACK 2.0 TFSI S tronic Chassis: WAUZZZF55HA033926 Engine: CVK 034720 Dept: U

You have been assisted by :- UB-Nora (11)

		Details	Qty	Unit Price	Amount
X	A8W8880742F	(A) (GER) AIRBAG 14/5/	Less 020%	1.00	1708.00
X	A4M0959651	(A) (SK) SENSOR 14/5/1	Less 020%	3.00	381.50
X	A8W0915459E	FUSE UNIT (LAST)	Less 020%	1.00	485.00
X	A8W0857705 V04	(A) (SK) SEAT BELT 14/	Less 020%	1.00	1005.00
X	A8W0857706 V04	(A) (SK) SEAT BELT 14/	Less 020%	1.00	1005.00
X	A4M0857819	Adjuster (LAST)	Less 020%	2.00	161.00
X	A8W2857001H 24A	(A) (GER) DASHBOARD 14	Less 020%	1.00	4838.00
X	A8W8867505 1R0	(A) (GER) ROOF LINING 1	Less 020%	1.00	1872.00
X	A8W8867233F 1R0	(A) (SK) LINING 14/5/1	Less 020%	1.00	186.50
X	A8W8867234F 1R0	(A) (SK) LINING 14/5/1	Less 020%	1.00	186.50
X	A8R0857607H DT4	HANDLE	Less 020%	1.00	129.00
X	A8W0959655F	(A) (GER) MODULE 14/5/	Less 020%	1.00	1927.00
X	A5Q0919133 704	WASHER	Less 020%	4.00	3.20
X	A3C8971582	(A) (SK) HOUSING 17/5/	Less 020%	1.00	173.50
X	A8W0820769C	BRACKET	Less 020%	1.00	6.30
X	A07P973702A	007249/ (V) (GER) HOUSI	Less 020%	1.00	8.60
X	A4D0971992	HOUSING	Less 020%	1.00	16.10
X	A8W6807611	PLATE (LAST)	Less 020%	1.00	207.00
X	AN 0161857	POP-RIVET	Less 020%	10.00	3.00
X	A8W6821471	BRACKET	Less 020%	1.00	31.50
X	A4M0121095	BOLT	Less 020%	2.00	2.20
X	A4M0121275A	MOUNTING (LAST)	Less 020%	2.00	8.40
X	A4M0121268A	MOUNTING (LAST)	Less 020%	2.00	11.60
X	A8W0816421J	CONDENSER	Less 020%	1.00	567.50
X	A3D0260749C	WASHER	Less 020%	1.00	4.00
X	A4E0260749A	WASHER	Less 020%	1.00	3.60
X	A7H0820896	SEAL	Less 020%	1.00	2.50
X	A8W6821433	BRACKET (LAST)	Less 020%	1.00	52.10
X	A8P4803593A	PLUG	Less 020%	2.00	18.20
X	A8W0805201	MOUNTING	Less 020%	2.00	34.20
X	A8W0820536	BRACKET	Less 020%	1.00	16.30
X	A8W6955102A	CYLINDER (LAST)	Less 020%	1.00	181.00

Parts 40,924.72
Labour 0.00
Sublet 15,804.00
Menus 0.00
Lubricant 0.00

Sub-Total 56,728.72

7% GST 3,971.01

Grand Total 60,699.73



3/1

Received by

For & on behalf of
Premium Automobiles Pte Ltd

Premium Automobiles

Telefax

to **AIG Asia Pacific Insurance Pte Ltd**
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SDY6818P

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/0585/2019/TF
20 June 2019

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

1 total pages

RE: CLAIM – OWNER'S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi A5 SPORTBACK 2.0 TFSI S tronic
Vehicle Chassis No. : WAUZZZF55HA033826
Vehicle Regn No. : SDY6818P
Vehicle Mileage : 44234 KM
Vehicle Owner : Mr. Leong Tuck Fook
Certificate No : 2100510352-01
Own Damage Excess : \$0.00
Accident Date : 7/5/2019
Place : Along Clemenceau Ave North Rd
Repair Cost : \$ 60,699.73
WIP No. : 52728
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature : 
Time : 21/6/19 @ 1700
Date :

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	10 May 2019 11:10		10 May 2019 10:28 Edit Adj Rpt	S\$56,728.72 Edit Estimates	S\$56,728.72 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by Insurer]									
Insured: LEONG TUCK FOOK , ID: S2586803Z, Tel: +6590186818, Email: LEONGEDWIN@YAHOO.COM.SG									
Vehicle Reg. No.: SDY6818P		Date of Loss: 07/05/2019 09:00 - :59 [22 Months and 13 Days From LTA Reg Date (Man Yr)]							
Claim Type: OD / 3703182905SG		Policy/Cover Note No.: 2100510352-01 (Comprehensive)							
		Excess: S\$0.00							
Repairer: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911									
Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Chan, Yoke Shi] yokeshi.chan@aig.com									
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 22/05/2019]									
Driver/Custodian: LEONG TUCK FOOK (54 / Male) , NRIC: S2586803Z, Tel: +6590186818 Email: LEONGEDWIN@YAHOO.COM.SG									
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
- AIG_SG (13/11/2019): Alert - Adj Mandate Approved (S\$56728.72) - SDY6818P - Claim Handler: Chan, Yoke... - AIG_SG (21/06/2019): Alert - Adj Mandate Approved (S\$82616.00) - SDY6818P - Claim Handler: Chan, Yoke... - AIG_SG (10/05/2019): Alert - Adj Mandate Approved (S\$82616.00) - SDY6818P - Claim Handler: Chan, Yoke... - AIG_SG (10/05/2019): SDY6818P / OD / 07/05/2019 / Coverage & Excess update									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

***SDY6818P (3703182905SG)**

OD

May 7 2019 9:55AM

[LEONG TUCK FOOK]

Premium Automobiles Pte Ltd

Upload Documents			Upload Photos	Compose New Letter	Upload Video	Upload Audio	View View in Browser	
Video							1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print			
1	07/05/19 17:04	Video - Accident [Linked Accident Report Documents]		Load AVI				
Assessment Reports							1 per page	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print			
1	10/05/19 12:39	Adjuster Immediate Advice		Load HTM				
2	17/06/19 14:29	Adjuster Immediate Advice		Load HTM				
Photos/Images							3 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print			
1	10/05/19 10:52	General View		Load JPG	☒			
2	10/05/19 10:52	General View		Load JPG	☒			
3	10/05/19 10:52	General View		Load JPG	☒			
4	10/05/19 10:52	General View		Load JPG	☒			
5	10/05/19 10:52	General View		Load JPG	☒			
6	10/05/19 10:52	General View		Load JPG	☒			
7	10/05/19 10:52	General View		Load JPG	☒			
8	10/05/19 10:52	General View		Load JPG	☒			
9	10/05/19 10:52	General View		Load JPG	☒			
10	10/05/19 10:52	General View		Load JPG	☒			
11	10/05/19 10:52	General View		Load JPG	☒			
12	10/05/19 10:52	General View		Load JPG	☒			
13	10/05/19 10:52	General View		Load JPG	☒			
14	10/05/19 10:52	General View		Load JPG	☒			
15	10/05/19 10:52	General View		Load JPG	☒			
16	10/05/19 10:52	General View		Load JPG	☒			
17	10/05/19 10:52	General View		Load JPG	☒			
18	10/05/19 10:52	General View		Load JPG	☒			
19	10/05/19 10:52	General View		Load JPG	☒			
20	10/05/19 10:52	General View		Load JPG	☒			
21	10/05/19 10:52	General View		Load JPG	☒			
22	10/05/19 10:52	General View		Load JPG	☒			
23	10/05/19 10:52	General View		Load JPG	☒			
24	10/05/19 10:52	General View		Load JPG	☒			
25	10/05/19 10:52	General View		Load JPG	☒			
26	10/05/19 10:52	General View		Load JPG	☒			
27	10/05/19 10:52	General View		Load JPG	☒			
28	10/05/19 10:52	General View		Load JPG	☒			
29	10/05/19 10:52	General View		Load JPG	☒			
30	10/05/19 10:52	General View		Load JPG	☒			
31	10/05/19 10:52	General View		Load JPG	☒			
32	10/05/19 10:52	General View		Load JPG	☒			
33	10/05/19 10:52	General View		Load JPG	☒			
34	10/05/19 10:52	General View		Load JPG	☒			
35	10/05/19 10:52	General View		Load JPG	☒			
36	10/05/19 10:52	General View		Load JPG	☒			

Video			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
37	10/05/19 10:52	General View	 Load JPG	☒
38	10/05/19 10:52	General View	 Load JPG	☒
39	10/05/19 10:52	General View	 Load JPG	☒
40	10/05/19 10:52	General View	 Load JPG	☒
41	10/05/19 10:52	General View	 Load JPG	☒
42	10/05/19 10:52	General View	 Load JPG	☒
43	10/05/19 10:52	General View	 Load JPG	☒
44	10/05/19 10:52	General View	 Load JPG	☒
45	10/05/19 10:52	General View	 Load JPG	☒
46	10/05/19 10:52	General View	 Load JPG	☒
47	10/05/19 10:52	General View	 Load JPG	☒
48	10/05/19 10:52	General View	 Load JPG	☒
49	10/05/19 10:52	General View	 Load JPG	☒
50	10/05/19 10:52	General View	 Load JPG	☒
51	10/05/19 10:52	General View	 Load JPG	☒
52	10/05/19 10:52	General View	 Load JPG	☒
53	10/05/19 10:52	General View	 Load JPG	☒
54	10/05/19 10:52	General View	 Load JPG	☒
55	10/05/19 10:52	General View	 Load JPG	☒
56	10/05/19 10:52	General View	 Load JPG	☒
57	10/05/19 10:52	General View	 Load JPG	☒
58	10/05/19 10:52	General View	 Load JPG	☒
59	10/05/19 10:52	General View	 Load JPG	☒
60	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
61	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
62	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
63	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
64	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
65	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
66	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
67	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
68	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
69	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
70	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
71	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
72	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
73	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
74	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
75	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
76	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
77	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
78	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
79	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
80	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
81	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
82	17/06/19 14:07	Reinspection Photo	 Load JPG	☒
83	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
84	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
85	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
86	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
87	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
88	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
89	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
90	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
91	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
92	17/06/19 14:08	Reinspection Photo	 Load JPG	☒

Video			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
93	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
94	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
95	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
96	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
97	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
98	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
99	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
100	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
101	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
102	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
103	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
104	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
105	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
106	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
107	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
108	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
109	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
110	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
111	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
112	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
113	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
114	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
115	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
116	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
117	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
118	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
119	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
120	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
121	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
122	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
123	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
124	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
125	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
126	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
127	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
128	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
129	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
130	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
131	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
132	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
133	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
134	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
135	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
136	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
137	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
138	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
139	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
140	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
141	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
142	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
143	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
144	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
145	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
146	17/06/19 14:08	Reinspection Photo	 Load JPG	☒
147	17/06/19 14:11	Reinspection Photo	 Load JPG	☒
148	17/06/19 14:11	Reinspection Photo	 Load JPG	☒

Video			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
149	17/06/19 14:11	Reinspection Photo		☒
150	17/06/19 14:11	Reinspection Photo		☒
151	17/06/19 14:11	Reinspection Photo		☒
152	17/06/19 14:11	Reinspection Photo		☒
153	17/06/19 14:11	Reinspection Photo		☒
154	17/06/19 14:11	Reinspection Photo		☒
Documentation			1 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	10/05/19 11:47	Singapore Accident Statement		☒
2	10/05/19 11:47	Certificate of Insurance		☒
3	10/05/19 11:49	Insured's Driving License		☒
4	10/05/19 11:51	SG CAR MART		☒
5	10/05/19 11:51	LTA		☒
6	10/05/19 11:52	MARK ESTIMATE		☒
7	28/05/19 09:43	SUPPLEMENTARY		☒
8	17/06/19 14:15	SUPPLEMENTARY		☒
9	01/11/19 14:43	FINAL MARKING		☒
10	01/11/19 14:43	SUPPLEMENTARY MARKING		☒
11	09/01/20 11:51	Workshop Invoice		☒
12	09/01/20 11:54	Discharge Voucher		☒

Linked Accident Report Documents

Video			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	07/05/19 17:04	Video - Accident		☒
Assessment Reports			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	04/09/19 01:00	Accident Statement		☒
Photos/Images			3 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	07/05/19 17:13	Accident Photo		☒
2	07/05/19 17:13	Accident Photo		☒
3	07/05/19 17:13	Accident Photo		☒
4	07/05/19 17:13	Accident Photo		☒
5	07/05/19 17:13	Accident Photo		☒
6	07/05/19 17:13	Accident Photo		☒
7	07/05/19 17:13	Accident Photo		☒
8	07/05/19 17:13	Accident Photo		☒
Documentation			1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	07/05/19 17:03	Sketch Plan		☒
2	07/05/19 17:03	Sketch Plan #2		☒

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)			
Show Remarks To: ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.			

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #08-16
Singapore 079120

Our File No: CC3/AIG19008293/AVD3E2

Date: 09/01/2020

REFERENCE

Insured/Claimant: LEONG TUCK FOOK Policy No: 2100510352-01
Date of Loss: 07/05/2019 Nature of Claim: OD Claim No: 3703182905SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SDY6818P**
Make & Model: AUDI A5, 2.0 TFSI QUATTRO (A) Engine No: CVK034720
Reg. Date: 24/06/2017 (Man. Year: 2017) Chassis No: WAUZZZF55HA033826
Colour: Grey Odometer: 44234 km
Engine Capacity: 1984 cc
Market Value/New Car Price: S\$150,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 245/40 R18 Rear Tyre Size: 245/40 R18
Front Left Side: Pirelli 6 mm Rear Left Side: Pirelli 6 mm
Front Right Side: Pirelli 6 mm Rear Right Side: Pirelli 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	73,111.49	41,364.72	31,746.77	43.42
Miscellaneous Items	0.00	0.00	0.00	
Labour	35,404.00	15,364.00	20,040.00	56.60
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	108,515.49	56,728.72	51,786.77	47.72
+ GST 7.00/7.00% (S\$)	7,596.08	3,971.01	3,625.07	47.72
Nett Amount (S\$)	116,111.57	60,699.73	55,411.84	47.72

INSPECTION

Date of Assignment: 10/05/2019
Date Inspected: 09/05/2019 Inspected At: Premium Automobiles Pte Ltd (UBI)
55 Ubi Road 1
Singapore 408699
Estimated Period of Repair: 26.0 days

Adjuster: ADRIAN LING

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Distorted	2,073.00 FS	*1,658.40 FS
2	1		*FRONT BUMPER FIXING PARTS	Not Necessary	368.00 FS	*- FS
3	1		*FRONT BUMPER GRILLE - CENTER	Not Necessary	178.00 FS	*- FS
4	1		*FRONT BUMPER SECURING STRIP	Not Necessary	64.00 FS	*- FS
5	1		*FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE	Cracked	207.00 FS	*165.60 FS
6	1		*FRONT BUMPER SPOILER	Not Necessary	489.00 FS	*- FS
7	1		*FRONT BUMPER AIR GUIDE - LH	Distorted	56.00 FS	*44.40 FS
8	1		*RADIATOR GRILLE	Cracked	2,131.00 FS	*1,704.80 FS
9	2		*RADIATOR GRILLE SENSOR SUPPORT	Necessary	96.00 FS	*75.52 FS
10	1		*RADIATOR GRILLE COVER - UPPER	Damaged	174.00 FS	*138.80 FS
11	1		*FRONT BUMPER AIR GUIDE GRILLE - LH / RH	N/S Deformed	862.00 FS	*344.40 FS
12	1		*FRONT BUMPER CARRIER	Bent	733.00 FS	*586.00 FS
13	1		*FRONT BUMPER BRACKET - LH	Damaged	195.00 FS	*156.00 FS
14	1		*FRONT BUMPER GUIDE SECTON - LH	Damaged	33.00 FS	*26.08 FS
15	2		*FOAM FILLER PIECE - LH / CENTRE	Distorted	129.00 FS	*103.12 FS
16	1		*FRONT BUMPER TOP COVER	Deformed	116.00 FS	*92.40 FS
17	1		*CAUTION STICKER	Necessary	13.00 FS	*9.76 FS
18	1		*A/C STICKER	Necessary	7.00 FS	*5.12 FS
19	1		*LOCK CARRIER BRACKET	Damaged	125.00 FS	*100.00 FS
20	2		*FRONT BUMPER SUPPORT - LH / RH	Damaged	52.00 FS	*40.64 FS
21	2		*FRONT BUMPER SENSOR	Damaged	462.00 FS	*369.60 FS
22	1		*FRONT BUMPER SENSOR SEAL RING	Necessary	12.00 FS	*10.24 FS
23	1		*SET FRONT BUMPER WIRING	Not Necessary	470.00 FS	*- FS
24	1		*HORN - HIGH TONR	Damaged	37.00 FS	*29.20 FS
25	1		*HORN BRACKET	Not Necessary	26.00 FS	*- FS
26	1		*FRONT FENDER - LH	Distorted	968.00 FS	*774.40 FS
27	1		*FRONT FENDER ATTACHMENT PART	Not Necessary	48.00 FS	*- FS
28	1		*FRONT FENDER CLOSING ELEMENT - LH	Damaged	68.00 FS	*53.76 FS
29	1		*FRONT FENDER BRACKET - LH	Damaged	32.00 FS	*25.20 FS
30	1		*FRONT FENDER BRACE - LH	Damaged	107.00 FS	*85.60 FS
31	1		*FRONT FENDER DEFORMATION BRACKET - LH	Damaged	45.00 FS	*35.60 FS
32	1		*FRONT WHEEL HOUSING LINER - LH	Deformed	256.00 FS	*204.80 FS
33	1		*FRONT WHEEL HOUSING LINER ATTACHMENT	Not Necessary	82.00 FS	*- FS
34	1		*FRONT WHEEL SPOILER - LH	Cracked	66.00 FS	*52.32 FS
35	1		*FRONT WHEEL SPOILER TRIM - LH	Cracked	32.00 FS	*25.04 FS
36	1		*FRONT FENDER STONE CHIP GUARD - LH	Necessary	46.00 FS	*36.64 FS
37	1		*BONNET	Distorted	2,602.00 FS	*2,081.60 FS
38	1		*BONNET ATTACHMENT PARTS	Not Necessary	111.00 FS	*- FS
39	1		*BONNET IMPACT PROTECTION (3PCS)	Necessary	75.00 FS	*59.44 FS
40	1		*BONNET SOUND ABSORBER	Crumpled	311.00 FS	*248.80 FS
41	1		*FRONT FENDER TOP COVER - LH	Necessary	32.00 FS	*25.44 FS
42	1		*FRONT HEADLIGHT TOP COVER - LH	Necessary	14.00 FS	*11.04 FS
43	1		*FRONT FENDER COVER - LH	Not Necessary	66.00 FS	*- FS
44	2		*BONNET GAS FILLED STRUT	Not Necessary	217.00 FS	*- FS
45	1		*BONNET STRIKER - LH / RH	Bent	92.00 FS	*72.48 FS
46	1		*BONNET HINGE - LH / RH	Bent	762.00 FS	*609.60 FS
47	2		*BONNET LOCK	Jammed	391.00 FS	*312.80 FS
48	2		*BONNET BOWDEN CABLE	Jammed	106.00 FS	*83.36 FS
49	1		*BONNET BOWDEN CABLE COVER	Not Necessary	9.00 FS	*- FS
50	1		*BONNET RELEASE LEVER	Not Necessary	12.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
51	1		*BONNET LOCK CABLE	Not Necessary	67.00 FS	*- FS
52	1		*PLENUM CHAMBER COVER	Not Necessary	89.00 FS	*- FS
53	1		*HEADLIGHT - LH / RH	N/S Smashed	14,408.00 FS	*5,763.20 FS
54	1		*HEADLIGHT POWER MODULE - LH	Damaged	693.00 FS	*554.00 FS
55	1		*HEADLIGHT CONTROL UNIT - LH	Damaged	685.00 FS	*548.00 FS
56	1		*HEADLIGHT HEAT SINK - LH	Damaged	1,053.00 FS	*842.40 FS
57	1		*HEADLIGHT VENTILATION HOSE - LH	Cut	32.00 FS	*25.36 FS
58	1		*HEADLIGHT LIFT CYLINDER - LH	Smashed	181.00 FS	*144.80 FS
59	2		*HEADLIGHT LIFT CYLINDER HOSE	Cut	113.00 FS	*89.12 FS
60	1		*HEADLIGHT LIFT CYLINDER BRACKET - LH	Bent	13.00 FS	*10.40 FS
61	1		*WATER RESERVOIR	Not Necessary	130.00 FS	*- FS
62	2		*WATER RESERVOIR PUMP	Not Necessary	265.00 FS	*- FS
63	1		*LOCK CARRIER	Cracked	928.00 FS	*742.00 FS
64	1		*A/C CONDENSER	Dented	454.00 FS	*454.00 FS
65	3		*REFRIGERANT LINE	Not Necessary	688.00 FS	*- FS
66	1		*RADIATOR	Bent	676.00 FS	*571.60 FS
67	1		*COOLANT	Necessary	84.00 FS	*67.20 FS
68	1		*INTERCOOLER	Not Necessary	535.00 FS	*- FS
69	1		*INTER COOLER PRESSURE PIPE (NPA)	Not Necessary	0.00 FS	*- FS
70	1		*RADIATOR FAN	Not Necessary	242.00 FS	*- FS
71	1		*RADIATOR FAN CONTROL UNIT	Not Necessary	2,107.00 FS	*- FS
72	4		*LOCK CARRIER AIR GUIDE - LH / UPPER / LOWER	Not Necessary	77.00 FS	*- FS
73	1		*INTAKE AIR DUCT	Not Necessary	19.00 FS	*- FS
74	1		*INTAKE AIR DUCT GUIDE	Not Necessary	48.00 FS	*- FS
75	1		*INTAKE AIR DUCT HOSE	Not Necessary	85.00 FS	*- FS
76	1		*AIR MASS METER	Not Necessary	533.00 FS	*- FS
77	1		*AIR FILTER	Not Necessary	339.00 FS	*- FS
78	1		*FRONT CONNECTING PLATE - LH	Buckled	337.00 FS	*269.60 FS
79	2		*FRONT FENDER CORNER CHROME TRIM - LH / RH	Necessary	290.00 FS	*231.20 FS
80	2		*FRONT DOOR CORNER CHROME TRIM - LH / RH	Necessary	290.00 FS	*231.20 FS
81	1		*ROOF MOLDING CHROME - LH / RH	Not Necessary	1,148.00 FS	*- FS
82	1		*FRONT DOOR WINDOW SLOW SEAL CHROME - LH / RH	Not Necessary	728.00 FS	*- FS
83	1		*STEERING WHEEL AIR BAG	Activated	3,384.00 FS	*2,707.20 FS
84	1		*AIRBAG - PASSENGER SIDE	Activated	4,019.00 FS	*3,215.20 FS
85	1		*HEAD AIRBAG - LH / RH	Activated	3,416.00 FS	*2,732.80 FS
86	1		*AIRBAG CONTROL UNIT	Activated	1,927.00 FS	*1,541.60 FS
87	1		*AIR BAG CRASH SENSOR - FRONT	Activated	1,145.00 FS	*915.60 FS
88	1		*BATTERY CENTRAL FUSE PROTECTION	Activated	485.00 FS	*388.00 FS
89	1		*FRONT SEAT BELT - LH / RH	Activated	2,010.00 FS	*1,608.00 FS
90	2		*FRONT SEAT BELT HEAD ADJUSTER	Damaged	322.00 FS	*257.60 FS
91	1		*STEERING WHEEL	Not Necessary	2,169.00 FS	*- FS
92	1		*DASHBOARD	Torn	4,838.00 FS	*3,870.40 FS
93	1		*AIRCOND AIR VENT	Not Necessary	153.00 FS	*- FS
94	1		*AIRCOND AIR VENT FOR WINDSCREEN	Not Necessary	113.00 FS	*- FS
95	1		*ROOF LINER	Crumpled	1,872.00 FS	*1,497.60 FS
96	2		*A PILLAR TRIM	Deformed	374.00 FS	*298.40 FS
97	1		*LH HANDLE - FRONT / REAR	Front Damaged	258.00 FS	*103.20 FS
98	1		*RH HANDLE - REAR	Not Necessary	129.00 FS	*- FS
99	1		*FRONT NO. PLATE	Necessary	40.00 FS	*40.00 FS
100	1		*ACYLIC SEALANT	Not Necessary	180.00 FS	*- FS
101	1		*CAVITY WAX	Not Necessary	140.00 FS	*- FS
102	1		*STONE CHIP TREATMENT	Not Necessary	180.00 FS	*- FS
103	1		*SUNDRIES	Necessary	1,500.00 FS	*135.55 FS
104	1		*D-PILLAR INNER TRIM LH	Not Necessary	187.00 FS	*- FS
105	1		*D-PILLAR INNER TRIM RH	Not Necessary	187.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
106	1		*FLAT CONTACT HOUSING WITH CABLE	Damaged	138.80 FS	*138.80 FS
107	1		*FRONT LOCK CARRIER AIR GUIDE - LH OUTER	Deformed	11.25 FS	*11.25 FS
108	1		*FAN RING	Cracked	193.20 FS	*193.20 FS
109	1		*SET RADIATOR RUBBER BUSH	Distorted	32.00 FS	*32.00 FS
110	1		*FRONT FENDER BRACKET - LH REAR	Bent	41.68 FS	*41.68 FS
111	2		*BONNET BUNGS	Not Necessary	37.00 FS	*- FS
112	2		*RADIATOR SUPPORT - LH / RH	Distorted	54.72 FS	*54.72 FS
113	1		*OUTER TEMP. SENSOR BRACKET	Cracked	13.04 FS	*13.04 FS
114	1		*HEADLIGHT WASHER CYLINDER - RH	Cracked	144.80 FS	*144.80 FS
115	1		*FRONT WINDSCREEN SOLAR FILM (3M)	Scratched	400.00 FS	*400.00 FS
116	1		*FRONT LOCK CARRIER AIR GUIDE - LH INNER	Deformed	22.00 FS	*22.00 FS
Total Parts (\$\$)					73,111.49	41,364.72

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CARRY OUT FIRST MEASUREMENT TEST ON CAR O-LINER	New	800.00	0.00
2	TO REMOVE, CHECK AND REINSTALL FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID	New	480.00	480.00
3	TO REMOVE AND RENEW AIRCON CONDENSER, CHARGES AIR COOLER, RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS	New	1,200.00	1,200.00
4	TO REMOVE CENTRE CONSOLE, INSTRUMENT PANELS AND CLUSTERS. RENEW DASHBOARD, BOTH FRONTAL AIRBAGS, SLIP RING. TRANSFER OLD FITTINGS. RENEW SEAT BELTS AND CONTROL UNIT, PILLAR TRIMS, ROOF LINING AND BOTH CURTAIN AIR BAGS	New	3,600.00	3,600.00
5	TO REMOVE AND REINSTALL ENGINE ASSY WITH GEARBOX ASSY TO FACILITATE CAR O-LINER REPAIRS	New	2,800.00	0.00
6	TO REMOVE AND REINSTALL FRONT SUSPENSION ASSY WITH SUBFRAME TO FACILITATE CAR O-LINER REPAIRS. INSPECT FOR DAMAGES AND RENEW IF NECESSARY	New	2,400.00	0.00
7	TO PLACE VEHICLE ON CAR O-LINER	New	1,800.00	0.00
8	TO DISMANTLE BOTH FRONT DOOR PANEL TRIMS. TO REMOVE AND REINSTALL BOTH WING MIRROR ASSY	New	600.00	0.00
9	TO DISMANTLE AND RENEW FRONT BUMPER, BONNET, LHS FRONT FENDER, BOTH HEADLIGHTS. TO REPAIR LHS UPPER A-PILLAR. CUT OUT AND REWELD LHS FENDER SUPPORT AND CLOSING ELEMENT. ALIGN BOTH FRONT CHASSIS FRAMES TO SPECIFICATION OF ORIGIN. RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANISE FRONT CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	11,600.00	4,750.00
10	TO RESPRAY FRONT BUMPER, BOTH FRONT FENDERS, BONNET, BOTH UPPER A-PILLAR, HINGES, ENGINE COMPARTMENT, LHS FRONT FENDER TOP SUPPORT AND BOTH FRONT DOORS. TO CARRY OUT JOINT SEALANT WORK AND STONE CHIP TREATMENT	New	9,500.00	4,950.00
11	TO CARRY OUT WHEEL ALIGNMENT	New	240.00	0.00
12	TO CARRY OUT DIAGNOSTIC CHECK	New	384.00	384.00
Gross Labour Cost (S\$)			35,404.00	15,364.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >