



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R



DAMAGE ASSESSMENT REPORT

AUTOMOTIVE ENGINEERING & MGT DIVISION Ref: CS3/SPF18022678/R1vbs2
ACCIDENT CLAIM SECTION (SPORE POLICE FORCE) 1 MOUNT PLEASANT ROAD BLK 8 OLD Date: 18-01-2019
POLICE ACADEMYSINGAPORE 298333
ATTN: FRANKIE THAY Code: SPF



1. Policy Particulars :- (THIRD PARTY CLAIM)

Insured Veh.	YM 4170B	Veh. Inspected	SLF 909E
Policy No.		Coverage (\$)	0.00
Claim No.	AEMD/105/009/2018/172	Excess (\$)	0.00
Assign From	FRANKIE THAY	Assign Date	18/12/2018

2. Vehicle Particulars & Condition

Make & Model	MERCEDES BENZ C250 AMG	c.c	1991
Engine No.	HIDDEN	Year of Reg.	2015
Chassis No.	WDD2050452R058523	Colour	WHITE
Odometer	29575 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	FAIR		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	225/40ZR19	MICHELIN	6 mm
L/H Front Tyre	225/40ZR19	MICHELIN	6 mm
R/H Rear Tyre	225/40ZR19	MICHELIN	6 mm
L/H Rear Tyre	225/40ZR19	MICHELIN	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	14/12/2018	Inspect Date / Time	07/01/2019 (01:51 PM)
Survey held at	MIRACLE WORKZ PTE LTD 48 TOH GUAN ROAD EAST #04-126 ENTERPRISE HUB SINGAPORE 608586		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.
D) THE ESTIMATED UPPER RANGE OF REPAIR COST FOR THE DAMAGED VEHICLE IS IN THE REGION OF \$2,000-\$3,000

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **3 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

OPINION ON REPAIR COST FOR VEHICLE NO. SLF 909E

Qty	Description of Parts	Condition	Recommended (\$)
REPLACEMENT OF PARTS			
1	FRT BUMPER	SCRATCHED	1,485.00
8	FRT BUMPER CLIPS @ \$6.00	NECESSARY	48.00
	LESS 10% DISCOUNT		-153.30
			1,379.70
SPECIAL NETT ITEMS			
1	FRT NUMBER PLATE (SN)	CRACKED	35.00
1	FRT NUMBER PLATE BASE (SN)	DEFORMED	85.00
			120.00
LABOUR			
	REPLACE ACCIDENT DAMAGE PART.		250.00
	SPRAY PAINTING DAMAGE PARTS.		250.00
	REMOVE & REFIT FRONT REVERSE SENSOR.		60.00
			560.00
GRAND TOTAL			2,059.70
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			1,650.00

Report Ref No. CS3/SPF18022678/R1vbs2

MRB

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,
MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

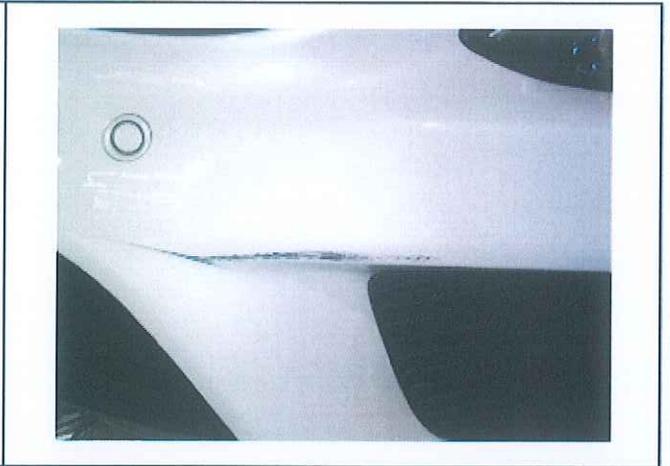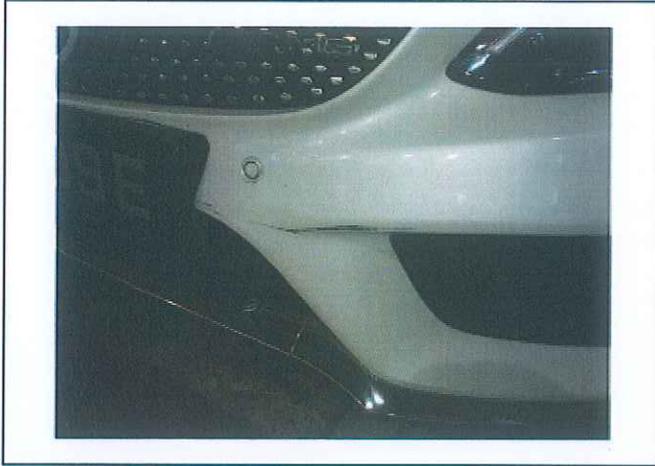




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

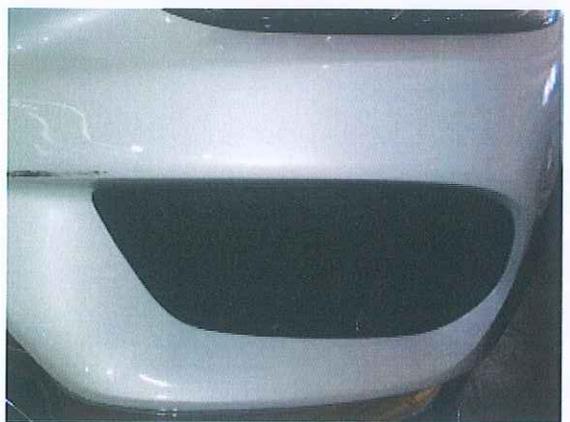




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

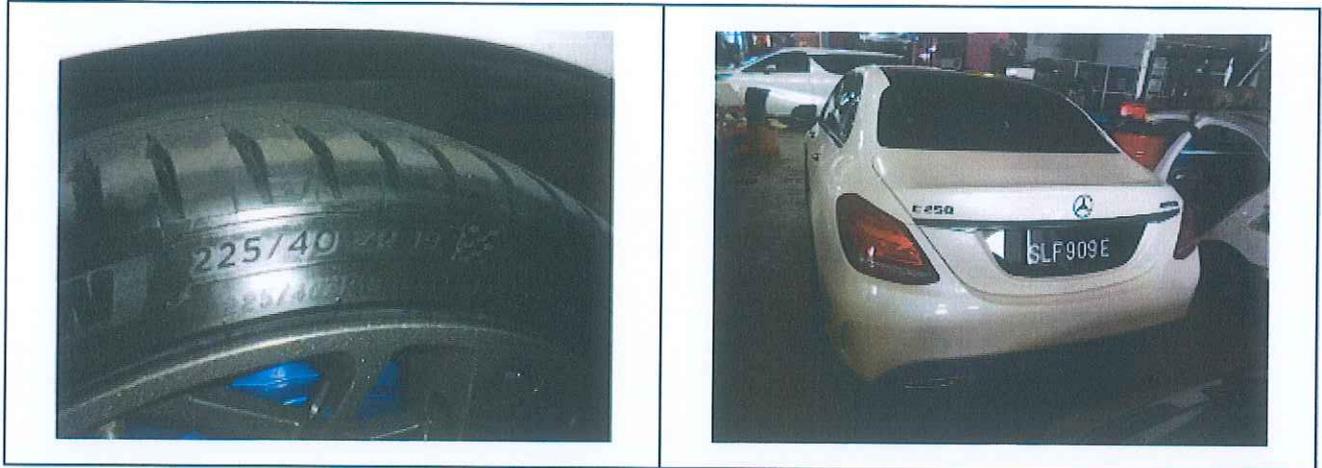



LKK Auto Consultants Pte Ltd







51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLF 909E

RE-INSPECTION

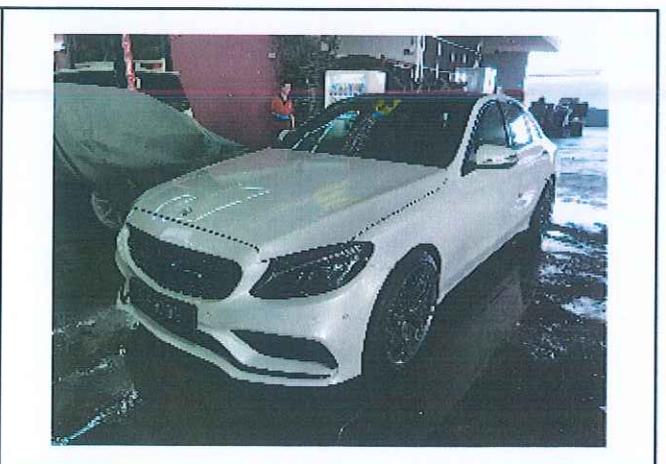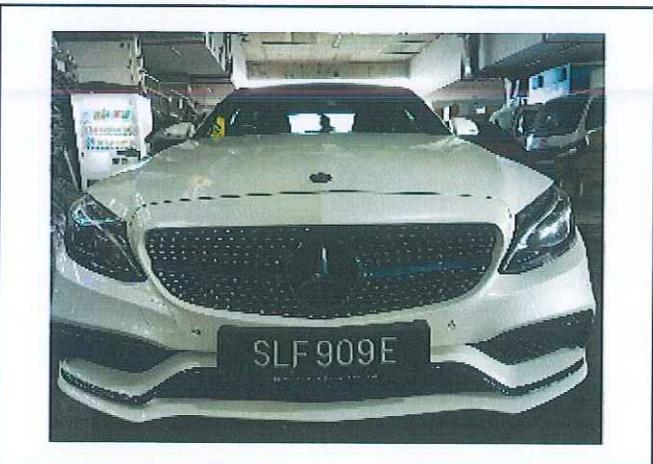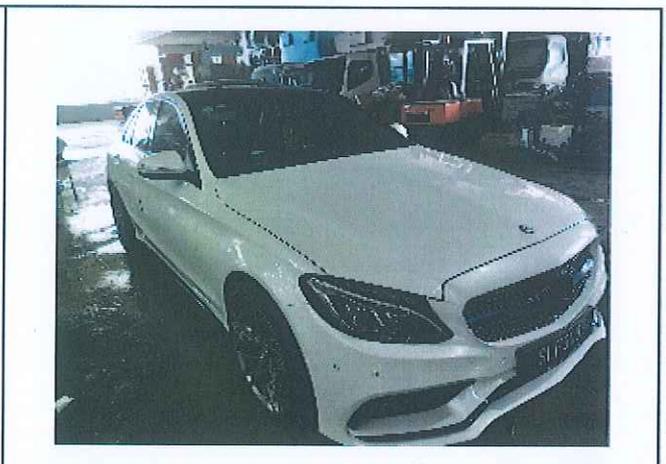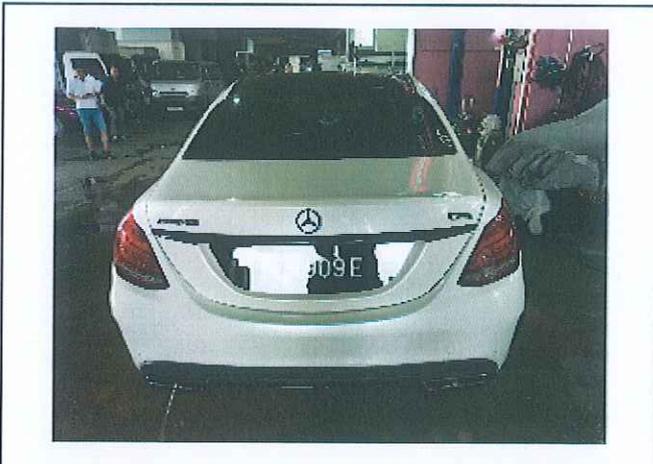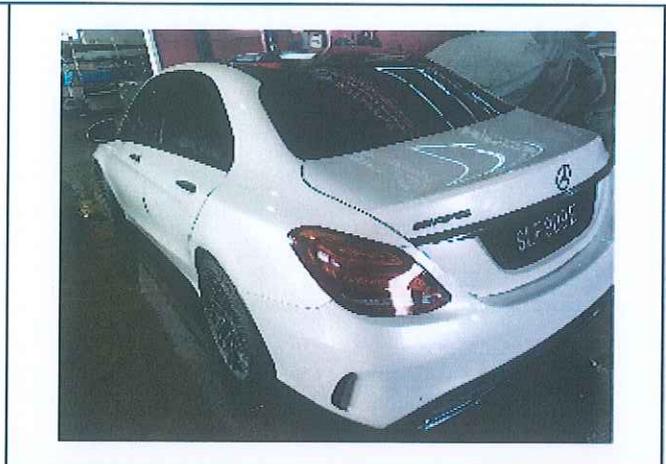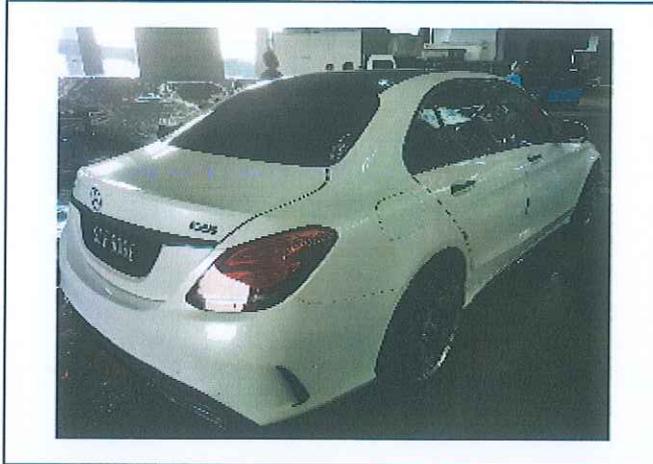



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

