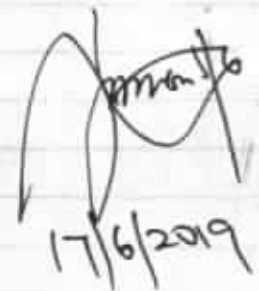


CS3/III19006386/71vd3-1  
 ASSIGNMENT (Office)  
 From (Person): Stanley Kai  
 Date/Time: 29/05/2019  
 Estimated Cost: III  
 To Inspect Vehicle For: SFH GOLEY  
 at Workshop: V-teeh Auto  
 of: 1500n Lee Street #06-04/07  
 Policy No: SH 8082Y  
 Claim No: 6264 6211  
 Date/Time: 08/04/2019  
 Date/Time: 3:11pm 01/04/19  
 Person Contacted: MS-Chong  
 Vehicle: 81/0117

Date/Time	Action/Instruction (X) Estimate
	SFH GOLEY-X
	SH 8082Y-X
	Dismantle: 11/4/2019 0439pm

19/6/19 Submit LS \$7750 (Red 1850, 1990)

  
 17/6/2019

RECEIVED 19 JUN 2019

439 8200, 12 days

Taufik

III

CoE 2024 Jan

2009 Jan

SFH6018Y

Type: All Car / Motorcycle / Van / Bus / Lorry / Boat / Private Motor

Truck / Trailer or

Handle Fit

1339

Make:

Pink

or Brand: All / All / All

Color:

102697

or Color: Brand: All / All / All

or Reading:

Length:

GE61131301

Width:

Van / Car / Motor / All / (Pass / Boat)

Steering: Locked / Jammed / Leaked / Burnt or

Brake: Locked / Jammed / Leaked / Burnt or

Model: All / (Pass / STD ARB or

Type: All

F:

R:

95/55R15

BS / DUN / EXNOVA / GY / ES / LAZA / MIG / OTECH / PIR / SAMI /

TOYO / YOKO or

Maxxis

Front

Rear

Left

Right

Left

Right

DOA:

DOA

Carney held at

10/4/196445x

Dir. of Damages: Frt / Rear / Qtr / Hgt / Wgt / Roof / or

(for Wgt / Chassis frame / Body Structure affected due to collision)

1. Name of Insured: WONG HUI SUI / CHIAI SUI / WAI / WAI

2. Address: 100, 100, 100

3. Phone: 100, 100

4. E-mail:

5. Business:

6. Occupation:

7. Date of Birth:

8. Date of Death:

9. Date of Marriage:

10. Date of Divorce:

11. Date of Issuance:

12. Remarks: The vehicle had commenced its repair at the time of inspection.

\$ 28K.

13. Date of Next Visit:

Completed? Yes or No

14. Date of Next Visit:

Completed? Yes or No

15. Date of Next Visit:

Completed? Yes or No

16. Date of Next Visit:

Completed? Yes or No

17. Date of Next Visit:

Completed? Yes or No

18. Date of Next Visit:

PRC

19. Date of Next Visit:

Vehicle: B1000

20. Date of Next Visit:

21. Date of Next Visit:

Range & Days

913000 - 915000 in 14 days

Rebate 912135

22. Date of Next Visit:

☐

Probi. Report

23. Date of Next Visit:

☐

Final Report

24. Date of Next Visit:

Days Of Repair:

Resurvey No. of Trip:

1

Summary Form

Warranty Form

1. Date of Trip:

2. Date of Trip:

3. Date of Trip:

4. Date of Trip:

5. Date of Trip:

Add For:

☐

Take Trip: 15

☐

Intercept: 15

☐

Force Trip: 15

☐

Warranty: 15

Report Form:

PRC

1. Date of Next Visit:

120

10

120

## Nivitha (LKK Auto)

---

**From:** Stanley Lai <stanley.lai@iii.com.sg>  
**Sent:** Wednesday, 29 May 2019 6:02 PM  
**To:** admin-d@lkkauto.com; 'sur@lkkauto.com'  
**Cc:** Sherini Pillai; Mekavathanan Sarangapani; Hsiao Tong (chewht@lkkauto.com); Olivia Lau (olivialau@lkkauto.com)  
**Subject:** RE: MCt19040266

Dear Sir/Mdm,

Rights granted in Merimen for the above LOD. Kindly proceed with the paper survey.

TP Veh No. : SFH6018Y

Warmest regards,  
Stanley Lai  
**Motor Claims Department**  
**India International Insurance Pte Ltd**  
64 Cecil Street #04-02 IOB Building  
Singapore 049711  
Tel: 6347 6100 Ext 206 Fax: 6224 4174  
*S&P 'A-' rated Company*



---

**From:** Mekavathanan Sarangapani  
**Sent:** Tuesday, 28 May, 2019 2:19 PM  
**To:** Hsiao Tong (chewht@lkkauto.com) <chewht@lkkauto.com>; Olivia Lau (olivialau@lkkauto.com) <olivialau@lkkauto.com>  
**Cc:** Sherini Pillai <sherini@iii.com.sg>; Stanley Lai <stanley.lai@iii.com.sg>  
**Subject:** MCt19040266

Paper survey please : 2008 vehicle

Claiming thru TP lawyers 10K ??

Meka

**Nivitha (LKK Auto)**

---

**From:** Do-Not-Reply <do-not-reply@merimen.com>  
**Sent:** Wednesday, 29 May 2019 7:00 PM  
**To:** sur@lkkauto.com; assignments@lkkauto.com  
**Subject:** Incoming New Document for SFH6018Y

This mail is associated with :  
**\*SFH6018Y (MCT19040266)**  
**[SH8082T]**  
TP  
TOY CAR  
Apr 8 2019 6:00PM  
[-]  
V-Tech Auto Service

The following new document(s) has been shared with you by India International Insurance for SFH6018Y :

- Letter of Demand from Third Party

This is an auto-generated email. Do not reply to this email.

Sent by : Sherini Pillai (India International Insurance Pte Ltd)



This email has been checked for viruses by AVG antivirus software.  
[www.avg.com](http://www.avg.com)

MCH/9040266.

## RESERVES\*

TPPD

V-Tree

PRESERVE

8k

460.00

TPPI

C/R

PRESERVE

3k

UNINSURED LOSS

No - one

PRESERVE

SUBRO

PRESERVE

LPPN

R.S

INVESTIGATION FEE

SURVEY FEES

LEGAL FEES

OTHERS

FRAUD CHECK

UPLOAD TO MERIMEN

GRANT RIGHTS

\*\*\*\*\*  
 \*\*\* TX REPORT \*\*\*  
 \*\*\*\*\*

TRANSMISSION OK

TX/RX NO 0825  
 RECIPIENT ADDRESS 85385368  
 DESTINATION ID  
 ST. TIME 18/05 13:07  
 TIME USE 00'32  
 PAGES SENT 2  
 RESULT OK



# JusEquity Law Corporation

**ADVOCATES & SOLICITORS - COMMISSIONER FOR OATHS**

171 Chin Swee Road #02-06, CES Centre Singapore 169677  
 Telephone (65) 6536 9339, Fax: (65) 6536 5388 (Litigation & Conveyancing)  
 Email: claims@juseq.com.sg website: www.juseq.com.sg



Our Ref: JEQ/190279/0419/NT (zl)

Your Ref: SH8082T

14 May 2019

**WITHOUT PREJUDICE**

**INDIA INTERNATIONAL INSURANCE PTE LTD**  
 64 Cecil Street #04/05  
 IOB Building  
 Singapore 049711

BY HAND

**COMFORT TRANSPORTATION PTE LTD**

383 Sin Ming Drive  
 GAS Building  
 Singapore 575717

**BY CERTIFICATE OF POSTING**

Dear Sirs

Our Ref:

Name:

Address:

Indemnity International Insurance Co.

MCT/19040266

Shen Jie P

16/5/2019

**PROPERTY DAMAGE CLAIM ARISING FROM ACCIDENT INVOLVING VEHICLES SFH6018Y & SH8082T AT MARINA BOULEVARD ON 08.04.2019**

SHA2607C.

We act for TOY CAR, the owner of motor vehicle no. SFH6018Y, in his claim for damages as a result of the above accident.

We are instructed that on the 8 April 2019, the driver of your insured motor vehicle no. SH8082T so negligently drove, managed and controlled the said motor vehicle that he caused or permitted the same to collide into our client's vehicle.

The said collision was solely caused by the negligence of the driver of your insured motor vehicle no. SH8082T.

As a result of the said collision, our client has suffered loss and damage which are set out hereunder



# JusEquity Law Corporation

**ADVOCATES & SOLICITORS - COMMISSIONER FOR OATHS**

171 Chin Swee Road #02-06, CES Centre Singapore 169677  
Telephone (65) 6536 9339, Fax : (65) 6536 5386 (Litigation & Conveyancing)  
Email : claims@juseq.com.sg website : www.juseq.com.sg



Our Ref: JEQ/190279/0419/VT (zi)

Your Ref: SH8082T

14 May 2019

**WITHOUT PREJUDICE**

**INDIA INTERNATIONAL INSURANCE PTE LTD**

**BY HAND**

64 Cecil Street #04/05

IOB Building

Singapore 049711

**COMFORT TRANSPORTATION PTE LTD**


**BY CERTIFICATE OF POSTING**

383 Sin Ming Drive

GAS Building

Singapore 575717

Dear Sirs

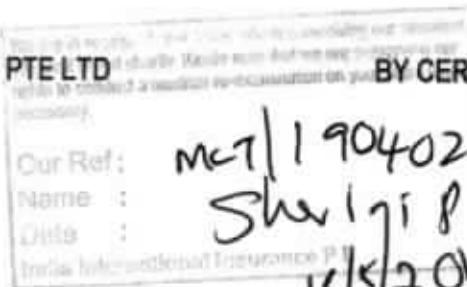

**PROPERTY DAMAGE CLAIM ARISING FROM ACCIDENT INVOLVING VEHICLES SFH6018Y & SH8082T AT MARINA BOULEVARD ON 08.04.2019**

**SHA2607C.**

We act for TOY CAR, the owner of motor vehicle no. SFH6018Y, in his claim for damages as a result of the above accident.

We are instructed that on the 8 April 2019, the driver of your insured motor vehicle no. SH8082T so negligently drove, managed and controlled the said motor vehicle that he caused or permitted the same to collide into our client's vehicle.

The said collision was solely caused by the negligence of the driver of your insured motor vehicle no. SH8082T.

As a result of the said collision, our client has suffered loss and damage which are set out hereunder as follows: -

A	Damages		
	a. Cost of repairs	\$	10,272.00
	b. Loss of use (14+2 days @ 80.00 per day)	\$	1,280.00

**CONFIDENTIALITY CAUTION**

This message is intended only for the use of the individual or entity to whom it is addressed and contains information that is privileged and confidential. If you, the reader of this message, are not the intended recipient, you should not disseminate, distribute or copy this communication. If you have received this communication in error, please notify us immediately by telephone and return the original message to us at the above address at our expense. Thank you.

B	Disbursements		
	a. Search Fees / LTA / GIA (at this stage)	\$	50.49
	b. Automobile Inspection Report	\$	500.00
C	Cost with GST (at this stage)	\$	1,070.00

We enclose herewith copies of the following documents in support of our client's claim: -

- a) GIA report lodged by the driver of our client's vehicle;
- b) GIA search and document invoice for SH8082T & SHA2607L;
- c) Certificate of our client's vehicle insurance;
- d) Our letter dated 10 April 2019 to 3<sup>rd</sup> party and his insurers;
- e) LTA search result for SH8082T;
- f) Repair invoice from V-Tech Auto Service;
- g) Automobile Inspection Report & Invoice from Aeon Auto Consultants LLP;
- h) Thirty-eight (38) pages colour / non-colour photographs depicting the damage to our client's motor vehicle.

We had on 10 April 2019 notified you / your insurer of the accident, and a pre-repair survey of our client's vehicle was carried out.

Please note that if you are insured and you wish to claim under your insurance policy, you should immediately pass this letter and all enclosed documents to your insurer.

Please note that you as insurers / owner should send to us an acknowledgement of receipt of this letter within 14 days of your receipt of this letter, failing which our client will have no alternative but to commence proceedings against your insured(s) / you without further notice to you.

Please also note that if you have a counterclaim against our clients arising out of the accident, you are also required to send to us a letter giving full particulars of the counterclaim together with all relevant supporting documents within 8 weeks of your receipt of this letter.

Yours faithfully



Encl.

> Back to OneMotoring

### Enquire PARF/COE Rebate for Registered Vehicle

<b>Vehicle Owner Particulars</b>	
Owner ID Type:	Business
Owner ID:	3907A
<b>Vehicle Details</b>	
Vehicle No.:	SFH6018Y
Vehicle to be Exported:	No
Intended Deregistration Date:	23 Apr 2019
Vehicle Make:	HONDA
Vehicle Model:	FIT 1.3G A
Primary Colour:	Pink
Manufacturing Year:	2008
Engine No.:	L13A4144912
Chassis No.:	GE61131301
Maximum Power Output:	73.0 kW (97 bhp)
Open Market Value:	\$14,770.00
Original Registration Date:	20 Jan 2009
First Registration Date:	20 Jan 2009
Transfer Count:	3
Actual ARF Paid:	\$14,770.00
<b>Intended PARF Rebate Details</b>	
PARF Eligibility:	Forfeited
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
<b>Intended COE Rebate Details</b>	
COE Expiry Date:	19 Jan 2024
COE Category:	A - Car (1600cc & below)
COE Period(Years):	5
PQP Paid:	\$13,024.00
COE Rebate Amount:	\$12,344.00
Total Rebate Amount:	\$12,344.00
<b>Message</b>	
Please note that the 5-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 23 Apr 2019

OK

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT	
Date Of Report	09/04/2019 17:12
Date Of Accident	08/04/2019 18:30
Exact Location Of Accident	MARINA BOULEVARD
Country/State of Loss	SINGAPORE
DETAILS OF OWN VEHICLE	
Vehicle Registration Number	SFH6018Y
<b>Insured/Policyholder</b>	
Name Of Registered Owner	TOY CAR
Co Reg No	52883907A
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-91823146
<b>Vehicle Particulars</b>	
Manufacturer	HONDA
Model	FIT
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	COMMERCIAL VEHICLE
<b>Insurance Company</b>	
Name of Insurance Company	NTUC INCOME INSURANCE CO-OPERATIVE LTD
Type Of Coverage	THIRD PARTY
Fleet Policy	NO
Policy Number	5103395423
Cover Note Number	
<b>Driver</b>	
Name of Driver	MOHAMED SHAHRIM BIN ABDUL KARIM
NRIC No	S8313502F
Date Of Birth	24/04/1983
Occupation	INDOOR
Date Of Driving Pass	27/09/2006
Driving Experience	12 YEARS AND 6 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-91823146
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	BLK 168 WOODLANDS STREET 11 #02-111
Postcode	730168
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

#### General information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

#### Other information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	3
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

#### Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

REFER TO ATTACHMENT

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SH8082T
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	TAXI
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

#### DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SHA2607L
-----------------------------	----------

Vehicle Make/Model/Colour

Details Of Properties

Vehicle Category

TAXI

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

## Sketch Plan

### SKETCH PLAN

#### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firm, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be based outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims;
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated; or
  - (ii) for complying with requirements under any regulations, laws or court orders.


  
Policyholder's Signature  
Date: / /

  
Authorized Driver's Signature  
(If different from Policyholder)  
Date: / /

  
Reporting Centre Personnel's Signature  
Name: \_\_\_\_\_  
ID Card No.: \_\_\_\_\_

# Sketch Plan #2

## SKETCH PLAN

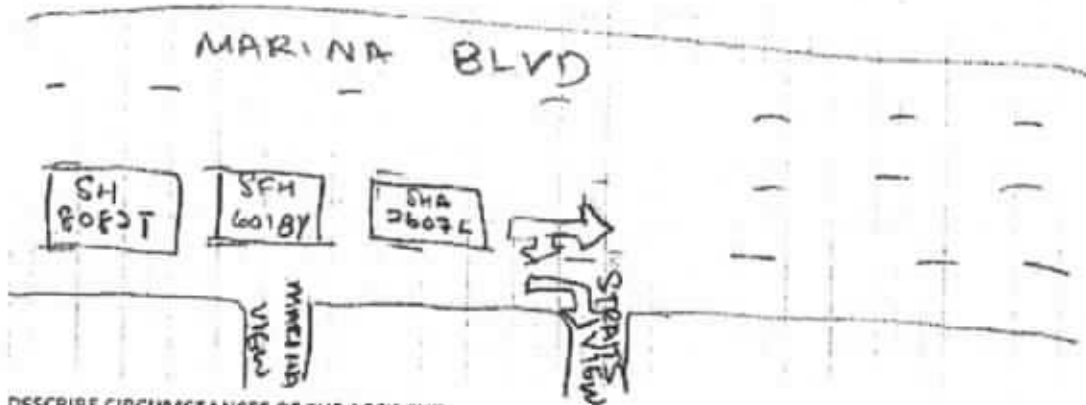

## DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I (SFH 6018Y) WAS TRAVELLING ALONG MARINA BLVD APPROACHING STRAITS VIEW WHEN SHA 2607L SLOWED DOWN AND Halted I FOLLOW SUIT AS I HALTED MY VEHICLE SH 8082T CRASHED ON TO MY REAR BUMPER, DUE TO THE IMPACT MY VEHICLE CRASHED IN TO SHA 2607L REAR BUMPER. NOBODY IS INJURED.

DECLARATION

I/We declare that the foregoing particulars are true in every respect.

Police Officer's Signature  
Date & Time

Driver's Signature  
(if driver is not the police officer)  
Date & Time

Report Officer's Signature  
Name  
NR123456



RECORDS MANAGEMENT CENTRE

**GENERAL INSURANCE ASSOCIATION OF SINGAPORE**

**RECORDS MANAGEMENT CENTRE**

6 Raffles Quay #18-00, Singapore 048580

Phone: +65 6224 0010 Fax: +65 6224 0030

Operating Hours: Monday to Friday 9am to 5pm

GST Registration No: M400017735

**TAX INVOICE**

Our Ref No: GR-19-056383

Date of Request: 10/04/2019

Your Ref No: 190279-VT

JusEquity Law Corporation  
No. 171 Chin Swee Road,  
#02-06 CES Centre  
Singapore 169877

Dear Sir/Madam,

**Your Search Criteria:**

Date of Accident: 08/04/2019

Place of Accident: MAINA BOULEVARD

Client Vehicle No: SFH6018Y

DESCRIPTION	AMOUNT (S\$)
E-File Search Fee (Public)	14.02
GST Amount	0.98
Total Amount Due (GST Inclusive)	15.00

Thank You.

This is a computer generated document and requires no signature.

---

For GIARMC Official use:

Date:

☒ GIRO ☐ Cash ☐ Cheque

## TAX INVOICE

Our Ref No: GR-19-056404

Date of Request: 10/04/2019

Your Ref No: 190279-VT

JusEquity Law Corporation  
No. 171 Chin Swee Road,  
#02-06 CES Centre  
Singapore 169877

Dear Sir/Madam,

Date of Accident: 08/04/2019

Vehicle No: SFH6018Y

Place of  
Accident: MARINA BOULEVARD

Involving Vehicle  
No: SH8082T

With reference to your application for the accident report, we have attached the following accident reports as requested:

DOCUMENTS	ACCIDENT LOCATION	PER DOC (S\$)	QTY	AMOUNT (S\$)
SH8082T	MARINA BOULEVARD	14.00	1	13.08
GST Amount				0.92
Total Amount Due (GST Inclusive)				14.00

The images provided to you are taken from the original reports forwarded to the centre by the members of the General Insurance Association of Singapore and we take no responsibility for their accuracy or contents and shall be under no liability whatsoever for any loss or damage arising out of or in connection with the reports or their images.

Thank You.

This is a computer generated document and requires no signature.

---

For GIARMC Official use:

Date:

☒ GIRO ☐ Cash ☐ Cheque

## TAX INVOICE

Our Ref No: GR-19-056403

Date of Request: 10/04/2019

Your Ref No: 190279-VT

JusEquity Law Corporation  
No. 171 Chin Swee Road,  
#02-06 CES Centre  
Singapore 169877

Dear Sir/Madam,

Date of Accident: 08/04/2019

Vehicle No: SFH6018Y

Place of  
Accident: MARINA BOULEVARD

Involving Vehicle  
No: SHA2607L

With reference to your application for the accident report, we have attached the following accident reports as requested:

DOCUMENTS	ACCIDENT LOCATION	PER DOC (S\$)	QTY	AMOUNT (S\$)
SHA2607L	MARINA BOULEVARD	14.00	1	13.08
GST Amount				0.92
Total Amount Due (GST Inclusive)				14.00

The images provided to you are taken from the original reports forwarded to the centre by the members of the General Insurance Association of Singapore and we take no responsibility for their accuracy or contents and shall be under no liability whatsoever for any loss or damage arising out of or in connection with the reports or their images.

Thank You.

This is a computer generated document and requires no signature.

For GIARMC Official use:

Date:

☒ GIRO ☐ Cash ☐ Cheque

## Certificate of Insurance

MOTOR VEHICLES (THIRD PARTY RISKS AND COMPENSATION) ACT (CHAPTER 189)  
MOTOR VEHICLES (THIRD PARTY RISKS AND COMPENSATION) RULES, 1960  
ROAD TRANSPORT ACT, 1987 (MALAYSIA)  
MOTOR VEHICLES (THIRD PARTY RISKS) RULES, 1959 (MALAYSIA)

**Certificate Number:** 5103395423

**Cover :** Third Party

1. Index mark and Registration Number of Vehicle : SFH6018Y  
Chassis Number : GE61131301
2. Name of Policyholder : TOY CAR
3. Effective Date of Insurance : 02 Nov 2018
4. Expiry Date of Insurance : 01 Nov 2019
5. Persons or Classes of Persons entitled to drive#  
(a) The Policyholder.  
(b) Any other person who is driving on the Policyholder's order or with his/her permission.  
Provided that the person driving is permitted in accordance with the licensing or other laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from driving the Motor Vehicle.
6. Limitations as to Use#  
(a) Use for social domestic and pleasure purposes and in connection with the Policyholder's or Hirer's business.

**This Policy does not cover**

- (a) Use for racing, pace-making, reliability trial or speed-testing.
- (b) Use for the carriage of goods (other than samples) in connection with any trade or business.
- (c) Use for any purpose in connection with the Motor Trade.

# Limitations rendered inoperative by Section 8 of the Motor Vehicle (Third Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

EXCESS (SECTION 1)	: N/A
EXCESS (SECTION 2)	: S\$1,500
ADDITIONAL EXCESS	: N/A
UNNAMED DRIVER EXCESS	: N/A
REPAIR AT OWNER'S PREFERRED WORKSHOP	: NO
INSURE WITH COE	: N/A
NCD PROTECTION	: NO
PRIMARY DRIVER	: N/A
NAMED DRIVER (1)	: N/A
NAMED DRIVER (2)	: N/A
HIRE PURCHASE COMPANY	: N/A
SUM INSURED	: N/A

I/We hereby Certify that the Policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia)

Agency : AUTOSHIELD PTE. LTD. (00000573469)  
Date of Issue : 28 Aug 2018 15:28 hrs

For NTUC INCOME INSURANCE CO-OPERATIVE LIMITED



Countersigned By:

Authorised Officer



Chief Executive



# JusEquity Law Corporation

**ADVOCATES & SOLICITORS • COMMISSIONER FOR OATHS**

171 Chin Swee Road #02-06, CES Centre, Singapore 169877  
Telephone: (65) 6536 9339, Fax: (65) 6536 5368 (Litigation)  
Email: [claims@juseq.com.sg](mailto:claims@juseq.com.sg) website: [www.juseq.com.sg](http://www.juseq.com.sg)

Our Ref: JEQ/190279/0419/ VT

Your Ref: **SH8082T**

10 April 2019

**COMFORT TRANSPORTATION PTE LTD**  
383 SIN MING DRIVE  
GAS BUILDING  
SINGAPORE 575717

**By Post Only**

**India International Insurance Pte Ltd**  
Singapore

**By Email:**  
[motorclaim@iii.com.sg](mailto:motorclaim@iii.com.sg)

Dear Sir

**ACCIDENT INVOLVING SFH6018Y & SH8082T ON 8-4-2019**

We act for the owner of vehicle no. SFH6018Y.

We hereby notify you of a road traffic accident on **8 April 2019** at about **1830 hrs**, at Marina Boulevard involving our client's vehicle and vehicle registration no. **SH8082T** driven by you / your insured at the material time. A copy of our client's accident report is enclosed.

As a result of the accident, our client's vehicle has been damaged. Before our client proceeds to repair the damaged vehicle, please let us know within 2 working days of your receipt of this notice whether you would like to conduct a pre-repair survey of the vehicle. If we do not receive any reply from you within the stipulated timeline, our client shall proceed to repair the vehicle without further reference to you.

Yours faithfully

Encl.

CONFIDENTIALITY CAUTION

This message is intended only for the use of the individual or entity to whom it is addressed and contains information that is privileged and confidential. If you, the reader of this message, are not the intended recipient, you should not disseminate, distribute or copy this communication. If you have received this communication in error, please notify us immediately by telephone and return the original message to us at the above address at our expense. Thank you.

## Enquire Vehicle & Owner Information ( Vehicle No. SH8082T As At 08 Apr 2019 / 18:30:00 )

### Law Firm Search Details

Search Reason: Insurance claim in relation to traffic accident

Law Firm Case No.: VT

### Current Owner Details

Owner ID Type: Company

Owner ID: 199303821R

Owner Name: COMFORT TRANSPORTATION PTE LTD

Registered Address Type: Private Residential (Condo Apt or House) / Shopping / Office Complexes

Registered Block/House No.: 383

Registered Street Name: SIN MING DRIVE

Registered Unit No.: -

Registered Building Name: GAS BUILDING

Registered Postal Code: 575717

### Current Vehicle Details

Vehicle No.: SH8082T

Make Description/Model: TOYOTA / PRIUS HYBRID 1.8 CVT

Insurance Company Name: INDIA INT'L INS PTE LTD



# V-TECH AUTO SERVICE

No.1 Soon Lee St #06-04/05/06/07 Pioneer Centre Singapore 627605  
Tel: 62646211, 62646222 Fax: 62646233 Email: vtech.autoservice@gmail.com  
Reg. 52949633W, GST Reg No. M90354098A 24 HRS TOWING SERVICES  
Website: <http://vtechauto.com.sg>

## Tax Invoice

Date	Invoice
06-May-2019	2019-1199

Bill To
TOY CAR 60 Jalan Lam Huat #03-42 Carros Centre (S) 737869 Kelvin Wong 97683998 kel9118@gmail.com

Ship To
SFH 6018 Y H/Fit


Rep	Terms	Due Date
CTF	Cash-GST	06-May-2019

Item	Description	Qty	Rate	Amount
Insurance Clai...	The repair has agreed to undertake the repair under a Lump Sum Basis. We Have further adjusted the amount to a Lump Sum Repair contract of:	1	9,600.00	9,600.00T

--

<b>Subtotal</b>	\$9,600.00
<b>GST (7.0%)</b>	\$672.00
<b>Total</b>	\$10,272.00
<b>Payments/Credits</b>	\$0.00
<b>Balance Due</b>	<b>\$10,272.00</b>

Payment Must Be Made Within 30 days. A 1.5% Per Month Late  
Payment Interest Will Be Levied For All Overdue Invoices.  
This is computer generated document.  
No signature is required.



## INVOICE

TO : TOY CAR  
C/O: V-TECH AUTO SERVICE  
NO.1 SOON LEE STREET#06-04/05  
PIONEER CENTRE  
SINGAPORE 627605

Invoice No.: 419/VT127  
Date: 30-Apr-2019

### PARTICULARS

Vehicle Registration No.: SFH 6018 Y  
Date of Loss: 08-Apr-2019  
Date of Assessment: 10-Apr-2019

### SERVICES

### FEES

1. Assessment with report Photographs -  
Including films, developing, storage and Transport.

\$500.00

**TOTAL** \$500.00

**SINGAPORE DOLLARS FIVE HUNDRED ONLY**

We would appreciate your cheque crossed and made payable to:  
"AEON AUTO CONSULTANTS LLP" with our invoice no. written on the back of the cheque.

**AEON AUTO CONSULTANTS LLP**



### **AEON AUTO CONSULTANTS LLP**

50 Chin Swee Road #09-04 Thong Chai Building Singapore 169874  
Telephone +65 97687958 Facsimile +65 68264112 Email [amas@aeonac.com](mailto:amas@aeonac.com)  
Reg. No. LLD701273L (registered with limited liability)

## AUTOMOBILE ASSESSMENT REPORT

TO: TOY CAR  
C/O: V-TECH AUTO SERVICE  
NO.1 SOON LEE STREET#06-04/05  
PIONEER CENTRE  
SINGAPORE 627605

Our Reference: 419/VT127  
Date: 30-Apr-2019

### ASSESSMENT OF VEHICLE NO. SFH 6018 Y

DATE OF LOSS: 08-Apr-2019

We have carried out a physical assessment at V-TECH AUTO SERVICE,  
No. 1 Soon Lee Street #06-04/05 Pioneer Centre Singapore 627605, according to your instruction  
on 10-Apr-2019 and are pleased to submit our report herewith.

### 1. VEHICLE PARTICULARS

Registration No.: SFH 6018 Y  
Make & Model: HONDA FIT 1.3G A  
Year of Registration: 2009  
Engine Capacity: 1339  
Chassis No.: GE61131301  
Model No.: L13A4144912  
Colour: PINK

### 2. VEHICLE CONDITION

Body Paint: GOOD  
Steering: SERVICEABLE  
Foot Brake: SERVICEABLE  
Parking Brake: SERVICEABLE  
Modification: NIL

### 3. TYRE PARTICULARS & CONDITION


Front  
RH Make/Size/Thread: FALKEN 195/55 R15 – 70%  
LH Make/Size/Thread: FALKEN 195/55 R15 – 70%  
Rear  
RH Make/Size/Thread: FALKEN 195/55 R15 – 70%  
LH Make/Size/Thread: FALKEN 195/55 R15 – 70%

#### 4. DESCRIPTION OF DAMAGE

At the time of the inspection, the vehicle sustained damages to the FRONT and REAR portion.

#### 5. REMARKS

Market Value:	Na
Salvage Value:	Na
Repair Limit:	Na
Estimated Amount:	\$15,962.92
Adjusted Amount:	\$12,023.16
Lump Sum:	<b>\$9,600.00</b>
Estimated Repair Days:	14 days

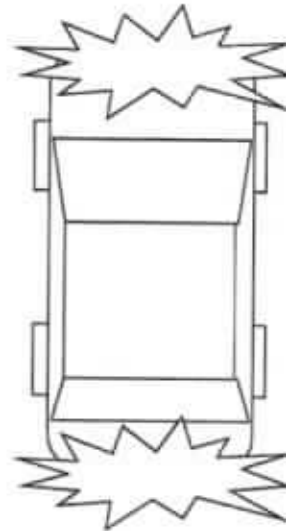

Pursuant to your instruction, we have **NOT AUTHORISED** repair.

The assessment was conducted on a "**Without Prejudice**" basis.

If we are not notified of anything to the contrary within **14 days** from the date hereof, this report shall be treated as correct.

#### Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by Aeon Auto Consultants LLP for any reliance on this report by any third party.

### ASSESSMENT REPORT FOR VEHICLE NO. SFH 6018 Y

#### ARTS (LIST ITEMS)

Qty	Description	Condition	Workshop's Estimate	Our Assessment
1	FRONT BONNET	Bent	416.90	416.90
2	FRONT BONNET HINGES L/R	Bent	59.60	RY 59.60
1	FRONT BONNET MECHANISM LOCK	Bent	126.80	126.80
4	FRONT BONNET RUBBER GUIDE STOPPER	Bent	46.00	NYX 46.00 Δ
1	FRONT BONNET WEATHER STRIP	Cut	8.00	8.00
1	FRONT GRILLE	Cracked	137.50	137.50
1	FRONT GRILLE 'LOGO' EMBLEM	Necessary	34.65	34.65
4	FRONT GRILLE CLIPS	Necessary	26.00	26.00
2	FRONT HEADLAMP L/R	Cracked	1,170.00	1,170.00
4	FRONT HEADLAMP CLIPS	Necessary	26.00	26.00
1	FRONT BUMPER	Cracked	503.00	503.00
2	FRONT BUMPER CORNER RETAINER L/R	Bent	81.00	81.00
1	FRONT BUMPER LOWER GRILLE	Cracked	150.80	150.80
1	FRONT BUMPER LOWER RUBBER MOULDING	Cracked	105.00	105.00
1	FRONT BUMPER REINFORCEMENT	Bent	222.20	222.20
2	FRONT BUMPER SIDE RETAINER L/R	Bent	40.50	40.50
1	FRONT BUMPER TOWING COVER	Necessary	35.20	35.20
2	FRONT FENDER L/R	Repair	733.20	-
1	AIRCON CONDENSFR	Bent	483.70	483.70
1	AIRCON COOLING PIPE	Bent	91.60	91.60
1	AIRCON DISCHARGE PIPE	Repair	155.00	-
2	AIRCON LOWER MOUNTING L/R	Bent	23.00	23.00
1	AIRCON RECEIVER DRYER PIPE	Repair	125.20	-
1	AIRCON SUCTION PIPE	Repair	160.00	-
2	AIRCON TOP MOUNTING L/R	Bent	21.00	21.00
1	FRONT WIPER WASHER MOTOR	Repair	162.50	-
1	FRONT WIPER WASHER TANK	Repair	45.80	-
1	REAR TAILGATE	Bent	708.00	708.00
1	REAR TAILGATE 'TIT' EMDLCM	Necessary	52.00	52.00
1	REAR TAILGATE 'LOGO' EMBLEM	Necessary	44.00	44.00
2	REAR TAILGATE DAMPER L/R	Bent	326.00	NYX 326.00 Δ
2	REAR TAILGATE HINGES L/R	Bent	148.00	RY 148.00
1	REAR TAILGATE INNER HANDLE	Repair	41.20	-
1	REAR TAILGATE INNER TRIM BOARD	Cracked	202.00	NYX 202.00
1	REAR TAILGATE LOCK STRIKER	Bent	11.50	11.50

**ASSESSMENT REPORT FOR VEHICLE NO. SFH 6018 Y**

1	REAR TAILGATE MECHANISM LOCK	Bent	309.00	309.0
1	REAR TAILGATE NUMBER PLATE LAMP GARNISH	Cracked	171.90	171.9
4	REAR TAILGATE NUMBER PLATE LAMP GARNISH CLIPS	Necessary	26.00	26.0
2	REAR TAILGATE NUMBER PLATE LAMP L/R	Cracked	91.00	91.0
1	REAR TAILGATE OUTER HANDLE	Cracked	171.00	171.0
4	REAR TAILGATE RUBBER GUIDE STOPPER	Bent	42.00	42.0
1	REAR TAILGATE WEATHER STRIP	Cut	138.00	138.0
1	REAR TAILGATE WINDSCREEN MOULDING	Necessary	135.00	135.0
1	REAR TAILGATE WIPER ARM	Repair	23.20	-
1	REAR TAILGATE WIPER BLADE	Repair	48.00	-
1	REAR TAILGATE WIPER COVER	Repair	9.50	-
1	REAR TAILGATE WIPER MOTOR	Faulty	238.00	238.0
1	REAR LH TAILLAMP	Repair	236.00	-
1	REAR RH TAILLAMP	Cracked	236.00	236.0
2	REAR TAILLAMP CLIPS	Necessary	13.00	13.0
2	REAR TAILLAMP PANEL L/R	Repair	356.00	-
1	REAR RH FENDER	Repair	626.70	-
2	REAR FENDER AIR VENT L/R	Bent	78.00	78.0
2	REAR FENDER INNER SHIELD L/R	Cracked	64.40	64.4
6	REAR FENDER INNER SHIELD CLIPS	Necessary	39.00	39.0
2	REAR FENDER INNER TRIM BOARD L/R	Cracked	367.80	367.8
1	REAR BUMPER	Cracked	516.00	516.0
2	REAR BUMPER CORNER RETAINER L/R	Bent	33.00	33.0
2	REAR BUMPER SIDE RETAINER L/R	Bent	40.40	40.4
1	REAR BUMPER TOWING COVER	Cracked	18.00	18.0
1	REAR END PANEL INNER TOP GARNISH	Cracked	155.00	155.0
4	REAR END PANEL INNER TOP GARNISH CLIPS	Necessary	26.00	26.0
1	REAR END PANEL	Bent	296.80	296.8
1	REAR RH SUB CHASSIS FRAME	Repair	330.00	-
1	REAR TOWING PANEL	Bent	124.00	124.0
1	SPARE TYRE PANEL TOP CARD BOARD WITH UPHOLSTERY	Bent	242.00	242.0
1	SPARE TYRE PANEL SPONGE COMPARTMENT	Bent	242.40	242.4
2	SPARE TYRE SIDE PANEL L/R	Repair	373.40	-
1	SPARE TYRE PANEL	Repair	737.00	-
1	REAR EXHAUST ALUMINIUM HEAT SHIELD	Repair	112.00	-
3	REAR EXHAUST RUBBER MOUNTING	Bent	66.00	66.0
1	REAR EXHAUST SILENCER BOX	Bent	446.80	446.8

	13,901.15	9,626.4
Less 20% discount	2,780.23	1,925.2
Parts Total:	11,120.92	7,701.2

8276.90  
6621.52

### ASSESSMENT REPORT FOR VEHICLE NO. SFH 6018 Y

#### **SPECIAL NETT ITEMS**

1	FRONT BUMPER CLIPS - SET	Necessary	30.00	30.00
1	FRONT BUMPER NUMBER PLATE	Bent	25.00	25.00
1	FRONT BUMPER NUMBER PLATE GARNISH	Cracked	50.00	50.00
1	REAR TAILGATE INNER TRIM BOARD CLIPS - SET	Necessary	30.00	30.00
1	REAR TAILGATE NUMBER PLATE	Bent	25.00	25.00
1	REAR TAILGATE NUMBER PLATE GARNISH	Cracked	50.00	50.00
1	REAR TAILGATE WINDSCREEN SEALANT	Necessary	80.00	80.00
1	REAR RH TAILLAMP BULB	Necessary	12.00	12.00
2	REAR FENDER INNER TRIM BOARD CLIPS L/R - SET	Necessary	60.00	60.00
1	REAR BUMPER CLIPS - SET	Necessary	30.00	30.00
1	REAR BUMPER REVERSE SENSOR - SET	Cracked	350.00	350.00
Special Nett Total :			742.00	742.00

#### **ABOUT**

S/N	Description	Workshop's Estimate	Our Assessment
1	To provide towing charge(3 trips), scene-wkshop,wkshop-idac,idac-wkshop.	150.00	150.00
2	To remove, reinstall electrical wiring harness, check lighting and rewire for parking sensor.	140.00	120.00
3	To remove, reinstall top trim upholstery, cushion seat, trim garnish, trim liner carpet.	140.00	120.00
4	To remove, change air con parts, vacuums, refill air con gas.	180.00	160.00
5	To remove, reinstall tailgate windscreen.	150.00	130.00
6	To remove and change exhaust silencer box with pipe, re-align where consistent to the accident.	120.00	100.00
7	To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident.	1,400.00	1,200.00
8	To provide labour, workmanship to change the above damaged bodyparts, repair, re-construct and re-align body structure, body alignments and damaged consistent to the accident.	1,700.00	1,500.00
9	To apply anti-rust chemical on repaired and replaced panel.	120.00	100.00
Labour Total :		4,100.00	3,580.00
<b>TOTAL (PARTS &amp; LABOUR) \$</b>		<b>15,962.92</b>	<b>12,023.16</b>

The workshop has agreed to undertake the repair on a Lump Sum basis.

The final adjusted Lump Sum contract amount is

**\$9,600.00**

**(SINGAPORE DOLLARS NINE THOUSAND SIX HUNDRED ONLY)**



Amas Ong  
Automobile Assessor




## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
INDIA INTERNATIONAL INSURANCE PL		Ref : CS3/III19006386/T1vd3e2-1	
64 CECIL STREET #05-02 IOB BUILDING SINGAPORE 049711		Date : 19-06-2019	
		Code : III2	
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>			
Insured Veh.	SH 8082T	Veh. Inspected	SFH 6018Y
Policy No.		Coverage (\$)	0.00
Claim No.	MCT19040266	Excess (\$)	0.00
Assign From	STANLEY LAI	Assign Date	29/05/2019
<b>2. Vehicle Particulars &amp; Condition</b>			
Make & Model	HONDA FIT	c.c	1339
Engine No.	HIDDEN	Year of Reg.	2009
Chassis No.	GE61131301	Colour	PINK
Odometer	102697	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
<b>3. Conditions of Tyres</b>			
	Size	Make	Balance
R/H Front Tyre	195/55 R15	MAXXIS	6 mm
L/H Front Tyre	195/55 R15	MAXXIS	6 mm
R/H Rear Tyre	195/55 R15	MAXXIS	6 mm
L/H Rear Tyre	195/55 R15	MAXXIS	6 mm
<b>4. Description of Damages</b>			
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.			
<b>5. General Information</b>			
Accident Date	08/04/2019	Inspection Date	10/04/2019
Survey held at	V-TECH AUTO SERVICE No.1 SOON LEE STREET #06-04/05/06/07 PIONEER CENTRE SINGAPORE 627605		
<b>5a. Remarks</b>			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
<b>5b. Estimate Days of Repair</b>			
ESTIMATED NORMAL PERIOD FOR REPAIR:		12 Working Days	



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SFH 6018Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>REPLACEMENT OF PARTS</b>			
1	FRONT BONNET	BENT	416.90	416.90
2	FRONT BONNET HINGES L/R	TO REPAIR SEE LABOUR	59.60	-
1	FRONT BONNET MECHANISM LOCK	BENT	126.80	126.80
4	FRONT BONNET RUBBER GUIDE STOPPER	NOT NECESSARY	46.00	-
1	FRONT BONNET WEATHERSTRIP	CUT	8.00	8.00
1	FRONT GRILLE	CRACKED	137.50	137.50
1	FRONT GRILLE 'LOGO' EMBLEM	NECESSARY	34.65	34.65
4	FRONT GRILLE CLIPS	NECESSARY	26.00	26.00
2	FRONT HEADLAMP L/R	CRACKED	1,170.00	1,170.00
4	FRONT HEADLAMP CLIPS	NECESSARY	26.00	26.00
1	FRONT BUMPER	CRACKED	503.00	503.00
2	FRONT BUMPER CORNER RETAINER L/R	BENT	81.00	81.00
1	FRONT BUMPER LOWER GRILLE	CRACKED	150.80	150.80
1	FRONT BUMPER LOWER RUBBER MOULDING	CRACKED	105.00	105.00
1	FRONT BUMPER REINFORCEMENT	BENT	222.20	222.20
2	FRONT BUMPER SIDE RETAINER L/R	BENT	40.50	40.50
1	FRONT BUMPER TOWING COVER	NECESSARY	35.20	35.20
2	FRONT FENDER L/R	TO REPAIR SEE LABOUR	733.20	-
1	AIRCON CONDENSER	BENT	483.70	483.70
1	AIRCON COOLING PIPE	BENT	91.60	91.60
1	AIRCON DISCHARGE PIPE	TO REPAIR SEE LABOUR	155.00	-
2	AIRCON LOWER MOUNTING L/R	BENT	23.00	23.00
1	AIRCON RECEIVER DRYER PIPE	TO REPAIR SEE LABOUR	125.20	-
1	AIRCON SUCTION PIPE	TO REPAIR SEE LABOUR	160.00	-
2	AIRCON TOP MOUNTING L/R	BENT	21.00	21.00
1	FRONT WIPER WASHER MOTOR	TO REPAIR SEE LABOUR	162.50	-

Report Ref No. CS3/III19006386/T1vd3e2-1



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT WIPER WASHER TANK	TO REPAIR SEE LABOUR	45.80	-
1	REAR TAILGATE	BENT	708.00	708.00
1	REAR TAILGATE 'FIT' EMBLEM	NECESSARY	52.00	52.00
1	REAR TAILGATE 'LOGO' EMBLEM	NECESSARY	44.00	44.00
2	REAR TAILGATE DAMPER L/R	NOT NECESSARY	326.00	-
2	REAR TAILGATE HINGES L/R	TO REPAIR SEE LABOUR	148.00	-
1	REAR TAILGATE INNER HANDLE	TO REPAIR SEE LABOUR	41.20	-
1	REAR TAILGATE INNER TRIM BOARD	NOT NECESSARY	202.00	-
1	REAR TAILGATE LOCK STRIKER	BENT	11.50	11.50
1	REAR TAILGATE MECHANISM LOCK	BENT	309.00	309.00
1	REAR TAILGATE NUMBER PLATE LAMP GARNISH	NOT NECESSARY	171.90	-
4	REAR TAILGATE NUMBER PLATE LAMP GARNISH CLIPS	NOT NECESSARY	26.00	-
2	REAR TAILGATE NUMBER PLATE LAMP L/R	NOT NECESSARY	91.00	-
1	REAR TAILGATE OUTER HANDLE	NOT NECESSARY	171.00	-
4	REAR TAILGATE RUBBER GUIDE STOPPER	BENT	42.00	42.00
1	REAR TAILGATE WEATHERSTRIP	CUT	138.00	138.00
1	REAR TAILGATE WINDSCREEN MOULDING	NECESSARY	135.00	135.00
1	REAR TAILGATE WIPER ARM	TO REPAIR SEE LABOUR	23.20	-
1	REAR TAILGATE WIPER BLADE	TO REPAIR SEE LABOUR	48.00	-
1	REAR TAILGATE WIPER COVER	TO REPAIR SEE LABOUR	9.50	-
1	REAR TAILGATE WIPER MOTOR	NOT NECESSARY	238.00	-
1	REAR LH TAILLAMP	TO REPAIR SEE LABOUR	236.00	-
1	REAR RH TAILLAMP	CRACKED	236.00	236.00
2	REAR TAILLAMP CLIPS	NECESSARY	13.00	13.00
2	REAR TAILLAMP PANEL L/R	TO REPAIR SEE LABOUR	356.00	-
1	REAR RH FENDER	TO REPAIR SEE LABOUR	626.70	-
2	REAR FENDER AIR VENT L/R	BENT	78.00	78.00

Report Ref No. CS3/III19006386/T1vd3e2-1



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR FENDER INNER SHIELD L/R	CRACKED	64.40	64.40
6	REAR FENDER INNER SHIELD CLIPS	NECESSARY	39.00	39.00
2	REAR FENDER INNER TRIM BOARD L/R	O/S CRACKED / N/S NOT NECESSARY	367.80	183.90
1	REAR BUMPER	CRACKED	516.00	516.00
2	REAR BUMPER CORNER RETAINER L/R	BENT	33.00	33.00
2	REAR BUMPER SIDE RETAINER L/R	BENT	40.40	40.40
1	REAR BUMPER TOWING COVER	CRACKED	18.00	18.00
1	REAR END PANEL INNER TOP GARNISH	CRACKED	155.00	155.00
4	REAR END PANEL INNER TOP GARNISH CLIPS	NECESSARY	26.00	26.00
1	REAR END PANEL	BENT	296.80	296.80
1	REAR RH SUB CHASSIS FRAME	TO REPAIR SEE LABOUR	330.00	-
1	REAR TOWING PANEL	BENT	124.00	124.00
1	SPARE TYRE PANEL TOP CARD BOARD WITH UPHOLSTERY	NOT NECESSARY	242.00	-
1	SPARE TYRE PANEL SPONGE COMPARTMENT	BENT	242.40	242.40
2	SPARE TYRE SIDE PANEL L/R	TO REPAIR SEE LABOUR	373.40	-
1	SPARE TYRE PANEL	TO REPAIR SEE LABOUR	737.00	-
1	REAR EXHAUST ALUMINIUM HEAT SHIELD	TO REPAIR SEE LABOUR	112.00	-
3	REAR EXHAUST RUBBER MOUNTING	BENT	66.00	66.00
1	REAR EXHAUST SILENCER BOX	BENT	446.80	446.80
	LESS 20% DISCOUNT		-2,780.23	-1,544.21
			11,120.92	6,176.84
<b><u>SPECIAL NETT ITEMS</u></b>				
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	FRONT BUMPER NUMBER PLATE (SN) }	BENT	25.00	45.00
1	FRONT BUMPER NUMBER PLATE GARNISH (SN) }	CRACKED	50.00	-
1	SET REAR TAILGATE INNER TRIM BOARD CLIPS (SN)	NECESSARY	30.00	30.00
1	REAR TAILGATE NUMBER PLATE (SN)	NOT NECESSARY	25.00	-
1	REAR TAILGATE NUMBER PLATE GARNISH (SN)	NOT NECESSARY	50.00	-
1	REAR TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	80.00	50.00

Report Ref No. CS3/III19006386/T1vd3e2-1



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR RH TAILLAMP BULB (SN)	NOT NECESSARY	12.00	-
2	SET REAR FENDER INNER TRIM BOARD CLIPS L/R (SN)	NECESSARY	60.00	40.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	CRACKED	350.00	200.00
			742.00	425.00
	<b>LABOUR</b>			
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL.		120.00	50.00
	TO PROVIDE TOWING CHARGE (3 TRIPS), SCENE-WKSHOP, WKSHOP-IDAC IDAC-WKSHOP.		150.00	60.00
	TO REMOVE, REINSTALL ELECTRICAL WIRING HARNESS, CHECK LIGHTING AND REWIRE FOR PARKING SENSOR.		140.00	30.00
	TO REMOVE, REINSTALL TOP TRIM UPHOLSTERY, CUSHION SEAT, TRIM GARNISH, TRIM LINER CARPET.		140.00	60.00
	TO REMOVE, CHANGE AIR CON PARTS, VACUUMS, REFILL AIR CON GAS.		180.00	100.00
	TO REMOVE, REINSTALL TAILGATE WINDSCREEN.		150.00	120.00
	TO REMOVE AND CHANGE EXHAUST SILENCER BOX WITH PIPE, RE-ALIGN WHERE CONSISTENT TO THE ACCIDENT.		120.00	80.00
	TO RE-SPRAY PAINTING ON THE CHANGED BODYPARTS, REPAIR PORTION, AND WEHRE CONSISTENT TO THE ACCIDENT.		1,400.00	1,200.00
	TO PROVIDE LABOUR, WORKMANSHIP TO CHANGE THE ABOVE DAMAGED BODYPARTS, REPAIR, RE-CONSTRUCT AND RE-ALIGN BODY STRUCTURE, BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT. INCLUSIVE OF THE REPAIR OF FRONT BONNET HINGES L/R, FRONT FENDER L/R, AIRCON DISCHARGE PIPE, AIRCON RECEIVER DRYER PIPE, AIRCON SUCTION PIPE, FRONT WIPER WASHER MOTOR, FRONT WIPER WASHER TANK, REAR TAILGATE HINGES L/R, REAR TAILGATE INNER HANDLE, REAR TAILGATE WIPER ARM, REAR TAILGATE WIPER BLADE, )		1,700.00	1,400.00



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 5 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REAR TAILGATE WIPER COVER, REAR LH TAILLAMP, REAR TAILLAMP PANEL L/R, REAR RH FENDER, REAR RH SUB CHASSIS FRAME, SPARE TYRE SIDE PANEL L/R, SPARE TYRE PANEL AND REAR EXHAUST ALUMINIUM HEAT SHIELD }		-	-
			4,100.00	3,100.00
GRAND TOTAL			15,962.92	9,701.84
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				7,750.00

Report Ref No. CS3/III19006386/T1vd3e2-1

MOHAMAD TAUFIKH  
M.MATAI, AMSAE-A  
Automotive Assessor

ADRIAN LING WAI PING  
B.Eng, AMSOE, AMIRTE, AMSAE-A, M.MATAI  
Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.  
No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.