

**Sng Ah Tee Motor Pte Ltd**  
**Blk 3 Pioneer Road North,**  
**#01-18,**  
**628457**

**Claim Reference:**  
**Assessment number: SLX9490R-TP-AXA**  
**Version: 1810**  
**Date calculated: 13/06/2019 4:24 PM**

**Full Report**  
**Registration: SLX9490R**  
**Printed: 13/06/2019 4:24 PM**

---

## Summary Information

### Claim

Location:	Singapore (SG)	Work Provider:	AXA Insurance Pte Ltd
Printed by:	DARREN SNG	Currency:	SGD
Claim Reference:		Date of Incident:	21/02/18
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

---

## Vehicle Details

### Vehicle

Manufacturer:	MERCEDES-BENZ
Model:	C-CLASS (W205)
Sub Model:	C 180
Model Sheet Number:	03 AP 42
Registration:	SLX9490R
VIN number:	WDD2050402R352644
Odometer:	

### Model Specs

FR PRODUCTION START	EQUIPMENT AVANTGARDE	EQUIPMENT AVANTGARDE	MODEL 2018
A/C THERMATIC	MIRROR PACKAGE	DIPPING MIRROR	ELECT FOLDING MIRROR
FRT COLLISION ALARM	KEYLESS IGNITION SYS	KEYLESS GO	REARVIEW CAMERA
AUDIO 20 TOUCHPAD	RADIO-CD/DVD	WIPER/RAIN SENSOR	INTERIOR LAMP PACK
LED HEADLAMP	LEATHER PAD ARTICO	FOLDING REAR SEAT	ELEC DRIVER SEAT MEM
PASSENGER SEAT MEMOR	STORAGE PACKAGE	ALU MOULDINGS	PARK ASSISTENT
KEYLESS GO	ELECTRIC BOOTLID	ILLUMINAT AMBIENTE	BOOTLID SENSORS
AMG SILL MOULDINGS	HD COOLING	ECO START/STOP	AGILITY SELECT SWITC
AUTOMATIC 9-SPEED	TYRE PRESSURE SENSOR	AGILITY CONTR SUSPEN	CRUISE CONTROL
TYRES 225/50 WR 17	WHEELS 7J X 17 ALLOY	TYRE W/FLAT RUNNING	EXTENDED FUEL TANK
PEDESTRIAN PROTECT	PRODUCT SOUTH AFRICA	TWO COAT METALLIC	CLEAR COAT HARD
PREP MAP PILOT			

**Sng Ah Tee Motor Pte Ltd**  
**Blk 3 Pioneer Road North,**  
**#01-18,**  
**628457**

**Claim Reference:**  
**Assessment number: SLX9490R-TP-AXA**  
**Version: 1810**  
**Date calculated: 13/06/2019 4:24 PM**

**Full Report**  
**Registration: SLX9490R**  
**Printed: 13/06/2019 4:24 PM**


## Vehicle Condition

### Vehicle Status

Pre-Accident Damage:  
Date of Inspection:

### Damage Areas

All ☐  
Underbody ☐

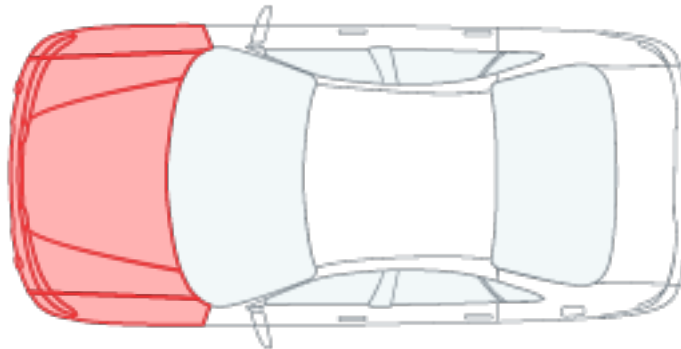

## Labour

Code	Description	Time Base 10 WU/h	Price = 45.00 SGD/h	
			WU	Price SGD
54-1011 01	SHORT TEST INCLUDES: CONNECT + DISCONNECT STAR DIAGNOSIS, PRINT DATA, DELETE ERROR MEMORY		3.0	13.50
54-7989 01	R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)		3.0	13.50
54-0650 01	MAIN BOARD MAINTAINED (FOR CHECK AND DIAGNOSIS WORK)		1.0	4.50
61-1086 01	R + R FRONT AND CENTRE ENGINE COMPARTMENT COVERING		3.0	13.50
88-1102 01	R + R FRONT BUMPER CPL		9.0	40.50
88-1148 02	DIS + ASS FRONT BUMPER (BUMPER REMOVED) AFTER CHECK: RENEW PARTS IF NECESSARY		7.0	31.50

**Sng Ah Tee Motor Pte Ltd**  
**Blk 3 Pioneer Road North,**  
**#01-18,**  
**628457**

**Claim Reference:**  
**Assessment number: SLX9490R-TP-AXA**  
**Version: 1810**  
**Date calculated: 13/06/2019 4:24 PM**

**Full Report**  
**Registration: SLX9490R**  
**Printed: 13/06/2019 4:24 PM**

Code	Description	WU	Price SGD
88-1358 01	ADDITION TO DIS + ASS FRONT BUMPER (BUMPER REMOVED) (VEHICLE WITH ULTRASONIC PARKING AID)	2.0	9.00
88-1374 01	ADDITION TO FRONT BUMPER DIS + ASS (VEHICLE WITH PEDESTRIAN PROTECT)	1.0	4.50
82-4710 01)	R + R LEFT HEADLAMP (BUMPER REMOVED/DETACHED)	3.0	13.50
82-4886 01	ADDITIONAL TO RENEW HEADLAMP (VEHICLE WITH LED HEADLAMP)	3.0	13.50
54-0800 ZAX	CHECK REARVIEW CAMERA	1.0	4.50
82-1120 01	ADJUST HEADLAMPS	5.0	22.50
<b>Labour Cost</b>		<b>Hrs</b>	<b>WU</b>
<b>Panel / Mechanical Labour</b>		<b>4.10</b>	<b>41.0</b>
<b>Total of Labour</b>			<b>184.50</b>

**Paint**

Paint Work		SYSTEM AZT		Time Basis 10WU/h	
Code	Description - TWO COAT METALLIC	WU	Price SGD		
	FRONT BUMPER COVER NEW PART PAINT K1R	11.0			

**Paint Material Per Part**

Code	Description	Price SGD
0283	FRONT BUMPER COVER NEW PART PAINT K1R	54.61

<b>Labour Cost - Paint</b>		<b>Hrs</b>	<b>WU</b>	<b>Price SGD</b>
Factor		45.00 SGD/h		
Time Paint			11.0	
Preparation Comp. Work Plastic		0.90	9.0	40.50
<b>Total</b>		<b>10 WU/h</b>	<b>2.00</b>	<b>90.00</b>

<b>Material Cost - Paint</b>		<b>Price SGD</b>
New Part Painting - Plastic K1R		54.61
Material-constant Plastic		16.20
<b>Total</b>		<b>70.81</b>

**Sng Ah Tee Motor Pte Ltd**  
**Blk 3 Pioneer Road North,**  
**#01-18,**  
**628457**

**Claim Reference:**  
**Assessment number: SLX9490R-TP-AXA**  
**Version: 1810**  
**Date calculated: 13/06/2019 4:24 PM**

**Full Report**  
**Registration: SLX9490R**  
**Printed: 13/06/2019 4:24 PM**

**Spare Parts**

				prices as at 2015-06-01
Code	Description	Part Number	Supplier	Price SGD
0283	FRONT BUMPER COVER	205 880		<b>670.00</b>
		0340649999		
0343	L/F BUMPER CARRIER	205 885 0565		<b>37.00</b>
0561	LEFT HEADLAMP ASSY	205 906 7503		<b>1,380.00</b>
f: OEM Parts	<b>Savings</b>			<b>0.00</b>
n: Non-OEM Parts	<b>Subtotal</b>			<b>2,087.00</b>
u: Used parts	<b>Addition(+15.00%)</b>			<b>313.05</b>
	<b>Total</b>			<b>2,400.05</b>

**Final Calculation**

	SGD	SGD
<b>Parts</b>	2,087.00	
Addition(+15.00%)	313.05	
<b>Total Parts</b>		<b>2,400.05</b>
<b>Labour Time Base 10 WU/h</b>		
Total 41.0 WU X 45.00 SGD/h	184.50	
<b>Total of Labour</b>		<b>184.50</b>
<b>Paint Work Time Base 10 WU/h</b>		
Labour Cost 20.0 WU X 45.00 SGD/h	90.00	
Material Cost	70.81	
<b>Total Paint Including Material</b>		<b>160.81</b>
<b>Repair Cost Excludes GST</b>		<b>2,745.36</b>
GST (+7.0%)		<b>192.18</b>
<b>Repair Cost Included GST</b>		<b>2,937.54</b>

**Sng Ah Tee Motor Pte Ltd  
Blk 3 Pioneer Road North,  
#01-18,  
628457**

**Claim Reference:**

**Assessment number: SLX9490R-TP-AXA**

**Version: 1810**

**Date calculated: 13/06/2019 4:24 PM**

**Full Report**

**Registration: SLX9490R**

**Printed: 13/06/2019 4:24 PM**

---

**Comments**

\* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS