LKK Auto Consultants #01-25 Paya Ubi Industrial Park, 51 **Ubi Avenue 1** 408933

Insurer Reference: Full Report

Repairer Reference: 190302 **Registration: ED2626B**

Date calculated: 28/07/2020 10:05 AM Printed: 28/07/2020 10:05 AM

Summary Information

Claim

Location: Work Provider: Singapore (SG) AXA Insurance Pte Ltd

Currency: Printed by: KK LAU SGD Claim Reference: Date of Incident: 03/06/19

Estimated Repair Time: Hire Car Start: Hire Car End: Actual Repair Days:

Vehicle Details

Vehicle

Manufacturer: TOYOTA Model: PRIUS V Sub Model: **BASE MODEL** Model Sheet Number: 70 A4 01 Registration: ED2626B

VIN number: Odometer: **Model Specs**

FROM 10.2018 LED HEADLAMP FOG LAMPS PREPARE OFF VEHICLE

TWO COAT PEARL/MICA


Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

AII **Underbody**

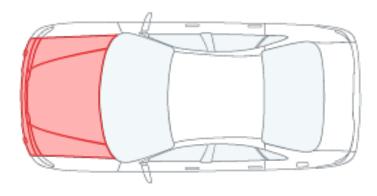

Labour

	Time Base 10 WU/h	Price = 45.00 SGD/h	
Code	Description	WU	Price SGD
190011)	DETACH + REFIT BATTERY CABLE INCLUDES: R + R BOOT STORAGE BOX AND NECESSARY ATTACHED PARTS	2.0	9.00
NO NUMBER	R + R FRONT LOWER ENGINE COVER	1.0	4.50
B010)	R + R FRONT BUMPER	7.0	31.50
B020)	RENEW FRONT BUMPER (BUMPER REMOVED) INCLUDES: R + R RADIATOR GRILLE, FRONT FOG LAMPS AND NECESSARY ATTACHED PARTS	13.0	58.50
	Labour Cost Panel / Mechanical Labour	Hrs WU 2.30 23.0	103.50
	Total of Labour		103.50

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT PEARL/MICA	WU Price SGI
	FRONT BUMPER NEW PART PAINT K1R	12.0
	R/F BUMPER COVER SURFACE PAINT PLAST.	3.0
	LOWER FRONT SPOILER SURFACE PAINT PLAST.	4.0
	L/F WING SURFACE PAINT	6.0

Paint Material Per Part

Code	Description	Price SGD
0283	FRONT BUMPER NEW PART PAINT K1R	55.10
0278	R/F BUMPER COVER SURFACE PAINT PLAST.	0.73
0330	LOWER FRONT SPOILER SURFACE PAINT PLAST.	4.03
0741	L/F WING SURFACE PAINT	10.21

Labour Cost - Paint		Hrs	WU	Price SGD
Factor	45.00 SGD/h			
Time Paint			25.0	
Preparation Main Work Metal		0.50	5.0	22.50
Preparation Comp. Work Plastic		1.50	15.0	67.50
Total	10 WU/h	4.50	45.0	202.50

Material Cost - Paint	Price SGD
New Part Painting - Plastic K1R	55.10
Surface-/Blend Paint	10.21
Surface Painting Plastic	4.76
Material-constant Metal	9.00
Material-constant Plastic	25.05
Total	104.12

Spare Parts

			р	rices as at 201	5-06-01/01
Code	Description	Part Number	Part Source		Price SGD
0283 0253	FRONT BUMPER FRONT LWR AIR GRILLE	52119 47969 53102 47180	Original Original		550.00 240.00
f: OEM Parts n: Non-OEM Parts u: Used parts	Savings Subtotal Addition(+10.00%)				0.00 790.00 79.00
	Total				869.00
Final Calculat	ion				
				SGD	SGD
Parts Addition(+10.0 Total Parts	00%)			790.00 79.00	869.00
Labour Time Base 10 WU/h Total 23.0 WU X 45.00 SGD/h Total of Labour			103.50	103.50	
	ne Base 10 WU/h 5.0 WU X 45.00 SGD/h uding Material			202.50 104.12	306.62
Repair Cost Exc	_				1,279.12
GST (+7.0%) Repair Cost Incl					89.54 1,368.66

Comments

* - USER SUPPLIED DATA NN - NO MANUFACTURERS CODE EXISTS) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.