

K.Kim Hin Auto Pte Ltd
160 Sin Ming Drive, #02-20, Sin
Ming AutoCity
575722

Claim Reference:
Assessment number: 190322
Version: 1810
Date calculated: 21/06/2019 4:31 PM

Full Report
Registration: SDK6776A
Printed: 21/06/2019 4:31 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	MSIG Insurance (Singapore) Pte Ltd
Printed by:	SANDRA KHONG	Currency:	SGD
Claim Reference:		Date of Incident:	30/05/19
Estimated Repair Time:	14	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	FORD
Model:	MUSTANG (CZG)
Sub Model:	BASE MODEL
Model Sheet Number:	02 CP 01
Registration:	SDK6776A
VIN number:	1FA6P8TH9G5286908
Odometer:	

Model Specs

FROM 02/2016	LIGHT-/RAIN SENSOR	NOISE CONTROL SYS	NAVIGAT SYSTEM FORD
FORD SYNC 2	RADIO DIGITAL	FOG LAMPS	REMOTE START SYSTEM
FRONT SEATS AIR CON	ELECTRIC FRONT SEAT	EQUIPMENT BASE	ANTI-THEFT ALARM
INTERIOR LIGHT LED	REAR PARKING SYSTEM	REARVIEW CAMERA	2.3 LTR 231/233 KW
6-SPEED GEARBOX	ACTIVE BONNET	ADAPTIVE SUSPENSION	CRUISE CONTROL
TYRES 255/40 YR 19	WHEELS 9J X 19 ALLOY	ALU PEDAL	2-DOOR (COUPE)
SILL MOULDINGS ALU	LWR GRILLE PAINTED	PREPARE OFF VEHICLE	TWO COAT PEARL/MICA

K.Kim Hin Auto Pte Ltd
160 Sin Ming Drive, #02-20, Sin
Ming AutoCity
575722

Claim Reference:
 Assessment number: 190322
 Version: 1810
 Date calculated: 21/06/2019 4:31 PM

Full Report
 Registration: SDK6776A
 Printed: 21/06/2019 4:31 PM


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
 Date of Inspection:

Damage Areas

All ☐
 Underbody ☐

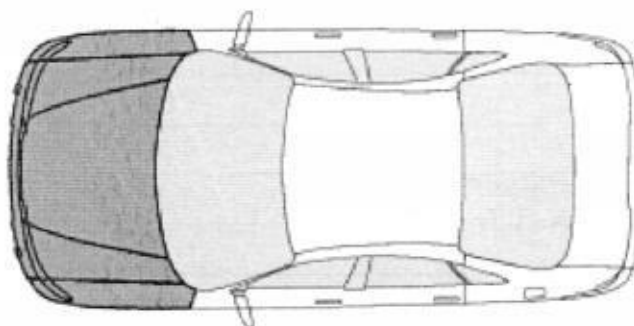

Labour

Code	Description	Time Base 10 WU/h	Price = 50.00 SGD/h	
			WU	Price SGD
43 427 4	RENEW FRONT BUMPER (REMOVED)		6.0	30.00
32 116 1	R + R BOTH HEADLAMPS INCLUDES: REMOVE AND REFIT FRONT BUMPER. NOT INCLUDED: ADJUST HEADLAMPS		11.0	55.00
40 697 1	R + R AIRBAG SENSOR		1.0	5.00
32 116 5	RENEW BOTH HEADLAMPS (REMOVED)		1.0	5.00
32 113 1	ADJUST HEADLAMPS		1.0	5.00
44 263 3	R + R FRONT LOCK CARRIER		10.0	50.00
44 274 2	R + R FRONT BUMPER CROSSMEMBER		3.0	15.00
44 252 2	R + R LEFT FRONT WING (FRT BUMPER AND L/HEADLAMP REMOVED) INCLUDES: L/F WHEELHOUSE COVER AND L/SILL MOULDING R + R.		9.0	45.00
44 253 2	R + R RIGHT FRONT WING (FRT BUMPER AND R/HEADLAMP REMOVED) INCLUDES: R/F WHEELHOUSE COVER AND		9.0	45.00

K.Kim Hin Auto Pte Ltd
160 Sin Ming Drive, #02-20, Sin
Ming AutoCity
575722

Claim Reference:

Assessment number: 190322

Version: 1810

Date calculated: 21/06/2019 4:31 PM

Full Report

Registration: SDK6776A

Printed: 21/06/2019 4:31 PM

Code	Description	WU	Price SGD
44 214 0	R/SILL MOULDING R + R. REPLACE BONNET INCLUDES: REMOVE/REFIT BONNET; FIT AND SET CLEARANCES; REFIT PARTS	11.0	55.00
41 232 1	R + R BONNET LOCK	1.0	5.00
NO NUMBER	REMOVE/REFIT LH BONNET HINGE (WITH BONNET REMOVED)	2.0	10.00
NO NUMBER	REMOVE/REFIT RH BONNET HINGE (WITH BONNET REMOVED)	2.0	10.00
NO NUMBER	R + R BONNET OPENER CABLE	1.0	5.00
NO NUMBER	R + R L/BONNET GAS PRESSURE DAMPER	2.0	10.00
NO NUMBER	R + R R/BONNET GAS PRESSURE DAMPER	2.0	10.00
44 030 4	BONNET EDGE SEALANT	2.0	10.00
43 230 1	R + R COWL TRIM INCLUDES: R + R BOTH WIPER ARMS	3.0	15.00
NO NUMBER	R + R LEFT LOWER A-PILLAR TRIM	1.0	5.00
NO NUMBER	R + R L/FR DOOR SILL COVER	1.0	5.00
32 815 1)	R + R HORN	1.0	5.00
43 814 1	R + R CENTRE CONSOLE	5.0	25.00
40 711 1)	R + R KNEE AIRBAG	3.0	15.00
33 514 1	R + R LIGHT SWITCH	1.0	5.00
33 650 1)	R + R AIRBAG MODULE	6.0	30.00
NO NUMBER	ADJUST AIRBAG CONTROL MODULE	1.0	5.00
24 254 1	R + R RADIATOR INCLUDES: CONDENSER, INTERCOOLER, AIR FILTER, AIR INTAKE HOSE R + R COOLANT AND AIR CONDITIONING DRAIN/REFILL	20.0	100.00
NO NUMBER	R + R STEERING COLUMN SWITCH COVER	1.0	5.00
1125	L/F UP W-HOUSE REINF REPAIR	30.0*	150.00
1126	R/F UP W-HOUSE REINF REPAIR	30.0*	150.00
1481	LEFT FRONT DOOR REPAIR	20.0*	100.00
1482	RIGHT FRONT DOOR REPAIR	30.0*	150.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		22.70	227.0
Total of Labour			1,135.00

K.Kim Hin Auto Pte Ltd
160 Sin Ming Drive, #02-20, Sin
Ming AutoCity
575722

Claim Reference:
 Assessment number: 190322
 Version: 1810
 Date calculated: 21/06/2019 4:31 PM

Full Report
 Registration: SDK6776A
 Printed: 21/06/2019 4:31 PM

Paint

Paint Work		Time Basis 10WU/h	
Code	Description - TWO COAT PEARL/MICA	WU	Price SGD
45 786 4	FRONT BUMPER CPL NEW PART PAINT ST 1	8.0	40.00
45 786 4	FRONT BUMPER NEW PART PAINT ST 1	8.0	40.00
LE 0410	FRONT GRILLE NEW PART PAINT ST 1	2.0	10.00
45 352 4	BONNET NEW PART PAINT ST 1	25.0	125.00
45 371 4	L/F WING NEW PART PAINT ST 1	6.0	30.00
45 371 4	R/F WING NEW PART PAINT ST 1	6.0	30.00
45 012 4	FRT LOCK CARRIER INNER PANEL PAINTING	4.0	20.00
45 012 4	FRT BUMPER C-MEMBER INNER PANEL PAINTING	4.0	20.00
45 433 4	LEFT FRONT DOOR REP PAINTING ST IV	27.0	135.00
45 433 4	RIGHT FRONT DOOR REP PAINTING ST IV	27.0	135.00
L 1111	L/F WHEELHOUSE CPL INNER PANEL PAINTING	4.0	20.00
L 1112	R/F WHEELHOUSE CPL INNER PANEL PAINTING	4.0	20.00
L 1125	L/F UP W-HOUSE REINF INNER PANEL PAINTING	4.0	20.00
L 1126	R/F UP W-HOUSE REINF INNER PANEL PAINTING	4.0	20.00
45 000 0	ADD/TIME FOR MAIN WORK	19.0	95.00
45 018 4ZAX	ADDITIONAL TIME PAINTING PLASTIC PARTS	4.0	20.00

Total Paint	Hrs	WU	Price SGD
	15.60	156.0	780.00

Spare Parts

				prices as at 2009-01-01
Code	Description	Part Number	Supplier	Price SGD
0258	FRT NO PLATE REINF	KNPLO		300.00 ✓
0281	FRONT BUMPER CPL	FR3B17C831CAPRA		930.00 ✓
0299	L/BUMPER GRILLE	FR3B17B969AC5YZ!		120.00 x90C
0300	R/BUMPER GRILLE	FR3B17B968AC5YZ!		120.00 x90C
0322	INN BUMPER REINFORCE	FR3B17E898AC		190.00 ?
0323	L/F OUT BUMPER BRKT	FR3B17D959AE		90.00 ?
0324	R/F OUT BUMPER BRKT	FR3B17D958AE		90.00 ?
0330	FRT LWR GRILLE COVER	FR3B8103EA		64.00 ?
0340	UPP RAD GRILLE MLDG	FR3B63001A04AA		50.00 ?
0341	LWR RAD GRILLE MLDG	FR3B63001A04AA		50.00 ?
0342	FR LWR BUMPER GRILLE	FR3B17K945CE5YZ!		165.00 ?

K.Kim Hin Auto Pte Ltd
160 Sin Ming Drive, #02-20, Sin
Ming AutoCity
575722

Claim Reference:

Assessment number: 190322

Version: 1810

Date calculated: 21/06/2019 4:31 PM

Full Report

Registration: SDK6776A

Printed: 21/06/2019 4:31 PM

Code	Description	Part Number	Supplier	Price SGD
0347	FRONT SPOILER	FR3B17F775AB5YZ9		205.00 <i>xSVC</i>
0349	FRONT AIR DEFLECTOR	FR3B6A975BC		265.00 <i>?</i>
0410	FRONT GRILLE	FR3B8200CE5YZ9	<i>dis/bp</i>	255.00 <i>✓</i>
0411	FRONT BONNET SEAL	FR3B16C824AC		140.00 <i>?</i>
0471	BONNET	FR3B16612AT	<i>buc</i>	1,800.00 <i>✓</i>
0475	L/BONNET HINGE	GR3B16801AD	<i>dis</i>	255.00 <i>✓</i>
0476	R/BONNET HINGE	GR3B16800AC	<i>dis</i>	255.00 <i>✓</i>
0477	L/BONNET	GR3B16E600AG	<i>rec</i>	360.00 <i>✓</i>
	PYROELEMENT			
0478	R/BONNET	GR3B16E600AG		360.00 <i>?</i>
	PYROELEMENT			
0481	BONNET INSULATION	GR3B6316738BB		165.00 <i>xSVC</i>
0493	BONNET LOCK	FR3A16700BB		100.00 <i>?</i>
0494	BONNET SAFETY LATCH	FR3B16A944AD		65.00 <i>?</i>
0496	BONNET STAY	FR3B16A931AA		110.00 <i>?</i>
0500	BONNET CABLE	GR3B16B975AD		150.00 <i>xSVC</i>
0509	L/F BONNET STOP	W715246S300		30.00 <i>xSVC</i>
0510	R/F BONNET STOP	W715246S300		30.00 <i>xSVC</i>
0561	LEFT HEADLAMP ASSY	FR3B13035CB	<i>mtg cr</i>	1,560.00 <i>✓</i>
0562	RIGHT HEADLAMP ASSY	FR3B13008CB	<i>mtg cr</i>	1,560.00 <i>✓</i>
0671	L/GAS DISCHARGE LAMP	CM5813N021AA		570.00 <i>xSVC</i>
0672	R/GAS DISCHARGE LAMP	CM5813N021AA		570.00 <i>?</i>
0675	L/HEADLAMP W-HARNESS	FR3B13A006BA		160.00 <i>?</i>
0676	R/HEADLAMP W-HARNESS	FR3B13A006BA		160.00 <i>?</i>
0741	L/F WING	FR3B16006AR	<i>buc/CRA</i>	540.00 <i>✓</i>
0742	R/F WING	FR3B16005AS	<i>buc</i>	540.00 <i>✓</i>
0753	L/F W-HOUSE FRT CVR	FR3B3C329AB		95.00 <i>xSVC</i>
0754	R/F W-HOUSE FRT CVR	GR3B3C071BA		95.00 <i>xSVC</i>
0755	L/F WING INSULATOR	FR3BB28082AA		100.00 <i>?</i>
0756	R/F WING INSULATOR	FR3BB28082AA		100.00 <i>?</i>
0841	L/F WHEELHOUSE COVER	FR3B16A563BE		98.00 <i>xSVC</i>
0842	R/F WHEELHOUSE COVER	FR3B16A562BE		98.00 <i>xSVC</i>
0843	L/CLIP	W714975S300		15.00 <i>?</i>
0844	R/CLIP	W714975S300		15.00 <i>?</i>
0845	L/CLIP	W713610S300		15.00 <i>?</i>
0846	R/CLIP	W713610S300		15.00 <i>?</i>
0930	FRT LOCK CARRIER	FR3B8B041BC	<i>CRA</i>	800.00 <i>✓</i>
1001	FRT BUMPER C-MEMBER	JR3B17750BA		750.00 <i>?</i>

K.Kim Hin Auto Pte Ltd
160 Sin Ming Drive, #02-20, Sin
Ming AutoCity
575722

Claim Reference:
 Assessment number: 190322
 Version: 1810
 Date calculated: 21/06/2019 4:31 PM

Full Report
 Registration: SDK6776A
 Printed: 21/06/2019 4:31 PM

Code	Description	Part Number	Supplier	Price SGD
1033	L/F UPP AIRBAG SENS	FR3T14B006AA		260.00 ?
1034	R/F UPP AIRBAG SENS	FR3T14B006AA		260.00 ?
1035	L/F SHOCK SENSOR	GR3T14B653BA		150.00 ?
1036	R/F SHOCK SENSOR	GR3T14B653BA		150.00 ?
1037	CENTRE IMPACT SENSOR	GR3T14B653AA		150.00 ?
1453	L/F WIPER ARM	GR3B17527BB		500.00 ?
1454	R/F WIPER ARM	GR3B17526BA		430.00 ?
4327	KNEE AIRBAG	GR3B63042A00BB3	burst	2,200.00 ✓
4465	CONDENSER	FR3B19C600AD	BT	800.00 ✓
7440	AIRBAG MODULE	GR3T14B321DF	rec	2,350.00 ✓
7731	L/F AIR DUCT	FR3B8103CH		100.00 ?
7732	R/F AIR DUCT	FR3B8102CD		150.00 ?
7733	L/R AIR DUCT	FR3B8103BC		60.00 ?
7734	R/R AIR DUCT	FR3B8102BB		60.00 ?
7740	GRILL BRACKET	FR3B8472AB		90.00 ?
7756	CTR UPP AIR CHANNEL	FR3B8C291AB		130.00 ?
7757	CTR FRT AIR CHANNEL	FR3Z8326A		160.00 ?
7761	RADIATOR	FR338005AH		1,750.00 x50 ✓
7767	ELECTRIC FAN CPL	FR338C607BD		750.00 x50 ✓
9649	HORN	FR3T13A803DA		200.00 ?
f: OEM Parts				Savings 0.00
n: Non-OEM Parts				Subtotal 25,270.00
u: Used parts				Addition(+10.00%) 2,527.00
Total				27,797.00

Extras

Code	Description	Price SGD
1000	RADIATOR COOLANT	48.00* ?
1001	AIR CON GAS	250.00* 50 ✓
1002	FRT NUMBER PLATE	40.00* ✓
Total Extras		338.00

K.Kim Hin Auto Pte Ltd
160 Sin Ming Drive, #02-20, Sin
Ming AutoCity
575722

Claim Reference:
 Assessment number: 190322
 Version: 1810
 Date calculated: 21/06/2019 4:31 PM

Full Report
Registration: SDK6776A
Printed: 21/06/2019 4:31 PM

Final Calculation

	SGD	SGD
Parts	25,270.00	
Addition(+10.00%)	2,527.00	
Total Parts		27,797.00
Labour Time Base 10 WU/h		
Total 227.0 WU X 50.00 SGD/h	1,135.00	
Total of Labour		1,135.00
Total Of Extras		338.00
Paint Work Time Base 10 WU/h		
Labour Cost 156.0 WU X 50.00 SGD/h	780.00	
Total Paint Including Material		780.00
Repair Cost Excludes GST		30,050.00
GST (+7.0%)		2,103.50
Repair Cost Included GST		32,153.50

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS



CO. REG. NO: 199402370D

GST NO: M2-0123250-3

KIM HIN AUTO PTE LTD

金興(龔)汽車私人有限公司

160 Sin Ming Drive, #02-18/19/20/21,

Sin Ming AutoCity, Singapore 575722

Tel: 6452 7018 Fax: 6458 3895

Email: service@kkinhin.com.sg

(SUPPLEMENTARY)

INSURER: **MSIG Insurance (Singapore) Pte. Ltd. (HQ)**

PARTICULARS OF CLAIM

Claim Type:	OD (OWN DAMAGE)	Ref. No:	
Policy No:	28824089QMY	Date of Loss:	30/05/2019
Vehicle Reg. No.:	SDK6776A	Driveable?	
Driver Age/Info:	39 / MALE	Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	CHOO XIU HUI	Contact No:	+6596976776
Driver:	MOH TZE YANG		
Make/Model:	FORD MUSTANG, 2.3 (A)	Vehicle Reg. Date:	15/09/2016
Vehicle Colour:	WHITE	Chassis No:	1FA6P8TH9G5286908
Engine No:	G5286908H		
Odometer:	0 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	14		
Description of Accident/Loss	PLEASE REFER TO SKETCH PLAN.		
Remarks:	SUPPLEMENTARY		
Present Location:	K KIM HIN AUTO PTE LTD (HQ)		

COST OF CLAIMS	Amount
Parts	396.00
Miscellaneous Items	0.00
Labour	0.00
Paintwork Labour	0.00
Towing	0.00
Gross Total (\$)	396.00
+ GST 7.00% (\$)	27.72
Nett Amount (\$)	423.72
+ Previous Estimates (\$)	32,153.50
Claim Total (\$)	32,577.22

REPAIR DETAILS**Reference****Part Source:** (Last Synchronised: 03 Jul 2019)**Parts:** N/A FORD MUSTANG 2.3 (A) (Model not available in database)**Labour:** Repairer's (Price-denominated Standard List)**Print Code:** K Kim Hin Auto Pte Ltd/SDK6776A/03/07/2019 15:53**Validity:** These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk *.**Estimates on Parts**

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*L/RAD-GRILLE BRACKET	0.00	0.00	<i>B1</i> *180.00 F
2	1		*R/RAD-GRILLE BRACKET	0.00	0.00	<i>A1</i> *180.00 F
						Sub Total (S\$) 360.00
						+ Margin on L,N Items 10.00% (S\$) 36.00
						Total Parts (S\$) 396.00

F=Franchise part.

K Kim Hin Auto Pte Ltd/SDK6776A/03/07/2019 15:53. Not valid without Reference section.

Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

Estimates on Labour

There are no labour items selected.

K Kim Hin Auto Pte Ltd/SDK6776A/03/07/2019 15:53. Not valid without Reference section.

Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >