

22/03/2002

ASS. REC. BY:

REF: CS/CTI 19010742 / 040302

Special Instruction:

Surveyor: MARCUS**ASSIGNMENT (Office)**From (Person): Elaine Cheong of CTI Date/Time: 18.6.19 11.01 A.M

Estimated Cost: _____ Bill to: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SLV 8464J Insured: SLB 1834Eat Workshop m/s Automobile Hub Tel: 97864483of 1 Kaki Bukit Ave 5, # 2-11Policy No: DMPGVR1904411900 Claim No: SAM 190202759C02

Sum Insured: _____ Excess: _____

Make of Veh: _____ D.O.A. 13.6.19
(Client's Record)

CA / REV / REP. / REV 24 HRS

Date/Time: 18.6.19 11.07 A.M Person Contacted: Mr Lim H.O.D. Endorsement: _____Vehicle IN/OUT

Date/Time	Action/Instruction	Estimate (✓)
	SLV 8464J - MA / AIG 19010541 / h4	D.O.A - 13/06/2019
	SLB 1834E - MA / AIG 19010541 / h4	D.O.A - 13/06/2019

(08/11/13) wef

ASS. REC. BY: *Marcus*

REF:

CTI/
ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

7

days

Res.: Yes or No

Lum Sum:

20

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

LTA 46903

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No:

SLV8464J

Yr Regn:

1 / 18

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

CA/

Make:

Mazda 3

C.C

1496

Colour:

Blue

A/C:

Insured / Std / NI / NA

Sp. Reading

9.491

T/Radio:

Insured / Std / NI / NA

Eng/No:

JM6BN22A8JO192879

C/No:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

205/60R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

8

Rear

8

R/Bal.

8

mm

R/Bal.

8

mm

L/Bal.

8

mm

L/Bal.

8

mm

D.O.A.

13/6/19

D.O.I.

18/6/19

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear & Rf.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1/7/19 4/5# 7300 confirmed with AM X-ray (Red & 14855.40, 67%)

RECEIVED 04 JUL 2019

Date/Time, File Pass to?

☐

Preli. Report

1) 04/7/19

☐

Final Report

Date/Time, File Return to?

2)

Days Of Repair:

7

Resurvey No. of Trip:

Survey Fee:

Transportation:

Add Fee:

☐

Site Insp (\$

) \$ + RS. \$

☐

Interview (\$

) Photos

☐

Tech. Invs (\$

) Others

☐

Weekend (\$

)

Report Format:

MOR-Tp

Lump Sum / I.B.I. (\$

7300

)

TOTAL

220

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	17 Jun 2019		18 Jun 2019 11:01 Assign				New Assignment Cancel Case

Main		Reference		Claim Details		Documents		Show All	
CLAIM SUBFOLDER DETAILS								[Created by insurer]	
Insured:									
Main Claimant:		LOO CHEE KOK, ID: S2649922D							
Vehicle Reg. No.:		SLV8464J		Date of Loss:		13/06/2019 19:00 - :59			
Claim Type:		TP / SNM19D202759C02		Policy/Cover Note No.:		DMPCSN1924411900			
Vehicle Reg. No. (Insured):		SKB1837E		Policy No. (Claimant):		1800008948			
				Excess:		S\$750.00			
Repairer:		Automobile Hub Enterprise () 1 KAKI BUKIT AVENUE 5, #2 -11 AUTOBAY @ KAKI BUKIT, 417883 Kaki Bukit - Tel:							
Handling Insurer:		China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Elaine Cheong]							
Claimant's Insurer:		AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000							
Adjuster:		LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 27/06/2019]							
ASSOCIATED MAIL RECEIVED								View All	
There are no mail for this case.								Compose Case Mail	
ALL ASSOCIATED TASKS								View All	
								Search Tasks	
								Create New Task	
								Complete	
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									



ALL-NEW
Mercedes-Benz GLE450 AMG
Premium Plus

TEST DRIVE TODAY!

☎ 6250 6696 / 9637 5329

F1 AUTO CARS

Post an Advertisement
Sell it yourself! Advertise it at just
\$58 until it's SOLD!

Post an Ad

Advertiser Login

Ways of Selling

New 5 Years Renewal Coe Honda Stream 1.8A



3.18%P.A \$0 Admin Fees@Gv
Finance. 2 Years
Warranty.\$2500 Down Monthly
From \$638
GV Credit Pte Ltd StarAd

- Free VICOM evaluation
- Free grooming and 6 months maintenance
- In-house workshop ensures quality service
- Member of SVTA and hire purchase association
- 100% deposit refund for unapproved loan

YONG LEE SENG MOTOR PTE LTD







Browse by Category

Sort by Date Posted 20 results/page

9 vehicles

mazda 3

Advanced Search Submit

	Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Search Selection	mazda 3		Any	Any	2018	Any	Any	Any	Available
	Mazda 3 1.5A		\$77,800	\$8,130 /yr	23-Feb-2018	1,496 cc	18,800 km	Sedan	Available
100% Approval! Flexible Loan Package! Up To 100%! Bank Or In-House Loan Available. Spacious And Reliable. Well Maintained And Serviced. No Further Repairs Needed. Original Paintwork, Clean And Neat In...									
Viking Motor Pte Ltd									
Posted: 18-Jun-2019 Tags: 2018 Mazda 3, 2018 mazda 3, Mazda 3, mazda 3, Mazda, 3, Used Mazda									
	Mazda 3 HB 1.5A Deluxe		\$78,800	\$8,060 /yr	26-Feb-2018	1,496 cc	12,000 km	Hatchback	Available
Consignment Code: A148. Flexible And Attractive Loan Packages Available To Choose From. Trade-Ins Available For Your Car! No Hidden Costs. For Further Information Or If You Have Any Questions Please D...									
Posted: 17-Jun-2019 Tags: 2018 Mazda 3, 2018 mazda 3, Mazda 3, mazda 3, Mazda, 3, Used Mazda									
	Mazda 3 1.5A Deluxe		\$80,800	\$8,260 /yr	09-Feb-2018	1,496 cc	11,000 km	Sedan	Available
100% Loan Available, Special Interest Rate 2.28%, Flexible Bank/In House Loan Available, Non Private Hire Vehicle With 1 Previous Owner! Low Mileage Done, Agent Serviced, Amazing Fuel Efficiency! 100%...									
Autotruster Traders Pte Ltd									
Posted: 17-Jun-2019 Tags: 2018 Mazda 3, 2018 mazda 3, Mazda 3, mazda 3, Mazda, 3, Used Mazda									
	Mazda 3 1.5A		\$77,800	\$8,110 /yr	19-Feb-2018	1,496 cc	18,000 km	Sedan	Available
100% Approval! Flexible Loan Package! Up To 100%! Bank Or In-House Loan Available. Spacious And Reliable. Well Maintained And Serviced. No Further Repairs Needed. Original Paintwork, Clean And Neat In...									
Viking Motor Pte Ltd									
Posted: 14-Jun-2019 Tags: 2018 Mazda 3, 2018 mazda 3, Mazda 3, mazda 3, Mazda, 3, Used Mazda									
Car Buying	Car Selling	Car Ownership							
Car Aftermarket	On The Move	Lifestyle							
	Mazda 3 HB 1.5A Sunroof		\$83,800	\$8,070 /yr	30-Oct-2018	1,496 cc	6,220 km	Hatchback	Available
Comes With Agent Warranty Till Oct 2021 For Peace Of Mind! Stylish And Reliable Mazda 3 With 1.5L SkyActiv Engine And Mated To A 6 Speed Auto Providing You Adequate Power For Your Daily Commute, Yet R...									
Select By Performance Premium Selection									
Posted: 11-Jun-2019 Tags: 2018 Mazda 3, 2018 mazda 3, Mazda 3, mazda 3, Mazda, 3, Used Mazda									
	Mazda 3 1.5A Sunroof		\$79,800	\$8,110 /yr	31-May-2018	1,496 cc	19,367 km	Sedan	Available
Comes With Agent Warranty Till May 2021 For Peace Of Mind! Stylish And Reliable Mazda 3 With 1.5L SkyActiv Engine And Mated To A 6 Speed Auto Providing You Adequate Power For Your Daily Commute, Yet R...									
Select By Performance Premium Selection									
Posted: 11-Jun-2019 Tags: 2018 Mazda 3, 2018 mazda 3, Mazda 3, mazda 3, Mazda, 3, Used Mazda									
Compare	Mazda 3 HB 1.5A Deluxe		\$80,500	\$8,380 /yr	03-Jan-2018	1,496 cc	10,876 km	Hatchback	Available



> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	9922D
Vehicle Details	
Vehicle No.:	SLV8464J
Vehicle to be Exported:	No
Intended Deregistration Date:	18 Jun 2019
Vehicle Make:	MAZDA
Vehicle Model:	MAZDA3 SEDAN 1.5 AT EU6
Primary Colour:	Blue
Manufacturing Year:	2017
Engine No.:	P520485149
Chassis No.:	JM6BN22A8J0192979
Maximum Power Output:	88.0 kW (118 bhp)
Open Market Value:	\$15,174.00
Original Registration Date:	18 Jan 2018
First Registration Date:	18 Jan 2018
Transfer Count:	0
Actual ARF Paid:	\$15,174.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	17 Jan 2028
PARF Rebate Amount:	\$11,380.00
Intended COE Rebate Details	
COE Expiry Date:	17 Jan 2028
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$41,400.00
COE Rebate Amount:	\$35,523.00
Total Rebate Amount:	\$46,903.00

The information contained herein is correct as at 18 Jun 2019

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	14/06/2019 11:00
Date Of Accident	13/06/2019 19:40
Exact Location Of Accident	PIE TWDS TUAS B4 CTE EXIT
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLV8464J
Insured/Policyholder	
Name Of Registered Owner	LOO CHEE KOK
NRIC No	S2649922D
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-90065832
Alternative Phone No	OFFICE-90065832

Vehicle Particulars

Manufacturer	MAZDA
Model	MAZDA 3
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	1800008948
Cover Note Number	-

Driver

Name of Driver	LOO WEN LI
NRIC No	S9071117B
Date Of Birth	15/07/1990
Occupation	OUTDOOR
Date Of Driving Pass	14/05/2012
Driving Experience	7 YEARS AND 0 MONTHS
Gender	FEMALE
Mobile Number	(LOCAL) +65-85229423
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address BLK 44 CHAI CHEE ST #10-104
 Postcode 461044
 Was driver an employee of the Insured's Company NO
 If No, Relationship of the Driver with the Insured CHILDREN
 Vehicle Registration Number of Driver's Own Vehicle -
 -
 Insurance Company of Driver's Own Vehicle -
 -

General Information of the Accident

Type Of Accident CHAIN COLLISION
 Weather Conditions DRIZZLING
 Road Surface WET

Other Information

Was any foreign vehicle involved in this accident? NO
 Number of vehicles (including own vehicle) involved in the accident 3
 Was any body injured in the Accident? NO
 Was any injured conveyed to hospital by ambulance?
 Was any other material or property damaged? YES
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
 Number of Passengers (Including Driver) 5
 Passenger 1
 NAME: : UNKNOWN
 GENDER: : MALE
 Passenger 2
 NAME: : UNKNOWN
 GENDER: : MALE
 Passenger 3
 NAME: : UNKNOWN
 GENDER: : FEMALE
 Passenger 4
 NAME: : UNKNOWN
 GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police? NO
 If Yes, Please state which Police Station
 Was notice of intended Prosecution given? NO
 If Yes, against whom?

Circumstances of Accident

I WAS TRAVELLING ALONG PIE TWDS TUAS BEFORE CTE EXIT ON THE FIRST LANE, WHEN NOTICED VEH INFRONT OF ME SLOW DOWN AND STOP, AS SUCH I FOLLOW TO SLOW DOWN AND STOP. MOMENT LATER, I FELT AN IMPACT FROM BEHIND, DUE TO THE IMPACT, MY VEH BEEN PUSH FORWARD AND HIT ONTO THE VEH INFRONT OF ME. AFTER THE INCIDENT, I ALIGHTED FROM MY VEH AND REALIZED VEH B (BEARING NO SKB1837E) FROM BEHIND COLLIDED ONTO MY VEH REAR PORTION.

Attachment(s)

Are accident photos available for attachment? YES
 Was there any video captured by Car Camera? YES
 Remarks/ Reasons: WITH DRIVER
 Was there any audio recorded? NO


DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SKB1837E
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SMA1743Z
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

SKETCH PLAN

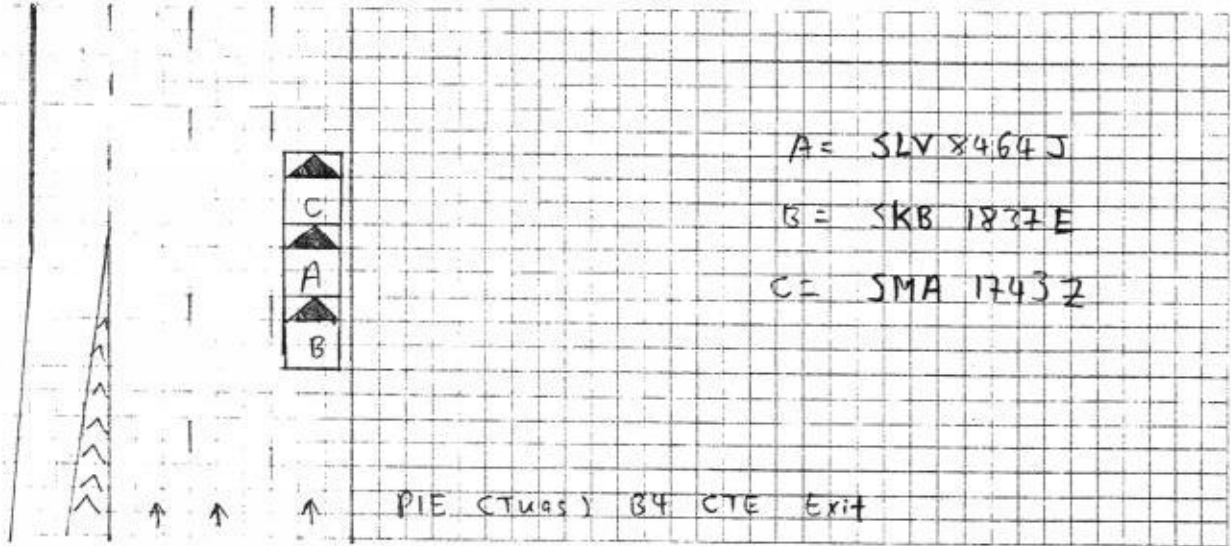

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Please Refer to statement

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:


Repair Estimate

Automobile Hub Enterprise

1 Kaki Bukit Avenue 6 #02-11 Autobay @ Kaki Bukit Singapore 417883
Tel: (65) 9786 4483 Fax: (65) 6509 6584 Email: autohub325@gmail.com

Make/Model: MAZDA 3
Engine/Chassis No.: JM6BN22A8J0192979
Date of accident:
Damaged area: Front & Rear

Date: 15/06/2019
Claim Type: TP
VRN: SLV8464J

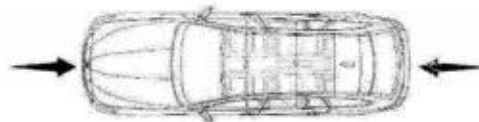

List items				
S/N	Parts description	QTY	UNIT PRICE	AMOUNT
1	FRONT BUMPER	1	\$ 1,032.00	\$ 1,032.00
2	FRONT REINFORCEMENT	1	\$ 445.00	\$ 445.00
3	FRONT BUMPER RETAINER	2	\$ 45.00	\$ 90.00
4	FRONT RADIATOR UPPER COVER	1	\$ 280.00	\$ 280.00
5	FRONT GRILLE	1	\$ 582.00	\$ 582.00
6	FRONT GRILLE CHROME MOULDING	2	\$ 177.00	\$ 354.00
7	FRONT BUMPER LOWER GRILLE COVER	2	\$ 67.00	\$ 134.00
8	HEAD LAMP	2	\$ 2,245.00	\$ 4,490.00
9	HID CONTROL UNIT	2	\$ 1,791.00	\$ 3,582.00
10	FRONT CENTER BRACE	1	\$ 69.00	\$ 69.00
11	FRONT SUPPORT PANEL	1	\$ 260.00	\$ 260.00
12	FRONT UPPER SUPPORT PANEL	1	\$ 165.00	\$ 165.00
13	FRONT BUMPER UNDER COWLING	1	\$ 164.00	\$ 164.00
14	FRONT GRILLE LOGO	1	\$ 75.00	\$ 75.00
15	BOOTLID	1	\$ 1,061.00	\$ 1,061.00
16	BOOTLID "MAZDA" LOGO	1	\$ 62.00	\$ 62.00
17	BOOTLID "MAZDA 3" EMBLEM	1	\$ 58.00	\$ 58.00
18	BOOTLID "SKYACTIV" EMBLEM	1	\$ 78.00	\$ 78.00
19	BOOTLID LAMP	2	\$ 564.00	\$ 1,128.00
20	BOOTLID LAMP SEAL	2	\$ 18.00	\$ 36.00
21	BOOTLID LOCK	1	\$ 192.00	\$ 192.00
22	BOOTLID LOCK STRIKER	1	\$ 58.00	\$ 58.00
23	BOOTLID WEATHERSTRIP	1	\$ 190.00	\$ 190.00
24	REAR BUMPER UPPER	1	\$ 1,036.00	\$ 1,036.00
25	REAR BUMPER SIDE RETAINER	2	\$ 92.00	\$ 184.00
26	REAR BUMPER REINFORCEMENT	1	\$ 526.00	\$ 526.00
27	REAR BUMPER REFLECTOR	2	\$ 138.00	\$ 276.00
28	REAR BUMPER TOW COVER	2	\$ 72.00	\$ 144.00
29	TAIL LAMP	2	\$ 1,016.00	\$ 2,032.00
30	TAIL LAMP SEAL	2	\$ 22.00	\$ 44.00
31	END PANEL	1	\$ 667.00	\$ 667.00
32	END PANEL TOP GARNISH	1	\$ 175.00	\$ 175.00
33	SPARE TYRE TOP BOARD	1	\$ 387.00	\$ 387.00
34	REAR BUMPER LOWER	1	\$ 412.00	\$ 412.00
Subtotal				\$ 20,468.00
List discount				20.00%
Total				\$ 16,374.40

not allocated
1/s 7300
18/6/19
Thyphlo Alamy
7dy.

782390
2022
626912

Repair Estimate

Special nett items				
No.	Parts description	QTY	UNIT PRICE	AMOUNT
1	FRONT BUMPER CLIPS <i>ru</i>	10	\$ 5.50	\$ 55.00
2	FRONT GRILLE CLIPS <i>11</i>	6	\$ 5.50	\$ 33.00
3	FRONT BUMPER UNDER COWLING CLIPS <i>11</i>	6	\$ 5.50	\$ 33.00
4	COOLANT <i>11</i>	1	\$ 60.00	\$ 60.00
5	FRONT LICENCE PLATE & GARNISH <i>11</i>	1	\$ 55.00	\$ 55.00
6	REAR BUMPER CLIPS <i>ru</i>	10	\$ 5.50	\$ 55.00
7	TAIL LAMP CLIPS <i>11</i>	6	\$ 5.50	\$ 33.00
8	END PANEL SEALANT <i>nbk</i>	1	\$ 100.00	\$ 100.00
9	END PANEL TOP GARNISH CLIPS <i>11</i>	6	\$ 5.50	\$ 33.00
10	BOOTLID INNER TRIM CLIPS <i>11</i>	8	\$ 5.50	\$ 44.00
11	REVERSE SENSOR <i>Shohb</i>	1 set	\$ 380.00	\$ 380.00
12	SUNDRIES <i>11</i>	1	\$ 50.00	\$ 50.00
Total				\$ 931.00

Labour			
No.	Description	Work unit	Amount
1	To dismantle / renew FRONT accident damaged portions. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	5	\$ 1,000.00
2	To disconnect front wire harness of electrical components to facilitate repairs, reconnect and check functions including focusing headlamps.	0.25	\$ 50.00
3	To remove and refit radiator to facilitate repair. To perform pressure test and check cooling system functionality.	0.5	\$ 100.00
4	Supply spray paint material and necessary items to respray front bumper, support panel and other affected area / panel.	5	\$ 1,000.00
5	To dismantle / renew the accident REAR damaged portion. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	6	\$ 1,200.00
6	To disconnect rear wire harness of electrical components to facilitate repairs, reconnect and check functions including taillamp lightings.	0.25	\$ 50.00
7	To remove, refit bootlid components and replace bootlid, check and re-adjust close gap, alignment and water seepage. holster garnish etc	0.5	\$ 100.00
8	Supply spray paint material and necessary items to respray rear bumper, bootlid, end panel and other affected area / panel.	6	\$ 1,200.00
9	To rust proof all affected portions after repair.	0.75	\$ 150.00
Total labour			\$ 4,850.00

Estimate Grand Total \$ 22,155.40

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before and after spray painting
- To display damaged parts during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

1-625812
S.N-36000
Lohn-2520.00
9/6812

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CT119010742/UQD3N2

Date: 10/07/2019

REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMPCSN1924411900	
Claimant Vehicle No :	SLV8464J	Insured Vehicle No :	SKB1837E	
Date of Loss:	13/06/2019	Nature of Claim:	TP	Claim No: SNM19D202759C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLV8464J	Engine No:	P520485149
Make & Model:	MAZDA 3, 1.5 L (A)	Chassis No:	JM6BN22A8J0192979
Reg. Date:	18/01/2018 (Man. Year: 2017)	Odometer:	9491 km
Colour:	Blue		
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/60 R16	Rear Tyre Size:	205/60 R16
Front Left Side:	Bridgestone 8 mm	Rear Left Side:	Bridgestone 8 mm
Front Right Side:	Bridgestone 8 mm	Rear Right Side:	Bridgestone 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	17,305.40	6,619.12	10,686.28	61.75
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,850.00	2,550.00	2,300.00	47.42
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	22,155.40	9,169.12	12,986.28	58.61
Approved Total (Overridden) (S\$)		7,300.00		
Nett Amount (S\$)	22,155.40	7,300.00	14,855.40	67.05

INSPECTION

Date of Assignment:	18/06/2019	
Date Inspected:	18/06/2019	Inspected At:
		Automobile Hub Enterprise
		1 KAKI BUKIT AVENUE 5, #2 -11
		AUTOBAY @ KAKI BUKIT
		Singapore 417883

Estimated Period of Repair: 7.0 days**Adjuster:** MARCUS CHUA**Manager:** SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 10 Jul 2019)	
Parts:	N/A	MAZDA 3 1.5 L (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLV8464J)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*FRONT BUMPER	Deformed / Torn	1,032.00 FL	*1,032.00 FL
2	1	*FRONT REINFORCEMENT	Repair	445.00 FL	*- FL
3	1	*FRONT BUMPER RETAINER	N/s Bent	90.00 FL	*45.00 FL
4	1	*FRONT RADIATOR UPPER COVER	Repair	280.00 FL	*- FL
5	1	*FRONT GRILLE	Twisted	582.00 FL	*581.00 FL
6	2	*FRONT GRILLE CHROME MOULDING	Cracked	354.00 FL	*354.00 FL
7	2	*FRONT BUMPER LOWER GRILLE COVER	Not Necessary	134.00 FL	*- FL
8	1	*HEAD LAMP	N/s Cracked	4,490.00 FL	*1,070.50 FL
9	2	*HID CONTROL UNIT	Not Necessary	3,582.00 FL	*- FL
10	1	*FRONT CENTER BRACE	Not Necessary	69.00 FL	*- FL
11	1	*FRONT SUPPORT PANEL	Not Necessary	260.00 FL	*- FL
12	1	*FRONT UPPER SUPPORT PANEL	Not Necessary	165.00 FL	*- FL
13	1	*FRONT BUMPER UNDER COWLING	Not Necessary	164.00 FL	*- FL
14	1	*FRONT GRILLE LOGO	Necessary	75.00 FL	*75.00 FL
15	1	*BOOTLID	Repair	1,061.00 FL	*- FL
16	1	*BOOTLID MAZDA LOGO	Necessary	62.00 FL	*62.00 FL
17	1	*BOOTLID MAZDA 3 EMBLEM	Necessary	58.00 FL	*58.00 FL
18	1	*BOOTLID SKYACTIV EMBLEM	Necessary	78.00 FL	*60.00 FL
19	2	*BOOTLID LAMP	Not Necessary	1,128.00 FL	*- FL
20	2	*BOOTLID LAMP SEAL	Not Necessary	36.00 FL	*- FL
21	1	*BOOTLID LOCK	Not Necessary	192.00 FL	*- FL
22	1	*BOOTLID LOCK STRIKER	Not Necessary	58.00 FL	*- FL
23	1	*BOOTLID WEATHERSTRIP	Necessary	190.00 FL	*190.00 FL
24	2	*REAR BUMPER SIDE RETAINER	Necessary	184.00 FL	*120.00 FL
25	1	*REAR BUMPER REINFORCEMENT	Dented	526.00 FL	*526.00 FL
26	2	*REAR BUMPER REFLECTOR	Not Necessary	276.00 FL	*- FL
27	1	*REAR BUMPER TOW COVER	N/s Missing	144.00 FL	*35.00 FL
28	2	*TAIL LAMP	Cracked / Damaged	2,032.00 FL	*1,830.00 FL
29	2	*TAIL LAMP SEAL	Necessary	44.00 FL	*44.00 FL
30	1	*END PANEL	Dented / Bent	667.00 FL	*530.40 FL
31	1	*END PANEL TOP GARNISH	Twisted	175.00 FL	*175.00 FL
32	1	*SPARE TYRE TOP BOARD	Not Necessary	387.00 FL	*- FL
33	1	*REAR BUMPER UPPER}	Dented / Deformed	1,036.00 FL	*1,036.00 FL
34	1	*REAR BUMPER LOWER}		412.00 FL	*- FL
35	10	*FRONT BUMPER CLIPS	Necessary	55.00 FS	*55.00 FS
36	6	*FRONT GRILLE CLIPS	Not Necessary	33.00 FS	*- FS
37	6	*FRONT BUMPER UNDER COWLING CLIPS	Not Necessary	33.00 FS	*- FS
38	1	*COOLANT	Not Necessary	60.00 FS	*- FS
39	1	*FRONT LICENCE PLATE & GARNISH	Not Necessary	55.00 FS	*- FS
40	10	*REAR BUMPER CLIPS	Necessary	55.00 FS	*55.00 FS
41	6	*TAIL LAMP CLIPS	Not Necessary	33.00 FS	*- FS
42	1	*END PANEL SEALANT	Necessary	100.00 FS	*50.00 FS
43	6	*END PANEL TOP GARNISH CLIPS	Not Necessary	33.00 FS	*- FS
44	8	*BOOTLID INNER TRIM CLIPS	Not Necessary	44.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
45	1		*SET REVERSE SENSOR	Shorted	380.00 FS	*200.00 FS
46	1		*SUNDRIES	Not Necessary	50.00 FS	*- FS
F=Franchise part, S=SpcNett, L=ListItemDisc.						
Sub Total (S\$)					21,399.00	8,183.90
- List Item Discount on L Items 20.00/20.00% (S\$)					4,093.60	1,564.78
Total Parts (S\$)					17,305.40	6,619.12

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO DISMANTLE / RENEW FRONT ACCIDENT DAMAGED PORTIONS. TO PANEL BEAT, RESHAPE, STRAIGHTEN, ORIENTATE AND ALIGN REPAIR / REPLACEMENT PARTS.	New	1,000.00	300.00
2	TO DISCONNECT FRONT WIRE HARNESS OF ELECTRICAL COMPONENTS TO FACILITATE REPAIRS, RECONNECT AND CHECK FUNCTIONS INCLUDING FOCUSING HEADLAMPS.	New	50.00	20.00
3	TO REMOVE AND REFIT RADIATOR FACILITATE REPAIR. TO PERFORM PRESSURE TEST AND CHECK COOLING SYSTEM FUNCTIONALITY.	New	100.00	0.00
4	SUPPLY SPRAY PAINT MATERIAL AND NECESSARY ITEMS TO RESPRAY FRONT BUMPER, SUPPORT PANEL AND OTHER AFFECTED AREA / PANEL.	New	1,000.00	300.00
5	TO DISMANTLE / RENEW THE ACCIDENT REAR DAMAGED PORTION. TO PANEL BEAT, RESHAPE, STRAIGHTEN, ORIENTATE AND ALIGN REPAIR / REPLACEMENT PARTS.	New	1,200.00	800.00
6	TO DISCONNECT REAR WIRE HARNESS OF ELECTRICAL COMPONENTS TO FACILITATE REPAIRS, RECONNECT AND CHECK FUNCTIONS INCLUDING TAILLAMP LIGHTINGS.	New	50.00	20.00
7	TO REMOVE, REFIT BOOTLID COMPONENTS, UPHOLSTERY GARNISH ETC.	New	100.00	80.00
8	SUPPLY SPRAY PAINT MATERIAL AND NECESSARY ITEMS TO RESPRAY REAR BUMPER, BOOTLID, AND END PANEL AND OTHER AFFECTED AREA / PANEL.	New	1,200.00	980.00
9	TO RUST PROOF ALL AFFECTED PORTIONS AFTER REPAIR.	New	150.00	50.00
Gross Labour Cost (\$\$)			4,850.00	2,550.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >