

REF:

REF:

NS/INC 19010750 / MVD302

QTY: NAR

INC

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured: SDV 5569E

Policy No. 510791614 (15/04/2019)

Claims No. MT/1051614-001

Sum Insured: Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Est. or Market Value:

IVAC Accident Report: Consistent? Yes or No

QIA / PR Seen: Consistent? Yes or No

Est. Repairs: 5 days Res.: Yes or No

Lump Sum: % J Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: Person Contacted:

Vehicle: IN / OUT

Veh No: SHC 3928T

Yr Regn: 26 FEB 2019

Type: M.Car / M.Cycle / BUS / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: HYUNDAI 140

c.c. 1,685

Colour: BLUE

A/C: Insured / Std / NI / NA

Sp. Reading 428 284

T/Radiop: Insured / Std / NI / NA

Eng/No:

CN/No: KM4L3414 MFU064678

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / SIRIm / STD / RIm or

Tyre Size: F: 205/60R16

R: 11

BS / DUN / EXHOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

X TOYO / YOKO or CST (R) HANKOOK (F)

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

15/6/19

D.O.A.

17/6/19

Survey held at

COKE LOMANG

Des. of Damages: Frl / Rear / OIS / NIS / UIC / Rooftop or

REAR OIS

The UIC / Chassis frame / Body Structure affected due to collision

INC L13

Date / Time Action / Instruction

SHC 3928T - (C3) AXA13014446 / M10934
SDV 5569E - X

ROA - 06/06/2019

28/6/19 LS \$ 5550 confirmed (Red 6418-50, 54%)

RECEIVED 03 JUL 2019

Date/Time, File Pass to?

: Prelim Report

1)

: Final Report

Date/Time, File Return to?

2) 3/7 - typist

Report Format:

TP

Lump Sum / I.B.I. (\$

5550)

Days Of Repair: 5

Resurvey No. of Trip: 1

Survey Fee:

160

Transportation:

S - HS - SI

Phone:

Other:

TOTAL

160

Add Fee: : Site Insp (\$

: Interview (\$

: Tech. Insp (\$

: Weekend (\$

TP Claims against NTUC Income: Follow-Through Survey

Date : 01/07/2019

S/No	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle No.	Date of Accident	Time of Accident	Estimate	Tentative repair cost
1	MT/1051614-001	COMFORT TRANSPORTATION PTE LTD	SHC 3928T	SDV 5569E	15/06/2019	02:15	\$ 11,968.50	\$ 5,550.00
2	MT/1050721-002	COMFORT TRANSPORTATION PTE LTD	SHC 1623K	SJT 9049C	22/06/2019	21:30	\$ 3,496.00	\$ 2,500.00
3	MT/1049907-002	COMFORT TRANSPORTATION PTE LTD	SHD 4523R	SIU 7769R	15/06/2019	12:30	\$ 1,405.68	\$ 400.00

eBaoTech

GeneralClaim

Hello, NAC_PAYA_UBI_800601

[Change Language](#)[Change Password](#)[Log Out](#)[My Desktop](#)[Notice of Loss](#)

Policy Query

Policy No. Date of Accident
Vehicle No.(For Motor) Certificate Number

Select	Policy No.	Certificate Number	Policyholder Name	Policyholder NRIC	Product	Cover Type	Vehicle No.	Insured Object	Commence Date	Expiry Date
<input type="radio"/>	5101791614		87 LEASING	53379062W	GFT	Third Party	SDV5569E	SDV5569E	15/04/2019	

> [Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	3821R
Vehicle Details	
Vehicle No.:	SHC3928T
Vehicle to be Exported:	No
Intended Deregistration Date:	18 Jun 2019
Vehicle Make:	HYUNDAI
Vehicle Model:	I40 1.7L CRDI AT ABS AIRBAG 4DR
Primary Colour:	Blue
Manufacturing Year:	2014
Engine No.:	D4FDEU475037
Chassis No.:	KMHLB41UMFU064678
Maximum Power Output:	100.0 kW (134 bhp)
Open Market Value:	\$19,807.00
Original Registration Date:	26 Feb 2015
First Registration Date:	26 Feb 2015
Transfer Count:	0
Actual ARF Paid:	\$12,307.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	25 Feb 2023
PARF Rebate Amount:	\$9,230.00
Intended COE Rebate Details	
COE Expiry Date:	25 Feb 2023
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$52,904.00
COE Rebate Amount:	\$24,385.00
Total Rebate Amount:	\$33,615.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 18 Jun 2019

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	17/06/2019 07:01
Date Of Accident	15/06/2019 02:15
Exact Location Of Accident	SERANGOON RD TURNING INTO SYED ALWI RD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHC3928T
Insured/Policyholder	
Name Of Registered Owner	COMFORT TRANSPORTATION PTE LTD
Co Reg No	199303821R
Email Address	FLEETSAFETY@CDGTAXI.COM.SG
Mobile Phone No	
Alternative Phone No	OFFICE-65508768

Vehicle Particulars

Manufacturer	HYUNDAI
Model	I40
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	MS FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-18088936MFSH
Cover Note Number	

Driver

Name of Driver	MICHAEL HO KEE FATT
NRIC No	S1705423F
Date Of Birth	16/03/1965
Occupation	OUTDOOR
Date Of Driving Pass	22/05/1985
Driving Experience	34 YEARS AND 0 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-90031623
Fax Number	
Contact Number	
EEmail Address	MICHOELHO@GMAIL.COM

Address	987D 10-589 JURONG WEST STREET 93
Postcode	644987
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - TAXI DRIVER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
POLICE STATION NAME [OTHER]	PASIR RIS NPC
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

SEE POLICE REPORT.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO


DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SDV5569E
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	HEW DI SHENG
NRIC/Passport Number	S9871377H
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	FRT
No. Of Passenger (Including Driver)	

DETAILS OF INJURED PERSON 1

Name	MICHAEL HO KEE FATT
Approximate Age	54
Injuries Sustain	NECK,BACK
Injured person in which vehicle?	SHC3928T
Were seat belts worn?	YES
Was this injured conveyed to hospital by ambulance?	NO
Address	
Postcode	

SKETCH PLAN

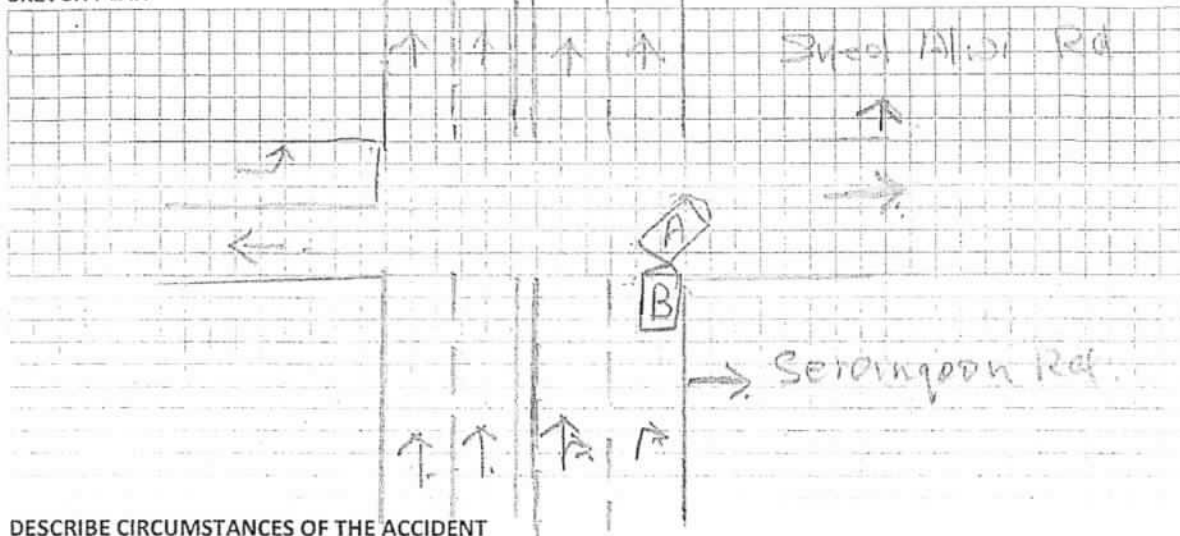

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Police Report Attached

7/20190616/2024

DECLARATION

I/We declare the foregoing particulars are true in every respect/

COMFORT TRANSPORTATION PTE LTD
CO. REG. NO. 199303821R

Policyholder's Signature

Driver's Signature

Jackson Heng
CSO

Jackson Heng
CEO

CSO

Закрыто



**SINGAPORE
POLICE FORCE**



T/20190616/2024

Police Station Of Origin:
Pasir Ris N.P.C
1 Pasir Ris Drive 4 #01-01 SINGAPORE
519457
Tel No: 1800-5852999

1 of 3

Report No. T/20190616/2024

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 16/06/2019 11:48		Vide Report No.: A/20190615/0042		Station Diary No.: 27	
Informant's Particulars					
Name of Informant: MICHAEL HO KEE FATT			Address: APT BLK 987D JURONG WEST STREET 93 #10-589 SINGAPORE 644987		
ID Type / ID No.: NRIC NO / S1705423F			Contact No.: Home/Office: Mobile: 90031623		
Nationality: SINGAPORE CITIZEN			Email:		
Sex: Male	Age: 54	Date of Birth: 16/03/1965	Type of Informant: Driver		
Race: Chinese			Language: English		Institution / School Name:
Occupation: TAXI DRIVER			Driving Licence Information: Class: 2B,2A,3,4 Date of Expiry:		

General Information of the Accident

Type of Accident:	Injury Others	Drink Drive: No	Date/Time of Accident: 15/06/2019 02:15	Type of Location: T-Junction
Location: Junction of Road 1 and Road 2 SERANGOON ROAD SYED ALWI ROAD At the junction				
Weather: Clear		Road Surface: Dry		Road Speed Limit:
Traffic Flow: One Way		Traffic Control: Not Controlled		Traffic Volume:
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: No

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No. of Passenger
SDV5569E	Car				Seriously Damaged	1
SHC3928T	Car				Slightly Damaged	0

Details of Person Involved

Any Pedestrian Involved: No	
No. of Pedestrians Injured: NIL	Use of Pedestrian Crossing: NA



**SINGAPORE
POLICE FORCE**



T/20190616/2024

Police Station Of Origin:
Pasir Ris N.P.C
1 Pasir Ris Drive 4 #01-01 SINGAPORE
519457
Tel No: 1800-5852999

2 of 3

Report No. T/20190616/2024

CONTINUATION OF REPORT

Driver			
Name	Hew Di Sheng	ID No.	S9871377H
Related Vehicle	SDV5569E (Car)	Contact No.	NIL
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL
Driver			
Name	MICHAEL HO KEE FATT	ID No.	S1705423F
Related Vehicle	SHC3928T (Car)	Contact No.	90031623
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: 2B,2A,3,4 Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

Brief Details.

On 15/06/2019 at about 0215hrs, I was driving my taxi, SHC3928T and was travelling along Serangoon Road and was heading to Mustafa Shopping Centre.

While I was about to turn right to Syed Alwi Road, suddenly I felt a great impact coming from my rear. I then alighted from my vehicle to make a check and I discovered that one car, SDV5569E had collided onto my rear of my vehicle.

At that time, I was not injured.



**SINGAPORE
POLICE FORCE**



T/20190616/2024

3 of 3

Report No. T/20190616/2024

Police Station Of Origin:
Pasir Ris N.P.C
1 Pasir Ris Drive 4 #01-01 SINGAPORE
519457
Tel No: 1800-5852999

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report:

G /

Staff Sgt IDRIS BIN ROSLI

Signature Of Informant:

Signature Of Interpreter:

Not applicable

Date/Time:

16/06/2019 11:48

Officer In Charge Of Case:

TP / AEIT /

Sgt 3 KOH CHEE SENG, KEVIN


Contact No.: 65472073



Classification Of Case:



SINGAPORE
POLICE FORCE

Authentication Stamp

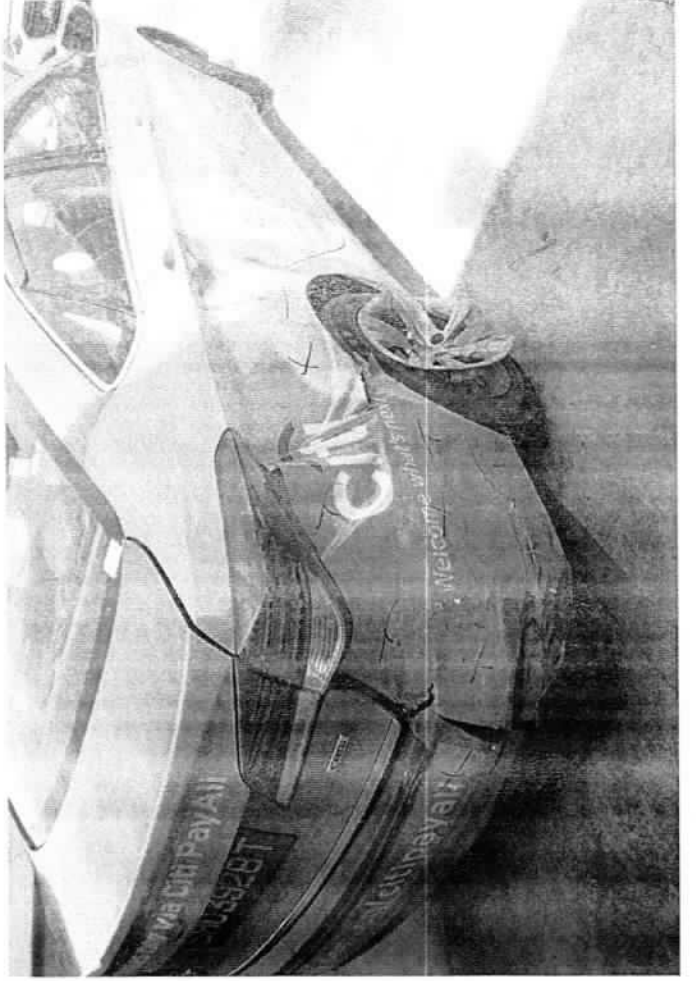

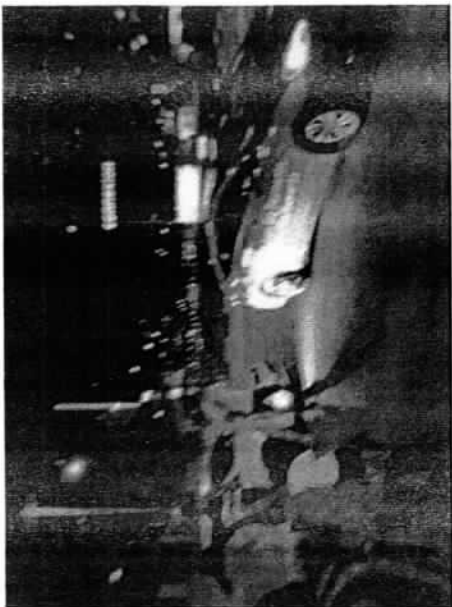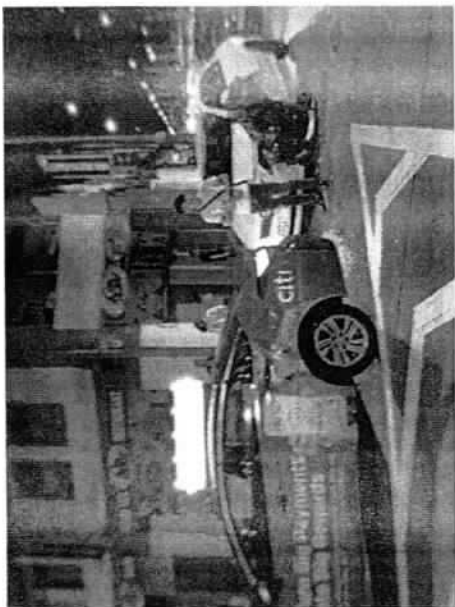

COMFORTDELGRO


Date/Time: 17.06.2019 08:33 Page : 1

Team: ARC Repair TP(CLSO)1		JOB CARD		Sales Order:		JC NO.: 305303765	
CUSTOMER MS CUSTOMER NO. 7010045 ADDRESS 383 SIN MING DRIVE Singapore SINGAPORE 575717 (R) 65508755 (O) (P)				REGN NO. SHC3928T		MILEAGE	
				MAKE: HYUNDAI		FUEL E.....1/2.....F	
				MODEL I-40		DATE/TIME IN 15.06.2019 02:15	
				YR OF MANU. 26.02.2015		TARGET DATE	
				CHASSIS CODE KMHLB41UMFU064678		COMPLETION DATE/TIME	
COUNT CARD NO.							

JOB DESCRIPTION

Accident Date: 15.06.2019
NATURE: 3P 15.06.2019

S/NO	LABOR CODE	DESCRIPTION
------	------------	-------------

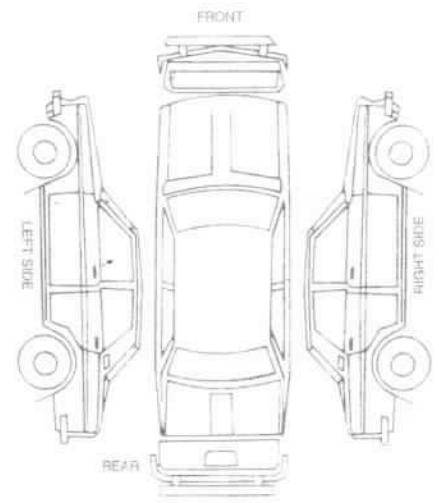

CHECKED & PASSED OUT BY: _____

SERVICE ADVISOR	CUSTOMER'S SIGNATURE
-----------------	----------------------

Acknowledgement Slip

Vehicle No.: SHC3928T CHIANG

Name of Service Advisor _____ Signature/Date _____

Returned to Service Reception upon collection

Exit Pass

Vehicle No.: SHC3928T

Name of Service Advisor _____ Date _____

To be kept by Security Guard

REPAIR ESTIMATE*


DATE 17/6/2019 10:52

DATE 17/6/2019 10:52

MODEL : HYUNDAI i40

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Boot Lid			\$ 2,174.90
	Boot Lid Lock Upper			\$ 102.60
	Boot Lid Lock Lower			\$ 31.70
	Boot Lid 'H' Emblem			\$ 28.70
	Boot Lid CRDI Plate			\$ 27.90
	Rear Bumper			\$ 553.00
	Rear Bumper Reinforcement			\$ 428.40
	Rear Bumper Reinforcement Bracket (LH/RH)		\$ 80.30	\$ 160.60
	Rear Bumper Clip 10 pcs			\$ 22.00
	Rear Bumper Bracket		\$ 35.60	\$ 71.20
	Rear Bumper Sponge			\$ 103.50
	Rear Bumper Under Cover			\$ 228.00
	Rear Bumper Reflector Lamp, RH			\$ 30.60
	Tail Lamp (RH)			\$ 697.80
	Rear Panel			\$ 526.70
	Rear Panel Garnish			\$ 57.70
	Rear Panel Lower Panel			\$ 89.40
	Rear Fender (RH)			\$ 2,171.40
	Rear Fender Inner Lining (RH)			\$ 169.30
	Rear Windscreen Moulding			\$ 28.30
	Exhaust Pipe Insulator,RH			\$ 58.55
	Exhaust Silencer ,RH			\$ 967.70
	Exhaust Pipe Hanger,RH			\$ 58.55
	Exhaust Pipe Centre			\$ 730.10
	Rear Tyre Rim (RH)			\$ 325.30
	Rear Wheel Hub-Cap (RH)			\$ 107.10
	SUB TOTAL			\$ 9,951.00
	LESS 20%			\$ 1,990.20
	DISCOUNTED TOTAL			\$ 7,960.80
	Boot Lid Comfort Logo & Tel No. Sticker			\$ 30.00
	Rear Bumper Reverse Sensor			\$ 135.70
	Rear Bumper Rubber Mat			\$ 50.00
	Rear Bumper Advertisement Logo			\$ 50.00
	Rear Fender Advertisement Logo (LH/RH)		\$ 100.00	\$ 200.00
	Rear Windscreen Sealant			\$ 46.00
	Rear Tyre (RH)			\$ 216.00
				\$ 727.70

SHC 3928T

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Labour Charge			
	Panel Beating			\$ 1,600.00 450
	Spray Painting Charge			\$ 1,000.00 600
	Wiring Charge			\$ 50.00 30
	Tuff Kote			\$ 50.00 40
	Remove/Refix Cushion & Upholstery Rear			\$ 150.00 XNN
	Remove/Refix Rear Windscreen Glass			\$ 120.00 XNN
	Remove/Refix Reverse Sensor			\$ 80.00 30
	Remove/Refix Exhaust Pipe			\$ 150.00 XNN
	Rear Wheel Alignment			\$ 80.00 X 60
	TOTAL LABOUR			\$ 3,280.00
	ESTIMATE TOTAL			\$ 11,968.50
	 NAZ LKK 17/6/19 1700 U/S 5 DAYS CHECK ITEMS PHOTOS AFTER REPAIR PHOTOS			
			<div> <p><u>LKK Auto Consultants</u> hence notify the Repairer of the following:</p> <ul style="list-style-type: none"> • To resurvey before/after spray painting • To display damaged part(s) during resurvey • Parts prices are subject to confirmation • Third party survey is on a "Without Prejudice" basis • No illegal modification(s) is allowed • Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company <p>Acknowledged by Repairer</p> <p>Signature:</p> <p>Date:</p> </div>	

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.

COMFORTDELGRO ENGINEERING PTE LTD

REPAIR ESTIMATE*

VEHICLE NO : SHC 3928T

DATE 17/6/2019 10:52

MAKE :

MODEL : HYUNDAI i40

Qty	Parts Description/ Labour	Type	Unit Price	Amount	
	Boot Lid			\$ 2,174.90	XR
	Boot Lid Lock Upper			\$ 102.60	XSVL
	Boot Lid Lock Lower			\$ 31.70	XSVL
	Boot Lid 'H' Emblem			\$ 28.70	NEC
	Boot Lid CRDI Plate			\$ 27.90	NEC
	Rear Bumper			\$ 553.00	URK
	Rear Bumper Reinforcement			\$ 428.40	DEF
	Rear Bumper Reinforcement Bracket (LH/RH)		\$ 80.30	\$ 160.60	BT
	Rear Bumper Clip 10 pcs			\$ 22.00	NEC
	Rear Bumper Bracket		\$ 35.60	\$ 71.20	XSVL
	Rear Bumper Sponge			\$ 108.50	CRK
	Rear Bumper Under Cover			\$ 228.00	DEF
	Rear Bumper Reflector Lamp, RH			\$ 30.60	MLB
	Tail Lamp (RH)			\$ 697.80	CRK
	Rear Panel			\$ 526.70	XSVL
	Rear Panel Garnish			\$ 57.70	XSVL
	Rear Panel Lower Panel			\$ 89.40	XSVL
	Rear Fender (RH)			\$ 2,171.40	DEF
	Rear Fender Inner Lining (RH)			\$ 169.30	XSVL
	Rear Windscreen Moulding			\$ 28.30	NEC
	Exhaust Pipe Insulator, RH			\$ 58.55	XSVL
	Exhaust Silencer, RH			\$ 967.70	DD
	Exhaust Pipe Hanger, RH			\$ 58.55	XSVL
	Exhaust Pipe Centre			\$ 730.10	BT
	Rear Tyre Rim (RH)			\$ 325.30	SCR
	Rear Wheel Hup-Cap (RH)			\$ 107.10	CRK
				\$ 6530.10	
				\$ 224.08	
	SUB TOTAL			\$ 9,951.00	
	LESS 20%			\$ 1,990.20	
	DISCOUNTED TOTAL			\$ 7,960.80	
	Boot Lid Comfort Logo & Tel No. Sticker			\$ 30.00	Nett JEL
	Rear Bumper Reverse Sensor			\$ 135.70	Nett / not work
	Rear Bumper Rubber Mat			\$ 50.00	Nett / SCR
	Rear Bumper Advertisement Logo			\$ 50.00	Nett / 3 ME
	Rear Fender Advertisement Logo (LH/RH)		\$ 100.00	\$ 200.00	Nett / 3 ME
	Rear Windscreen Sealant			\$ 46.00	Nett / SCR
	Rear Tyre (RH)			\$ 216.00	Nett XSVL
				\$ 727.70	

22/06

SHC 3928T

Qty	Parts Description/ Labour	Type	Unit Price	Amount
	Labour Charge			
	Panel Beating			\$ 1,600.00 450
	Spray Painting Charge			\$ 1,000.00 600
	Wiring Charge			\$ 50.00 30
	Tuff Kote			\$ 50.00 40
	Remove/Refix Cushion & Upholstery Rear			\$ 150.00 XNN
	Remove/Refix Rear Windscreen Glass			\$ 120.00 XNN
	Remove/Refix Reverse Sensor			\$ 80.00 30
	Remove/Refix Exhaust Pipe			\$ 150.00 XNN
	Rear Wheel Alignment			\$ 80.00 X 60
		1210.		
	TOTAL LABOUR			\$ 3,280.00
	ESTIMATE TOTAL			\$ 11,968.50
	NAZ LKK			
	17/6/19 1700			
	LIS			
	5 DAYS			
	CHECK ITEMS PHOTOS			
	AFTER REPAIR PHOTOS			
	This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company.			

6929.21

COMFORTDELGRO ENGINEERING

ComfortDelGro Engineering Pte Ltd
59 Loyang Drive Singapore 508969
Fax: 6546 8156

Our Job Ref No : 305303765
Date : 25/06/19

FINALIZATION FORM

To : LKK
Attn : NAZ
Vehicle Reg No. : SHC3928T

Fax :

15/06/2019

The survey and estimates of the repairs of the above-mentioned vehicle are as follows:-


1. The repair job shall bill to: NTUC SDV5569E
2. The finalized amount shall be:
- (a) Spare Parts after List discount
- (b) Labour Charges
- Total for Part-By-Part Repair Cost**
- (c.) Lumpsum Repair (if applicable)
Total for Lumpsum repair cost after Less:
Final Lumpsum Repair cost \$5,550.00


3. Estimated normal period for repairs: 5 working days.

4. We shall treat the above amount as Correct and Confirmed if there is no reply from you within 7 working days

5. Thank you for your assistance.

We confirm the estimates and finalized amount

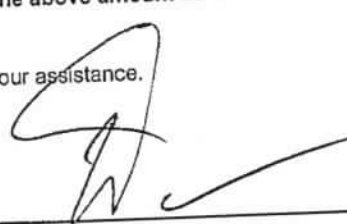Signature : 
Name : CHIANG
Tel : 62148314
Fax : 65468156

Signature : 
Name : NAZ LKK
Date : 28/6/19

For Official Use Only

Item	Amount	Document Attached Yes or No	Confirm By (Signature)	Remarks
1. Rental Rate P/Day		YES		
2. Loss of Income Paid		N		
3. Survey Fees				
4. LTA Search Fee	7.49			
5. Medical Fees (on behalf of driver, if applicable)				
6. Overrun				

Remarks:




National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC19010750/Nvd3e2				
73 BRAS BASAH ROAD #05-01 NTUC TRADE UNION HOUSESINGAPORE 189556			Date: 12-07-2019	
Code: INC4				
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SDV 5569E	Veh. Inspected	SHC 3928T	
Policy No.	5101791614	Coverage (\$)	0.00	
Claim No.	MT/1051614-001	Excess (\$)	0.00	
Assign From		Assign Date	17/06/2019	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI I40	c.c	1685	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	KMHLB41UMFU064678	Colour	BLUE	
Odometer	428284	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/60 R16	HANKOOK	6 mm	
L/H Front Tyre	205/60 R16	HANKOOK	6 mm	
R/H Rear Tyre	205/60 R16	CST	6 mm	
L/H Rear Tyre	205/60 R16	CST	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	15/06/2019	Inspection Date	17/06/2019	
Survey held at	COMFORTDELGRO ENGINEERING PTE LTD 59 LOYANG DRIVE SINGAPORE 508969			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days		



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 3928T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BOOT LID	TO REPAIR SEE LABOUR	2,174.90	-
1	BOOT LID LOCK UPPER	SERVICEABLE	102.60	-
1	BOOT LID LOCK LOWER	SERVICEABLE	31.70	-
1	BOOT LID 'H' EMBLEM	NECESSARY	28.70	28.70
1	BOOT LID CRDI PLATE	NECESSARY	27.90	27.90
1	REAR BUMPER	CRACKED	553.00	553.00
1	REAR BUMPER REINFORCEMENT	DEFORMED	428.40	428.40
2	REAR BUMPER REINFORCEMENT BRACKET (LH/RH) @\$80.30	O/S BENT	160.60	80.30
10	REAR BUMPER CLIP	NECESSARY	22.00	22.00
2	REAR BUMPER BRACKET @\$35.60	SERVICEABLE	71.20	-
1	REAR BUMPER SPONGE	CRACKED	103.50	103.50
1	REAR BUMPER UNDER COVER	DEFORMED	228.00	228.00
1	REAR BUMPER REFLECTOR LAMP, RH	MISSING	30.60	30.60
1	TAIL LAMP (RH)	CRACKED	697.80	697.80
1	REAR PANEL	SERVICEABLE	526.70	-
1	REAR PANEL GARNISH	SERVICEABLE	57.70	-
1	REAR PANEL LOWER PANEL	SERVICEABLE	89.40	-
1	REAR FENDER (RH)	DEFORMED	2,171.40	2,171.40
1	REAR FENDER INNER LINING (RH)	SERVICEABLE	169.30	-
1	REAR WINDSCREEN MOULDING	NECESSARY	28.30	28.30
1	EXHAUST PIPE INSULATOR, RH	SERVICEABLE	58.55	-
1	EXHAUST SILENCER, RH	DENTED	967.70	967.70
1	EXHAUST PIPE HANGER, RH	SERVICEABLE	58.55	-
1	EXHAUST PIPE CENTRE	BENT	730.10	730.10
1	REAR TYRE RIM (RH)	SCRATCHED	325.30	325.30
1	REAR WHEEL HUP-CAP (RH)	CRACKED	107.10	107.10
	LESS 20% DISCOUNT		-1,990.20	-1,306.02
			7,960.80	5,224.08

Report Ref No. NS/INC19010750/Nvd3e2



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
NETT ITEMS				
1	BOOT LID COMFORT LOGO & TEL NO. STICKER (N)	NECESSARY	30.00	30.00
1	REAR BUMPER REVERSE SENSOR (N)	NOT WORKING	135.70	135.70
	LESS 10% DISCOUNT		-	-16.57
			165.70	149.13
SPECIAL NETT ITEMS				
1	REAR BUMPER RUBBER MAT (SN)	SCRATCHED	50.00	50.00
1	REAR BUMPER ADVERTISEMENT LOGO (SN)	NECESSARY	50.00	50.00
2	REAR FENDER ADVERTISEMENT LOGO (LH/RH) @\$100.00 (SN)	NECESSARY	200.00	200.00
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	46.00	46.00
1	REAR TYRE (RH) (SN)	SERVICEABLE	216.00	-
			562.00	346.00
LABOUR				
	PANEL BEATING. INCLUSIVE OF THE REPAIR OF BOOT LID.		1,600.00	450.00
	SPRAY PAINTING CHARGE.		1,000.00	600.00
	WIRING CHARGE.		50.00	30.00
	TUFF KOTE.		50.00	40.00
	REMOVE / REFIX CUSHION & UPHOLSTERY REAR.	NOT NECESSARY	150.00	-
	REMOVE / REFIX REAR WINDSCREEN GLASS.	NOT NECESSARY	120.00	-
	REMOVE / REFIX REVERSE SENSOR.		80.00	30.00
	REMOVE / REFIX EXHAUST PIPE.	NOT NECESSARY	150.00	-
	REAR WHEEL ALIGNMENT.		80.00	60.00
			3,280.00	1,210.00
GRAND TOTAL			11,968.50	6,929.21
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)				5,550.00

Report Ref No. NS/INC19010750/Nvd3e2

MUHAMMAD NAZRIL BIN ABDULLAH

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons), B.Bus, MBA, PEng, PE,
MInstAEA, MASME, MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.