

ASS. REC. BY: Adnan REF: CS/FCI19010762/Aqd3 ¹¹² Special Instruction:

Synopsis: WBS ASSIGNMENT (Office)

From (Person): Karen Tan of FCI Date/Time: 11:50am @ 18/6/19

Estimated Cost: _____ Bill to: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SLL 744G Insured: SHA 1406G

at Workshop info: Premium Tel: _____

of 55 Ubi Road 1

Policy No: _____ Claim No: D19003919MPSH

Sum Insured: _____ Excess: _____

Make of Veh: _____ D.O.A. 14/06/2019

(Please Accura)

CA / REV / REP. / REV 24 HRS (DS)

Date/Time: 12:24pm @ 18/6/19 Person Contacted: Sheila Vehicle IN/OUT

Date/Time	Action/Instruction
	<u>SLL 744G-X</u>
	<u>SHA 1406 G- CS/FCI18018432/Aqd3a2</u> <u>DOA: 28/9/16</u>
<u>18/6/19 @ 1:53pm</u>	<u>revised to Karen Tan by email</u>
<u>03/7/19 @ 3:39pm</u>	<u>confirmed with Mr Bob Final Ag \$ 31646.60, " 11 days.</u>
	<u>(led \$ 2974.90, 20%)</u>

African

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent?: Yes or No
 GIA / PR Seen: _____ Consistent?: Yes or No
 Est. Repairs: 11 868 days Res.: Yes or No
 Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SLL7446 Yr Regn: 2017 / Feb.
 Type: M.C. / M.Cycle / Bus / Van / Low / Taxi / Prime Mover /

Truck / Trailer or

Make: Audi A3 Sedan c.c. 999
 Colour: Blue A/C: Insured / Std / Nil / NA
 Sp. Reading: 27643 T/Radio: Insured / Std / Nil / NA

Eng/No: _____

C/No: W4YZZ8VXH1040977

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / 6/Rim / STD A/Rim or

Tyre Size: F: 225/45R17

R: 225/45R17

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Continental

Front		Rear	
R/Bal.	<u>06</u> mm	R/Bal.	<u>06</u> mm
L/Bal.	<u>06</u> mm	L/Bal.	<u>06</u> mm
D.O.A.		D.O.I.	<u>18/06/19</u>

Survey held at Premium

Des. of Damages: Frt / Rear / O/S / NIS / UIC / Rooftop or

Front N/S

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction
TP 1st Cap.

RECEIVED 24 SEP 2019

3/9/2019

MV:

PV:

Nett:

Date/Time, File Pass to?	Date/Time, File Return to?
1) <u>04/9/2019</u>	2) _____
3) _____	4) _____
5) _____	6) _____
Final Report:	

Part Prices Check:

IN OUT

Survey Fee:

Date: 29X15-435

Basic & Add.

S + RS - GI

Photos

Others

TOTAL

<u>170+435</u>
<u>50+50+50+50+50</u>
<u>128</u>
<u>983</u>

31/11/19



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: D19003919MFSH

Date: 19 June 2019

Our Ref: CS/FCI19010762/Aqd3

The Motor Claims Department
MS First Capital Insurance Ltd


Dear Sir/Madam,

INITIAL INSPECTION REPORT OF VEHICLE NO. SLL 744G .

Please be informed that we had conducted the inspection of the abovementioned vehicle on 18/06/2019 at the premises of M/s PREMIUM AUTOMOBILES, and have the following to report:-

Workshop Estimate Amount	: S\$ 35,865.00 .
Revised Estimate Amount	: S\$ 22,480.00 .
"Check" Items Amount	: S\$ 6,572.00 .
Market Value	: S\$ - .
LTA Reimbursement Value	: S\$ - .
Nett Value	: S\$ - .

Description of Damage:
The vehicle sustained damages
at the front n/s portion.

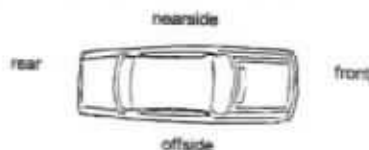

Yours faithfully

ADRIAN LING WAI PING
B.Eng, AMSOE, AMIRTE, AMSAE-A, M.MATAI
Licensed Appraiser

Date	17-06-2019	Our Ref No. D19003919MFSH
Accident Date	14-06-2019	Claim Type. Third Party
Insured Vehicle	SHA1406G	Third Party Vehicle. SLL744G
Survey Location	55 UBI ROAD 1	
Contact Person.	TROY GOH	
Contact No.	63882323/ 67689911	Fax No. 68411183
Survey Type	WITHOUT PREJUDICE: WE ADMIT LIABILITY QUANTUM TO BE AGREED:	
Appointed Surveyor	LKK AUTO CONSULTANTS PTE LTD	
Contact Person	NA	Fax No. 68416315
Contact Number.	NA	

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

Cc : Workshop	PREMIUM AUTOMOBILES PTE LTD	Attention. NIL
Cc : TP Solicitor	NA	TP Solicitor Fax No. NA
Officer Incharge	KARENT	

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.
This is a computer generated letter, no signature required.

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Tuesday, 3 September 2019 3:37 PM
To: Carrine Leong; jlayee.yap@premiumauto.com.sg; Premiumauto Claims; 'Boo seng yak'
Cc: SUR
Subject: RE: FINAL REVISION - SLL744G - TP FIRST CAP - SURVEYED 18 JUN 19

Dear Mr Boo,

WITHOUT PREJUDICE

Confirm final fig \$31,646.60 before GST and 11 repair days.

Kindly send the relevant documents to MS First Capital Insurance company.

Please note that the finalisation subject to insurer's approval.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Mei Kwan (LKKAUTO) <Meikwan@lkkauto.com>
Sent: Tuesday, 13 August 2019 6:38 PM
To: SUR <sur@lkkauto.com>
Subject: FW: FINAL REVISION - SLL744G - TP FIRST CAP - SURVEYED 18 JUN 19

[CS/FCI19010762/Aqd3](#)

From: Boo seng yak <boojohnny@gmail.com>
Sent: Tuesday, 13 August, 2019 6:23 PM
To: Adrian Ling (LKKAUTO) <adrianling@lkkauto.com>; CS A Team <cs-a@lkkauto.com>; Admin A <admin-a@lkkauto.com>; Carrine Leong <carrine.leong@premiumauto.com.sg>; jlayee.yap@premiumauto.com.sg; Chang Chee Sing <claims@premiumauto.com.sg>
Subject: FINAL REVISION - SLL744G - TP FIRST CAP - SURVEYED 18 JUN 19

Hi Adrian and all,

Revised estimate, photo file, towing contract, invoice for rim, re-survey documents is all attached.

Please confirm repair cost of \$31,646.60 @ 11 days of repair exclude 1 Sunday.

Your early closure is well appreciated.

Best regards - jb

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Wednesday, 19 June 2019 1:57 PM
To: 'CWS Motor Claims'; assignments
Cc: 'Karen Tan'; SUR
Subject: RE: SURVEY ASSESSMENT - D19003919MFSH/1
Attachments: CSFC119010762Aqd3.pdf

Dear Karen,

Enclosed herewith preliminary advice of SLL 744G.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAUTO)
Sent: Tuesday, 18 June 2019 12:25 PM
To: 'CWS Motor Claims' <cwsmotorclaims@msfirstcapital.com.sg>; assignments <assignments@lkkauto.com>
Cc: 'Karen Tan' <karentan@msfirstcapital.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: SURVEY ASSESSMENT - D19003919MFSH/1

Dear Sir/Mdm,

Thank you for the assignment.

Best Regards,

G.Nivitha | Admin

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: CWS Motor Claims [<mailto:cwsmotorclaims@msfirstcapital.com.sg>]
Sent: Tuesday, 18 June 2019 11:50 AM
To: ASSIGNMENTS@LKKAUTO.COM
Cc: CWS Motor Claims <cwsmotorclaims@msfirstcapital.com.sg>; Karen Tan <karentan@msfirstcapital.com.sg>
Subject: PRI: SURVEY ASSESSMENT - D19003919MFSH/1

Dear Sir/Mdm,

We refer to the above reference.

Please find attached the necessary documents for survey.

Kindly submit your report via CWS within the next 14 days.

Accident Photo



Details of Accident

DATE: 14 / 06 / 2019

TIME: 11 : 40 Hrs

Exact Location of Accident: Near ~~Shanti~~ Ulu Pandan CC

Details of Own Vehicle

Vehicle Registration Number: SLL 744 G

Name of Registered Owner: Wahjudi Gunawan

Nric: Pink / Blue 52738402 A

Fin / Passport No.:

Date of Birth (DD/MM/YYYY): 05 / 02 / 1967

Address: 11 G Mount Sinai Lane, #04-32, S277056

Contact: (Hm) (Off) (Hp)

Email:

Vehicle Particulars (Own Vehicle)

Vehicle make & model

: A3

Type of vehicle

: Sedan

Exact purpose for which vehicle was

Being used at time of accident

: Private / commercial / Hire & Reward

Are you claiming under your own

: Yes / No

Insurance policy for repair to your vehicle?

: If no, please indicate intention:

Third party

Vehicle Category:

: Private / Commercial / Motorcycle

Insurance (Own Vehicle)

Name of Insurance Company

: Liberty

Type of Policy

: ACT / Comprehensive / 3rd Party / 3rd party Fire & Theft

Fleet Policy

: Yes / No

Policy Number

: SD 19 V00570 / VPC 2 / R01

Motor CI

:

Driver Particulars

Name of Driver: Lea Junita Marta

Nric: Pink / Blue 56963423 J

Fin / Passport No.:

Date of Birth (DD/MM/YYYY): 09 / 06 / 1969

Occupation: Indoor / Outdoor

Class 3 Pass date:

: / /

Gender: Male / Female

Address: 11 G Mount Sinai Lane, #04-32, S277056

Contact: 64686325 (Hm) (Off) 91733217 (Hp)

Email: lea.gunawan@gmail.com

Was driver an employee of the insured's co.?

: Yes / No

If no, relationship of driver with the insured

: wife

Vehicle registration no. of driver's own vehicle:

(If Applicable)

Insurance company of driver's own vehicle

:

(If Applicable)

No. of Pax inside your vehicle: 1

1) Name: Lea J. Marta Gender: Male / Female

2) Name: Gender: Male / Female

3) Name: Gender: Male / Female

4) Name: Gender: Male / Female

Any Video Footage: Yes / No

Accident Statement : Part 2

General Information of Accident

Type of Collision : Side swipe
(eg. Chain collision, side swipe, front to rear)

Weather Conditions : Clear / Raining Others : _____
Road Surface : Dry / Wet Others : _____

Other Information

a) Was anybody injured in the accident? Yes / No If Yes : Anyone Convey by Ambulance Yes / No
b) Was any other vehicle or property damaged? Yes / No
(including witness)

Details of Police Action

Was the accident reported to the police? Yes / No
Was notice of intended prosecution given? Yes / No

Details of Other Vehicle Property

Vehicle Registration No. : SHA 1406 G
Vehicle Make / Model / Colour : Hyundai - Blue
Details of Property : Comfort Taxi

Details of Other Vehicle's Insured Policy Holder Driver

Name of Driver : Moh Foo Hua Patrick
NRIC / Pink / Blue : S17077182 Fin / Passport No : _____
Contact : 97230393 97230393
Address : _____ S()

Insurance Company

Name of Insurance Company : _____
Nature of Damage : _____

Details of Witness

Name : _____
Contact : _____
Email Address : _____

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate	:	Accident Repairs
Workshop	:	Ubi Road 1
Contact No	:	6366 2323
Fax No	:	6841 1183
Reference	:	PA/TP/0756/2019/TG
Date	:	17-Jun-19

Vehicle NOT IN workshop. Kindly arrange survey

Your insured vehicle no : **SHA 1406 G**

First Capital Insurance Ltd

36 Robinson Road

16-01 City House

Singapore 068877

Attn: Motor Claims Dept

Tel:6854 3909 Fax: 6507 3849

Owner's Name	:	Mr. Wahjudi Gunawan
Address	:	11G Mount Sinai Lane #04-32 Singapore 277056
Telephone	:	(HP)+65 91738717
Type of Claim	:	Third Party Claim
Policy No.	:	SD19V00570/VPC2/R01
Vehicle No	:	SLL 744 G
Model Code	:	A3 Sedan 1.0 TFSI 8V
Model / Year	:	25/9/2014
Engine No	:	CHZ 181099
Chassis No	:	WAUZZZ8VXH1040977
Mileage	:	-
Date In	:	-
Liability	:	-
Excess Cost	:	-
Estimated By	:	Johnny Boo / Allan Wu
Accident Date	:	14-Jun-19
Place of Accident	:	Near Ulu Pandan CC

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLL 744 G

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
1	To remove and transfer front wire harness for headlights, horns, outside temperature sensor and headlight washer assy.	S/N \$ 360.00	✓
2	To dismantle lhs front door panel trim. To remove and reinstall lhs wing mirror assy.	S/N \$ 300.00	✓
3	To remove and reinstall aircon condenser, additional radiator and radiator. Check electrical fans and control unit. Pressurise cooling system. To carry out vacuum and regas.	S/N \$ 1,200.00	?
4	To dismantle and renew front bumper, bonnet, lhs fender and lhs headlight. Cut out and reweld lhs fender support and closing element. Renew front lock carrier and align to position. Re-organise front crash management components. Reinstall all parts removed.	\$ 8,050.00	3150 without Lock Carrier 4900 with Lock carrier.
5	To respray front bumper, bonnet, lhs front fender, and lhs front fender support and lhs front door. To carry out joint sealant works and stone chip treatment.	\$ 4,700.00	3200 4 x 700 = 2800 Fender Support = 400
6	To renew lhs front rim and carry out wheel alignment. To inspect lhs front suspension for further damage.	S/N \$ 280.00	✓
7	To carry out diagnostic check	S/N \$ 192.00	✓
TOTAL LABOUR CHARGES		: \$ 15,082.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLL 744 G**

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	FRONT BUMPER <i>Distorted</i>	\$ 1,830.00	✓
2	FRONT BUMPER FIXING PARTS <i>new</i>	\$ 170.00	✓
3	FRONT BUMPER GUIDE SECTION-LH <i>Dist</i>	\$ 35.00	✓ 34.40
4	FRONT BUMPER GRILLE - CENTER <i>crushed</i>	\$ 146.00	✓ 145.50
5	FRONT BUMPER CLOSING ELEMENT <i>new torn</i>	\$ 488.00	✓ 487.50
6	FRONT BUMPER CLOSING ELEMENT - LH <i>Damaged</i>	\$ 270.00	? ✓
7	FRONT BUMPER COVER TRIM - LH <i>new</i>	\$ 148.00	✓
8	WHEEL HOUSING LINER - LH <i>new Not new</i>	\$ 34.00	✓ ? X
9	FRONT RADIATOR GRILLE <i>crushed</i>	\$ 1,301.00	✓
10	FRONT RADIATOR CLOSING ELEMENT <i>crushed</i>	\$ 174.00	? 173.50 ✓
11	FRONT AIR GUIDE GRILLE - LH <i>new</i>	\$ 171.00	✓ 170.50
12	FRONT BUMPER FRAME <i>Bent</i>	\$ 660.00	? 659.50 ✓
13	FOAM FILLER PIECE <i>crushed</i>	\$ 172.00	✓
14	FRONT REINFORCEMENT BAR <i>new</i>	\$ 111.00	? X
15	FRONT REINFORCEMENT BAR <i>Not new</i>	\$ 111.00	? X
16	STICKER FOR AC <i>new</i>	\$ 7.00	✓ 6.40
17	FRONT PANEL WARNING STICKER <i>new</i>	\$ 13.00	✓ 12.20
18	FRONT FENDER - LH <i>Distorted</i>	\$ 778.00	✓ 777.50
19	POP RIVET <i>new</i>	5 \$ 15.00	✓
20	FRONT FENDER ATTACHMENT PARTS <i>Not new</i>	\$ 65.00	✓ X
SUB TOTAL SPARE PARTS		\$ 6,699.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLL 744 G

S/N	Parts Description		Damaged Parts & Prices	
			S/Nett	Remark
21	FENDER BRACKET - LH	} Bent	\$ 25.00	✓ 24.70
22	FENDER BRACKET - LH		\$ 35.00	✓ 34.70
23	BRACE	Bent	\$ 88.00	✓ 87.30
24	WHEEL HOUSING LINER - LH	torn	\$ 158.00	✓ 157.50
25	WHEEL HOUSING LINER ATTACHMENT PARTS	Part New	\$ 81.00	? X
26	BONNET	Dented	\$ 2,898.00	✓ 2895
27	BONNET ATTACHMENT PARTS	Part New	\$ 149.00	? X
28	LID HINGE - LH	} Part New	\$ 56.00	+
29	LID HINGE - RH		\$ 56.00	+
30	GAS FILLED STRUT	} Part New	\$ 109.00	+
31	CATCH HOOK		\$ 81.00	+
32	STRIKER - LH		\$ 100.00	+
33	EDGE PROTECTION	new	\$ 25.00	✓ 24.90
34	SIDE SEAL - LH	new	\$ 37.00	✓ 36.50
35	CATCH HOOK	} new	\$ 58.00	+
35	BONNET LID LOCK		\$ 184.00	+
36	BOWDEN CABLE		\$ 53.00	+
37	LID LOCK CABLE		\$ 67.00	+
38	HOOD INSULATION PAD	new	\$ 201.00	+
39	FRONT HEADLIGHT LED - LH	smashed	\$ 5,029.00	✓
40	LED WITH HEAT SINK	2yrs d.	\$ 666.00	? 665.50

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLL 744 G

S/N	Parts Description		Damaged Par S/Nett
21	HEADLIGHT MODULE <i>shipped.</i>	\$	693.00 ? 692.50 ✓
22	HEADLIGHT CONTOL UNIT <i>Dented</i>	\$	508.00 ? 507.50 ✓
23	HEADLIGHT HOSE - LH <i>Neu</i>	\$	36.00 x
24	LIFT CYLINDER <i>Crushed</i>	\$	128.00 ✓ 127.50
25	LIFT CYLINDER HOSE <i>Not torn</i>	\$	61.00 x 60.70 ✓
26	WASHER RESERVOIR <i>Crushed</i>	\$	186.00 ✓ 185.50
27	SIGNAL HORN FOR HIGH TUNE - LH <i>Crushed</i>	\$	182.00 ? ✓
28	FENDER TOP SUPPORT <i>Bent</i>	\$	66.00 ✓ 65.40
29	FRONT RADIATOR PANEL SUPPORT <i>Crushed.</i>	\$	663.00 ? ✓
30	COOLANT <i>Not Nec</i>	4 \$	84.00 ? x
31	RADIATOR AIR GUIDE - LH <i>Behind.</i>	\$	22.00 ? 21.40 ✓
32	RADIATOR AIR GUIDE - UPPER CENTRE <i>Not Nec</i>	\$	11.00 ? x
33	AIR FILTER <i>Not Nec</i>	\$	53.00 ? x
34	CHROME WINDOW TRIM <i>Neu</i>	\$	282.00 +
35	RUBBER VALVE <i>Neu</i>	4 \$	13.00 +
36	FRONT NUMBER PLATE <i>Neu</i>	\$	40.00 ✓
37	FRONT RIM - LH <i>cut</i>		TBC ✓ 600
38	ACRYLIC SEALANT <i>Not Nec</i>	\$	180.00 ? x
39	CAVITY WAX <i>Not Nec</i>	\$	140.00 ? x
40	STONE CHIP TREATMENT <i>Not Nec</i>	\$	180.00 ? x
41	SUNDRIES <i>Neu</i>	\$	400.00 ? 149.70 ✓
TOTAL SPARE PARTS		\$	20,783.00
TOTAL LABOUR CHARGES		\$	15,082.00
GRAND TOTAL		\$	35,865.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

39371.50

39489.50

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name

: Adrian Lim

Surveyed Date

: 18/06/19

Authorised Date

:

Excess Cost

:

Liability

:

Remarks

: Not Authorised, 7 days - without Lock Carrier
10 days - with Lock Carrier.

LKK Auto Consultants hence notify

the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Please Note

- : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly. For inspection of vehicle, please refer to Ms Norah Khai at Tel:6768 9828 for appointment.

Yours faithfully,


Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

rk Order: 56897
 l: WAUZZZ8VXH1040977
 :hnician: BENG
 ense: SLL 744 G
 ometer: 27644
 e 25.6.19 11:58

udi : A3 : 2013- (MQB - 8V) : Standard Suspension (2UA) + (G01 G02 G03 G04 G05 G14 G15 G16
 G21 G22 G23 G24 G41 G42 G43 G44 G51) : without Independent Rear Suspension

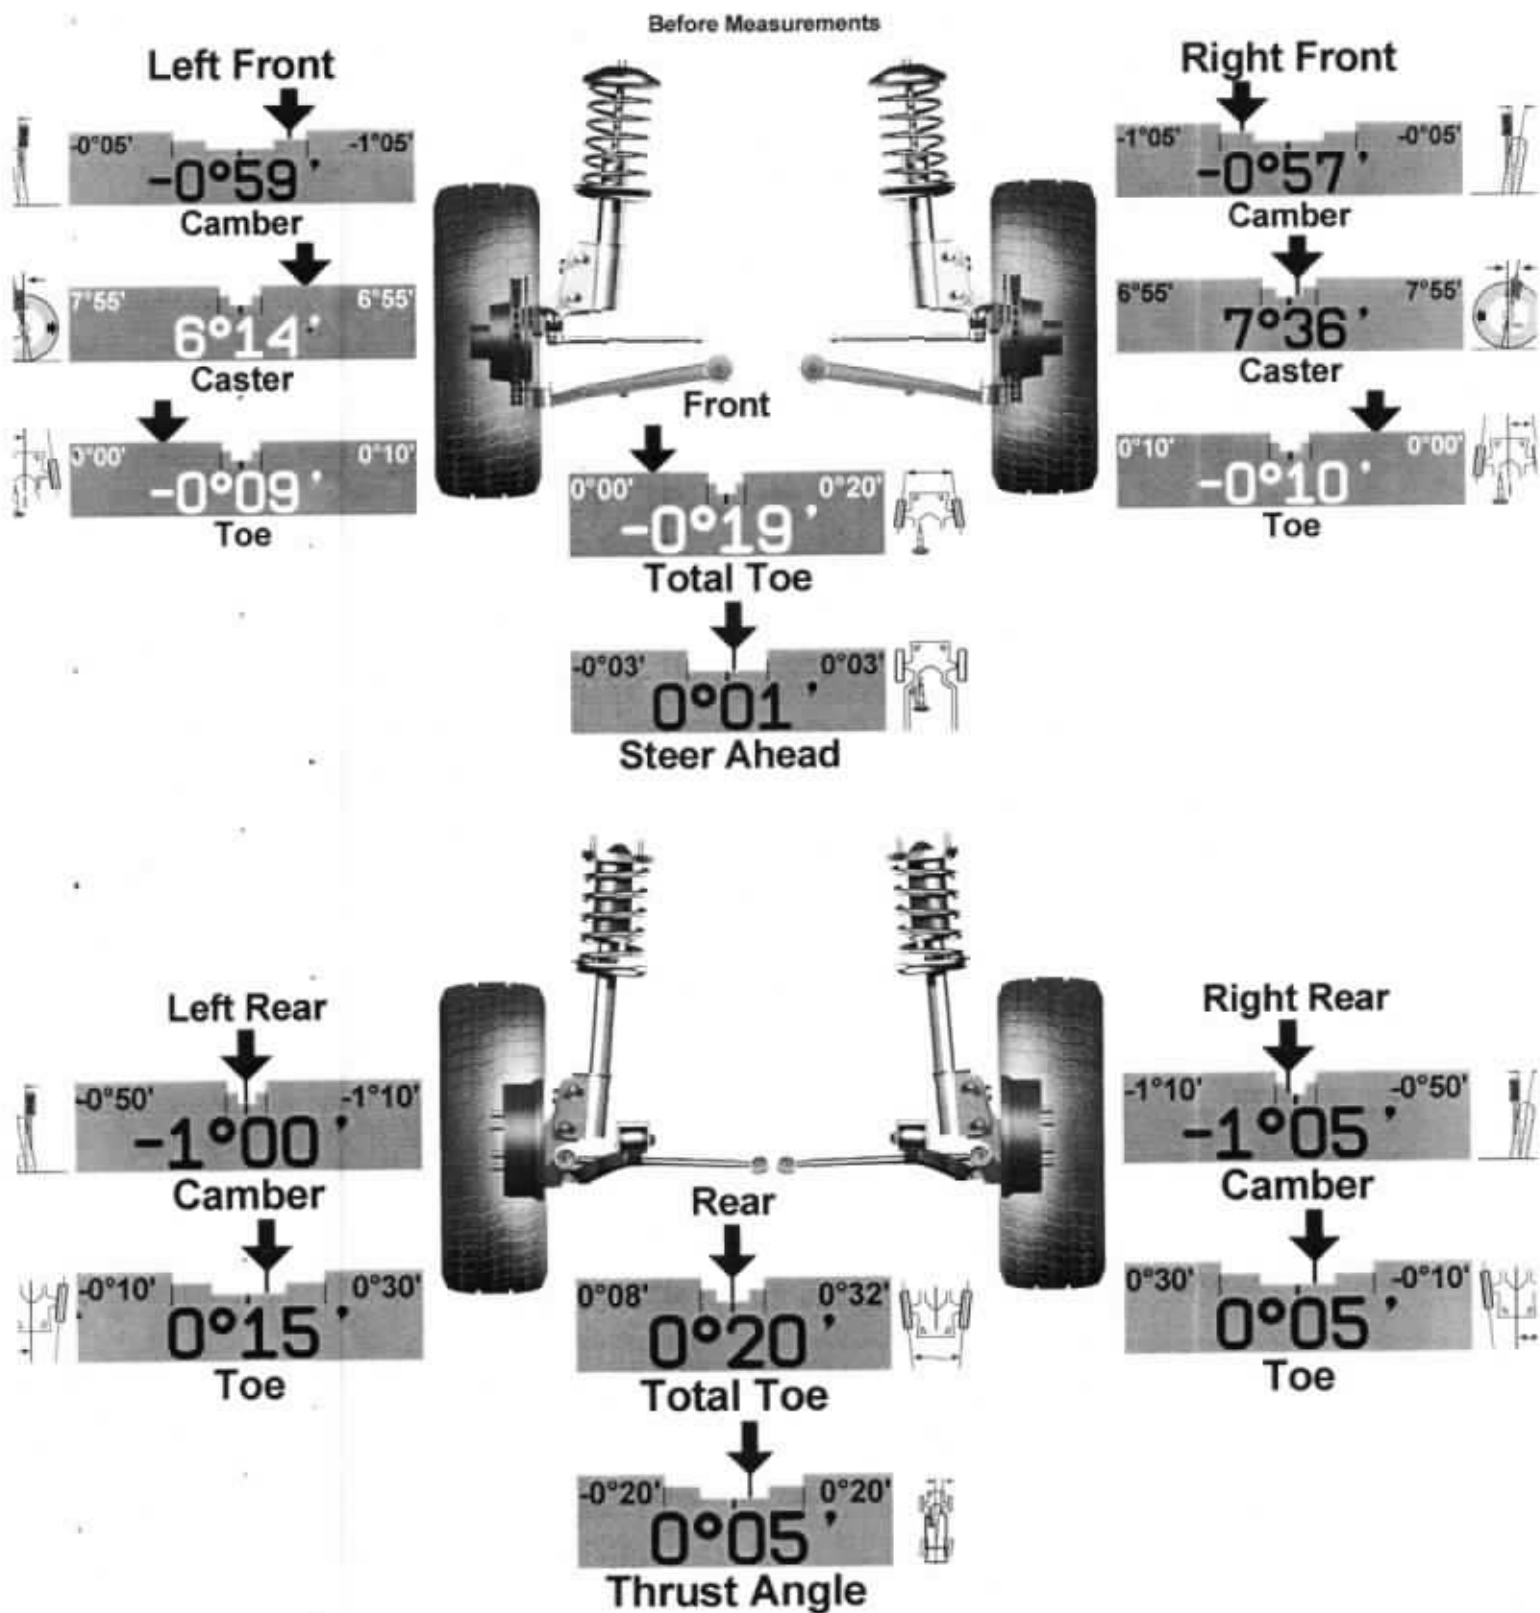

One or more values are not within specification. Tire wear, handling and safety problems may result.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/TP/0756/2019/TG
Date : 17-Jun-19

Vehicle NOT IN workshop. Kindly arrange survey

Your insured vehicle no : **SHA 1406 G**

First Capital Insurance Ltd

36 Robinson Road

16-01 City House

Singapore 068877

Hi Adrian

We took 11 days exclude 1 Sunday
with added repairs - jb - 13 Aug 19

Attn: Motor Claims Dept

Tel:6854 3909 Fax: 6507 3849

Owner's Name : Mr. Wahjudi Gunawan
Address : 11G Mount Sinai Lane
#04-32
Singapore 277056
Telephone : (HP)+65 91738717
Type of Claim : Third Party Claim
Policy No. : SD19V00570/VPC2/R01
Vehicle No : **SLL 744 G**
Model Code : A3 Sedan 1.0 TFSI 8V
Model / Year : 25/9/2014
Engine No : CHZ 181099
Chassis No : WAUZZZ8VXH1040977
Mileage :
Date In : -
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 14-Jun-19
Place of Accident : Near Ulu Pandan CC

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SLL 744 G

S/n	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To remove and transfer front wire harness for headlights, horns, outside temperature sensor and headlight washer assy.	S/N \$	360.00	\$ 360.00
2	To dismantle lhs front door panel trim. To remove and reinstall lhs wing mirror assy,	S/N \$	300.00	\$ 300.00
3	To remove and reinstall aircon condenser, additional radiator and radiator. Check electrical fans and control unit. Pressurise cooling system. To carry out vacuum and regas.	S/N \$	1,200.00	\$ 1,200.00
4	To dismantle and renew front bumper, bonnet, lhs fender and lhs headlight. Cut out and reweld lhs fender support and closing element. Renew front lock carrier and align to position. Re-organise front crash management components. Reinstall all parts removed.	\$	8,050.00	\$ 4,900.00
5	To respray front bumper, bonnet, lhs front fender, and lhs front fender support and lhs front door. To carry out joint sealant works and stone chip treatment.	\$	4,700.00	\$ 3,200.00
6	To renew lhs front rim and carry out wheel alignment. To inspect lhs front suspension for further damage.	S/N \$	280.00	\$ 280.00
7	Added labour charges - see attached	\$	280.00	\$ 280.00
8	Added labour charges - see attached	\$	1,200.00	\$ 1,200.00
9	To carry out diagnostic check	S/N \$	192.00	\$ 192.00
TOTAL LABOUR CHARGES		:	<u>\$ 16,562.00</u>	<u>\$ 11,912.00</u>

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLL 744 G**

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	FRONT BUMPER	\$ 1,830.00	\$ 1,830.00
2	FRONT BUMPER FIXING PARTS	\$ 170.00	
3	FRONT BUMPER GUIDE SECTION-LH	\$ 35.00	\$ 34.40
4	FRONT BUMPER GRILLE - CENTER	\$ 146.00	\$ 145.50
5	FRONT BUMPER CLOSING ELEMENT	\$ 488.00	\$ 487.50
6	FRONT BUMPER CLOSING ELEMENT - LH	\$ 270.00	\$ 270.00
7	FRONT BUMPER COVER TRIM - LH	\$ 148.00	
8	WHEEL HOUSING LINER - LH	\$ 34.00	
9	FRONT RADIATOR GRILLE	\$ 1,301.00	\$ 1,301.00
10	FRONT RADIATOR CLOSING ELEMENT	\$ 174.00	\$ 173.50
11	FRONT AIR GUIDE GRILLE - LH	\$ 171.00	\$ 170.50
12	FRONT BUMPER FRAME	\$ 660.00	\$ 659.50
13	FOAM FILLER PIECE	\$ 172.00	\$ 172.00
14	FRONT REINFORCEMENT BAR	\$ 111.00	
15	FRONT REINFORCEMENT BAR	\$ 111.00	
16	STICKER FOR AC	\$ 7.00	\$ 6.40
17	FRONT PANEL WARNING STICKER	\$ 13.00	\$ 12.20
18	FRONT FENDER - LH	\$ 778.00	\$ 777.50
19	POP RIVET	5 \$ 15.00	\$ 15.00
20	FRONT FENDER ATTACHMENT PARTS	\$ 65.00	
SUB TOTAL SPARE PARTS		\$ 6,699.00	\$ 6,055.00

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SLL 744 G

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
			\$	6,055.00
21	FENDER BRACKET - LH	\$	25.00	\$ 24.70
22	FENDER BRACKET - LH	\$	35.00	\$ 34.70
23	BRACE	\$	88.00	\$ 87.30
24	WHEEL HOUSING LINER - LH	\$	158.00	\$ 157.50
25	WHEEL HOUSING LINER ATTACHMENT PARTS	\$	81.00	
26	BONNET	\$	2,898.00	\$ 2,898.00
27	BONNET ATTACHMENT PARTS	\$	149.00	
28	LID HINGE - LH	\$	56.00	
29	LID HINGE - RH	\$	56.00	
30	GAS FILLED STRUT	\$	109.00	
31	CATCH HOOK	\$	81.00	
32	STRIKER - LH	\$	100.00	
33	EDGE PROTECTION	\$	25.00	\$ 24.90
34	SIDE SEAL - LH	\$	37.00	\$ 36.80
35	CATCH HOOK	\$	58.00	
35	BONNET LID LOCK	\$	184.00	
36	BOWDEN CABLE	\$	53.00	
37	LID LOCK CABLE	\$	67.00	
38	HOOD INSULATION PAD	\$	201.00	
39	FRONT HEADLIGHT LED -LH	\$	5,029.00	\$ 5,029.00
40	LED WITH HEAT SINK	\$	666.00	\$ 665.50

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLL 744 G**

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 15,013.40
21	HEADLIGHT MODULE		\$ 693.00	\$ 692.50
22	HEADLIGHT CONTOL UNIT		\$ 508.00	\$ 507.50
23	HEADLIGHT HOSE - LH		\$ 36.00	
24	LIFT CYLINDER		\$ 128.00	\$ 127.50
25	LIFT CYLINDER HOSE		\$ 61.00	\$ 60.20
26	WASHER RESERVOIR		\$ 186.00	\$ 185.50
27	SIGNAL HORN FOR HIGH TUNE - LH		\$ 182.00	\$ 182.00
28	FENDER TOP SUPPORT		\$ 66.00	\$ 65.40
29	FRONT RADIATOR PANEL SUPPORT		\$ 663.00	\$ 663.00
30	COOLANT	4	\$ 84.00	
31	RADIATOR AIR GUIDE - LH		\$ 22.00	\$ 21.40
32	RADIATOR AIR GUIDE - UPPER CENTRE		\$ 11.00	
33	AIR FILTER		\$ 53.00	
34	CHROME WINDOW TRIM		\$ 282.00	
35	RUBBER VALVE	4	\$ 13.00	
36	FRONT NUMBER PLATE		\$ 40.00	\$ 40.00
37	FRONT RIM - LH		\$ 600.00	\$ 600.00
38	ACRYLIC SEALANT		\$ 180.00	
39	CRAVITY WAX		\$ 140.00	
40	STONE CHIP TREATMENT		\$ 180.00	
41	Added parts - see attached		\$ 1,455.00	\$ 1,426.50
42	SUNDRIES		\$ 400.00	\$ 149.70
	TOTAL SPARE PARTS	:	\$ 22,838.00	\$ 19,734.60
	TOTAL LABOUR CHARGES		\$ 16,562.00	\$ 11,912.00
	GRAND TOTAL		\$ 39,400.00	\$ 31,646.60

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Supplementary Estimate

GST Reg No. 19-9902271-W

First Capital Insurance Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Motor Claims Dept Tel:6854 3909 Fax: 6507 3849		Estimate No. Date Service Advisor Pages Regn No Model No	PA/TP/0756/2019/TG 26-Jun-19 Kee Siang 1 of 1 SLL 744 G A3 Sedan 1.0 TFSI 8V
Quantity	Description	Unit Price	Amount
<u>Labours</u>			
1	To dismantle lhs front suspension components. Inspect for damages and renew accordingly. S/N	\$ 1,200.00	\$ 1,200.00
			\$ 1,200.00
<u>Parts</u>			
1	Lower Arm - LH	\$ 336.00	\$ 336.00
2	Lower Arm Ball Joint - LH	\$ 117.00	\$ 116.50
3	Wheel Bearing Housing -LH	\$ 442.00	\$ 532.00
4	Wheel Bearing Assembly - LH	\$ 442.00	\$ 442.00
5	Tie Rod End - LH	\$ 118.00	
6			
	Materials	\$ 1,455.00	\$ 1,426.50
	Labour	\$ 1,200.00	\$ 1,200.00
	Total	\$ 2,655.00	\$ 2,626.50

For Premium Automobiles Pte Ltd

 Authorised Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Supplementary Estimate

GST Reg No. 19-9902271-W

First Capital Insurance Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Tel:6864 3909 Fax: 6507 3849

Estimate No.
Date
Service Advisor
Pages
Regn No
Model No

PA/TP/0756/2019/TG
26-Jun-19
Kee Siang
1 of 1
SLL 744 G
A3 Sedan 1.0 TFSI 8V

Quantity	Description	Unit Price	Amount
Labours			
1	To dismantle lhs front suspension components. Inspect for damages and renew accordingly. S/N	\$ 1,200.00	
Parts			
1	Lower Arm - LH <i>3 Bent</i>	\$ 336.00	
2	Lower Arm Ball Joint - LH	\$ 117.00	
3	Wheel Bearing Housing - LH <i>2nd</i>	\$ 442.00	
4	Wheel Bearing Assembly - LH <i>new</i>	\$ 442.00	
5	Tie Rod End - LH <i>the new</i>	\$ 118.00	
6			
GRAND TOTAL		\$ 2,655.00	

For Premium Automobiles Pte Ltd



Authorised Signature

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Supplementary Estimate

GST Reg No. 19-9902271-W

First Capital Insurance Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Motor Claims Dept Tel:6854 3909 Fax: 6507 3849		Estimate No. Date Service Advisor Pages Regn No Model No	PA/TP/0756/2019/TG 26-Jun-19 Kee Siang 1 of 1 SLL 744 G A3 Sedan 1.0 TFSI 8V
Quantity	Description	Unit Price	Amount
<u>Labours</u>			
1	Towing and recovery charges S/N	\$ 280.00	\$ 280.00 ✓
		\$ 280.00	\$ 280.00
GRAND TOTAL		\$ 280.00	#####

For Premium Automobiles Pte Ltd

Admin L
sls

Authorised Signature



L S TYRES & AUTOMOTIVE PTE LTD

53 UBI AVE 1 #01-04/05 PAYA UBI INDUSTRIAL PARK SINGAPORE 408934

TEL: (65) 6744 4280 (65) 6748 1472 FAX: (65) 6748 3822

Reg & GST No: 200616874E

Tax Invoice No: LS172752

Invoice To :

CASH

Singapore

Date: 01-Jul-19

Credit Terms: Cash Only

Vehicle Type: AUDI

Vehicle Model: A3

Vehicle No: SLL744G

Mileage: 27652

Stockcode	Description	Quantity	Unitprice	Amount
AI308-07	AI308 7517 5/112 +42 HS	1	\$600.00	\$600.00

Remarks:

TOTAL \$600.00

7% GST \$42.00

GRAND TOTAL \$642.00

1. Any irregularity of delivery should be reported within 7 days, otherwise no claim will be entertained.
2. All cheques are to be crossed "A/C Payee/ Not Negotiable" made payable to "L S Tyres & Automotive Pte Ltd"
3. 1% interest per month will be charged for overdue payments.

Sold By



Customer Signature



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3581 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD		Ref : CS/FCI19010762/Aqd3n2		
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Date : 09-09-2019		
		Code : FCI2		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHA 1406G	Veh. Inspected	SLL 744G	
Policy No.		Coverage (\$)	0.00	
Claim No.	D19003919MFSH	Excess (\$)	0.00	
Assign From	KARENT	Assign Date	18/06/2019	
2. Vehicle Particulars & Condition				
Make & Model	AUDI A3 SEDAN	c.c	999	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	WAUZZZ8VXH1040977	Colour	BLUE	
Odometer	27643	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/45 R17	CONTINENTAL	6 mm	
L/H Front Tyre	225/45 R17	CONTINENTAL	6 mm	
R/H Rear Tyre	225/45 R17	CONTINENTAL	6 mm	
L/H Rear Tyre	225/45 R17	CONTINENTAL	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	14/06/2019	Inspection Date	18/06/2019	
Survey held at	PREMIUM AUTOMOBILES PTE LTD 55 UBI ROAD 1 SINGAPORE 408699			
5a. Remarks				
A) DAMAGES CONSISTENT TO ACCIDENT REPORT. B) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. C) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		11 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLL 744G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	FRONT BUMPER (SN)	DISTORTED	1,830.00	1,830.00
1	FRONT BUMPER FIXING PARTS (SN)	NOT NECESSARY	170.00	-
1	FRONT BUMPER GUIDE SECTION-LH (SN)	DAMAGED	35.00	34.40
1	FRONT BUMPER GRILLE-CENTER (SN)	CRACKED	146.00	145.50
1	FRONT BUMPER CLOSING ELEMENT (SN)	TORN	488.00	487.50
1	FRONT BUMPER CLOSING ELEMENT-LH (SN)	DAMAGED	270.00	270.00
1	FRONT BUMPER COVER TRIM-LH (SN)	NOT NECESSARY	148.00	-
1	WHEEL HOUSING LINER-LH (SN)	NOT NECESSARY	34.00	-
1	FRONT RADIATOR GRILLE (SN)	CRACKED	1,301.00	1,301.00
1	FRONT RADIATOR CLOSING ELEMENT (SN)	CRACKED	174.00	173.50
1	FRONT AIR GUIDE GRILLE-LH (SN)	CUT	171.00	170.50
1	FRONT BUMPER FRAME (SN)	BENT	660.00	659.50
1	FOAM FILLER PIECE (SN)	CRACKED	172.00	172.00
1	FRONT REINFORCEMENT BAR (SN)	NOT NECESSARY	111.00	-
1	FRONT REINFORCEMENT BAR (SN)	NOT NECESSARY	111.00	-
1	STICKER FOR AC (SN)	NECESSARY	7.00	6.40
1	FRONT PANEL WARNING STICKER (SN)	NECESSARY	13.00	12.20
1	FRONT FENDER-LH (SN)	DISTORTED	778.00	777.50
5	POP RIVET (SN)	NECESSARY	15.00	15.00
1	FRONT FENDER ATTACHMENT PARTS (SN)	NOT NECESSARY	65.00	-
1	FENDER BRACKET-LH (SN)	BENT	25.00	24.70
1	FENDER BRACKET-LH (SN)	BENT	35.00	34.70
1	BRACE (SN)	BENT	88.00	87.30
1	WHEEL HOUSING LINER-LH (SN)	TORN	158.00	157.50
1	WHEEL HOUSING LINER ATTACHMENT PARTS (SN)	NOT NECESSARY	81.00	-
1	BONNET (SN)	DENTED	2,898.00	2,898.00
1	BONNET ATTACHMENT PARTS (SN)	NOT NECESSARY	149.00	-
1	LID HINGE-LH (SN)	NOT NECESSARY	56.00	-
1	LID HINGE-RH (SN)	NOT NECESSARY	56.00	-
1	GAS FILLED STRUT (SN)	NOT NECESSARY	109.00	-
1	CATCH HOOK (SN)	NOT NECESSARY	81.00	-

Report Ref No. CS/FCI19010762/Aqd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	STRIKER-LH (SN)	NOT NECESSARY	100.00	-
1	EDGE PROTECTION (SN)	NECESSARY	25.00	24.90
1	SIDE SEAL-LH (SN)	NECESSARY	37.00	36.80
1	CATCH HOOK (SN)	NOT NECESSARY	58.00	-
1	BONNET LID LOCK (SN)	NOT NECESSARY	184.00	-
1	BOWDEN CABLE (SN)	NOT NECESSARY	53.00	-
1	LID LOCK CABLE (SN)	NOT NECESSARY	67.00	-
1	HOOD INSULATION PAD (SN)	NOT NECESSARY	201.00	-
1	FRONT HEADLIGHT LED-LH (SN)	SMASHED	5,029.00	5,029.00
1	LED WITH HEAT SINK (SN)	DAMAGED	666.00	665.50
1	HEADLIGHT MODULE (SN)	CHIPPED	693.00	692.50
1	HEADLIGHT CONTROL UNIT (SN)	DENTED	508.00	507.50
1	HEADLIGHT HOSE-LH (SN)	NOT NECESSARY	36.00	-
1	LIFT CYLINDER (SN)	CRACKED	128.00	127.50
1	LIFT CYLINDER HOSE (SN)	TORN	61.00	60.20
1	WASHER RESERVOIR (SN)	CRACKED	186.00	185.50
1	SIGNAL HORN FOR HIGH TUNE-LH (SN)	CRACKED	182.00	182.00
1	FENDER TOP SUPPORT (SN)	BENT	66.00	65.40
1	FRONT RADIATOR PANEL SUPPORT (SN)	CRACKED	663.00	663.00
4	COOLANT (SN)	NOT NECESSARY	84.00	-
1	RADIATOR AIR GUIDE-LH (SN)	DEFORMED	22.00	21.40
1	RADIATOR AIR GUIDE-UPPER CENTRE (SN)	NOT NECESSARY	11.00	-
1	AIR FILTER (SN)	NOT NECESSARY	53.00	-
1	CHROME WINDOW TRIM (SN)	NOT NECESSARY	282.00	-
4	RUBBER VALVE (SN)	NOT NECESSARY	13.00	-
1	FRONT NUMBER PLATE (SN)	NECESSARY	40.00	40.00
1	FRONT RIM-LH (SN)	CUT	600.00	600.00
1	ACRYLIC SEALANT (SN)	NOT NECESSARY	180.00	-
1	CAVITY WAX (SN)	NOT NECESSARY	140.00	-
1	STONE CHIP TREATMENT (SN)	NOT NECESSARY	180.00	-
1	SUNDRIES (SN)	NECESSARY	400.00	149.70
1	LOWER ARM-LH (ADDITIONAL)(SN)	BENT	336.00	336.00
1	LOWER ARM BALL JOINT-LH (ADDITIONAL)(SN)	BENT	116.50	116.50

Report Ref No. CS/FC119010762/Aqd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	WHEEL BEARING HOUSING-LH(ADDITIONAL)(SN)	DAMAGED	532.00	532.00
1	WHEEL BEARING ASSEMBLY-LH(ADDITIONAL)(SN)	NECESSARY	442.00	442.00
1	TIE ROD END-LH (ADDITIONAL)(SN)	NOT NECESSARY	118.00	-
			22,927.50	19,734.60
	LABOUR			
	TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS,HORNS,OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY.		360.00	360.00
	TO DISMANTLE LHS FRONT DOOR PANEL TRIM.TO REMOVE AND REINSTALL LHS WING MIRROR ASSY.		300.00	300.00
	TO REMOVE AND REINSTALL AIRCON CONDENSER,ADDITIONAL RADIATOR AND RADIATOR.CHECK ELECTRICAL FANS AND CINTROL UNIT,PRESSURISE COOLING SYSTEM.TO CARRY OUT VACUUM AND REGAS.		1,200.00	1,200.00
	TO DISMANTLE AND RENEW FRONT BUMPER,BONNET,LHS FENDER AND LHS HEADLIGHT.CUT OUT AND REWELD LHS FENDER SUPPORT AND CLOSING ELEMENT.RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION.RE-ORGANISE FRONT CRASH MANAGEMENT COMPONENTS.REINSTALL ALL PARTS REMOVED.		8,050.00	4,900.00
	TO RESPRAY FRONT BUMPER,BONNET,LHS FRONT FENDER,AND LHS FRONT FENDER SUPPORT AND LHS FRONT DOOR.TO CARRY OUT JOINT SEALANT WORKS AND STONE CHIP TREATMENT.		4,700.00	3,200.00
	TO RENEW LHS FRONT RIM AND CARRY OUT WHEEL ALIGNMENT.TO INSPECT LHS FRONT SUSPENSION FOR FUTHER DAMAGE.		280.00	280.00
	TO CARRY OUT DIAGNOSTIC CHECK.		192.00	192.00
	TOWING AND RECOVERY CHARGES (ADDITIONAL).		280.00	280.00
	TO DISMANTLE LHS FRONT SUSPENSION COMPONENTS.INSPECT FOR DAMAGES AND RENEW ACCORDINGLY (ADDITIONAL).		1,200.00	1,200.00
	-		-	-
	-		-	-
	-		-	-
			16,562.00	11,912.00
GRAND TOTAL			39,489.50	31,646.60

Report Ref No. CS/FCI19010762/Aqd3n2



RECOMMENDED COST OF REPAIRS			31,646.60
-----------------------------	--	--	-----------

Report Ref No. CS/FCI19010762/Aqd3n2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M,MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report in whole or in part, does so at his or her own risk.