

ASS. REP. BY:

REF:

08/INC19010801/Tiq dser

Surveyor: Taufik

ASSIGNMENT (Office)

From (Person): Theresa Vimala

of

INC

Date/Time: 18/6/19 @ 10:36am

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SKT 4266M

Insured:

SLD 5272K

at Workshop m/s

Dynamic Autowork

Tel:

9856 4815

of

8 Kaki Bukit Ave 4 # 08-09

Policy No:

Claim No:

MT/1049/96-002

Sum Insured:

Excess:

Make of Veh:

D.O.A.

15/6/2019

(Client's Record)

CA / REV / REP. / REV 24 HRS

(up)

H.O.D. Endorsement:

Date/Time: 11:07am 18/6/19

Person Contacted:

Michelle

Vehic

IN OUT

Date/Time	Action/Instruction	Estimate
	SKT 4266M - NA/INC18008357/24	DDA: 6/5/18
	SLD 5272K - X	
12/7/19	258m continued with Michelle vs \$4300, 5 days. (red \$8614.72, 67%)	

## ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD ☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_


Sum Insured: \_\_\_\_\_

Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

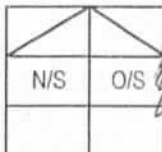Remark: The veh had commenced its  
repair at the time of inspection.

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: 5 days Res.: Yes or No

Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_

Person Contacted: \_\_\_\_\_

Vehicle: IN / OUT

Veh No: \_\_\_\_\_

SKT 4266M

Yr Regn: \_\_\_\_\_

2015, June

Type: ☒ M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: \_\_\_\_\_

Honda Mobilis

C.C.

H97

Colour: \_\_\_\_\_

Silver

A/C: \_\_\_\_\_

Insured / Std / NI / NA

Sp. Reading: \_\_\_\_\_

228230

T/Radio: \_\_\_\_\_

Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: \_\_\_\_\_

MRMDD4870F.P00148

Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ Inorder / Jammed / Leaked / Burnt orBrake: ☒ Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: \_\_\_\_\_

F: \_\_\_\_\_

185/55R16

R: \_\_\_\_\_

4.4

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. \_\_\_\_\_

6

mm

R/Bal. \_\_\_\_\_

6

mm

L/Bal. \_\_\_\_\_

6

mm

L/Bal. \_\_\_\_\_

6

mm

D.O.A. \_\_\_\_\_

D.O.I. \_\_\_\_\_

25/6/12 4pm

Survey held at \_\_\_\_\_

Dynamic Auto Wash

Des. of Damages: Frt / Rear / ☒ O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

4/5/4300, 5 days

RECEIVED 12 JUL 2019

  
26/6

Date/Time, File Pass to?

☐
  
☐

: Preli. Report

: Final Report

1) 12/7 12:15

Date/Time, File Return to?

2)

Days Of Repair: 5Resurvey No. of Trip: 2

Add Fee:

☐
  
☐
  
☐
  
☐

: Site Insp (\$)

: Interview (\$)

: Tech. Invs (\$)

: Weekend (\$)

Survey Fee:

Transportation:

S + RS, SI

Photos

Others

TOTAL

Report Format:

Lump Sum / I.B.I. (\$) 7P  
4300

290

290

## Nivitha (LKK Auto)

**From:** Theresa Vimala D/O Balagangadharan <thrsvim.bala@income.com.sg>  
**Sent:** Tuesday, 18 June 2019 2:41 PM  
**To:** admin-d@LKKauto.com  
**Cc:** Clarence Richard Anthony  
**Subject:** FW: TP CASES FARMED OUT TO LKK ON 18/06/2019

Hi Nivitha – Here are the details as requested. Thank you

SN	OIC	Claim No.	Survey Date	Vehicle	WorkShop Name	WorkShop Address	WorkShop Contact	Survey Time	Oi veh	DOA	Additional Remarks
1	JARED LIU	MT/1049087-002	18/6/2019	SLU1945P	MG SOLUTION PTE LTD	23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING)	Jamie Yan / 6744 4165		SIH2058K	16/5/2019	
2	MOHD AIRWAN	MT/1049029-002	18/6/2019	SGZ1154M	MG SOLUTION PTE LTD	23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING)	Jamie Yan / 6744 4165		SID5020U	13/6/2019	
3	ENG HUEY HUEY	MT/1049196-002	18/6/2019	SKT4266M	DYNAMIC AUTOWORK PTE LTD	8 KAKI BUKIT AVENUE 4 #08-09 PREMIER @ KAKI BUKIT	Michelle / 9856 4815		SID5272K	15/6/2019	

With Regards

**Theresa Vimala**  
Senior Administrator  
Motor Insurance  
T +65 6430 7898  
[www.income.com.sg](http://www.income.com.sg)

**income**  
made different



At Income, we are 'In with You' on Performance, Growth, Innovation and Impact. These attributes reflect what we promise as an employer and what we want our people to exemplify.

Find out more at [Income.com.sg/careers](http://Income.com.sg/careers)

**in** with  
you

---

#### Disclaimer

This e-mail contains privileged or confidential information which is intended only for the use of the recipient(s) named above. If you have received this message in error, please notify the sender immediately and delete all copies of it. Thank you.

This email has been checked for viruses by AVG antivirus software.

[www.avg.com](http://www.avg.com)

---

#### Disclaimer

This e-mail contains privileged or confidential information which is intended only for the use of the recipient(s) named above. If you have received this message in error, please notify the sender immediately and delete all copies of it. Thank you.

## Shiau Chan (LKKAUTO)

---

**From:** Dynamic Autowork <dynamicautowork@gmail.com>  
**Sent:** Friday, 12 July 2019 2:58 PM  
**To:** Shiau Chan (LKKAUTO)  
**Cc:** Taufikh (LKKAUTO)  
**Subject:** Re: SGKT4226M (Finalize)

Dear All,

Thanks for reply.

Lump Sum \$4,300.00 and 5 repair days--OFFER ACCEPT.

--

Thank You.

Yours Sincerely,

Michelle  
HP : 9856 4815

8 Kaki Bukit Avenue 4  
#08-09Premier @ Kaki Bukit  
Singapore (415875)  
Tel : 6341 6789  
Fax : 6341 6778

On Fri, Jul 12, 2019 at 1:59 PM Shiau Chan (LKKAUTO) <[siewsc@lkkauto.com](mailto:siewsc@lkkauto.com)> wrote:

Dear Michelle,

WITHOUT PREJUDICE

Offer Lump Sum \$4,300.00 and 5 repair days.

Kindly check and confirm.

Best Regards,

**Shiau Chan (Ms)** | Case Handler

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	17/06/2019 12:32
Date Of Accident	15/06/2019 08:15
Exact Location Of Accident	THOMSON ROAD / MOULMEIN ROAD
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKT4266M
<b>Insured/Policyholder</b>	
Name Of Registered Owner	LEE CHENG HAI
NRIC No	S1315350G
Email Address	CHLEE0414@GMAIL.COM
Mobile Phone No	(LOCAL) +65-98009796
Alternative Phone No	OFFICE-98009796

### Vehicle Particulars

Manufacturer	HONDA
Model	MOBILIO SV 1.5 CVT
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE HIRE

### Insurance Company

Name of Insurance Company	NTUC INCOME INSURANCE CO-OPERATIVE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	5105586404 CLASSIC
Cover Note Number	

### Driver

Name of Driver	LEE CHENG HAI
NRIC No	S1315350G
Date Of Birth	14/04/1958
Occupation	OUTDOOR
Date Of Driving Pass	03/11/1976
Driving Experience	42 YEARS AND 7 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-98009796
Fax Number	
Contact Number	OFFICE-98009796
Email Address	CHLEE0414@GMAIL.COM

Address	BLK 866 #05-221 TAMPINES STREET 83 TAMPINES VISTA
Postcode	520866
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

#### General Information of the Accident

Type Of Accident	SIDE SWIPE
Weather Conditions	CLEAR
Road Surface	DRY

#### Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

#### Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

REFER TO ATTACHED

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SLD5272K
Vehicle Make/Model/Colour	TOYOTA ALPHARD AUTO
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	



SKETCH PLAN

IMPORTANT NOTICE


1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:


- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all Insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all Insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated; or
  - (ii) for complying with requirements under any regulations, laws or court orders.

  
Policyholder's Signature  
Date & Time:

  
Driver's Signature  
(If driver is not the policyholder)  
Date & Time:

**IDAC KAKI BUKIT (VAC)**  
23 Kaki Bukit Ave 4  
Reporting Centre  
Singapore 415933  
Name: \_\_\_\_\_  
Tel: 67416697 Fax: 67492305  
NRIC/FRN: \_\_\_\_\_  
Email: [vackb@singnet.com.sg](mailto:vackb@singnet.com.sg)

SKETCH PLAN

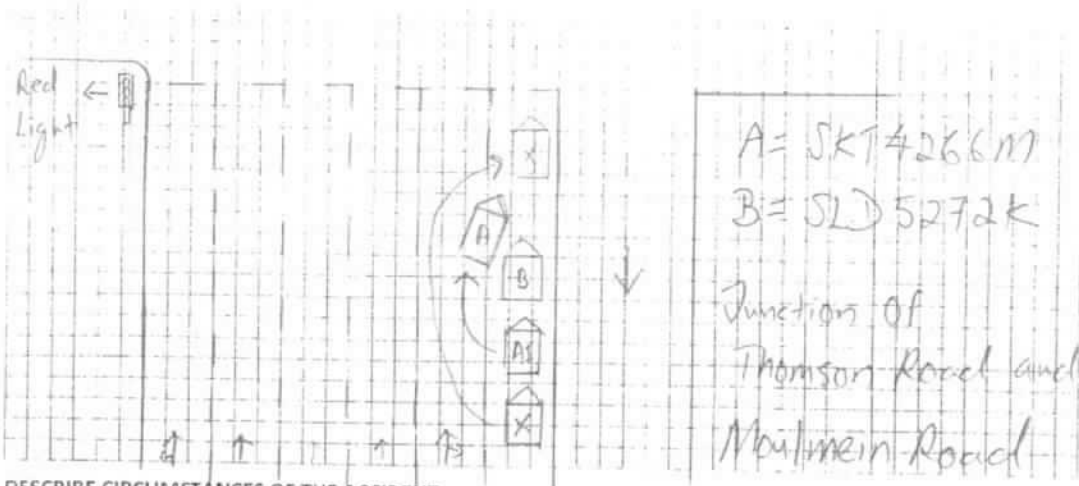

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Refer to attach

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature  
Date & Time:

Driver's Signature  
(If driver is not the policyholder)  
Date & Time:

IDAC KAKI BUKIT (VAC)

23 Kaki Bukit Ave 4

Reporting Singapore 415933

Tel: 67416697 Fax: 67492305

Email: vackb@singnet.com.sg

On 15.06.19 at about 08:15 hours at Junction of Thomson Road and Moulmein Road. I was stationary on the lane 1 waiting for the traffic light to turn green. When the traffic light turned green and the most front vehicle drove forward, but the front vehicle (B) keep stopped there hence I horned to alert.

When the traffic light turned to red again, a vehicle (SMJ 5258L) was overtaking from behind to the most front, so I drove to the front of vehicle (B) too and came to a stop because of the traffic light still red. A witness (driver of SMJ 5258L) approached to the vehicle (B) to check the vehicle (B).

After about 20 seconds, suddenly vehicle (B) moved forward without noticing my vehicle (A) and collided onto right hand side portion of my vehicle (A).

Vehicle (A): SKT 4266M

Vehicle (B): SLD 5272K

Witness details: Tan Yong Soon (Hp:8222 7797)



TOTAL PRICE	\$ 8,905.90
LESS 20%	\$ 1,781.18
<b>SUB TOTAL PRICE</b>	<b>\$ 7,124.72</b>

TO : NTUC MOTOR CLAIMS DEPTS  
 VEHICLE NO : SKT4266M  
 MODEL : HONDA MOBILIO  
 DATE OF ACCIDENT : 15.06.19  
 TIME OF ACCIDENT : 08:15HRS

**SPECIAL NETT ITEMS**

S/N	DESCRIPTION	QTY	UNIT S/NETT	TOTAL S/NETT
1	FRONT DOOR SEALANT RH	1	\$ 150.00	\$ 150.00
2	FRONT DOOR OUTER MOULDING CLIP RH (SET)	1	\$ 30.00	\$ 30.00
3	FRONT DOOR TRIM BOARD CLIP (SET)	1	\$ 50.00	\$ 50.00
4	CENTER PILLAR GARNISH CLIP RH (SET)	1	\$ 30.00	\$ 30.00
5	SIDE SKIRT CLIP RH	1	\$ 50.00	\$ 50.00
6	ROCKER PANEL SEALANT RH	1	\$ 150.00	\$ 150.00
7	REAR DOOR SEALANT RH	1	\$ 150.00	\$ 150.00
8	REAR DOOR TRIM BOARD CLIP (SET)	1	\$ 50.00	\$ 50.00
9	REAR DOOR GLASS FRAME GARNISH CLIP RH (SET)	1	\$ 30.00	\$ 30.00
10	REAR DOOR OUTER MOULDING CLIP RH (SET)	1	\$ 30.00	\$ 30.00
11	DOOR VISOR (SET)	1	\$ 350.00	\$ 350.00

**TOTAL \$ 1,070.00**

**CLAIM DETAILS: LABOUR AND SPRAY PAINTING**

S/N	JOB DESCRIPTION	PRICE	ADJUSTED COST
1	TO PANEL BEAT, WELD ,CUT, ADJUST, KNOCK	\$ 1,600.00	600
2	TO SPRAY PAINT	\$ 1,600.00	700
3	TUFF COAT	\$ 250.00	30.
4	WIRING, BULB CHECKING	\$ 180.00	30.
5	REMOVE & REFIX CUSHION SEAT/UPHOLSTERY & ROOF LINING TO FACILITATE REPAIR	\$ 350.00	40 Xnn.
6	REMOVE & REFIX AUDIO SPEAKER	\$ 120.00	30.
7	TRANSFER FRONT DOOR MECHANISM	\$ 80.00	60.
8	REMOVE & REINSTALL FRONT WINDOW GLASS	\$ 80.00	30
9	TRANSFER REAR DOOR MECHANISM	\$ 80.00	60.

TO : NTUC MOTOR CLAIMS DEPTS  
 VEHICLE NO : SKT4266M  
 MODEL : HONDA MOBILIO  
 DATE OF ACCIDENT : 15.06.19  
 TIME OF ACCIDENT : 08:15HRS

10	REMOVE & REINSTALL REAR WINDOW GLASS	\$ 80.00	30.
11	CONDUCT WATER LEAKAGE TEST	\$ 120.00	x ny.
12	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT/CONTROL UNITS, RESET MEMORIES TO SPECIFICATION ETC.	\$ 180.00	100.

**TOTAL**

**\$ 4,720.00**

1670.

**ESTIMATE REPORT**

TOTAL PARTS COST : \$ 8,194.72  
 TOTAL LABOUR COST : \$ 4,720.00  
 TOTAL REPAIR COST : \$ 12,914.72

3440

290

1670.

5400

4584300.

NB: THIS IS ONLY AN ESTIMATE AND SHOULD ADDITIONAL WORK BE FOUND NECESSARY TO BE CARRIED OUT IN THE COURSE OF REPAIRS, EXTRA MATERIALS AND LABOUR COST WILL BE CHARGED ACCORDINGLY WHICH HOWEVER, YOU WILL BE INFORMED PRIOR TO ACTION TAKEN.

PARTS PRICES ARE SUBJECT TO CHANGES.

YOURS FAITHFULLY,

**ABBY**

SERVICE ADVISOR

ABBY

HP : 9856 4815

Tanpin 97495749  
 WP

25/6/19 @ 4pm

Unmpsn

Resurvey after repair.

05 days

**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

71  
**Shiau Chan (LKKAUTO)**

---

**From:** Dynamic Autowork <dynamicautowork@gmail.com>  
**Sent:** Wednesday, 10 July 2019 4:48 PM  
**To:** Taufikh (LKKAUTO)  
**Subject:** SGKT4226M (Finalize)  
**Attachments:** 10072019164638.pdf; Picture2.jpg; Picture4.jpg; Picture1.jpg; Picture3.jpg; Picture5.jpg; Picture6.jpg

Dear Taufikh,

Please refer to attach file and after repair photo.  
Can we close the case at \$4,900 (5days)

--

Thank You.

Yours Sincerely,

Michelle  
HP : 9856 4815

8 Kaki Bukit Avenue 4  
#08-09Premier @ Kaki Bukit  
Singapore (415875)  
Tel : 6341 6789  
Fax : 6341 6778

# Vision Autowork Pte.Ltd.

(Co. Reg. No. 201500371E)

8 Kaki Bukit Ave 4, #08-09 Premier@Kaki Bukit

Singapore 415875

Tel : 6341 6789 Fax: 6341 6778

E-mail:visionautowork@gmail.com

COR 2 days

11 5900 00

DATE : 24.06.19

TO : NTUC MOTOR CLAIMS DEPTS  
VEHICLE NO : SKT4266M  
MODEL : HONDA MOBILIO  
DATE OF ACCIDENT : 15.06.19  
TIME OF ACCIDENT : 08:15HRS

WE APPEND HEREUNDER THE ESTIMATED COST OF REPAIRS TO BE CARRIED OUT TO THE ABOVE VEHICLE.

## CLAIM DETAIL : PARTS

S/N	DESCRIPTION	QTY	UNIT LIST PRICE	TOTAL LIST PRICE
1	FRONT DOOR RH	1	\$ 976.20	\$ 976.20
2	FRONT DOOR BLACK STICKER RH	1	\$ 109.40	\$ 109.40
3	FRONT DOOR OUTER HANDLE RH	1	\$ 321.30	\$ 321.30
4	FRONT DOOR OUTER MOULDING RH	1	\$ 176.50	\$ 176.50
5	FRONT DOOR HINGE RH	2	\$ 49.10	\$ 98.20
6	FRONT DOOR CHECKER RH	1	\$ 121.40	\$ 121.40
7	FRONT DOOR WEATHER STRIP RH	1	\$ 176.70	\$ 176.70
8	FRONT DOOR GLASS CHANNEL RH	1	\$ 112.40	\$ 112.40
9	FRONT DOOR INNER LOCK RH	1	\$ 328.10	\$ 328.10
10	FRONT DOOR LOCK CATCH RH	1	\$ 27.20	\$ 27.20
11	FRONT DOOR INNER TRIM BOARD RH	1	\$ 597.40	\$ 597.40
12	FRONT DOOR POWER WINDOW MOTOR C/W REGULATOR RH	1	\$ 625.10	\$ 625.10
13	SIDE SKIRT RH	1	\$ 476.40	\$ 476.40
14	ROCKER PANEL RH	1	\$ 492.60	\$ 492.60
15	CENTER PILLAR RH (OUTER)	1	\$ 899.20	\$ 899.20
16	REAR DOOR RH	1	\$ 894.70	\$ 894.70
17	REAR DOOR BLACK STICKER RH	1	\$ 109.40	\$ 109.40
18	REAR DOOR HINGE RH	2	\$ 49.10	\$ 98.20
19	FRONT DOOR CHECKER RH	1	\$ 121.40	\$ 121.40
20	REAR DOOR WEATHER STRIP RH	1	\$ 176.70	\$ 176.70
21	REAR DOOR LOCK CLUTCH RH	1	\$ 27.20	\$ 27.20
22	REAR DOOR SPEAKER RH	1	\$ 321.40	\$ 321.40
23	REAR DOOR INNER LOCK RH	1	\$ 327.10	\$ 327.10
24	REAR DOOR GLASS REGULATOR GEAR MOTOR RH	1	\$ 524.40	\$ 524.40
25	REAR DOOR OUTER MOULDING RH	1	\$ 170.60	\$ 170.60
26	REAR DOOR INNER TRIM BOARD RH	1	\$ 596.70	\$ 596.70

TOTAL PRICE \$ 8,905.90

LESS 20% \$ 1,781.18

SUB TOTAL PRICE \$ 7,124.72

Rising  
JHR

31.07.19 22.00

00.00.00 - 00.00

31.07.19 00.00



TO : NTUC MOTOR CLAIMS DEPTS  
 VEHICLE NO : SKT4266M  
 MODEL : HONDA MOBILIO  
 DATE OF ACCIDENT : 15.06.19  
 TIME OF ACCIDENT : 08:15HRS

**SPECIAL NETT ITEMS**

S/N	DESCRIPTION	QTY	UNIT S/NETT	TOTAL S/NETT
1	FRONT DOOR SEALANT RH	1	\$ 150.00	\$ 150.00
2	FRONT DOOR OUTER MOULDING CLIP RH (SET)	1	\$ 30.00	\$ 30.00
3	FRONT DOOR TRIM BOARD CLIP (SET)	1	\$ 50.00	\$ 50.00
4	CENTER PILLAR GARNISH CLIP RH (SET)	1	\$ 30.00	\$ 30.00
5	SIDE SKIRT CLIP RH	1	\$ 50.00	\$ 50.00
6	ROCKER PANEL SEALANT RH	1	\$ 150.00	\$ 150.00
7	REAR DOOR SEALANT RH	1	\$ 150.00	\$ 150.00
8	REAR DOOR TRIM BOARD CLIP (SET)	1	\$ 50.00	\$ 50.00
9	REAR DOOR GLASS FRAME GARNISH CLIP RH (SET)	1	\$ 30.00	\$ 30.00
10	REAR DOOR OUTER MOULDING CLIP RH (SET)	1	\$ 30.00	\$ 30.00
11	DOOR VISOR (SET)	1	\$ 350.00	\$ 350.00

**TOTAL \$ 1,070.00**

**CLAIM DETAILS: LABOUR AND SPRAY PAINTING**

S/N	JOB DESCRIPTION	PRICE	ADJUSTED COST
1	TO PANEL BEAT, WELD ,CUT, ADJUST, KNOCK	\$ 1,600.00	700
2	TO SPRAY PAINT	\$ 1,600.00	700
3	TUFF COAT	\$ 250.00	30.
4	WIRING, BULB CHECKING	\$ 180.00	30.
5	REMOVE & REFIX CUSHION SEAT/UPHOLSTERY & ROOF LINING TO FACILITATE REPAIR	\$ 350.00	40
6	REMOVE & REFIX AUDIO SPEAKER	\$ 120.00	30.
7	TRANSFER FRONT DOOR MECHANISM	\$ 80.00	60.
8	REMOVE & REINSTALL FRONT WINDOW GLASS	\$ 80.00	30
9	TRANSFER REAR DOOR MECHANISM	\$ 80.00	60.

TO : NTUC MOTOR CLAIMS DEPTS  
 VEHICLE NO : SKT4266M  
 MODEL : HONDA MOBILIO  
 DATE OF ACCIDENT : 15.06.19  
 TIME OF ACCIDENT : 08:15HRS

10	REMOVE & REINSTALL REAR WINDOW GLASS	\$ 80.00	30.
11	CONDUCT WATER LEAKAGE TEST	\$ 120.00	X
12	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT/CONTROL UNITS, RESET MEMORIES TO SPECIFICATION ETC.	\$ 180.00	100.

TOTAL \$ 4,720.00 1510.00

#### ESTIMATE REPORT

TOTAL PARTS COST : \$ 8,194.72  
 TOTAL LABOUR COST : \$ 4,720.00  
 TOTAL REPAIR COST : \$ 12,914.72

NB: THIS IS ONLY AN ESTIMATE AND SHOULD ADDITIONAL WORK BE FOUND NECESSARY TO BE CARRIED OUT IN THE COURSE OF REPAIRS, EXTRA MATERIALS AND LABOUR COST WILL BE CHARGED ACCORDINGLY WHICH HOWEVER, YOU WILL BE INFORMED PRIOR TO ACTION TAKEN.  
 PARTS PRICES ARE SUBJECT TO CHANGES.

YOURS FAITHFULLY,

*ABBY*

SERVICE ADVISOR

ABBY

HP : 9856 4815

Tanpin 97495749  
 WP

25/6/19 @ 4pm

Unmpsm

Resumy after repair.  
 05 days

2019.00

2019.00

1219.00

5000.00

1219.00

4000.00



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### DAMAGE ASSESSMENT REPORT

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: CS/INC19010801/T1qd3e2

73 BRAS BASAH ROAD  
#05-01 NTUC TRADE UNION HOUSESINGAPORE  
189556

Date: 15-07-2019



ATTN: ENG HUEY HUEY

Code: INC

#### 1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SLD 5272K	Veh. Inspected	SKT 4266M
Policy No.		Coverage (\$)	0.00
Claim No.	MT/1049196-002	Excess (\$)	0.00
Assign From	THERESA VIMALA	Assign Date	18/06/2019

#### 2. Vehicle Particulars & Condition

Make & Model	HONDA MOBILIO	c.c	1497
Engine No.	HIDDEN	Year of Reg.	2015
Chassis No.	MRHDD4870FP000148	Colour	SILVER
Odometer	228230 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

#### 3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	185/55 R16	TOYO	6 mm
L/H Front Tyre	185/55 R16	TOYO	6 mm
R/H Rear Tyre	185/55 R16	TOYO	6 mm
L/H Rear Tyre	185/55 R16	TOYO	6 mm

#### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.
--

#### 5. General Information

Accident Date	15/06/2019	Inspect Date / Time	25/06/2019 ( 04:00 PM )
Survey held at	DYNAMIC AUTOWORK PTE LTD 8 KAKI BUKIT AVE 4 #08-09 PREMIER @ KAKI BUKIT SINGAPORE 415875		

#### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

#### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	5 Working Days
-------------------------------------	----------------



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKT 4266M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	FRONT DOOR RH	BENT	976.20	826.20
1	FRONT DOOR BLACK STICKER RH	NECESSARY	109.40	109.40
1	FRONT DOOR OUTER HANDLE RH	NOT NECESSARY	321.30	-
1	FRONT DOOR OUTER MOULDING RH	DEFORMED	176.50	176.50
2	FRONT DOOR HINGE RH @\$49.10	NOT NECESSARY	98.20	-
1	FRONT DOOR CHECKER RH	NOT NECESSARY	121.40	-
1	FRONT DOOR WEATHER STRIP RH	NECESSARY	176.70	176.70
1	FRONT DOOR GLASS CHANNEL RH	DEFORMED	112.40	112.40
1	FRONT DOOR INNER LOCK RH	BENT	328.10	328.10
1	FRONT DOOR LOCK CATCH RH	NOT NECESSARY	27.20	-
1	FRONT DOOR INNER TRIM BOARD RH	CRACKED	597.40	447.40
1	FRONT DOOR POWER WINDOW MOTOR C/W REGULATOR RH	NOT NECESSARY	625.10	-
1	SIDE SKIRT RH	DEFORMED	476.40	376.40
1	ROCKER PANEL RH	NOT NECESSARY	492.60	-
1	CENTER PILLAR RH (OUTER)	TO REPAIR SEE LABOUR	899.20	-
1	REAR DOOR RH	BENT	894.70	745.30
1	REAR DOOR BLACK STICKER RH	NECESSARY	109.40	109.40
2	REAR DOOR HINGE RH @\$49.10	BENT	98.20	98.20
1	FRONT DOOR CHECKER RH	NOT NECESSARY	121.40	-
1	REAR DOOR WEATHER STRIP RH	NECESSARY	176.70	176.70
1	REAR DOOR LOCK CLUTCH RH	NOT NECESSARY	27.20	-
1	REAR DOOR SPEAKER RH	NOT NECESSARY	321.40	-
1	REAR DOOR INNER LOCK RH	NOT NECESSARY	327.10	-
1	REAR DOOR GLASS REGULATOR GEAR MOTOR RH	NOT NECESSARY	524.40	-
1	REAR DOOR OUTER MOULDING RH	DEFORMED	170.60	170.60
1	REAR DOOR INNER TRIM BOARD RH	CRACKED	596.70	446.70
	LESS 20% DISCOUNT		-1,781.18	-860.00
			7,124.72	3,440.00

Report Ref No. CS/INC19010801/T1qd3e2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	FRONT DOOR SEALANT RH (SN)	NECESSARY	150.00	30.00
1	SET FRONT DOOR OUTER MOULDING CLIP RH (SN)	NOT NECESSARY	30.00	-
1	SET FRONT DOOR TRIM BOARD CLIP (SN)	NOT NECESSARY	50.00	-
1	SET CENTER PILLAR GARNISH CLIP RH (SN)	NOT NECESSARY	30.00	-
1	SIDE SKIRT CLIP RH (SN)	NECESSARY	50.00	30.00
1	ROCKER PANEL SEALANT RH (SN)	NOT NECESSARY	150.00	-
1	REAR DOOR SEALANT RH (SN)	NECESSARY	150.00	30.00
1	SET REAR DOOR TRIM BOARD CLIP (SN)	NOT NECESSARY	50.00	-
1	SET REAR DOOR GLASS FRAME GARNISH CLIP RH (SN)	NOT NECESSARY	30.00	-
1	SET REAR DOOR OUTER MOULDING CLIP RH (SN)	NOT NECESSARY	30.00	-
1	SET DOOR VISOR (SN)	NECESSARY	350.00	200.00
			1,070.00	290.00
	<b><u>LABOUR</u></b>			
	TO PANEL BEAT, WELD, CUT, ADJUST, KNOCK. INCLUSIVE OF THE REPAIR OF CENTER PILLAR RH (OUTER).		1,600.00	600.00
	TO SPRAY PAINT.		1,600.00	700.00
	TUFF COAT.		250.00	30.00
	WIRING, BULB CHECKING.		180.00	30.00
	REMOVE & REFIX CUSHION SEAT / UPHOLSTERY & ROOF LINING TO FACILITATE REPAIR.	NOT NECESSARY	350.00	-
	REMOVE & REFIX AUDIO SPEAKER.		120.00	30.00
	TRANSFER FRONT DOOR MECHANISM.		80.00	60.00
	REMOVE & REINSTALL FRONT WINDOW GLASS.		80.00	30.00
	TRANSFER REAR DOOR MECHANISM.		80.00	60.00
	REMOVE & REINSTALL REAR WINDOW GLASS.		80.00	30.00
	CONDUCT WATER LEAKAGE TEST.	NOT NECESSARY	120.00	-
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT / CONTROL UNITS, RESET MEMORIES TO SPECIFICATION ETC.		180.00	100.00
			4,720.00	1,670.00
	<b>GRAND TOTAL</b>		<b>12,914.72</b>	<b>5,400.00</b>

Report Ref No. CS/INC19010801/T1qd3e2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)				4,300.00
---	--	--	--	----------

Report Ref No. CS/INC19010801/T1qd3e2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons), B.Bus, MBA, PEng, PE,  
MInstAEA, MASME, MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.