

CC 3, MG 190 11309, Koa32

JIKK
IDAC

Surveyor:

KSC

DOI:

25/6/19

Date / Time:

25/6/19

Registered in Merimen:

26/6/19

Pre-assign / CCU / FTE

SKP 5285 A



Insured Vehicle No.:

Name of Insured:

Ang Kirk Kine

Insured Tel No.:

HP:

Excess Sec II :SS

D.O.A.:

22/6/19

Is driver the owner?

(YES / NO)

Nature of Accident:

If NO, Driver Name / Age:

Driver Tel No.:

(V/L YES / NO)

Claim No.:

Policy No.:

Make / Model:

Place of Accident:

OI GIA REPORT: YES / NO ; TP GIA REPORT: YES / NO

Insured Liability: % Final? Yes / No

SKP 5285 A

SHD 400M

SLR 9057Y

SLR 6387S

INSRS:
WSP:
Tel:
Liability:
RMKS:

n

INSRS:
WSP:
Tel:
Liability:
RMKS:Transcar
wINSRS:
WSP:
Tel:
Liability:
RMKS:

fwd

INSRS:
WSP:
Tel:
Liability:
RMKS:

Date/ Time

SHD 400M - C21 Asmt 9004026/Kfa3 : 009: 113/19
NAI FWD 19011065/24 : D.O.A: 22/6/19
SKP 5285 A. X: -

14.08.19

FILE PASS TO TYPST TO PREPARE REPORT.

STAGE

DATE / PIC

Non-Reporting ltr (1st):

Non-Reporting ltr (2nd):

Non-Reporting ltr (Final):

Notification ltr (if non-pickup):

Call OI: YEMAN 12.7.19

After call ltr to OI:

Documentation Check List: Handler Typist

Notification ltr (if non-pickup)

After call ltr to OI:

Authorisation To Act:

Release Voucher:

Final Repair Bill:

Car Rental Invoice:

Towing Invoice

LTA / GIA:

Medical Bill:

PIR:

Mandate/Reject Instruction:

LOD

Payment Breakdown Form:

PRELIMINARY ADVICE Date/Time:

Sent By:

Post-Repair Photos:

Others:

FINALIZATION

Date/Time:

Confirm with:

Confirm by: KSC

Repair Cost:

PIP

SS 71,443.96

(

16 days)

Reduction:

76 %

Email ☒Call ☐

FINAL SETTLEMENT

Date/Time: 22.10.19

Confirm with JASMINE

Email ☒Call ☐

Final Liability:

% 100

(Agreed / Assessed) BOLA S/N No.:

28

If NO or B 28, Ass. Lia: 100%

Repair Cost:

10/57

SS 59,386.44

4 YEN CL OI LISA

Loss of Rental (LOR):

SS 1,822.86

(

18 days)

x = 101.27

Loss of Use (LOU):

SS -

(\$

x

days)

Loss of Income (LOI):

SS -

(\$

x

days)

LOR only ☒LOU only ☐LOR + LOU ☐LOR + LOI ☐

(Tick only one)

GIA/LTA Search

SS 7.49

Medical:

SS -

Disbursement:

SS -

(e.g. Tow/ Independent)

Legal Cost

SS -

Total:

SS 31,216.79

Global Sum SS:

FINAL PAYMENT

Date/Time: 22.10.19

Confirm with: JASMINE

Email ☒Call ☐

Payee 1:

SS 31,216.79

Name 1:

TRANS-CAR AUTO SERVICES PTE LTD.

Payee 2: (Strike if N.A.)

SS

Name 2:

Payee 3: (Strike if N.A.)

SS

Name 3:

COPY SENT
11/11/19

ASS. REC. BY:

REF:

ALG/

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MY

To inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

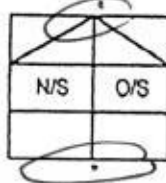
Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 16 days Res.: Yes or No

Lum Sum: 20.1% 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: S110 400m Yr Regn: 10, 16

Type: M.Car / M.Cycle / Bus / Van / Lorry (Taxi) / Prime Mover /

Truck / Trailer or A)

Make: Renault Latitude c.c. 1995

Colour M. White / Blue A/C: Insured / Std / NI / NA

Sp. Reading 389699 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: VI-1 ABL 15 AUG 28 3283

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 215/60R16

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or GTI

Front Rear

R/Bal. 7 mm R/Bal. 5 mm

L/Bal. 7 mm L/Bal. 5 mm

D.O.A. 22/6/19 D.O.I. 25/6/19

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

1 File pass to

PIP : + 27,463.96 (RED: + 87,190.39 76%)

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trlp: _____

Survey Fee:

Transportation:

S + RS. SI

Fixes

Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$) _____

Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech Invs (\$ _____)☐ : Weekend (\$ _____)

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 400M**AAD1906-212**

Not Withheld
Assessing 11 Sep 8?

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration :

SHD 400M

VF1ABL15AUC283283

RENAULT

LATITUDE

22.6.19

AIG

17/10/2016

		PART
1	1	BUMPER COVER REAR
2	1	BUMPER LOWER REAR
3	1	BUMPER BRACKET CTR REAR
4	1	BUMPER BRACKET SIDE RH REAR
5	1	BUMPER RETAINER RH REAR
6	1	BUMPER REFLECTOR RH
7	1	BUMPER BRACKET SIDE LH REAR
8	1	BUMPER RETAINER LH REAR
9	1	BUMPER REFLECTOR LH
10	1	BUMPER BEAM REAR
11	1	BUMPER BEAM BRACKET LH REAR
12	1	BUMPER BEAM BRACKET RH REAR
13	1	BOOT REAR
14	1	BOOT FINISHER
15	1	BOOT WHEATERSTRIP
16	1	BOOT REFLECTOR LAMP LH
17	1	BOOT REFLECTOR LAMP RH
18	1	BOOT BADGE 'RENAULT'
19	1	BOOT BADGE
20	1	BOOT STRUT LH
21	1	BOOT STRUT RH
22	1	BOOT HINGE LH
23	1	BOOT HINGE RH
24	1	BOOT INNER TRIM
25	1	BOOT SWITCH
26	1	BOOT LOCK
27	1	BOOT LOCK CATCH
28	2	LICENCE PLATE LAMP
29	2	BOOT RUBBER PLUG
30	1	FENDER PANEL INNER TRIM REAR LH

		LIST
\$	R ₁	1,108.46 ✓
\$	R ₁	768.84 ✓
\$	D.I.T	113.47 ✓
\$	S ₁	135.97 X
\$	S ₁	44.99 X
\$	CM	43.61 ✓
\$	S ₁	135.97 X
\$	S ₁	44.99 X
\$	CM	43.61 ✓
\$	R ₁	777.52 ✓
\$	R ₁	225.95 ✓
\$	R ₁	225.95 ✓
\$	R ₁	2,872.68 ✓
\$	S ₁	470.06 X
\$	D.I.T/G	323.05 ✓
\$	CM	493.35 ✓
\$	CM	493.35 ✓
\$	R ₁	225.36 ✓
\$	R ₁	225.36 ✓
\$	S ₁	276.08 } X
\$	S ₁	276.08 }
\$	R ₁	367.84 }
\$	R ₁	367.84 }
\$	S ₁	586.45 }
\$	S ₁	168.13 }
\$	R ₁	202.67 }
\$	R ₁	74.40 }
\$	S ₁	50.52 }
\$	S ₁	221.81 }
\$	S ₁	671.45 }

Trans-cab Auto Services Pte Ltd

AAD1906-212

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 400M

31	1	FENDER PANEL REAR LH	\$	R	3,299.13	X
32	1	WHEELARCH REAR LH	\$	SL	543.47	X
33	1	FENDER PANEL INNER TRIM REAR RH	\$	SL	671.45	X
34	1	FENDER PANEL REAR RH	\$	R	3,299.13	X
35	1	WHEELARCH REAR RH	\$	SL	543.47	X
36	1	TAILLAMP RH	\$	mg cm	552.55	✓
37	1	TAILLAMP PANEL RH	\$	R	986.70	X
38	1	TAILLAMP LH	\$	mg cm	552.55	✓
39	1	TAILLAMP PANEL LH	\$	R	986.70	X
40	1	OUTER PANEL REAR (End Panel)	\$	R	1,471.77	✓
41	1	OUTER PANEL REAR (End Panel)TRIM	\$	CM	404.56	✓
42	1	SPARE WHEEL PANEL (Luggage Floor Panel)	\$	BALAN	2,189.88	✓
43	1	SPARE WHEEL PANEL TRIM	\$	SL	612.21	X
44	1	EXHAUST REAR	\$	R	7,489.05	X
45	1	EXHAUST CAP REAR	\$	RD	230.49	✓
46	1	BUMPER COVER FRT	\$	CM	1,259.42	✓
47	1	BUMPER SPOILER FRT	\$	DIT	181.75	✓
48	1	BUMPER ABSORBER FRT	\$	CM	394.68	✓
49	1	BUMPER RETAINER FRT LH	\$	DIT	151.41	✓
50	1	BUMPER SUPPORT FRT	\$	SL	123.88	X
51	1	BUMPER RETAINER FRT RH	\$	DIT	150.77	✓
52	1	BUMPER SUPPORT FRT	\$	SL	123.88	X
53	1	BUMPER UNDERTRAY FRT	\$	SL	472.83	X
54	1	BUMPER GRILLE LOWER FRT	\$	CM	266.80	✓
55	1	BUMPER FOG LAMP GRILLE LH	\$	SL	207.21	X
56	1	BUMPER FOG LAMP GRILLE RH	\$	SL	207.21	X
57	1	BUMPER BEAM FRT	\$	R	914.08	✓
58	1	TOW COVER FRT	\$	SL	28.61	X
59	1	RADIATOR GRILLE	\$	CM	1,707.78	✓
60	1	RADIATOR GRILLE BADGE 'RENAULT'	\$	mg	225.36	✓
61	1	RADIATOR GRILLE FRAME	\$	CM	1,353.75	✓
62	1	FRAME FULL SUPPORT PANEL	\$	CM	615.90	✓
63	1	FRAME FULL SUPPORT BRACKET	\$	R	89.79	X
64	1	FRONT BRACE PANEL	\$	R	177.22	X
65	1	HORN	\$	SL	314.17	X
66	1	HORN BRACKET	\$	R	40.45	X
67	1	HEADLAMP LH	\$	mg cm	1,184.43	✓
68	1	HEADLAMP RH	\$	mg cm	1,184.43	✓

Trans-cab Auto Services Pte Ltd**AAD1906-212**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 400M

69	1	HEADLAMP PANEL FRT LH	\$	R	152.15	}
70	1	HEADLAMP PANEL FRT RH	\$	R	152.15	
71	1	BONNET	\$	R	1,941.63	
72	1	BONNET INSULATOR	\$	SL	405.73	
73	1	BONNET STRUT LH	\$	SL	88.61	
74	1	BONNET STRUT RH	\$	SL	88.61	
75	1	BONNET HINGE LH	\$	R	348.31	
76	1	BONNET HINGE RH	\$	R	348.31	
77	1	BONNET LOCK	\$	R	305.48	
78	1	BONNET CABLE	\$	SL	119.19	
79	1	BONNET CABLE COVER	\$	SL	161.03	
80	1	BONNET SEAL OUTER	\$	SL	92.36	
81	1	BONNET SEAL INNER	\$	SL	157.28	
82	1	FENDER PANEL FRT LH	\$	R	783.83	
83	1	WHEELARCH FRT LH	\$	SL	278.84	
84	1	FENDER BRACKET LOWER LH	\$	SL	15.79	
85	1	FENDER INSULATOR LH	\$	SL	130.84	
86	1	FENDER INSULATOR RH	\$	SL	130.84	
87	1	FENDER PANEL FRT RH	\$	R	783.83	
88	1	WHEELARCH FRT RH	\$	SL	278.84	
89	1	FENDER BRACKET LOWER RH	\$	SL	15.79	
90	1	WIPER RESERVOIR	\$	SL	348.25	
91	1	WIPER RESERVOIR NECK	\$	SL	136.11	
92	1	WIPER RESERVOIR MOTOR	\$	SL	270.06	
93	1	AIR CLEANER LOWER	\$	SL	271.26	
94	1	AIR CLEANER HOSE	\$	SL	76.14	
95	1	BASE BATTERY TRAY	\$	SL	363.40	
96	1	AIR CLEANER BOX	\$	SL	464.20	
97	1	TURBO DUCT	\$	SL	1,027.80	
98	1	A/C HEATER VALVE	\$	SL	484.50	
99	1	SUBFRAME OUTER FRT	\$	SL	2,652.45	
100	1	SUBFRAME BRACKET OUTER LH	\$	R	92.36	
101	1	SUBFRAME BRACKET OUTER RH	\$	R	92.36	
102	1	ENGINE UNDERTRAY	\$	SL	564.98	
103	1	A/C CONDENSER	\$	PR	2,020.37	
104	1	A/C CONDENSER GARNISH LH UPPER	\$	SL	39.67	X
105	1	A/C CONDENSER GARNISH RH UPPER	\$	SL	39.67	X
106	1	A/C CONDENSER GARNISH LH	\$	SL	58.81	X

Trans-cab Auto Services Pte Ltd

AAD1906-212

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 400M

107	1	A/C CONDENSER GARNISH RH	\$	S\$ 59.60
108	1	A/C PIPE CONDENSER TO COMPRESSOR	\$	S\$ 208.39
109	1	A/C PIPE CONDENSER TO EXPENSION VALVE	\$	S\$ 658.72
110	1	A/C PIPE COMPRESSOR	\$	S\$ 334.29
111	1	A/C PIPE	\$	S\$ 658.72
112	1	A/C COMRPRESSOR	\$	S\$ 2,684.61
113	1	AIR COOLER	\$	S\$ 792.60
114	1	AIR INTERCOOLER HOSE (LONG)	\$	S\$ 1,014.13
115	1	AIR INTERCOOLER HOSE (Short)	\$	S\$ 375.14
116	1	TRANSMISSION COOLER	\$	S\$ 1,219.30
117	1	TRANSMISSION COOLER PAD	\$	S\$ 17.96
118	1	RADIATOR	\$	S\$ 1,202.20
119	2	RADIATOR STUD UPPER	\$	S\$ 14.41
120	2	RADIATOR BUSH UPPER	\$	S\$ 50.12
121	2	RADIATOR MTG LOWER	\$	S\$ 55.85
122	1	RADIATOR FAN COWLING	\$	S\$ 820.54
123	1	RADIATOR FAN MOTOR LH	\$	S\$ 967.36
124	1	RADIATOR FAN MOTOR RH	\$	S\$ 1,479.46
125	1	RADIATOR TANK	\$	S\$ 324.62
127	1	RADIATOR HOSE UPPER	\$	S\$ 240.56
128	1	RADIATOR HOSE LOWER	\$	S\$ 491.18
129	1	RADIATOR TANK HOSE	\$	S\$ 61.18
130	1	AUTO COMPUTER	\$	S\$ 5,032.17
131	1	INJECTION COMPUTER	\$	S\$ 4,706.30
132	1	RHD HYDRAULIC POWER(ROCK&PINION)	\$	S\$ 5,154.52
133	1	STEERING PUMP ELECTRIC L70Y	\$	S\$ 2,306.90
134	1	STEERING PINION RACK L70Y	\$	S\$ 4,413.11

TOTAL \$ 98,370.50
10% \$ 9,837.05
\$ 88,533.45

Special Nett

1	1SET	PARKING AID	\$	Shar 700.00 400.00
2	1SET	REAR BUMPER CLIP	\$	na 66.00 —
3	1SET	BUMPER BRACKET CTR CLIP	\$	na 33.00 —
4	1SET	BUMPER BRACKET SIDE CLIP RH RR	\$	na 10.00 X
5	1SET	BUMPER RETAINER RH CLIP RR	\$	na 20.00 X
6	1SET	BUMPER BRACKET SIDE CLIP LH RR	\$	na 10.00 X

Trans-cab Auto Services Pte Ltd

AAD1906-212

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 400M

7	1SET BUMPER RETAINER CLIP LH RR	\$	nn	20.00	X
8	1SET BUMPER LOWER REAR RIVET	\$	nn	22.00	X
9	1SET BUMPER LOWER REAR CLIP	\$	nn	66.00	✓
10	1 EXHAUST MOUNTING REAR	\$	nn	17.82	X
11	1SET BOOT FINISHER CLIP	\$	nn	24.20	X
12	1 BOOT INNER TRIM CLIP	\$	nn	45.00	X
13	1SET FENDER WHEELARCH REAR RH CLIP	\$	nn	35.00	X
14	1SET FENDER WHEELARCH REAR LH CLIP	\$	nn	35.00	X
15	1 FENDER INNER TRIM CLIP LH	\$	nn	28.00	X
16	1 FENDER INNER TRIM CLIP RH	\$	nn	28.00	X
17	1 TAILLAMP CLIP RH	\$	nn	5.00	—
18	1 TAILLAMP CLIP LH	\$	nn	5.00	—
19	2 REAR WINDSCREEN SEALANT	\$	nn	80.00	X
20	1 WINDSCREEN MOULDING	\$	nn	100.00	X
21	1 REAR WINDSCREEN INNER SPONGE SEAL	\$	nn	100.00	X
22	1 SPARE TYRE RIM (ROUE 7J 16H 2547)	\$	nn	385.00	X
23	1 SPARE TYRE	\$	nn	330.00	X
24	1SET RADIATOR GRILLE FRAME CLIP	\$	nn	52.00	X
25	1SET BUMPER CLIP FRT	\$	nn	66.00	✓
26	1 BUMPER BRACKET CLIP FRT LH	\$	nn	12.00	} X
27	1 BUMPER SUPPORT CLIP FRT LH	\$	nn	10.50	
28	1 BUMPER BRACKET CLIP FRT RH	\$	nn	12.00	
29	1 BUMPER SUPPORT CLIP FRT RH	\$	nn	10.50	
30	1SET RADIATOR GRILLE SCREW	\$	nn	16.00	
31	1SET BUMPER GRILLE LOWER CLIP	\$	nn	69.00	
32	1SET FRAME FULL SUPPORT PANEL CLIP	\$	nn	70.00	
33	2 FRAME FULL SUPPORT PANEL NUT	\$	nn	20.00	
34	2 FRAME FULL SUPPORT PANEL STUD	\$	nn	30.00	
35	1 Windscreen moulding	\$	nn	100.00	
36	1 FRONT WINDSCREEN SEALANT	\$	nn	253.80	} 45/nn
37	1 FRONT WINDSCREEN INNER SPONGE SEAL	\$	nn	100.00	
38	1SET Front licence plate with holder	\$	nn	80.00	
39	1 WHEELARCH CLIP FRT LH	\$	nn	30.50	X
40	1 WHEELARCH CLIP FRT RH	\$	nn	30.50	X
41	2 BONNET STRUT L70Y	\$	nn	88.61	X
42	6 BONNET INSULATOR CLIP L70Y	\$	nn	7.30	X
43	2 BONNET CABLE COVER SCREW L70Y	\$	nn	10.85	X
44	2 BONNET CABLE CLIP L70Y	\$	nn	6.31	X

Trans-cab Auto Services Pte Ltd

AAD1906-212

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 400M

45	1	BOOT STICKER "Trans-cab"	\$	<i>nn</i>	30.00	—
46	1	BOOT STICKER "6555-3333"	\$	<i>nn</i>	30.00	—
47	1	FRONT RIGHT TYRE	\$	<i>nn</i>	300.00	X
48	1	FRONT RIGHT TYRE RIM	\$	<i>nn</i>	380.00	X
49	1	FRONT LEFT TYRE	\$	<i>nn</i>	300.00	X
50	1	FRONT LEFT TYRE RIM	\$	<i>nn</i>	380.00	X
TOTAL			\$		4,660.90	

TOTAL PARTS \$ 93,194.35**LABOUR**

Putty And Spray Painting Of The Affected Portion.	\$	7,500.00	<i>15401</i>
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	7,500.00	<i>18001</i>
To Rust-Proofing Of The Affected Areas.	\$	170.00	<i>901</i>
To reinstall rear bumper parking sensor.	\$	170.00	<i>601</i>
To transfer of rear luggage floor panel fittings, attachment and perform water seepage test.	\$	<i>nn</i> 170.00	X
To drop diesel tank, pipes, hoses to facilitate bodywork repair, final checking and testing.	\$	380.00	<i>601</i>
To drop rear exhaust box, renew the same, to repair and realign centre exhaust pipe.	\$	170.00	<i>801</i>
To transfer of bootlid fittings, attachments and perform water seepage test.	\$	170.00	<i>601</i>
To transfer of rear end panel fittings, attachment and perform water seepage test.	\$	<i>nn</i> 170.00	X
To transfer of rear windscreen fittings and conduct water seepage test.	\$	<i>nn</i> 170.00	X

Trans-cab Auto Services Pte Ltd**AAD1906-212**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 400M

To supply and re-do rear luggage floor panel insulation padding.	\$	380.00	801
To vacuum, replace, refix and recharge air condenser	\$	380.00	1001
To Check Electrical Lighting Concerned.	\$	170.00	401
Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.	\$	380.00	2501
Towing Fees	\$	150.00	501
To dismantle and refit aircon assy and attachment, vacuum and charge-in-gas.	\$	<i>Replaced</i> 380.00	1001 X
To repair and realign rear exhaust pipe.	\$	<i>nn</i> 170.00	X
To check steering geometry and computer wheel alignment	\$	<i>nn</i> 220.00	X
To apply paint protection system (PPS) maintain and enhancement	\$	<i>nn</i> 380.00	X
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	<i>nn</i> 380.00	X
To Transfer Of Fender Fittings, Attachments And Perform Water Seepage Test.	\$	<i>nn</i> 340.00	X
To transfer of front bumper fittings, attachment and perform water seepage test.	\$	<i>nn</i> 180.00	X
To transfer of front bonnet fittings, attachment and perform water seepage test.	\$	<i>nn</i> 180.00	X
To replace, refix and top up coolant for radiator.	\$	170.00	* 501

Trans-cab Auto Services Pte Ltd**AAD1906-212**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 400M

To transfer of rear bumper fittings, attachment and perform water seepage test.	\$	<i>na</i> 180.00	<i>X</i>
To transfer of front windscreen fittings and conduct water seepage test.	\$	<i>na</i> 170.00	<i>X</i>
To transfer of tire, rim and on wheel balancing.	\$	<i>na</i> 170.00	<i>X</i>
To Transfer Of Rear Fender Fittings, Attachments And Perform Water Seepage Test.	\$	<i>na</i> 340.00	<i>X</i>
To vacuum, replace, refill and recharge Air Intercooler	\$	<i>na</i> 170.00	<i>X</i>
TOTAL	\$	21,460.00	
Over All Total	\$	114,654.35	<i>4</i>

Repair Days (PART BY PART)***30 DAYS****16 days*

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature: _____
Date: _____

Claim Audit

AUDIT TRAIL				
No.	On	Audit	Remarks	By
1	26 Jun 2019 15:29	Clim Dtl Modified	Claimant's Name: -> TRANS-CAB SERVICES PTE LTD. Claimant's ID: -> 200303878 K.	[A] HOW MEI KWAN
2	26 Jun 2019 15:29	Clim Veh Model Changed	(205736) RENAULT LATITUDE 2.0 L DCI AUTO D/AB 4DR (A).	[A] HOW MEI KWAN
3	26 Jun 2019 15:29	Clim Created	Reg No: SHD400M. Acct Date: 2019/06/22. Claim Type: TP. Insurer: AIG Asia Pacific Insurance Pte. Ltd. (SG). TP Insurer: AXA Insurance Pte Ltd (HQ). Workshop: Trans-cab Auto Services Pte Ltd ()	[A] HOW MEI KWAN
4	26 Jun 2019 15:29	Adj Co Assigned	LKK Auto Consultants Pte Ltd (HQ):	[A] HOW MEI KWAN
5	26 Jun 2019 15:29	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2019/07/05	[A] HOW MEI KWAN
6	26 Jun 2019 15:29	Adj Mandate Set	Approved:8000.00.Reinsp:Adj decides.	[A] HOW MEI KWAN
7	26 Jun 2019 15:29	Clim Ins Co Changed	[200005] AIG Asia Pacific Insurance Pte. Ltd. (SG) -> [203630] AIG Asia Pacific Insurance Pte. Ltd. (Express)	[I] Merimen Administrator
8	26 Jun 2019 15:30	Label Added	(23):Express.	[A] HOW MEI KWAN
9	26 Jun 2019 15:30	Adj Adjuster Assigned	[None] -> KENNETH KONG	[A] HOW MEI KWAN
10	19 Sep 2019 17:53	Adj Rpt Initiated		[A] NUR SHAQILAH BTE ABDOL WAHAB
11	19 Sep 2019 17:53	Clim Dtl Modified	JPJ Reg. Date: -> 2016/10/17.	[A] NUR SHAQILAH BTE ABDOL WAHAB
12	19 Sep 2019 17:53	Clim Details Notified		[A] NUR SHAQILAH BTE ABDOL WAHAB
13	23 Sep 2019 17:52	Adj Mandate Request	Cur.Req:31216.79:LIABILITY: 100% B:28 4VEH CC OI LAST	[A] Asher Sng Rong Yi

Date From



Date To



Audit Type None

Go

ACTIVITY

No record

Merimen Billing for this case - Transaction History

Bill Ref No	Bill Date	Bill Type	Acc Type	Acc Name	Co Name (Branch)	Ref 1	Ref 2	Amount
2191842	27 Jun 2019 10:31:51	TP Case (Insurer)	Motor	LKK Auto Consultants Pte Ltd	AIG Asia Pacific Insurance Pte. Ltd. (Express)	SHD400M	SKF5285A	11.77
2286095	19 Sep 2019 17:53:07	OD/TP Case (Adjuster)	Motor	LKK Auto Consultants Pte Ltd	LKK Auto Consultants Pte Ltd (HQ)	SHD400M	SKF5285A	11.77

10/17/2019

Merimen e-Claims

Print Received Message

This mail is associated with :

***SHD400M (7728042718SG)**

[SKF5285A]

TP

TRANS-CAB SERVICES PTE LTD

Jun 22 2019 10:00PM

[ANG KIRK GINE]

Trans-cab Auto Services Pte Ltd

From AIG Asia Pacific Insurance Pte. Ltd. (Express) (AIG_SG_EXPRESS), sent on 16/10/2019 16:36 PM.
To LKK_HQ
Subject Alert - Adj Mandate Approved (S\$31216.79) - SHD400M - Claim Handler: Chan, Kian-Meng

Approved:31216.79.

...CLAIM SUBFOLDER...(Pending for Survey Report)

Express

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	26 Jun 2019 Edit Reg		25 Jun 2019 00:00 Edit Adj Rpt	\$527,463.96 Edit Estimates	\$527,463.96 View Rpt		Pending for Survey Report Cancel Case

Main

Reference

Claim Details

Documents

[Show All](#)

CLAIM SUBFOLDER DETAILS

[Created by adjuster]

Insured:	ANG KIRK GINE, ID: S8172951D		
Main Claimant:	TRANS-CAB SERVICES PTE LTD, Co. Reg. No.: 200303878K		
Vehicle Reg. No.:	SHD400M	Date of Loss:	22/06/2019 22:00 - :59 [32 Months and 5 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP / 7728042718SG	Policy/Cover Note No.:	(Comprehensive) Coverage: 12/06/2019 - 11/06/2020
Vehicle Reg. No. (Insured):	SKF5285A	Policy No. (Claimant):	VPX/P1680520
		Excess:	
Repairer:	Trans-cab Auto Services Pte Ltd () No 2 Ang Mo Kio Street 63, 569111 Ang Mo Kio - Tel:		
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (Express) - Tel: 65-6419-3000 ... [Handled by Chan, Kian-Meng] Kianmeng.Chan1@aig.com		
Claimant's Insurer:	AXA Insurance Pte Ltd (HQ) - Tel: 6338 7288		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by KENNETH KONG] ... [Final Rpt due 05/07/2019]		

ASSOCIATED MAIL RECEIVED

[View All](#)[Compose Case Mail](#)

- AIG_SG_EXPRESS (16/10/2019): Alert - Adj Mandate Approved (\$531216.79) - SHD400M - Claim Handler: Chan, Kian-...

ALL ASSOCIATED TASKS

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date Priority Type Task Group Subject Handler Assigned By Completed On Created On Done?

No results.

Claim Documents

*SHD400M (7728042718SG)
[SKF5285A]
TP
TRANS-CAB SERVICES PTE LTD
Jun 22 2019 10:00PM
[ANG KIRK GINE]
Trans-cab Auto Services Pte Ltd

[Upload Documents](#)
[Upload Photos](#)
[Compose New Letter](#)
[Upload Video](#)
[Upload Audio](#)

View [View in Browser](#) ▼

Letters/Correspondences

1 per page ▼

☒

No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	(Draft)	Third Party Express Settlement – Payment Breakdown	 Edit	

Photos/Images

3 per page ▼

☒

No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	23/09/19 17:51	General View	 Load JPG	☒
2	23/09/19 17:51	General View	 Load JPG	☒
3	23/09/19 17:51	General View	 Load JPG	☒
4	23/09/19 17:51	General View	 Load JPG	☒
5	23/09/19 17:51	General View	 Load JPG	☒
6	23/09/19 17:51	General View	 Load JPG	☒
7	23/09/19 17:51	General View	 Load JPG	☒
8	23/09/19 17:51	General View	 Load JPG	☒
9	23/09/19 17:51	General View	 Load JPG	☒
10	23/09/19 17:51	General View	 Load JPG	☒
11	23/09/19 17:51	General View	 Load JPG	☒
12	23/09/19 17:51	General View	 Load JPG	☒
13	23/09/19 17:51	General View	 Load JPG	☒
14	23/09/19 17:51	General View	 Load JPG	☒
15	23/09/19 17:51	General View	 Load JPG	☒
16	23/09/19 17:51	General View	 Load JPG	☒
17	23/09/19 17:51	General View	 Load JPG	☒
18	23/09/19 17:51	General View	 Load JPG	☒
19	23/09/19 17:51	General View	 Load JPG	☒
20	23/09/19 17:51	General View	 Load JPG	☒
21	23/09/19 17:51	General View	 Load JPG	☒
22	23/09/19 17:51	General View	 Load JPG	☒
23	23/09/19 17:51	General View	 Load JPG	☒
24	23/09/19 17:51	General View	 Load JPG	☒
25	23/09/19 17:51	General View	 Load JPG	☒
26	23/09/19 17:51	General View	 Load JPG	☒
27	23/09/19 17:51	General View	 Load JPG	☒
28	23/09/19 17:51	General View	 Load JPG	☒
29	23/09/19 17:51	General View	 Load JPG	☒
30	23/09/19 17:51	General View	 Load JPG	☒
31	23/09/19 17:51	General View	 Load JPG	☒
32	23/09/19 17:51	General View	 Load JPG	☒
33	23/09/19 17:51	General View	 Load JPG	☒
34	23/09/19 17:51	General View	 Load JPG	☒
35	23/09/19 17:51	General View	 Load JPG	☒
36	23/09/19 17:51	General View	 Load JPG	☒
37	23/09/19 17:51	General View	 Load JPG	☒

Letters/Correspondences			1 per page ▼	✓
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
38	23/09/19 17:51	General View	Load JPG	✓
39	23/09/19 17:51	General View	Load JPG	✓
40	23/09/19 17:51	General View	Load JPG	✓
41	23/09/19 17:51	Odometer Reading	Load JPG	✓
42	23/09/19 17:51	Chassis Number	Load JPG	✓
43	23/09/19 17:51	General View	Load JPG	✓
44	23/09/19 17:51	General View	Load JPG	✓
45	23/09/19 17:51	General View	Load JPG	✓
46	23/09/19 17:51	Reinspection Photo	Load JPG	✓
47	23/09/19 17:51	Reinspection Photo	Load JPG	✓
48	23/09/19 17:51	Reinspection Photo	Load JPG	✓
49	23/09/19 17:51	Reinspection Photo	Load JPG	✓
50	23/09/19 17:51	Reinspection Photo	Load JPG	✓
51	23/09/19 17:51	Reinspection Photo	Load JPG	✓
52	23/09/19 17:51	Reinspection Photo	Load JPG	✓
53	23/09/19 17:51	Reinspection Photo	Load JPG	✓
54	23/09/19 17:51	Reinspection Photo	Load JPG	✓
55	23/09/19 17:51	Reinspection Photo	Load JPG	✓
56	23/09/19 17:51	Reinspection Photo	Load JPG	✓
57	23/09/19 17:51	Reinspection Photo	Load JPG	✓
58	23/09/19 17:51	Reinspection Photo	Load JPG	✓
59	23/09/19 17:51	Reinspection Photo	Load JPG	✓
60	23/09/19 17:51	Reinspection Photo	Load JPG	✓
61	23/09/19 17:51	Reinspection Photo	Load JPG	✓
62	23/09/19 17:51	Reinspection Photo	Load JPG	✓
63	23/09/19 17:51	Reinspection Photo	Load JPG	✓
64	23/09/19 17:51	Reinspection Photo	Load JPG	✓
65	23/09/19 17:51	Reinspection Photo	Load JPG	✓
66	23/09/19 17:51	Reinspection Photo	Load JPG	✓
67	23/09/19 17:51	Reinspection Photo	Load JPG	✓
68	23/09/19 17:51	Reinspection Photo	Load JPG	✓
69	23/09/19 17:51	Reinspection Photo	Load JPG	✓
70	23/09/19 17:51	Reinspection Photo	Load JPG	✓
71	23/09/19 17:51	Reinspection Photo	Load JPG	✓
72	23/09/19 17:51	Reinspection Photo	Load JPG	✓
73	23/09/19 17:51	Reinspection Photo	Load JPG	✓
74	23/09/19 17:51	Reinspection Photo	Load JPG	✓
75	23/09/19 17:51	Reinspection Photo	Load JPG	✓
Documentation			1 per page ▼	✓
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	26/06/19 19:21	TP ESTIMATE - MARKED	Load PDF	
2	26/06/19 19:21	TP GIA REPORT	Load PDF	
3	23/09/19 17:41	LETTER TO OI	Load PDF	
4	23/09/19 17:41	LOD	Load PDF	
5	23/09/19 17:41	LTA SEARCH	Load PDF	
6	23/09/19 17:41	RENTAL MILEAGE	Load PDF	
7	23/09/19 17:41	RENTAL RECEIPT	Load PDF	
8	04/11/19 13:15	AUTHORISATION TO ACT	Load PDF	
9	04/11/19 13:15	RELEASE VOUCHER	Load PDF	
10	04/11/19 13:15	WORKSHOP INVOICE	Load PDF	
No	Finalized On	AIG Asia Pacific Insurance Pte. Ltd. (SG)	Thumbnail	Print
1	27/06/19 10:25	OI GIA REPORT	Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST

Reset

Save

Print

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

NOTE: TO BE COMPLETED BY SURVEYOR

TEAM _____

THIRD PARTY EXPRESS SETTLEMENT (PAYMENT BREAKDOWN)

Vehicle No:	SKF5285A (Insd veh)	Model:	RENAULT LATITUDE 2.0 L DCI
	SHD400M (TP veh)		AUTO D/AB 4DR (A)
Date of Accident:	22/06/2019		

Global Sum Settlement	:	[]	Yes	[X]	No	
Repair Estimate	:	\$			122,680.14	
Final Repair Cost	:	\$			29,386.44	
Loss of Use	:	\$				days at \$0.00 per day
Rental (if any)	:	\$			1,822.86	18 days
LTA / GIA Search Fee	:	\$			7.49	
Others:	:	\$				
	:	\$				
Final Settlement Sum	:	\$			31,216.79	
Is Third Party Workshop GIA Registered? [] YES [X] NO (Kindly indicate below)						
A) For Non GIA Registered Workshop:		Agreed Liability ____ 100 ____ (%)				
B) For GIA Registered Workshop:		BOLA Applicable: Yes/ No BOLA Scenario No: ____				
BOLA Liability: ____ (%)		Assessed Liability (*): ____ 100 ____ (%)				
* Assessed Liability to be filled only for chain collisions and for cases where BOLA does not apply.						
Remarks _____						

Payment Instruction: Payee's Breakdown			
1)	Trans-Cab Auto Services Pte Ltd	: \$	31,216.79
2)		: \$	
3)		: \$	
4)		: \$	

NUR SHAQILAH BTE ABDOL WAHAB

LKK Auto Consultants Pte Ltd

04 Nov
2019

Date

Please attach all the supporting documents to the form.

(Final Repair Bill; Rental Invoice; Release Voucher; Authorisation to Act; Survey Report; Medical Report/ Bill (if any))

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC3/AIG19011309/KEA3S2
Date: 04/11/2019

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No:
Claimant Vehicle No : SHD400M **Insured Vehicle No :** SKF5285A
Date of Loss: 22/06/2019 **Nature of Claim:** TP **Claim No:** 7728042718SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SHD400M**
 Make & Model: RENAULT LATITUDE, 2.0 L DCI AUTO D/AB 4DR (A) Engine No: M9R8839C003340
 Reg. Date: 17/10/2016 (Man. Year: 2016) Chassis No: VF1ABL15AUC283283
 Colour: Metallic White/Red Odometer: 369699 km
 Engine Capacity: 1995 cc
 Market Value/New Car Price: N/A
 Sum Insured (\$\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Good Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/60 R16 Rear Tyre Size: 215/60 R16
 Front Left Side: Giti 7 mm Rear Left Side: Giti 5 mm
 Front Right Side: Giti 7 mm Rear Right Side: Giti 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	93,194.34	23,203.96	69,990.38	75.10
Miscellaneous Items	0.00	0.00	0.00	
Labour	21,460.00	4,260.00	17,200.00	80.15
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (\$\$)	114,654.34	27,463.96	87,190.38	76.05
+ GST 7.00/7.00% (\$\$)	8,025.80	1,922.48	6,103.32	76.05
Nett Amount (\$\$)	122,680.14	29,386.44	93,293.70	76.05
+ Car Rental (18.0 x S\$101.27/day) (\$\$)		1,822.86		
+ Doc/Search Fee (\$\$)		7.49		
Nett Liability (\$\$)		31,216.79		

INSPECTION

Date of Assignment: 25/06/2019
 Date Inspected: 25/06/2019 Inspected At: Trans-cab Auto Services Pte Ltd
 No 2 Ang Mo Kio Street 63
 Singapore 569111
 Estimated Period of Repair: 16.0 days

Adjuster: KENNETH KONG

Manager: Asher Sng Rong Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BUMPER COVER REAR	Bent	1,108.46 FL	*1,108.46 FL
2	1		*BUMPER LOWER REAR	Bent	768.84 FL	*768.84 FL
3	1		*BUMPER BRACKET CTR REAR	Distorted	113.47 FL	*113.47 FL
4	1		*BUMPER BRACKET SIDE RH REAR	Serviceable	135.97 FL	*- FL
5	1		*BUMPER RETAINER RH REAR	Serviceable	44.99 FL	*- FL
6	1		*BUMPER REFLECTOR RH	Cracked	43.61 FL	*43.61 FL
7	1		*BUMPER BRACKET SIDE LH REAR	Serviceable	135.97 FL	*- FL
8	1		*BUMPER RETAINER LH REAR	Serviceable	44.99 FL	*- FL
9	1		*BUMPER REFLECTOR LH	Cracked	43.61 FL	*43.61 FL
10	1		*BUMPER BEAM REAR	Bent	777.52 FL	*777.52 FL
11	1		*BUMPER BEAM BRACKET LH REAR	Bent	225.95 FL	*225.95 FL
12	1		*BUMPER BEAM BRACKET RH REAR	Bent	225.95 FL	*225.95 FL
13	1		*BOOT REAR	Bent	2,872.68 FL	*2,872.68 FL
14	1		*BOOT FINISHER	Serviceable	470.06 FL	*- FL
15	1		*BOOT WEATHERSTRIP	Distorted / Cut	323.05 FL	*323.05 FL
16	1		*BOOT REFLECTOR LAMP LH	Cracked	493.35 FL	*493.35 FL
17	1		*BOOT REFLECTOR LAMP RH	Cracked	493.35 FL	*493.35 FL
18	1		*BOOT BADGE RENAULT	Necessary	225.36 FL	*225.36 FL
19	1		*BOOT BADGE	Necessary	225.36 FL	*225.36 FL
20	1		*BOOT STRUT LH	Serviceable	276.08 FL	*- FL
21	1		*BOOT STRUT RH	Serviceable	276.08 FL	*- FL
22	1		*BOOT HINGE LH	Repair	367.84 FL	*- FL
23	1		*BOOT HINGE RH	Repair	367.84 FL	*- FL
24	1		*BOOT INNER TRIM	Serviceable	586.45 FL	*- FL
25	1		*BOOT SWITCH	Serviceable	168.13 FL	*- FL
26	1		*BOOT LOCK	Repair	202.67 FL	*- FL
27	1		*BOOT LOCK CATCH	Repair	74.40 FL	*- FL
28	2		*LICENCE PLATE LAMP	Serviceable	50.52 FL	*- FL
29	2		*BOOT RUBBER PLUG	Serviceable	221.81 FL	*- FL
30	1		*FENDER PANEL INNER TRIM REAR LH	Serviceable	671.45 FL	*- FL
31	1		*FENDER PANEL REAR LH	Repair	3,299.13 FL	*- FL
32	1		*WHEELARCH REAR LH	Serviceable	543.47 FL	*- FL
33	1		*FENDER PANEL INNER TRIM REAR RH	Serviceable	671.45 FL	*- FL
34	1		*FENDER PANEL REAR RH	Repair	3,299.13 FL	*- FL
35	1		*WHEELARCH REAR RH	Serviceable	543.47 FL	*- FL
36	1		*TAILLAMP RH	Mtg Cracked	552.55 FL	*552.55 FL
37	1		*TAILLAMP PANEL RH	Repair	986.70 FL	*- FL
38	1		*TAILLAMP LH	Mtg Cracked	552.55 FL	*552.55 FL
39	1		*TAILLAMP PANEL LH	Repair	986.70 FL	*- FL
40	1		*OUTER PANEL REAR (END PANEL)	Bent	1,471.77 FL	*1,471.77 FL
41	1		*OUTER PANEL REAR (END PANEL) TRIM	Cracked	404.56 FL	*404.56 FL
42	1		*SPARE WHEEL PANEL (LUGGAGE FLOOR PANEL)	Bent / Buckled	2,189.88 FL	*2,189.88 FL
43	1		*SPARE WHEEL PANEL TRIM	Serviceable	612.21 FL	*- FL
44	1		*EXHAUST REAR	Repair	7,489.05 FL	*- FL
45	1		*EXHAUST CAP REAR	Dented	230.49 FL	*230.49 FL
46	1		*BUMPER COVER FRT	Cracked	1,259.42 FL	*1,259.42 FL
47	1		*BUMPER SPOILER FRT	Distorted	181.75 FL	*181.75 FL
48	1		*BUMPER ABSORBER FRT	Cracked	394.68 FL	*394.68 FL
49	1		*BUMPER RETAINER FRT LH	Distorted	151.41 FL	*151.41 FL
50	1		*BUMPER SUPPORT FRT	Serviceable	123.88 FL	*- FL
51	1		*BUMPER RETAINER FRT RH	Distorted	150.77 FL	*150.77 FL
52	1		*BUMPER SUPPORT FRT	Serviceable	123.88 FL	*- FL
53	1		*BUMPER UNDERTRAY FRT	Serviceable	472.83 FL	*- FL
54	1		*BUMPER GRILLE LOWER FRT	Cracked	266.80 FL	*266.80 FL
55	1		*BUMPER FOG LAMP GRILLE LH	Serviceable	207.21 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
56	1		*BUMPER FOG LAMP GRILLE RH	Serviceable	207.21 FL	*- FL
57	1		*BUMPER BEAM FRT	Bent	914.08 FL	*914.08 FL
58	1		*TOW COVER FRT	Serviceable	28.61 FL	*- FL
59	1		*RADIATOR GRILLE	Cracked	1,707.78 FL	*1,707.78 FL
60	1		*RADIATOR GRILLE BADGE RENAULT	Necessary	225.36 FL	*225.36 FL
61	1		*RADIATOR GRILLE FRAME	Cracked	1,353.75 FL	*1,353.75 FL
62	1		*FRAME FULL SUPPORT PANEL	Cracked	615.90 FL	*615.90 FL
63	1		*FRAME FULL SUPPORT BRACKET	Repair	89.79 FL	*- FL
64	1		*FRONT BRACE PANEL	Repair	177.22 FL	*- FL
65	1		*HORN	Serviceable	314.17 FL	*- FL
66	1		*HORN BRACKET	Repair	40.45 FL	*- FL
67	1		*HEADLAMP LH	Mtg Cracked	1,184.43 FL	*1,184.43 FL
68	1		*HEADLAMP RH	Mtg Cracked	1,184.43 FL	*1,184.43 FL
69	1		*HEADLAMP PANEL FRT LH	Repair	152.15 FL	*- FL
70	1		*HEADLAMP PANEL FRT RH	Repair	152.15 FL	*- FL
71	1		*BONNET	Repair	1,941.63 FL	*- FL
72	1		*BONNET INSULATOR	Serviceable	405.73 FL	*- FL
73	1		*BONNET STRUT LH	Serviceable	88.61 FL	*- FL
74	1		*BONNET STRUT RH	Serviceable	88.61 FL	*- FL
75	1		*BONNET HINGE LH	Repair	348.31 FL	*- FL
76	1		*BONNET HINGE RH	Repair	348.31 FL	*- FL
77	1		*BONNET LOCK	Repair	305.48 FL	*- FL
78	1		*BONNET CABLE	Serviceable	119.19 FL	*- FL
79	1		*BONNET CABLE COVER	Serviceable	161.03 FL	*- FL
80	1		*BONNET SEAL OUTER	Serviceable	92.36 FL	*- FL
81	1		*BONNET SEAL INNER	Serviceable	157.28 FL	*- FL
82	1		*FENDER PANEL FRT LH	Repair	783.83 FL	*- FL
83	1		*WHEELARCH FRT LH	Serviceable	278.84 FL	*- FL
84	1		*FENDER BRACKET LOWER LH	Serviceable	15.79 FL	*- FL
85	1		*FENDER INSULATOR LH	Serviceable	130.84 FL	*- FL
86	1		*FENDER INSULATOR RH	Serviceable	130.84 FL	*- FL
87	1		*FENDER PANEL FRT RH	Repair	783.83 FL	*- FL
88	1		*WHEELARCH FRT RH	Serviceable	278.84 FL	*- FL
89	1		*FENDER BRACKET LOWER RH	Serviceable	15.79 FL	*- FL
90	1		*WIPER RESERVOIR	Serviceable	348.25 FL	*- FL
91	1		*WIPER RESERVOIR NECK	Serviceable	136.11 FL	*- FL
92	1		*WIPER RESERVOIR MOTOR	Serviceable	270.06 FL	*- FL
93	1		*AIR CLEANER LOWER	Serviceable	271.26 FL	*- FL
94	1		*AIR CLEANER HOSE	Serviceable	76.14 FL	*- FL
95	1		*BASE BATTERY TRAY	Serviceable	363.40 FL	*- FL
96	1		*AIR CLEANER BOX	Serviceable	464.20 FL	*- FL
97	1		*TURBO DUCT	Serviceable	1,027.80 FL	*- FL
98	1		*A/C HEATER VALVE	Serviceable	484.50 FL	*- FL
99	1		*SUBFRAME OUTER FRT	Serviceable	2,652.45 FL	*- FL
100	1		*SUBFRAME BRACKET OUTER LH	Repair	92.36 FL	*- FL
101	1		*SUBFRAME BRACKET OUTER RH	Repair	92.36 FL	*- FL
102	1		*ENGINE UNDERTRAY	Serviceable	564.98 FL	*- FL
103	1		*A/C CONDENSER	Punctured	2,020.37 FL	*2,020.37 FL
104	1		*A/C CONDENSER GARNISH LH UPPER	Serviceable	39.67 FL	*- FL
105	1		*A/C CONDENSER GARNISH RH UPPER	Serviceable	39.67 FL	*- FL
106	1		*A/C CONDENSER GARNISH LH	Serviceable	58.81 FL	*- FL
107	1		*A/C CONDENSER GARNISH RH	Serviceable	59.60 FL	*- FL
108	1		*A/C PIPE CONDENSER TO COMPRESSOR	Serviceable	208.39 FL	*- FL
109	1		*A/C PIPE CONDENSER TO EXPANSION VALVE	Serviceable	658.72 FL	*- FL
110	1		*A/C PIPE COMPRESSOR	Serviceable	334.29 FL	*- FL
111	1		*A/C PIPE	Serviceable	658.72 FL	*- FL
112	1		*A/C COMPRESSOR	Serviceable	2,684.61 FL	*- FL
113	1		*AIR COOLER	Serviceable	792.60 FL	*- FL
114	1		*AIR INTERCOOLER HOSE (LONG)	Serviceable	1,014.13 FL	*- FL
115	1		*AIR INTERCOOLER HOSE (SHORT)	Serviceable	375.14 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
116	1		*TRANSMISSION COOLER	Serviceable	1,219.30 FL	*- FL
117	1		*TRANSMISSION COOLER PAD	Serviceable	17.96 FL	*- FL
118	1		*RADIATOR	Serviceable	1,202.20 FL	*- FL
119	2		*RADIATOR STUD UPPER	Serviceable	14.41 FL	*- FL
120	2		*RADIATOR BUSH UPPER	Serviceable	50.12 FL	*- FL
121	2		*RADIATOR MTG LOWER	Serviceable	55.85 FL	*- FL
122	1		*RADIATOR FAN COWLING	Serviceable	820.54 FL	*- FL
123	1		*RADIATOR FAN MOTOR LH	Serviceable	967.36 FL	*- FL
124	1		*RADIATOR FAN MOTOR RH	Serviceable	1,479.46 FL	*- FL
125	1		*RADIATOR TANK	Serviceable	324.62 FL	*- FL
126	1		*RADIATOR HOSE UPPER	Serviceable	240.56 FL	*- FL
127	1		*RADIATOR HOSE LOWER	Serviceable	491.18 FL	*- FL
128	1		*RADIATOR TANK HOSE	Serviceable	61.18 FL	*- FL
129	1		*AUTO COMPUTER	Serviceable	5,032.17 FL	*- FL
130	1		*INJECTION COMPUTER	Serviceable	4,706.30 FL	*- FL
131	1		*RHD HYDRAULIC POWER (RACK & PINION)	Serviceable	5,154.52 FL	*- FL
132	1		*STEERING PUMP ELECTRIC L70Y	Serviceable	2,306.90 FL	*- FL
133	1		*STEERING PINION RACK L70Y	Serviceable	4,413.11 FL	*- FL
134	1		*SET PARKING AID	Shorted	700.00 FS	*400.00 FS
135	1		*SET REAR BUMPER CLIP	Necessary	66.00 FS	*66.00 FS
136	1		*SET BUMPER BRACKET CTR CLIP	Necessary	33.00 FS	*33.00 FS
137	1		*SET BUMPER BRACKET SIDE CLIP RH RR	Not Necessary	10.00 FS	*- FS
138	1		*SET BUMPER RETAINER RH CLIP RR	Not Necessary	20.00 FS	*- FS
139	1		*SET BUMPER BRACKET SIDE CLIP LH RR	Not Necessary	10.00 FS	*- FS
140	1		*SET BUMPER RETAINER CLIP LH RR	Not Necessary	20.00 FS	*- FS
141	1		*SET BUMPER LOWER REAR RIVET	Not Necessary	22.00 FS	*- FS
142	1		*SET BUMPER LOWER REAR CLIP	Necessary	66.00 FS	*66.00 FS
143	1		*EXHAUST MOUNTING REAR	Not Necessary	17.82 FS	*- FS
144	1		*SET BOOT FINISHER CLIP	Not Necessary	24.20 FS	*- FS
145	1		*BOOT INNER TRIM CLIP	Not Necessary	45.00 FS	*- FS
146	1		*SET FENDER WHEELARCH REAR RH CLIP	Not Necessary	35.00 FS	*- FS
147	1		*SET FENDER WHEELARCH REAR LH CLIP	Not Necessary	35.00 FS	*- FS
148	1		*FENDER INNER TRIM CLIP LH	Not Necessary	28.00 FS	*- FS
149	1		*FENDER INNER TRIM CLIP RH	Not Necessary	28.00 FS	*- FS
150	1		*TAILLAMP CLIP RH	Necessary	5.00 FS	*5.00 FS
151	1		*TAILLAMP CLIP LH	Necessary	5.00 FS	*5.00 FS
152	2		*REAR WINDSCREEN SEALANT	Not Necessary	80.00 FS	*- FS
153	1		*WINDSCREEN MOULDING	Not Necessary	100.00 FS	*- FS
154	1		*REAR WINDSCREEN INNER SPONGE SEAL	Not Necessary	100.00 FS	*- FS
155	1		*SPARE TYRE RIM (ROUE 7J 16H 2547)	Serviceable	385.00 FS	*- FS
156	1		*SPARE TYRE	Serviceable	330.00 FS	*- FS
157	1		*SET RADIATOR GRILLE FRAME CLIP	Not Necessary	52.00 FS	*- FS
158	1		*SET BUMPER CLIP FRT	Necessary	66.00 FS	*66.00 FS
159	1		*BUMPER BRACKET CLIP FRT LH	Not Necessary	12.00 FS	*- FS
160	1		*BUMPER SUPPORT CLIP FRT LH	Not Necessary	10.50 FS	*- FS
161	1		*BUMPER BRACKET CLIP FRT RH	Not Necessary	12.00 FS	*- FS
162	1		*BUMPER SUPPORT CLIP FRT RH	Not Necessary	10.50 FS	*- FS
163	1		*SET RADIATOR GRILLE SCREW	Not Necessary	16.00 FS	*- FS
164	1		*SET BUMPER GRILLE LOWER CLIP	Not Necessary	69.00 FS	*- FS
165	1		*SET FRAME FULL SUPPORT PANEL CLIP	Not Necessary	70.00 FS	*- FS
166	2		*FRAME FULL SUPPORT PANEL NUT	Not Necessary	20.00 FS	*- FS
167	2		*FRAME FULL SUPPORT PANEL STUD	Not Necessary	30.00 FS	*- FS
168	1		*WINDSCREEN MOULDING	Serviceable	100.00 FS	*- FS
169	1		*FRONT WINDSCREEN SEALANT	Not Necessary	253.80 FS	*- FS
170	1		*FRONT WINDSCREEN INNER SPONGE SEAL	Not Necessary	100.00 FS	*- FS
171	1		*SET FRONT LICENCE PLATE WITH HOLDER	Bent	80.00 FS	*45.00 FS
172	1		*WHEELARCH CLIP FRT LH	Not Necessary	30.50 FS	*- FS
173	1		*WHEELARCH CLIP FRT RH	Not Necessary	30.50 FS	*- FS
174	2		*BONNET STRUT L70Y	Serviceable	88.61 FS	*- FS
175	6		*BONNET INSULATOR CLIP L70Y	Not Necessary	7.30 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
176	2		*BONNET CABLE COVER SCREW L70Y	Not Necessary	10.85 FS	*- FS
177	2		*BONNET CABLE CLIP L70Y	Not Necessary	6.31 FS	*- FS
178	1		*BOOT STICKER TRANS-CAB	Necessary	30.00 FS	*30.00 FS
179	1		*BOOT STICKER 6555-3333	Necessary	30.00 FS	*30.00 FS
180	1		*FRONT RIGHT TYRE	Serviceable	300.00 FS	*- FS
181	1		*FRONT RIGHT TYRE RIM	Serviceable	380.00 FS	*- FS
182	1		*FRONT LEFT TYRE	Serviceable	300.00 FS	*- FS
183	1		*FRONT LEFT TYRE RIM	Serviceable	380.00 FS	*- FS

F=Franchise part, S=SpcNett, L=ListItemDisc.

Sub Total (\$\$)	103,031.39	25,699.29
- List Item Discount on L Items 10.00/10.00% (\$\$)	9,837.05	2,495.33
Total Parts (\$\$)	93,194.34	23,203.96

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION	New	7,500.00	1,540.00
2	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME.	New	7,500.00	1,800.00
3	TO RUST-PROOFING OF THE AFFECTED AREAS.	New	170.00	90.00
4	TO REINSTALL REAR BUMPER PARKING SENSOR.	New	170.00	60.00
5	TO TRANSFER OF REAR LUGGAGE FLOOR PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	New	170.00	0.00
6	TO DROP DIESEL TANK, PIPES, HOSES TO FACILITATE BODYWORK REPAIR, FINAL CHECKING TESTING.	New	380.00	60.00
7	TO DROP REAR EXHAUST BOX, RENEW THE SAME, TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.	New	170.00	80.00
8	TO TRANSFER OF BOOTLID FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	New	170.00	60.00
9	TO TRANSFER OF REAR END PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	New	170.00	0.00
10	TO TRANSFER OF REAR WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST.	New	170.00	0.00
11	TO SUPPLY AND RE-DO REAR LUGGAGE FLOOR PANEL INSULATION PADDING.	New	380.00	80.00
12	TO VACUUM, REPLACE, REFIX AND RECHARGE AIR CONDENSER.	New	380.00	100.00
13	TO CHECK ELECTRICAL LIGHTING CONCERNED.	New	170.00	40.00
14	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH, TO FACILITATE REPAIR.	New	380.00	250.00
15	TOWING FEES.	New	150.00	50.00
16	TO DISMANTLE AND REFIT AIRCON SYSTEM AND ATTACHMENT, VACUUM AND CHARGE-IN-GAS.	New	380.00	0.00
17	TO REPAIR AND REALIGN REAR EXHAUST PIPE.	New	170.00	0.00
18	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	New	220.00	0.00
19	TO APPLY PAINT PROTECTION SYSTEM (PPS) MAINTAIN AND ENHANCEMENT.	New	380.00	0.00
20	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR.	New	380.00	0.00
21	TO TRANSFER OF FENDER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	New	340.00	0.00
22	TO TRANSFER OF BUMPER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	New	180.00	0.00
23	TO TRANSFER OF FRONT BONNET FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	New	180.00	0.00
24	TO REPLACE, REFIX AND TOP UP COOLANT FOR RADIATOR.	New	170.00	50.00
25	TO TRANSFER OF REAR BUMPER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	New	180.00	0.00
26	TO TRANSFER OF FRONT WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST.	New	170.00	0.00
27	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.	New	170.00	0.00
28	TO TRANSFER OF REAR FENDER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	New	340.00	0.00
29	TO VACUUM, REPLACE, REFIX AND RECHARGE AIR INTERCOOLER.	New	170.00	0.00
Gross Labour Cost (S\$)			21,460.00	4,260.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >