

23/06/2012

ASS. REC. BY:

REF: CS/MSG19011455/E+4311

Special Instruction:

SUIVA/OX

Steve

ASSIGNMENT (Office)

From (Person): Mr Azan Binte Harding of MS29 Date/Time: 28.6.19 9:26am

Estimated Cost: Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SLC 1327 Insured:

at Workshop m/s Kon Fook Sing Tel: 6747 1560

of NO 61 Boku Lane 12

Policy No: MSD/VPCB/19-000490 Claim No: MSD/VPCB/19-000490

Sum Insured: Excess: 700/-

Make of Veh: D.O.A. 23.6.19

(Client's Record)

CA / REV / REP. / REV 24 HRS

Date/Time: 28.6.19 9:54am Person Contacted: Ah Tan

H.O.D. Endorsement:

Vehicle IN/OUT

Date/Time Action/Instruction (✓) Estimate

SLC 1327 T: X

1/7@11:47am - Rensed via menimen.

1/7@15:00pm - authorise by Mr Azan in menimen

1/7@4:45pm - inform Margaret authorise repair \$700/-

ASSIGNMENT

From:

Date:

28.6.2019

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: SLC 1327T

at Workshop mis Kan Fook Sing

of NO 61 Dafu Lane 12

Insured:

Policy No:

Claims No:

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

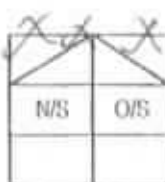

Bal. or Market Value:

IDAC Accident Report: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: days Res: Yes or No

Lum Sum: % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SLC 1327T

Yr Regn:

29/4/16

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Mazda 5

c.c

1998

Colour:

Silver

A/C:

Insured / Std / NI / NA

Sp. Reading:

N/A

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

JM6CW 19716 012-3657

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

205/55R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

23/6/19

D.O.I.

28/6/19

Survey held at

Kan Fook Sing

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

MV - 73K

Part by Part \$12,946.62 (Red. 3437.40; 20%)

RECEIVED 13 AUG 2019

[Signature]
13/8/2019

Date/Time, File Pass to?

☐

: Preli. Report

1) 13/8 Typist

☒

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

10

Resurvey No. of Trip:

1

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

Survey Fee:

Transportation:

20 + RD, 20

Photos

Others

TOTAL

200
11
211

Report Format :

Lump Sum / I.B.I. (\$ 12,946.62)

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	25 Jun 2019 15:09 Sendback Est	27 Jun 2019 14:14 S\$15,378.42	28 Jun 2019 09:32 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All
-------------	------------------	----------------------	------------------	--------------------------

CLAIM SUBFOLDER DETAILS

Insured:	KOH BOON CHYE, ID: S81278213, Tel: +6588224747, Email: NOEMAIL		
Vehicle Reg. No.:	SLC1327T	Date of Loss:	23/06/2019 20:00 - :59 [37 Months and 25 Days From LTA Reg Date (Man Yr)]
Claim Type:	OD	Policy/Cover Note No.:	MSD/VPCB/19-000490 (Comprehensive) Coverage: 29/04/2019 - 28/04/2020
		Excess:	
Repairer:	Kan Fook Sing Motor Workshop (Defu) No. 61 Defu Lane 12, 539147 Defu Lane - Tel: 67479560		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Nor Azian Binte Noordin - 6594 2558]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Imm.Advice due 29/06/2019]		
Driver/Custodian:	KOH BOON CHYE (37 / Male), NRIC: S81278213, Tel: +6588224747 Email: NOEMAIL		
Adj Asg. Remarks:	Car in, Survey & revert. Please contact us ASAP if you cannot attend this assignment.		

ASSOCIATED MAIL RECEIVED

[View All](#) [Compose Case Mail](#)

There are no mail for this case.



ALL ASSOCIATED TASKS

[View All](#) [Search Tasks](#) [Create New Task](#) [Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Denise Tay (LKKAuto)

From: Nor Azian Binte Noordin <NorAzian_Noordin@sg.msig-asia.com>
Sent: Tuesday, 2 July 2019 11:28 AM
To: SUR; Denise Tay (LKKAuto)
Subject: FW: OD Claim - SLC1327T on 23/06/2019

Dear Denise / LKK Auto,

OI has requested to speak to you regarding his concerns on the repair.

Can you contact his friend, Gary, at 82334784? If he is not reachable, you may contact OI, Mr Koh, at 88224747.


Thanks.

Best Regards

Nor Azian Binte Noordin
Executive, Claims Services (Motor)
Direct line +65 6594 2558 | Direct fax +65 6225 7402 | NorAzian_Noordin@sg.msig-asia.com



MSIG Insurance (Singapore) Pte Ltd 16 Raffles Quay, #24-01 Hong Leong Building, Singapore 048581 | T: +65 6220 9644 | F: +65 6225 6371 | Co. Reg. No. 200412212G | msig.com.sg



A Member of **MS&AD** INSURANCE GROUP

From: patricia [mailto:patricia@kanfs.net]
Sent: Tuesday, July 02, 2019 11:21 AM
To: Nor Azian Binte Noordin <NorAzian_Noordin@sg.msig-asia.com>
Subject: RE: OD Claim - SLC1327T on 23/06/2019

EXTERNAL EMAIL: Be careful when you click any links or open any attachment(s).

Dear Mdm,

Noted.

Thank you
Patricia

On Tue, 2 Jul 2019 03:04:18 +0000, Nor Azian Binte Noordin wrote

> Dear Patricia,
>
> Please test drive his car first after repair before OI collects his car.
>
> Thanks.

View Received Message

This mail is associated with :

SLC1327T (MSC/V/19-000739)

OD

Jun 23 2019 8:00PM

[KOH BOON CHYE]

Kan Fook Sing Motor Workshop

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From MSIG Insurance (Singapore) Pte. Ltd. (MSIG_SG), sent on 01/07/2019 15:00 PM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$13549.92) - SLC1327T - Claim Handler: Nor Azian Binte Noordin

Approved:13549.92:A If C. Check items of \$693.00 to be verified and confirmed, Excess of \$700.00 is applicable.

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way
#21-01 SGX Centre 2
Singapore 068807From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Nor Azian Binte Noordin

Date: 01 Jul 2019

Preliminary Advice

Vehicle No	: SLC1327T	Accident Date	: 23/06/2019
Make	: MAZDA 5	Policy No.	: MSD/VPCB/19-000490
Assignment Date	: 28/06/2019	Excess	: S\$700.00
Date of Inspection	: 28/06/2019	Est. Duration of Repair	: 10.00
Inspection At	: KAN FOOK SING MOTOR WORKSHOP (DEFU) NO. 61 DEFU LANE 12 SINGAPORE 539147		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	15,378.42
Revised Amount	:S\$	13,549.92
Check Items (Estimated)	:S\$	693.00
Total	:S\$	14,242.92

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	73,000.00
COE / PARF Rebate	:S\$	48,261.00
Salvage Value	:S\$	
Margin for Repair	:S\$	24,739.00

Remarks

(x) The vehicle is economical for repair.

() The above survey was conducted on a 'without prejudice' basis.

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	7821J
Vehicle Details	
Vehicle No.:	SLC1327T
Vehicle to be Exported:	No
Intended Deregistration Date:	01 Jul 2019
Vehicle Make:	MAZDA
Vehicle Model:	MAZDA5 5-DOOR WAGON 2.0L SP.6EAT SUNROOF
Primary Colour:	Silver
Manufacturing Year:	2016
Engine No.:	PE10337721
Chassis No.:	JM6CW1071G0123683
Maximum Power Output:	111.0 kW (148 bhp)
Open Market Value:	\$19,211.00
Original Registration Date:	29 Apr 2016
First Registration Date:	29 Apr 2016
Transfer Count:	1
Actual ARF Paid:	\$19,211.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	28 Apr 2026
PARF Rebate Amount:	\$14,408.00
Intended COE Rebate Details	
COE Expiry Date:	28 Apr 2026
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$49,602.00
COE Rebate Amount:	\$33,853.00
Total Rebate Amount:	\$48,261.00

The information contained herein is correct as at 01 Jul 2019

OK



BIDDED CARPLATE NUMBERS FOR SALE

Find and buy your favourite car plate number here!

START SEARCH NOW!

Post an Advertisement
Sell it yourself! Advertise it at just
\$58 until it's SOLD!

Post an Ad Advertiser Login Ways of Selling

New 5 Years Cor Removal Toyota Airta 3.5L



2.10L/100km & 10 Years Powertrain
Finance, 2 Years Warranty, L2000
Down Monthly From \$1000
Or Credit Pte Ltd



HIN LUNG AUTO
Hubei Group

One Stop Car Hub
Finance, Insurance, Workshop
New and Used Cars

30 years of car hub

Browse by Category

Sort by Date Posted 20 results/page

6 vehicles

Mazda 5

Advanced Search

Model	Price	Depreciation	Eng Date	Eng Cap	Mileage	Veh Type	Status
Search Selection Mazda 5	Any	Any	2016	Any	Any	Any	Available



Mazda 5 2.0A Sunroof

\$75,800

\$9,900 /yr

16-Mar-2016

1,998 cc

60,439 km

MPV

Available

1 Owner TIR Date, Low Fuel Consumption, Twin Sliding Doors For Easy Access. Well Maintained Inside Out. High Loan And Trade In Option Available Here. Call For A Viewing Appointment Today!

Posted: 16-Jun-2018 Tags: 2016 Mazda 5, 2016 mazda 5, Mazda 5, mazda 5, Mazda 5, Used Mazda



Mazda 5 2.0A Sunroof

\$75,500

\$9,570 /yr

18-May-2016

1,998 cc

47,000 km

MPV

Available

1 Careful Owner, 5 Years Warranty On Engine With Agent. Sticker On Car Will Be Removed To Its Original. Owner Looking For An Upgrade. Immaculate Condition. Easy Loan Available. Trade In Welcome. Up To...

Bavarian Marques Pte Ltd

Posted: 18-Jun-2018 Tags: 2016 Mazda 5, 2016 mazda 5, Mazda 5, mazda 5, Mazda 5, Used Mazda



Mazda 5 2.0A Sunroof

\$72,800

\$8,960 /yr

30-Jun-2016

1,998 cc

83,203 km

MPV

Available

Guaranteed Cheapest, Pearl White Mazda 5 2.0A! Agent Serviced Since Day 1 With Receipt! Genuine Mileage Done 83203km. New Yokohama Tyres/Paintwork. Road Tax TIR Dec 15. 100% Accident Free. Call Now!

Lake View Credit Pte Ltd

Posted: 16-Jun-2018 Tags: 2016 Mazda 5, 2016 mazda 5, Mazda 5, mazda 5, Mazda 5, Used Mazda



Mazda 5 2.0A Sunroof

\$72,888

\$8,860 /yr

29-Jul-2016

1,998 cc

79,000 km

MPV

Available

AA Trust Certified Quality Pre-Owned Vehicle! Ownership Is 1 As Family Internal Transfer From Father To Son With Prove. Super Well Maintan By Owner! Accident Free! The Popular All Rounder MPV That It...

AA Trust Automobile

Posted: 25-Jun-2018 Tags: 2016 Mazda 5, 2016 mazda 5, Mazda 5, mazda 5, Mazda 5, Used Mazda

Car Buying

Car Selling

Car Ownership

Buying a pre-owned car, but unsure of its condition?

Car Aftermarket

On The Move

Lifestyle

Car, STA Car Evaluation



Mazda 5 2.0A Sunroof

\$82,800

\$9,700 /yr

30-Nov-2016

1,998 cc

40,600 km

MPV

Available

2 Years Mazda Extended Warranty Program Available. Genuine Mileage & Full Service History! Purchase With A Peace Of Mind From Eurikars Pre-Owned Central! The Most Affordable MPV Family Car With Generous...

Eurikars Pte Owned

Posted: 22-Jun-2018 Tags: 2016 Mazda 5, 2016 mazda 5, Mazda 5, mazda 5, Mazda 5, Used Mazda



Mazda 5 2.0A Sunroof

\$81,800

\$9,460 /yr

28-Dec-2016

1,998 cc

35,000 km

MPV

Available

Low Interest From 1.99%, In House Loan Available. Very Low Mileage, 1 Owner Only! Super Well Maintained/Tip Top Condition With Sunroof. Extended Warranty Provided. Buy It From Us With A Peace Of Mind...

Dickson Automobile

Posted: 23-May-2018 Tags: 2016 Mazda 5, 2016 mazda 5, Mazda 5, mazda 5, Mazda 5, Used Mazda

Save this search criteria, to get email alerts whenever a match is found.

Model	Price	Depreciation	Eng Date	Eng Cap	Mileage	Veh Type	Status
-------	-------	--------------	----------	---------	---------	----------	--------

For old advertisements, view Expired ads

20 results/page

Home New Cars Used Cars Sell My Car Directory Products Insurance Article Forum Resources

sgCarMart is the number one classifieds for parallel import cars, Toyota, Honda, Nissan, Mitsubishi & Infiniti. There are plenty of cars for sale, from vans, trucks, ladder cars, luxury cars, sports cars or stationwagons, SUV, MPV, hatchback, to CNG cars & DPF cars. You can also buy from a car auction, side-ut car loans, financial services, low mileage cars, car brands, carpark rates & car insurance. Find live used Mazda 5, Mazda 5 Singapore, used Mazda 5 Singapore, used Mazda 5 Singapore, used Mazda 5 Singapore or even buy used Mazda 5 Singapore. We have new car dealers, company/limited companies, authorized car dealers, and used car dealers on our site. Find new car price lists, new car launches and new car promotions. Visit our partner sites for job openings for Singapore jobs, real estate properties for sale, movies, car performance parts, car discounts, forum discussion, commercial vehicle leasing & CDE results.

All prices and other information displayed on sgCarMart.com are gathered from sources and based on advertisements that are believed by sgCarMart.com to be reliable, but no assurance can be given that this information is accurate, complete or current. sgCarMart.com does not assume any responsibility for errors or omissions or warrant the accuracy of this information.

© 2018 sgCarMart

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	24/06/2019 14:19
Date Of Accident	23/06/2019 20:00
Exact Location Of Accident	CTE -SLE BEFORE YIO CHU KANG EXIT
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLC1327T
Insured/Policyholder	
Name Of Registered Owner	KOH BOON CHYE
NRIC No	S8127821J
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-88224747
Alternative Phone No	OFFICE-88224747

Vehicle Particulars

Manufacturer	MAZDA
Model	5

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? YES

If No, Please state action to be taken

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	MSIG INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	
Cover Note Number	

Driver

Name of Driver	KOH BOON CHYE
NRIC No	S8127821J
Date Of Birth	03/09/1981
Occupation	INDOOR
Date Of Driving Pass	07/03/2004
Driving Experience	15 YEARS AND 3 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-88224747
Fax Number	
Contact Number	OFFICE-88224747
Email Address	NOEMAIL

Address	BLK 810 TAMPINES AVE 4 #10-179 S52810
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	
Was any other material or property damaged?	NO
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

refer to attached report

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	WITH OWNER
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SDG6622G
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	PHUA HOCK SENG
NRIC/Passport Number	
Contact Number	90231030
Address	NA
	NA
Postcode	NA
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	3

Passenger 1

NAME: :
GENDER: : FEMALE


Passenger 2

NAME: : CHILD
GENDER: :

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SKZ3464H
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE HIRE
Name of Driver	KONG KOK MUN
NRIC/Passport Number	
Contact Number	93676079
Address	NA
Postcode	NA
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

SKETCH PLAN



A: SLG 1327T
B: SDC 6622G
C: SKZ 3444H.

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

of CTE

I was slowly driving on the 3rd lane towards 1PE. There's no traffic jam on the CTE all on moving mode. Suddenly the A car SKZ 3444H E brake and the accident happen. I being on the rear end (car B) SDC 6622G due can't to stop in time.

	INSURER: MSIG.
	VEHICLE: SLG 1327T.
	DOA: 23/6/19.
	CLAIM TYPE: OD
	WORKSHOP: KFS.

DECLARATION

I/We declare the foregoing particulars are true in every respect.


 Policyholder's Signature
 Date & Time: 0233 pm 24/06/19


 Driver's Signature
 (If driver is not the policyholder)
 Date & Time: 0233 pm 24/06/19


 Reporting Centre Personnel's Signature
 Name:
 NRIC/FIN No.:

Kan Fook Sing Motor Workshop
61 Defu Lane 12
539147

Claim Reference:

Assessment number: KFSA100120

Version: 1810

Date calculated: 27/06/2019 2:11 PM

Full Report

Registration: SLC1327T

Printed: 27/06/2019 2:11 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	MSIG Insurance (Singapore) Pte Ltd
Printed by:	Ryan Kan	Currency:	SGD
Claim Reference:		Date of Incident:	23/06/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	MAZDA
Model:	5 (CW/HF)
Sub Model:	BASE MODEL
Model Sheet Number:	36 88 01
Registration:	SLC1327T
VIN number:	
Odometer:	

Model Specs

FROM 02/2016	AIR CONDITIONING	REMOTE CENTRAL LOCK	XENON HEADLAMPS
FOG LAMPS	ANTI-THEFT ALARM	2.0 LTR 106/110KW	AUTO GEARBOX 5 SPEED
START & STOP SYSTEM	ABS	CRUISE CONTROL	WHEELS 6.5J X 16
SILL EXTENSION	TWO COAT METALLIC	PREPARE OFF VEHICLE	

Steve (LKK)
8322 8813

OD - Not Authorise (Revert)
EX (ent) - TBA

10 days
LKK P/P
Ry bel SM


11/7/19

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Kan Fook Sing Motor Workshop
61 Defu Lane 12
539147

Claim Reference:
Assessment number: KFSA100120
Version: 1810
Date calculated: 27/06/2019 2:11 PM

Full Report
Registration: SLC1327T
Printed: 27/06/2019 2:11 PM


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

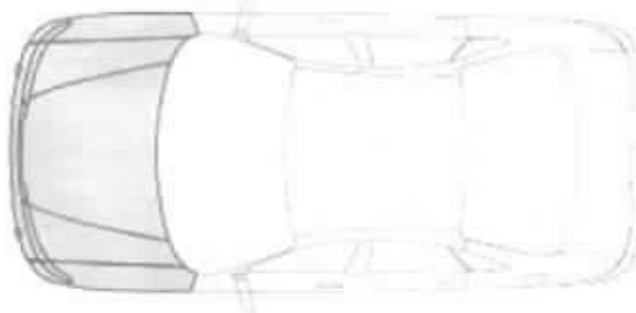

Labour

Code	Description	Time Base 10 WU/h	Price = 50.00 SGD/h	
			WU	Price SGD
S0201X-R-X	RENEW COMPLETE FRONT BUMPER. INCLUDES: BUMPER AND CROSS MEMBER R +R ATTACHED PARTS OF THE BUMPER ASSEMBLE		13.0	65.00
S0601B-R-X)	RENEW L/FRT WING (BUMPER REMOVED) INCLUDES: WHEEL HOUSE SHELL, L/HEADLAMP, AND ALL NECESSARY TRIMS REMOVE AND REFIT		6.0	30.00
S0601A-R-X)	RENEW R/FRT WING (BUMPER REMOVED) INCLUDES: WHEEL HOUSE SHELL, R/HEADLAMP, AND ALL NECESSARY TRIMS REMOVE AND REFIT		6.0	30.00
T0301Z-R-X)	R + R BOTH HEADLAMPS (BUMPER REMOVED)		4.0	20.00

Kan Fook Sing Motor Workshop
61 Defu Lane 12
539147

Claim Reference:

Assessment number: KFSA100120

Version: 1810

Date calculated: 27/06/2019 2:11 PM

Full Report

Registration: SLC1327T

Printed: 27/06/2019 2:11 PM

Code	Description	WU	Price SGD
S0612X-R-X)	INCLUDES: ADJUST HEADLAMPS R + R FRONT PANEL (BUMPER CPL AND HEADLAMP REMOVED)	12.0	60.00
	INCLUDES: BONNET LOCK REMOVE AND REFIT		
NO NUMBER	R + R BONNET STAY	1.0	5.00
S0503X-R-X	RENEW BONNET	6.0	30.00
	INCLUDES: R + R BONNET, STRAIGHTEN AND ADJUST BONNET, CONVERT ATTACHED PARTS		
S0504B-R-X)	RENEW LEFT BONNET HINGE (BONNET REMOVED)	1.0	5.00
S0504A-R-X)	RENEW RIGHT BONNET HINGE (BONNET REMOVED)	1.0	5.00
S0509X-R-X	R + R BONNET CABLE	5.0	25.00
S1001B-R-X)	R + R L/F DOOR	3.0	15.00
S1001A-R-X)	R + R R/F DOOR	3.0	15.00
S0708A-R-X)	R + R INSTRUMENT PANEL	24.0	120.00
S2206X-R-X)	R + R AIRBAG CONTROL UNIT	2.0	10.00
S1702Z-R-X	REMOVE AND REFIT L + R A-PILLAR TRIM	2.0	10.00
S1703B-R-X	R + R LEFT B-PILLAR LOWER TRIM	2.0	10.00
S1703A-R-X	R + R R/LOWER B-PILLAR TRIM	2.0	10.00
G0501X-R-X	R + R BATTERY	3.0	15.00
AC122X-R-X	DRAIN-REFILL COOLENT LIQUID	5.0	25.00
E0204X-R-X)	R + R FAN COWL	1.0	5.00
E0209X-R-X)	RENEW FAN SHROUD (FAN REMOVED)	1.0	5.00
F0105A-R-X	R + R AIR CLEANER	3.0	15.00
E0301X-R-X)	R + R UPPER RADIATOR HOSE	2.0	10.00
E0302X-R-X)	R + R LOWER RADIATOR HOSE	3.0	15.00
F0101X-R-X)	R + R INTAKE MANIFOLD	9.0	45.00
F0107F-R-X)	R + R THROTTLE VALVE HOUSING ADD	3.0	15.00
B0605X-R-X)	R + R GEARBOX SUPPORT	6.0	30.00
B0605A-R-X)	R + R R/ENGINE MOUNTING	7.0	35.00
U0004X-R-X	DRAIN + REFILL AIR CONDITIONING	7.0	35.00
NO NUMBER	R + R REFRIGERANT PIPE	5.0	25.00
NO NUMBER	R + R REFRIGERANT PIPE	5.0	25.00
U0705X-R-X)	R + R PRESSURE PIPE	5.0	25.00
U0707X-R-X)	R + R CONDENSER	6.0	30.00
N0105X-R-X	R + R STEERING COLUMN	9.0	45.00
	INCLUDES: R + R STEERING WHEEL, COMBI- SWITCH AND IGNITION LOCK		

Kan Fook Sing Motor Workshop
61 Defu Lane 12
539147

Claim Reference:

Assessment number: KFSA100120

Version: 1810

Date calculated: 27/06/2019 2:11 PM

Full Report

Registration: SLC1327T

Printed: 27/06/2019 2:11 PM

Labour Cost	Hrs	WU	
Panel / Mechanical Labour	17.30	173.0	865.00
Total of Labour			865.00

Paint

Paint Work	SYSTEM AZT	Time Basis 10WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	FRT BUMPER SUPPORT SURFACE PAINT	4.0 ✓
	BONNET NEW PART PAINTING	20.0 ✓
	L/F WING NEW PART PAINTING	11.0 ✓
	R/F WING NEW PART PAINTING	11.0 ✓
	LOCK CARR CTR SUPP SURFACE PAINT	4.0 ✓
	FRONT COVER PANEL SURFACE PAINT	4.0 X
	FRONT BUMPER NEW PART PAINT K1R	11.0 ✓
	LEFT FRONT DOOR SURFACE PAINT	8.0 ✓
	RIGHT FRONT DOOR SURFACE PAINT	8.0 ✓

Paint Material Per Part

Code	Description	Price SGD
0340	FRT BUMPER SUPPORT SURFACE PAINT	2.99 ✓
0471	BONNET NEW PART PAINTING	61.40 ✓
0741	L/F WING NEW PART PAINTING	23.74 ✓
0742	R/F WING NEW PART PAINTING	23.74 ✓
1018	LOCK CARR CTR SUPP SURFACE PAINT	1.49 ✓
1019	FRONT COVER PANEL SURFACE PAINT	1.00 ✓
0281	FRONT BUMPER NEW PART PAINT K1R	53.14 ✓
1481	LEFT FRONT DOOR SURFACE PAINT	23.16 ✓
1482	RIGHT FRONT DOOR SURFACE PAINT	23.16 ✓

Labour Cost - Paint	Hrs	WU	Price SGD
Factor	50.00 SGD/h		
Time Paint		81.0	
Preparation Main Work Metal	2.50	25.0	125.00 ✓
Preparation Comp. Work Plastic	0.50	5.0	25.00 ✓
Total	10 WU/h	111.0	555.00 ✓

Kan Fook Sing Motor Workshop

61 Defu Lane 12

539147

Claim Reference:

Assessment number: KFSA100120

Version: 1810

Date calculated: 27/06/2019 2:11 PM

Full Report

Registration: SLC1327T

Printed: 27/06/2019 2:11 PM

Material Cost - Paint

New Part Painting	
New Part Painting - Plastic K1R	
Surface-/Blend Paint	
Material-constant Metal Preparation	
Material-constant Plastic	
Total	

Price SGD
108.88
53.14
51.80
28.60
9.00
251.42

Spare Parts

				prices as at 2015-06-01/01	
Code	Description	Part Number	Supplier		Price SGD
0281	FRONT BUMPER	CG1650031BBB	DR		400.00 ✓
0295	FRT CTR BUMPER BRKT	C51350111	DR		70.00 X
0296	MOUNTING CLAMP	FD0168AC3	DR		25.00 X
0317	L/F BUMPER BRACKET	C513500U1B	DR		12 13.00 ✓
0318	R/F BUMPER BRACKET	C513500T1B	DR		12 13.00 ✓
0319	L/F INN BUMPER BRKT	C51350161B	DR		16 25.00 ✓
0320	R/F INN BUMPER BRKT	C51350151A	DR		25.00 X
0340	FRT BUMPER SUPPORT	C51350070A	DR		200.00 ✓
0347	L/F BUMPER COVER	C51350C21	DR		40.00 X
0349	FRT BUMPER GRILLE	C513501T0D	DR		240.00 ✓
0414	R/RAD GRILLE MNTG	C513501U1	DR		85.00 X
0415	L/RAD GRILLE MNTG	C513501V1	DR		85.00 X
0433	MANUFACTURER BADGE	C29151731	DR		18 0.00 ✓
0471	BONNET	C5Y35231X	DR		450.00 ✓
0475	L/BONNET HINGE	C51352420	DR		25.00 ✓
0476	R/BONNET HINGE	C51352410	DR		25.00 ✓
0481	BONNET INSULATION	C51356681	DR		55 50.00 ✓
0485	INSULATION MNTG KIT	TD1156694	DR		25.00 ✓
0493	BONNET LOCK	BBM456620A	DR		90 75.00 ✓
0495	BONNET STAY	BBM456651	DR		25.00
0500	BONNET OPENER	C51356720	DR		25.00
0529	FRONT BONNET SEAL	BBM456750	DR		28.00
0561	L/F HEADLAMP	C51451041C	DR		450.00 ✓
0562	R/F HEADLAMP	C51451031C	DR		450.00 ✓
0741	L/F WING	CG3752211	DR		125.00 ✓
0742	R/F WING	CG3752111	DR		125.00 ✓
0789	L/F WING CLAMP KIT	907200612	DR		12.50 25.00 ✓
0790	R/F WING CLAMP KIT	907200612	DR		12.50 25.00 ✓
0841	L/F WHEELHOUSE COVER	C51356140B	DR		75.00
0842	R/F WHEELHOUSE COVER	C51356130B	DR		75.00

Kan Fook Sing Motor Workshop

61 Defu Lane 12

539147

Claim Reference:

Assessment number: KFSA100120

Version: 1810

Date calculated: 27/06/2019 2:11 PM

Full Report

Registration: SLC1327T

Printed: 27/06/2019 2:11 PM

Code	Description	Part Number	Supplier	Price SGD
1009	FRONT PANEL	C51353110G	DR	210 ✓ 220.00
1018	LOCK CARR CTR SUPP	C5135215Y	DD	✓ 18.00
1019	FRONT COVER PANEL	C51356078	CRU X NN	110.00
4323	AIRBAG SYSTEM	REPLACE	APC	1250 ✓ 1,350.00
4325	PASSENGER AIRBAG	C51357K50A	DR	✓ 1,380.00
4331	INSTRUMENT PANEL	C51360400E	DR	✓ 700.00
4465	CONDENSER	C51361480B	DD	290 300.00
4481	COMPR/CONDENSER HOSE	C51361461A	? X MI	130.00
4482	COMPR/EVAP HOSE	C51361462	? X MI	130.00
4483	COND/EVAPORATOR HOSE	C5136146X	? X MI	110.00
4661	L/F SEAT BELT	C23557L90C10	Sumat	680 ✓ 650.00
4662	R/F SEAT BELT	C23557L30C10		680 ✓ 650.00
7437	FRONT AIRBAG SENSOR	BBM457K1X	X APC MI	220.00
7440	AIRBAG CONTROL UNIT	C51357K30B	X APC MI	500.00
7447	AIRBAG SPRING	BBP366CS0A	APC	✓ 110.00
7761	RADIATOR	LFY915SB0	DD	100 ✓ 300.00
7764	RADIATOR SHROUD CPL	LFDV15025B	DR	✓ 480.00
7773	L/UPP RADIATOR HOSE	LFDV1518X	X CRU	50 85.00
7774	R/LWR RADIATOR HOSE	LFDV1518Y	X MI	50.00
7944	VALVE COVER	LFBL102F0A	X MI	320.00
8221	INTAKE MANIFOLD	LF2L13100D	DR	✓ 380.00
8371	FILTER OUTLET HOSE	LFBL13221A	X CRU MI	48.00
8386	FILTER INLET HOSE	LFDV13201C	X MI	60.00
8395	FILTER ELEMENT	LFBL13Z409A	CRU	✓ 32.00
8401	UPP AIR FILTER COVER	LFBL13Z01	DR	✓ 45.00
8402	AIR FILTER HOUSING	LFBL13Z0X	DR	✓ 65.00
8631	R/RUBBER BUSH	BBM439060D	X MI	125.00
8951	GEARBOX SUPPORT	BP4N39010D	X MI	55.00
8952	GEARBOX RUBBER MNTG	BP4S39040B	X MI	110.00
9629	BATTERY	LFBL185209D	X MI	0.00
9631	BATTERY BOX COVER	LFBL1859XC	X DR MI	85.00
9663	MODULE BOX COVER	C5976676Y	DR	35.00 ✓
1000	FRT BUMP ABSORBER	FBA	DR	38.00 ✓
1001	BATTERY	BAT	X MI	168.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	12,358.00
Addition(+10.00%)	1,235.80
Total	13,593.80

Kan Fook Sing Motor Workshop
61 Defu Lane 12
539147

Claim Reference:
 Assessment number: KFSA100120
 Version: 1810
 Date calculated: 27/06/2019 2:11 PM

Full Report
 Registration: SLC1327T
 Printed: 27/06/2019 2:11 PM

Extras

Code	Description	Price SGD
1002	FRT NUMPER PLATE FNP <i>OR</i>	30.00*
1003	AIR CON GAS ACC <i>MC</i>	100.00*
	Total Extras	130.00

Final Calculation

	SGD	SGD
Parts	12,358.00	
Addition(+10.00%)	1,235.80	
Total Parts		13,593.80
Labour Time Base 10 WU/h		
Total 173.0 WU X 50.00 SGD/h	865.00 <i>745</i>	
Total of Labour		865.00
Total Of Extras		130.00
Paint Work Time Base 10 WU/h		
Labour Cost 111.0 WU X 50.00 SGD/h	555.00 <i>535</i>	
Material Cost	251.42 <i>250.02</i>	
Total Paint Including Material		806.42
Repair Cost Excludes GST		15,395.22
GST (+7.0%)		1,077.67
Repair Cost Included GST	<i>17478.49</i>	16,472.89
Deductions (Excludes GST)		
Deduction For Excess	-500.00	
Total Of Deductions (Excludes GST)		-500.00
Grand Total Excludes GST		14,895.22
GST (+7.0%)		1,042.67
Grand Total Included GST		15,937.89

Kan Fook Sing Motor Workshop
61 Defu Lane 12
539147

Claim Reference:

Assessment number: KFSA100120

Version: 1810

Date calculated: 27/06/2019 2:11 PM

Full Report

Registration: SLC1327T

Printed: 27/06/2019 2:11 PM

Comments

* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

REPAIR DETAILS

SLC132TT Supplementary

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 23 Jul 2019)
 Parts: M1-MPV MAZDA 5 2.0 SkyActiv SP (A) (Catalogue:Merimen Singapore 1.0)
 Labour: Repairer's (Price-denominated Standard List)
 Print Code: Kan Fook Sing Motor Workshop/SLC132TT/23/07/2019 14:19
 Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
 Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*FRT BUMPER CLAMP KIT / ARC	0.00	0.00	*25.00 F ✓
2	1		*AIR INTAKE GRILLE / OR	0.00	0.00	*70.00 F ✓
3	1		*WATER HOSE / TAI	0.00	0.00	*20.00 F ✓
4	1		*L/RADIATOR SEAL / MIS	0.00	0.00	*18.00 F ✓
5	1		*R/RADIATOR SEAL / MIS	0.00	0.00	*18.00 F ✓
6	1		*THROTTLE BODY / OR	0.00	0.00	*350.00 F ✓
7	1		*INTAKE AIR SENSOR / OR	0.00	0.00	*95.00 F ✓

F=Franchise part.

Sub Total (S\$)	596.00
+ Margin on L,N Items 10.00% (S\$)	59.60
Total Parts (S\$)	655.60

Kan Fook Sing Motor Workshop/SLC132TT/23/07/2019 14:19. Not valid without Reference section.
 Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No	Qty	Particulars	Amount
<u>Miscellaneous Items</u>			
1	1	CALIBRATE AIRBAG ECU / ARC	350.00 ✓
Sub Total (S\$)			350.00

Estimates on Labour

There are no labour items selected.

Kan Fook Sing Motor Workshop/SLC132TT/23/07/2019 14:19. Not valid without Reference section.
 Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

简福星摩哆工廠
KAN FOOK SING MOTOR WORKSHOP
61 DEFU LANE 12
SINGAPORE 539147
TEL: 67479560, 68582126, 68584361
FAX: 67481006, 62818428

MSIG INSURANCE (SINGAPORE) PTE LTD
4 SHENTON WAY #21-01
SGX CENTRE 2
SINGAPORE 068807

INVOICE NO : TEST
DATE : 20-07-2019

VEHICLE NO. : SLC1327T
ACCIDENT DATE : 23-06-2019 20:00
THIRD PARTY REF. : SDG6622G

ATTN: MOTOR CLAIMS DEPT.

INVOICE COST OF REPAIRS TO VEHICLE SLC1327T MAZDA 5

QTY	PARTS DESCRIPTION	AMOUNT (SG\$)
1	STEERING AIR BAG	1250.00—
1	STEERING AIR BAG WIRE	110.00—
1	DASHBOARD	700.00—
1	DASHBOARD AIR BAG	1380.00—
2	SEAT BELT @\$680	1360.00—
1	FRONT BONNET	450.00—
1	FRONT BONNET LOCK	90.00—
1	FRONT BONNET INSULATOR	55.00—
10	FRONT BONNET INSULATOR CLIP @\$2.50	25.00—
2	FRONT BONNET HINGES @\$25	50.00—
1	FRONT SUPPORT PANEL	210.00—
1	FRONT BRACE PANEL	18.00—
2	FRONT HEADLAMP @\$450	900.00—
2	FRONT HEADLAMP LOWER BRACKET LH	16.00—
2	FRONT FENDER @\$125	250.00—
10	FRONT FENDER SHIELD CLIP @\$2.50	25.00—
1	FRONT BUMPER	400.00—
1	FRONT BUMPER GRILLE	240.00—
1	FRONT BUMPER FOAM	38.00—
1	FRONT BUMPER REINFORCEMENT	200.00—
2	FRONT BUMPER SIDE RETAINER @\$12	24.00—
10	FRONT BUMPER CLIP @\$2.50	25.00*

1/3

简福星摩哆工廠
 KAN FOOK SING MOTOR WORKSHOP
 61 DEFU LANE 12
 SINGAPORE 539147
 TEL: 67479560, 68582126, 68584361
 FAX: 67481006, 62818428

VEHICLE NO. : SLC1327T
 ACCIDENT DATE : 23-06-2019 20:00
 THIRD PARTY REF. : SDG6622G

QTY	PARTS DESCRIPTION	AMOUNT (SG\$)
1	AIR CON CONDENSER	290.00
1	RADIATOR	160.00
1	RADIATOR TOP HOSE	50.00
1	AIR CLEANER BOX TOP	45.00
1	AIR CLEANER BOX LOWER	65.00
1	AIR FILTER	32.00
1	FUSES BOX TOP COVER	35.00
2	AIR CON SIDE GARNISH @\$18.00	36.00
1	INLET MANIFOLD SENSOR	95.00
1	FRONT GRILLE EMBLEM	18.00
1	INLET MANIFOLD	380.00
1	BY-PASS HOSE	20.00
1	THROTTLE BODY	350.00
1	FAN ASSY	480.00
1	FRONT BUMPER AIR INTAKE	70.00
		9,942.00
ADD 10 %		994.20
TOTAL (A)		10,936.20

SPECIAL NETT ITEMS

1	FRONT NUMBER PLATE	30.00
1	AIR CON COOLANT	100.00
1	TO PROGRAMME/CALIBRATE AIR BAG ECU	350.00
TOTAL (C)		480.00

LABOUR CHARGES

1	TOTAL PANEL/MECHANICAL LABOUR	745.00
---	-------------------------------	--------

2/3

简福星摩哆工廠
 KAN FOOK SING MOTOR WORKSHOP
 81 DEFU LANE 12
 SINGAPORE 539147
 TEL: 67479560, 68582126, 68584361
 FAX: 67481006, 62818428

VEHICLE NO. : SLC1327T
 ACCIDENT DATE : 23-06-2019 20:00
 THIRD PARTY REF. : SDG6622G

<u>QTY</u>	<u>PARTS DESCRIPTION</u>	<u>AMOUNT (SG\$)</u>
1	TOTAL PAINTWORK	535.00
1	TOTAL PAINT/MATERIAL	250.42
TOTAL (D)		1530.42
TOTAL REPAIR COST :		12,946.62
G S T % :		857.26
EXCESS AMOUNT :		700.00
INVOICE AMOUNT :		13,103.88

3/3



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:
48A SUNGEI KADUT AVE SINGAPORE 729672
TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

WINDSCREEN GLASS
Dept Direct: 6417 9391 / 6745 3833



Dept Direct: 6308 9818

Dept Direct: 6308 9611

Dept Direct: 6417 9292



Dept Direct: 6417 9796

Dept Direct: 6417 9795

Dept Direct: 6417 9796

Dept Direct: 6417 9795

Wiper blade: NWSB (Nippon Wiper blade), Sliper (Made in Korea),
Forch (Made in Germany)
Spark plug: Nippon Denso, NGK (Made in Japan)

KAN FOOK SING MOTOR WORKSHOP
NO.61 DEFULANE 12

SINGAPORE
TEL : 67479560 FAX : 67481006
ATTN : / TAN

TAX INVOICE AR201907-05775
DATE 10/07/2019
CUSTOMER ID KAN001
VEH REG. NO. SLC13271
TERMS 30 days
PO NO.
PAGE NO. Page 1 of 1
CURR. SGI

SQ	STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
1	C513-50-0T1B MZ5 CW	RETAINER.F BUMPER RH	U1 MZ-A26-J	1	12.00	12.00
2	C513-50-0U1B MZ5 CW	RETAINER.F BUMPER LH	U1 MZ-A32-B	1	12.00	12.00
3	C513-50-161B MZ5 CW	BRACKET.H/LAMP LH	U1 MZ-A32-A	1	16.00	16.00
4	C513-56-681 MZ5 CW	INSULATOR.BONNET	U1 MZ-A106-SD	1	55.00	55.00
5	PE02-18-211 CW GL BN DK ND KF	SENSOR.INLET MANIFOLD	U1 MZ-C3-B1	1	95.00	95.00
6	C291-51-731 MZ5 CW 09-	MASCOT.F GRILLE	U1 MZ-A23-N	1	18.00	18.00

SUB-TOTAL : 208.0
ADD GST 7.00 % 14.0

E. & O.E

TOTAL AMOUNT SGD : 222.0

[E] 10/07/2019 3:42:37P

[P] 10/07/2019 3:44:29PM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive : KOW



* AR201907-05775 *

This is computer generated document.
No signature is required.

ORIGINAL

Goods Received in Good Order

Signature / Co Stamp / Date



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:
48A SUNGEI KADUT AVE SINGAPORE 729672
TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M



Dept Direct: 6417 9121 / 6745 9939

Dept Direct: 6305 6610

Dept Direct: 6305 3611

Dept Direct: 6417 9122

Dept Direct: 6417 9124

Dept Direct: 6417 9123

Dept Direct: 6417 9125

Dept Direct: 6417 9126

Wiper blade: NFB (Nippon Wiper blade), S&P (Made in Korea),
Forch (Made in Germany)
Spark plug: Nippon Denso, NGK (Made in Japan)

KANFOOK SING MOTOR WORKSHOP
NO.61 DEFU LANE 12

SINGAPORE
TEL : 67479560 FAX : 67481006
ATTN : TAN

TAX INVOICE : AR201907-04576
DATE : 08/07/2019
CUSTOMER ID : KAN001
VEH REG. NO. : SLC1327T
TERMS : 30 d's
PO NO. :
PAGE NO. : Page 1 of 1
CURR : SGD

SQ	STOCKID	DESCRIPTION	StkLoc	QTY	UPRICE	AMOUNT
1.	C513-60400E MZ5CW	DASHBOARD	PA PL4-G1-04	1	700.00	700.00

SUB-TOTAL : 700.00
ADD GST 7.00 % 49.00

E. & OE

TOTAL AMOUNT SGD : 749.00

[P] 08/07/2019 17:23:48

[E] 08/07/2019 5:17:23PM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive: KOW

This is computer generated document.

No signature is required.



* A R 2 0 1 9 0 7 - 0 4 5 7 6 *

Goods Received in Good Order

Signature / Co Stamp / Date

ORIGINAL



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:
48A SUNGEI KADUT AVE SINGAPORE 729672
TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

SHIMADZU BLADE
Dept Direct: 6417 9791 / 6745 9888



Dept Direct: 6305 5510

Dept Direct: 6305 5511

Dept Direct: 6417 9792



Dept Direct: 6417 9794

Dept Direct: 6417 9795

Dept Direct: 6417 9796

Dept Direct: 6417 9797

Wiper blade: NWB (Nippon Wiper blade), Sliper (Made in Korea),
Forch (Made in Germany)
Spark plug: Nippon Denso, NGK (Made in Japan)

KANFOOK SING MOTOR WORKSHOP
NO.61 DEFU LANE 12

SINGAPORE
TEL: 67479560 FAX: 67481006
ATTN: TAN

TAX INVOICE : AR201907-04580
DATE : 08/07/2019
CUSTOMER ID : KAN001
VEH REG. NO. : SLC1327T
TERMS : 30 days
PO NO. :
PAGE NO. : Page 1 of 2
CURR : SGD

SQ	STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
1.	C5Y3-52-31X MZ5 CW	F.BONNET	CC C21-O1-2A	1	450.00	450.00
2.	C513-52-410 MZ5 2.0 11--	HINGE,BONNET RH	CC C21-M1-8BI	1	25.00	25.00
3.	C513-52-420 MZ5 2.0 11--	HINGE,BONNET LH	CC C21-M1-7BI	1	25.00	25.00
4.	C513-52-15Y MZ5 CW	STAY,LOCK	CC C21-M1-7BI	1	18.00	18.00
5.	C513-51-0K0F MZ5 CW	F.H LAMP RH	CC C21-I1-4B	1	450.00	450.00
6.	C513-51-0L0F MZ5 CW	F.H LAMP LH	CC C21-I1-6B	1	450.00	450.00
7.	CG37-52-111 MZ5 CW	F.FENDER RH (W SUNROOF)	CC C21-S1-3A	1	125.00	125.00

CONTINUE NEXT PAGE

[P] 08/07/2019 17:38:12

[E] 08/07/2019 5:19:50PM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

ORIGINAL



日美汽車私人有限公司 JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:
48A SUNGEI KADUT AVE SINGAPORE 729572
TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M



Dept Direct: 6417 9791 / 6748 9820



Dept Direct: 6417 9794



Dept Direct: 6363 9818



Dept Direct: 6417 9795



Dept Direct: 6363 9819



Dept Direct: 6417 9796



Dept Direct: 6363 9811



Dept Direct: 6417 9796



Dept Direct: 6417 9728



Dept Direct: 6417 9722



Dept Direct: 6417 9722



Dept Direct: 6417 9722

Wiper blade: NNB (Nippon Wiper blade), Sliper (Made in Korea)
Forch (Made in Germany)
Spark plug: Nippon Denso, NGK (Made in Japan)

KANFOOK SING MOTOR WORKSHOP
NO.61 DEFU LANE 12

SINGAPORE
TEL: 67479560 FAX: 67481006
ATTN: TAN

TAX INVOICE : AR201907-04580
DATE : 08/07/2019
CUSTOMER ID : KAN001
VEH REG. NO. : SLC1327T
TERMS : 30 days
PO NO. :
PAGE NO. : Page 2 of 2
CURR : SGD

SQ	STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
8.	CG37-52-2Y1 MZ5 CW	FFENDER LH (W SUNROOF)	CC C21-S1-3B	1	125.00	125.00
9.	G513-56-130B MZ5 CW	FFEND-SHIELD RH	CC C21-H1-2S	1	85.00	85.00
10.	C513-50-111 MZ5 CW	FOAM.F BUMPER	CC C21-N1-5B	1	38.00	38.00

SUB-TOTAL : 1,791.00
ADD GST 7.00% 125.37

E & O E TOTAL AMOUNT SGD : 1,916.37

[P] 08/07/2019 17:38:12

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

[E] 08/07/2019 5:19:50PM

JAE Auto Pte. Ltd.

Sales Executive: KOW

This is computer generated document.
No signature is required.



AR201907-04580

Goods Received in Good Order

Signature / Co Stamp / Date

ORIGINAL



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672

TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

=====
KAN FOOK SING MOTOR WORKSHOP
NO.61 DEFU LANE 12

SINGAPORE

TEL : 67479560 FAX : 67481006

ATTN : TAN

WINDSHIELD GLASS
Dept Direct: 6417 8701 / 8746 9000



Dept Direct: 6308 9610



Dept Direct: 6417 8704



Dept Direct: 6308 9610



Dept Direct: 6417 8705



Dept Direct: 6306 9611



Dept Direct: 6417 8706



Dept Direct: 6417 8707



Dept Direct: 6417 8708



Dept Direct: 6417 8704



Dept Direct: 6417 8705



Dept Direct: 6417 8705



Dept Direct: 6417 8706



Dept Direct: 6417 8707



Dept Direct: 6417 8708

Wiper blade: NWB (Nippon Wiper blade), Siiper (Made in Korea),

Forch (Made in Germany)

Spark plug: Nippon Denso, NGK (Made in Japan)

TAX INVOICE : AR201907-0463
DATE : 09/07/2019
CUSTOMER ID : KAN00
VEH REG. NO. : SLC13277
TERMS : 30 day
PO NO. :
PAGE NO. : Page 1 of 1
CURR. : SGI

SQ	STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
1	BBS9-56-620A MZ5 CW/MZ3 BL	LOCK BONNET W/BURGLAR	U1 SUPPLIER	1	90.00	90.00
2	C513-53-110D MZ5 CW	F.SUPPORT PANEL	U1 SUPPLIER	1	210.00	210.00
3	C513-50-070A MZ5 CW	F REINFORCEMENT	U1 MZ-L1	1	200.00	200.00
4	C513-57-K00A MZ5 CW	AIR/BAG STEERING	U1 SUPPLIER	1	1250.00	1,250.00
5	C513-57-K50A MZ5 CW	AIR/BAG F PASSENGER	U1 SUPPLIER	1	1380.00	1,380.00
6	C235-57-L30C10 MZ5 08--	BELT F SEAT RH (TINTED TOP)	U1 SUPPLIER	1	680.00	680.00
7	C235-57-L90C10 MZ5 08--	BELT F SEAT LH	U1 SUPPLIER	1	680.00	680.00

CONTINUE NEXT PAGE

[P] 09/07/2019 9:15:51AM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

ORIGINAL

[E] 09/07/2019 9:09:58AM



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672

TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

KAN FOOK SING MOTOR WORKSHOP
NO.61 DEFU LANE 12

SINGAPORE

TEL: 67479560 FAX: 67481006

ATTN: TAN

WIPER BLADE
Dept Direct: 6417 9791 / 9745 9906



Wiper blade: NWB (Nippon Wiper blade), Siliper (Made in Korea),
Forch (Made in Germany)

Spark plug: Nippon Denso, NGK (Made in Japan)

TAX INVOICE : AR201907-04631
DATE : 09/07/2019
CUSTOMER ID : KAN001
VEH REG. NO. : SLC13271
TERMS : 30 days
PO NO. :
PAGE NO. : Page 2 of 2
CURR. : SGD

SQ STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
BBP3-66-CS0A	CLOCK SPRING.STG A/BAG	U1	1	110.00	110.00
MZ3 BL /MZ5 CW		MZ-A26-L			

SUB-TOTAL : 4,600.00
ADD GST 7.00 % 322.00

E. & O.E TOTAL AMOUNT SGD : 4,922.00

[P] 09/07/2019 9:15:51AM

[E] 09/07/2019 9:09:58AM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive : KOW

This is computer generated document.

No signature is required.



* A R 2 0 1 9 0 7 - 0 4 6 3 1 *

ORIGINAL

Goods Received in Good Order

Signature / Co Stamp / Date



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 301B UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:
48A SUNGEI KADUT AVE SINGAPORE 729672
TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

KAN FOOK SING MOTOR WORKSHOP
NO.61 DEFU LANE 12

SINGAPORE
TEL : 67479560 FAX : 67481006
ATTN : TAN

WINDSHIELD GLASS
Dept Direct: 6417 8791 / 6745 9039



Dept Direct: 6308 9610

Dept Direct: 6308 9611

Dept Direct: 6417 8792



Dept Direct: 6417 8794

Dept Direct: 6417 8795

Dept Direct: 6417 8796

Dept Direct: 6417 8797

Wiper blade: NWB (Nippon Wiper blade), Silper (Made in Korea),
Forch (Made in Germany)

Spark plug: Nippon Denso, NGK (Made in Japan)

TAX INVOICE : AR201907-04650
DATE : 09/07/2019
CUSTOMER ID : KAN00:
VEH REG. NO. : SLC13271
TERMS : 30 day
PO NO. :
PAGE NO. : Page 1 of :
CURR. : SGD

8Q STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
1. C513-50-031BBB MZ5 CW	F BUMPER	U1 SUPPLIER	1	400.00	400.00

SUB-TOTAL : 400.00
ADD GST 7.00 % 28.00

E. & O.E TOTAL AMOUNT SGD : 428.00

[P] 09/07/2019 9:23:21AM

[E] 09/07/2019 9:22:54AM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive : KOW

This is computer generated document.

No signature is required.



AR201907-04650

ORIGINAL

Goods Received in-Good Order

[Signature]

Signature / Co Stamp / Date



日美汽車私人有限公司

JAE AUTO PTE LTD

Bik 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672
TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-D119201-3 CO. REG. NO.: 199307741M

WINDSHIELD GLASS
Dept Direct: 6417 0791 / 6745 5333



Dept Direct: 6305 9010

Dept Direct: 6305 9011

Dept Direct: 6417 0790



Dept Direct: 6417 0794

Dept Direct: 6417 0795

Dept Direct: 6417 0796

Dept Direct: 6417 0797

Wiper blade: NWB (Nippon Wiper blade), Siliper (Made in Korea),

Forch (Made in Germany)

Spark plug: Nippon Denso, NGK (Made in Japan)

=====

KAN FOOK SING MOTOR WORKSHOP
NO.61 DEFU LANE 12

SINGAPORE

TEL : 67479560 FAX : 67481006

ATTN : TAN

TAX INVOICE : AR201907-05106

DATE : 09/07/2019

CUSTOMER ID : KAN001

VEH REG. NO. : SLC13271

TERMS : 30 days

PO NO. :

PAGE NO. : Page 1 of 2

CURR. : SGD

Q STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
1. LFDV-15-26Y CW	HOSE	U1 MZ-A33-C	1	20.00	20.00
2. PE01-13-100A CX5/MZ5 CW/BIANTE 12-	INLET MANIFOLD	U1 MZ-A3	1	380.00	380.00
3. PE01-13-640B MZ6 GJ-GL/CX5/CW	THROTTLE BODY (2.0)	U1 U1L1-CEN-D4	1	350.00	350.00
4. PE07-13-3A0A KE/GJ-GL/CW/BIANTE	AIR FILTER (MZ BM 2.0L)	U1 MZ-A22	1	32.00	32.00
5. PE25-13-3AX MZ5 CW/BIANTE 2012-PI	AIR CLEANER COVER (TOP)	U1 MZ-A16	1	45.00	45.00
6. PE25-13-3AY MZ5 CW/BIANTE 2012-PI	HOUSING A/CLEANER LOWER	U1 MZ-A4	1	65.00	65.00
7. LFDV-15-025A MZ5 CW M/T	FAN ASSY	U1 MZ-A111	1	480.00	480.00

CONTINUE NEXT PAGE

[P] 09/07/2019 3:11:00PM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

ORIGINAL

[E] 09/07/2019 3:05:02PM



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672
TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M



Sunglens Glass
Dept Direct: 6417 9791 / 6745 0333



Dept Direct: 6417 9794

Dept Direct: 6417 9795

Dept Direct: 6417 9796

Dept Direct: 6417 9793

Wiper blade: HVB (Nippon Wiper blade), Silper (Made in Korea),
Forch (Made in Germany)
Spark plug: Nippon Denso, NGK (Made in Japan)

=====

KAN FOOK SING MOTOR WORKSHOP
NO.61 DEFU LANE 12

SINGAPORE
TEL : 67479560 FAX : 67481006
ATTN : TAN

TAX INVOICE : AR201907-05106
DATE : 09/07/2019
CUSTOMER ID : KAN001
VEH REG. NO. : SLC13271
TERMS : 30 days
PO NO. :
PAGE NO. : Page 2 of 2
CURR. : SGD

QTY	STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
8.	CH35-66-76Y MZ5 CW 2010	COVER FUSE BOX TOP	U1 MZ-A66-B	1	35.00	35.00
9.	PE25-15-18X MZ5 2010	HOSE UPPER	U1 MZ-A33-C	1	50.00	50.00
10.	C514-50-1T0E MZ5 CW	GRILLE F BUMPER(DARK SILVER)	U1 MZ-B53	1	240.00	240.00
11.	C513-50-7M1B/E MZ5 CW	INTAKE F BUMPER(CTR)	U1 MZ-B44	1	70.00	70.00
12.	C597-50-A23 MZ5 CW	AIR GUIDE LH INTAKE F BUMPER	U1 MZ-A36-A	1	18.00	18.00

SUB-TOTAL : 1,785.00
ADD GST 7.00 % 124.95

E & O E TOTAL AMOUNT SGD : 1,909.95

[P] 09/07/2019 3:11:00PM

[P] 09/07/2019 3:05:02PM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive : KOW

This is computer generated document.
No signature is required.



* AR201907-05106 *

ORIGINAL

Goods Received in Good Order

Signature / Co Stamp / Date



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672
TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

WINDSCREEN GLASS
Dept Direct: 6417 9791 / 6745 9239



Dept Direct: 6355 9810

Dept Direct: 6303 9611

Dept Direct: 6417 9702



Dept Direct: 6417 9704

Dept Direct: 6417 9708

Dept Direct: 6417 9706

Dept Direct: 6417 9702

Wiper blade: NWB (Nippon Wiper blade), Siliper (Made in Korea),
Forch (Made in Germany)
Spark plug: Nippon Denso, NGK (Made in Japan)

KANFOCK SING MOTOR WORKSHOP
NO.61 DEFU LANE 12

SINGAPORE
TEL : 67479560 FAX : 67481006
ATTN : TAN

TAX INVOICE : AR201907-05114
DATE : 09/07/2019
CUSTOMER ID : KAN001
VEH REG. NO. : SLC1327T
TERMS : 30 days
PO NO. :
PAGE NO. : Page 1 of 1
CURR. : SGD

SO STOCKID	DESCRIPTION	Stk Loc	QTY	U PRICE	AMOUNT
C597-50-A22	AIR GUDIE RH INTAKE F BUMPER	C21-M1-7AB	1	18.00	18.00
MZ5 CW					

SUB-TOTAL : 18.00
ADD GST 7.00 % 1.26

E. & O.E TOTAL AMOUNT SGD : 19.26

[P] 09/07/2019 15:18:10

[E] 09/07/2019 3:11:41PM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive: KOW

This is computer generated document.

No signature is required.



* AR201907-05114 *

ORIGINAL

Goods Received in Good Order

Signature / Co Stamp / Date



特 立 机 器 贸 易

MEGA POWER ENGINEERING & TRADING

Automobile Air Conditioning System Is Our Business

Head Office: 39 Genting Road Singapore 349485 Tel: 6842 3389 Fax: 6842 3373
Email: meg11089@singtel.com.sg Business Reg No 40869100W

TAX INVOICE

GST Reg# : M8-8002998-3
Invoice No. : INV 10173558
Invoice Date : 9-Jul-2019
Terms : 60DAYS
PO No. :
Vehicle No. : SLC1327T
Chassis No. :
Staff : KUN JIN

Bill To: KAN001

KAN FOOK SING MOTOR WORKSHOP
61DEFU LANE 12
SINGAPORE 539147
Attn: Account Dept

Ship To: GA1

KAN FOOK SING MOTOR WORKSHOP
61DEFU LN 12
Attn: JACKY
Tel: 91112026

Remarks:

MUST KEY IN VEHICLE NO. #
AVOID LUNCHTIME: 12.30-2PM

SLC 1327

S/NC	DESCRIPTION	MOQ	BIN	WH	QTY	PRICE	SP	TOTAL (SGD)
PO Number :	DO Number :							
1 CD-00336			2C1502-1	G1	1	290.00	—	290.00
MAZ 5 Y13 CW10 ORG COND W/DR								

Rate : 1 SGD : 1.000000 SGD

Note : Goods sold are not returnable.

All Brand New compressor sold are without warranty.

Late payment is subject to 2% interest per month.

SUB-TOTAL	290.00	SGD
DISC 0.00%	(-)	SGD
GST 7%	20.30	SGD
AMOUNT	310.30	SGD

This is a computer-generated document.

No signature is required.

Printed on: 09/07/2019 15:34:43

CUSTOMER COPY

Customer Signature & Stamp



Blk 5025, Ang Mo Kio Ind Park 2 #01-55/57 S(509526) Tel: 6482 3389 Fax: 6491 1187

No. 13 Kallu Bukit Rd 4 #01-27 Bartley Bz Centre S(417807) Tel: 6365 3369 Fax: 6365 3329

No. 5 Soon Lee St #01-26 Pioneer Point S(627507) Tel: 6252 3389 Fax: 6275 3389

No. 21 Tan Guan Rd East #01-33 Tan Guan Centre S(608609) Tel: 67653389 Fax: 6316 3464



Handwritten signature

LOCAL

Page 1 of 1

CHOP SONG HUAT

1 Kaki Bukit Avenue 6, #01-104, Auto Bay @ Kaki Bukit, Singapore 417883
Tel: (65) 6747 4366 Fax: (65) 6747 7560
No. 1, Syed Alwi Road #01-03, Song Lin Building, Singapore 207628
Tel: (65) 6294 3698 Fax: (65) 6297 0448
Reg. No. 040495/00X

No. 41730

Date 09 07. 2019

M. Kan Fook Sing

Specialize In All Types of Motor Vehicle's Radiator.

[illegible]

貨物出門恕不退換。
Goods sold are not returnable.

E. & O. E.

共銀
TOTAL

\$160	w
-------	---

Checked by

Customer Name & Address:

KAN FOOK SING MOTOR WORKSHOP
61 DEFU LANE 12
SINGAPORE 539147
**SLC1327T MZD5

INVOICE No.: A 11445

DATE: 10/7/2019

TERMS:

S/No.	DESCRIPTION	QUANTITY	UNIT PRICE	AMOUNT
1	CLIP	10	\$ 2.50	\$ 25.00
2	INSULATOR FASTENER	10	\$ 2.50	\$ 25.00
3	CLIP	10	\$ 2.50	\$ 25.00
Singapore Dollars			TOTAL	\$ 75.00
			GST 7%	\$ 5.25
			DEPOSIT	\$ -
			BALANCE	\$ 80.25

Goods Sold are not exchangeable and returnable.

All cheques should be crossed "A/C PAYEE" and made payable to LION'S AUTO TRADING PTE LTD.

for LION'S AUTO TRADING PTE LTD

Customer's Signature and Stamp

Authorized Signature

Kan Fook Sing Motor Workshop
61 Defu Lane 12
539147

Claim Reference:
Assessment number: KFSA100120
Version: 1810
Date calculated: 23/07/2019 2:26 PM

Full Report
Registration: SLC1327T
Printed: 23/07/2019 2:26 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	MSIG Insurance (Singapore) Pte Ltd
Printed by:	Patricia Kan	Currency:	SGD
Claim Reference:		Date of Incident:	23/06/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	MAZDA
Model:	5 (CW/HF)
Sub Model:	BASE MODEL
Model Sheet Number:	36 88 01
Registration:	SLC1327T
VIN number:	
Odometer:	

Model Specs

FROM 02/2016	AIR CONDITIONING	REMOTE CENTRAL LOCK	XENON HEADLAMPS
FOG LAMPS	ANTI-THEFT ALARM	2.0 LTR 106/110KW	AUTO GEARBOX 5 SPEED
START & STOP SYSTEM	ABS	CRUISE CONTROL	WHEELS 6.5J X 16
SILL EXTENSION	TWO COAT METALLIC	PREPARE OFF VEHICLE	

Kan Fook Sing Motor Workshop
61 Defu Lane 12
539147

Claim Reference:
Assessment number: KFSA100120
Version: 1810
Date calculated: 23/07/2019 2:26 PM

Full Report
Registration: SLC1327T
Printed: 23/07/2019 2:26 PM


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

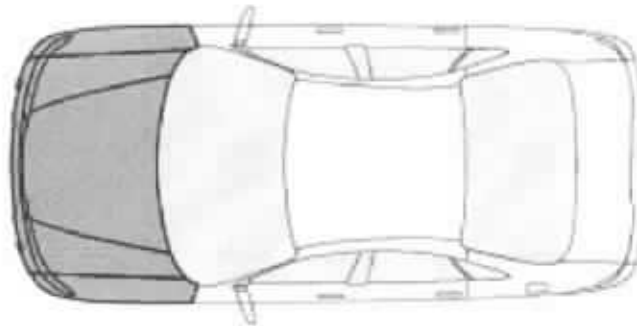

Labour

Code	Description	Time Base 10 WU/h	Price = 50.00 SGD/h	
			WU	Price SGD
F0801X-R-X	R + R INTAKE AIR SENSOR		4.0	20.00
S0201X-R-X	RENEW COMPLETE FRONT BUMPER INCLUDES: BUMPER AND CROSS MEMBER R + R ATTACHED PARTS OF THE BUMPER ASSEMBLE		13.0	65.00
S0601B-R-X)	RENEW L/FRT WING (BUMPER REMOVED) INCLUDES: WHEEL HOUSE SHELL, L/HEADLAMP, AND ALL NECESSARY TRIMS REMOVE AND REFIT		6.0	30.00
S0601A-R-X)	RENEW R/FRT WING (BUMPER REMOVED) INCLUDES: WHEEL HOUSE SHELL, R/HEADLAMP, AND ALL NECESSARY TRIMS REMOVE AND REFIT		6.0	30.00
T0301Z-R-X)	R + R BOTH HEADLAMPS		4.0	20.00

Kan Fook Sing Motor Workshop
61 Defu Lane 12
539147

Claim Reference:

Assessment number: KFSA100120

Version: 1810

Date calculated: 23/07/2019 2:26 PM

Full Report

Registration: SLC1327T

Printed: 23/07/2019 2:26 PM

Code	Description	WU	Price SGD
	(BUMPER REMOVED)		
	INCLUDES: ADJUST HEADLAMPS		
S0612X-R-X)	R + R FRONT PANEL	12.0	60.00
	(BUMPER CPL AND HEADLAMP REMOVED)		
	INCLUDES: BONNET LOCK		
	REMOVE AND REFIT		
NO NUMBER	R + R BONNET STAY	1.0	5.00
S0503X-R-X	RENEW BONNET	6.0	30.00
	INCLUDES: R + R BONNET,		
	STRAIGHTEN AND ADJUST BONNET,		
	CONVERT ATTACHED PARTS		
S0504B-R-X)	RENEW LEFT BONNET HINGE	1.0	5.00
	(BONNET REMOVED)		
S0504A-R-X)	RENEW RIGHT BONNET HINGE	1.0	5.00
	(BONNET REMOVED)		
S0509X-R-X	R + R BONNET CABLE	5.0	25.00
S1001B-R-X)	R + R L/F DOOR	3.0	15.00
S1001A-R-X)	R + R R/F DOOR	3.0	15.00
S0708A-R-X)	R + R INSTRUMENT PANEL	24.0	120.00
S2206X-R-X)	R + R AIRBAG CONTROL UNIT	2.0	10.00
S1702Z-R-X	REMOVE AND REFIT L + R A-PILLAR TRIM	2.0	10.00
S1703B-R-X	R + R LEFT B-PILLAR LOWER TRIM	2.0	10.00
S1703A-R-X	R + R R/LOWER B-PILLAR TRIM	2.0	10.00
G0501X-R-X	R + R BATTERY	3.0	15.00
AC122X-R-X	DRAIN-REFILL COOLENT LIQUID	5.0	25.00
E0204X-R-X)	R + R FAN COWL	1.0	5.00
E0209X-R-X)	RENEW FAN SHROUD (FAN REMOVED)	1.0	5.00
F0105A-R-X	R + R AIR CLEANER	3.0	15.00
E0301X-R-X)	R + R UPPER RADIATOR HOSE	2.0	10.00
F0101X-R-X)	R + R INTAKE MANIFOLD	9.0	45.00
F0107F-R-X)	R + R THROTTLE VALVE HOUSING ADD	3.0	15.00
NO NUMBER	R + R EXPANSION TANK WATER HOSE	3.0	15.00
U0004X-R-X	DRAIN + REFILL AIR CONDITIONING	7.0	35.00
U0707X-R-X)	R + R CONDENSER	6.0	30.00
N0105X-R-X	R + R STEERING COLUMN	9.0	45.00
	INCLUDES: R + R STEERING WHEEL, COMBI-SWITCH AND IGNITION LOCK		

Kan Fook Sing Motor Workshop
61 Defu Lane 12
539147

Claim Reference:
 Assessment number: KFSA100120
 Version: 1810
 Date calculated: 23/07/2019 2:26 PM

Full Report
 Registration: SLC1327T
 Printed: 23/07/2019 2:26 PM

Labour Cost	Hrs	WU	
Panel / Mechanical Labour	14.90	149.0	745.00
Total of Labour			745.00

Paint

Paint Work	SYSTEM AZT	Time Basis 10WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	FRT BUMPER SUPPORT SURFACE PAINT	4.0
	BONNET NEW PART PAINTING	20.0
	L/F WING NEW PART PAINTING	11.0
	R/F WING NEW PART PAINTING	11.0
	LOCK CARR CTR SUPP SURFACE PAINT	4.0
	FRONT BUMPER NEW PART PAINT K1R	11.0
	LEFT FRONT DOOR SURFACE PAINT	8.0
	RIGHT FRONT DOOR SURFACE PAINT	8.0

Paint Material Per Part

Code	Description	Price SGD
0340	FRT BUMPER SUPPORT SURFACE PAINT	2.99
0471	BONNET NEW PART PAINTING	61.40
0741	L/F WING NEW PART PAINTING	23.74
0742	R/F WING NEW PART PAINTING	23.74
1018	LOCK CARR CTR SUPP SURFACE PAINT	1.49
0281	FRONT BUMPER NEW PART PAINT K1R	53.14
1481	LEFT FRONT DOOR SURFACE PAINT	23.16
1482	RIGHT FRONT DOOR SURFACE PAINT	23.16

Labour Cost - Paint	Hrs	WU	Price SGD
Factor	50.00 SGD/h		
Time Paint		77.0	
Preparation Main Work Metal	2.50	25.0	125.00
Preparation Comp. Work Plastic	0.50	5.0	25.00
Total	10 WU/h	107.0	535.00

Kan Fook Sing Motor Workshop
61 Defu Lane 12
539147

Claim Reference:
 Assessment number: KFSA100120
 Version: 1810
 Date calculated: 23/07/2019 2:26 PM

Full Report
 Registration: SLC1327T
 Printed: 23/07/2019 2:26 PM

Material Cost - Paint	Price SGD
New Part Painting	108.88
New Part Painting - Plastic K1R	53.14
Surface-/Blend Paint	50.80
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	250.42

Spare Parts

				prices as at 2015-06-01/01	
Code	Description	Part Number	Supplier	Price SGD	
0281	FRONT BUMPER	CG1650031BBB		400.00	✓
0317	L/F BUMPER BRACKET	C513500U1B		12.00	✓
0318	R/F BUMPER BRACKET	C513500T1B		12.00	✓
0319	L/F INN BUMPER BRKT	C51350161B		16.00	✓
0340	FRT BUMPER SUPPORT	C51350070A		200.00	✓
0349	FRT BUMPER GRILLE	C513501T0D		240.00	✓
0350	FRT BUMPER CLAMP KIT	USE SINGLE PARTS		25.00	✓
0412	AIR INTAKE GRILLE	C513507M1E		70.00	✓
0433	MANUFACTURER BADGE	C29151731		18.00	✓
0471	BONNET	C5Y35231X		450.00	✓
0475	L/BONNET HINGE	C51352420		25.00	✓
0476	R/BONNET HINGE	C51352410		25.00	✓
0481	BONNET INSULATION	C51356681		55.00	✓
0485	INSULATION MNTG KIT	TD1156694		25.00	✓
0493	BONNET LOCK	BBM456620A		90.00	✓
0561	L/F HEADLAMP	C51451041C		450.00	✓
0562	R/F HEADLAMP	C51451031C		450.00	✓
0741	L/F WING	CG3752211		125.00	✓
0742	R/F WING	CG3752111		125.00	✓
0789	L/F WING CLAMP KIT	907200612		12.50	✓
0790	R/F WING CLAMP KIT	907200612		12.50	✓
1009	FRONT PANEL	C51353110G		210.00	✓
1018	LOCK CARR CTR SUPP	C5135215Y		18.00	✓
4323	AIRBAG SYSTEM	REPLACE		1,250.00	✓
4325	PASSENGER AIRBAG	C51357K50A		1,380.00	✓
4331	INSTRUMENT PANEL	C51360400E		700.00	✓
4465	CONDENSER	C51361480B		290.00	✓
4661	L/F SEAT BELT	C23557L90C10		680.00	✓
4662	R/F SEAT BELT	C23557L30C10		680.00	✓
7447	AIRBAG SPRING	BBP366CS0A		110.00	✓
7761	RADIATOR	LFY915SB0		160.00	✓
7764	RADIATOR SHROUD CPL	LFDV15025B		480.00	✓

Kan Fook Sing Motor Workshop
61 Defu Lane 12
539147

Claim Reference:
 Assessment number: KFSA100120
 Version: 1810
 Date calculated: 23/07/2019 2:26 PM

Full Report
 Registration: SLC1327T
 Printed: 23/07/2019 2:26 PM

Code	Description	Part Number	Supplier	Price SGD
7773	L/UPP RADIATOR HOSE	LFDV1518X		50.00
7776	WATER HOSE	LFDV1526Y	/ TAI	20.00 (A)
7783	L/RADIATOR SEAL	LFDV15226	/ MTS	18.00 (A)
7784	R/RADIATOR SEAL	LFDV15222	/ MTS	18.00 (A)
8149	THROTTLE BODY	LF2L13640	/ OR	350.00 (A)
8221	INTAKE MANIFOLD	LF2L13100D		380.00
8395	FILTER ELEMENT	LFBL13Z409A		32.00
8401	UPP AIR FILTER COVER	LFBL13Z01		45.00
8402	AIR FILTER HOUSING	LFBL13Z0X		65.00
8484	INTAKE AIR SENSOR	L30118211B	/ OR	95.00 (A)
9663	MODULE BOX COVER	C5976676Y		35.00
1000	FRT BUMP ABSORBER	FBA		38.00
f: OEM Parts				Savings 0.00
n: Non-OEM Parts				Subtotal 9,942.00
u: Used parts				Addition(+10.00%) 994.20
Total				10,936.20

Extras

Code	Description	Price SGD
1002	FRT BUMPER PLATE FNP	30.00*
1003	AIR CON GAS ACC	100.00*
1004	CALIBRATE AIRBAG ECU P/C A/B ECU	350.00*
Total Extras		480.00

Kan Fook Sing Motor Workshop
61 Defu Lane 12
539147

Claim Reference:
 Assessment number: KFSA100120
 Version: 1810
 Date calculated: 23/07/2019 2:26 PM

Full Report
 Registration: SLC1327T
 Printed: 23/07/2019 2:26 PM

Final Calculation

	SGD	SGD
Parts	9,942.00	
Addition(+10.00%)	994.20	
Total Parts		10,936.20
Labour Time Base 10 WU/h		
Total 149.0 WU X 50.00 SGD/h	745.00	
Total of Labour		745.00
Total Of Extras		480.00
Paint Work Time Base 10 WU/h		
Labour Cost 107.0 WU X 50.00 SGD/h	535.00	
Material Cost	250.42	
Total Paint Including Material		785.42
Repair Cost Excludes GST		12,946.62
GST (+7.0%)		906.26
Repair Cost Included GST		13,852.88
Deductions (Excludes GST)		
Deduction For Excess	-700.00	
Total Of Deductions (Excludes GST)		-700.00
Grand Total Excludes GST		12,246.62
GST (+7.0%)		857.26
Grand Total Included GST		13,103.88

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	25 Jun 2019 Sendback Est	27 Jun 2019 14:14 S\$15,378.42	28 Jun 2019 09:32 Edit Adj Rpt	S\$12,946.62 Edit Estimates	S\$12,946.62 View Rpt		Pending for Survey Report Cancel Case
Supp #1	23 Jul 2019 14:17	23 Jul 2019 14:19 S\$1,005.60	23 Jul 2019 14:19			(Combined)	Combined with Main Uncombine Suppl.

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS									
Insured: KOH BOON CHYE , ID: S81278211, Tel: +6588224747, Email: NOEMAIL									
Vehicle Reg. No.: SLC1327T		Date of Loss:	23/06/2019 20:00 - :59 [37 Months and 25 Days From LTA Reg Date (Man Yr)]						
Claim Type: OD / MSC/V/19-000739		Policy/Cover Note No.:	MSD/VPCB/19-000490 (Comprehensive) Coverage: 29/04/2019 - 28/04/2020						
		Excess:	S\$700.00						
Repairer: Kan Fook Sing Motor Workshop (Defu) No. 61 Defu Lane 12, 539147 Defu Lane - Tel: 67479560									
Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Nor Azlan Binte Noordin - 6594 2558]									
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by CHEN TSUE YEE] ... [Final Rpt due 28/07/2019]									
Driver/Custodian: KOH BOON CHYE (37 / Male) , NRIC: S81278211, Tel: +6588224747 Email: NOEMAIL									
Adj Asg. Remarks: Car in, Survey & revert. Please contact us ASAP if you cannot attend this assignment.									
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
- MSIG_SG (07/08/2019): Alert - Adj Mandate Approved (S\$12946.62) - SLC1327T - Claim Handler: Nor Azlan ... - MSIG_SG (01/07/2019): Alert - Adj Mandate Approved (S\$13549.92) - SLC1327T - Claim Handler: Nor Azlan ...									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

SLC1327T (MSC/V/19-000739)

OD

Jun 23 2019 8:00PM

[KOH BOON CHYE]

Kan Fook Sing Motor Workshop

Upload Documents		Upload Photos		Compose New Letter		View		View in Browser	
Assessment Reports						1 per page		☒	
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)		Thumbnail	Print				
1	24/06/19 17:35	Accident Statement		Load HTM					
2	27/06/19 14:14	Repairer Estimates		Load HTM					
3	23/07/19 14:19	Repairer Estimates Suppl. #1		Load HTM					
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print				
1	01/07/19 11:42	Adjuster Immediate Advice		Load HTM					
2	07/08/19 15:24	Adjuster Immediate Advice		Load HTM					
Photos/Images						3 per page		☒	
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)		Thumbnail	Print				
1	24/06/19 17:33	Accident Photo [Linked Accident Report Documents]		Load JPG	☒				
2	24/06/19 17:33	Accident Photo [Linked Accident Report Documents]		Load JPG	☒				
3	24/06/19 17:33	Accident Photo [Linked Accident Report Documents]		Load JPG	☒				
4	24/06/19 17:33	Accident Photo [Linked Accident Report Documents]		Load JPG	☒				
5	24/06/19 17:33	Accident Photo [Linked Accident Report Documents]		Load JPG	☒				
6	24/06/19 17:33	Accident Photo [Linked Accident Report Documents]		Load JPG	☒				
7	24/06/19 17:33	Accident Photo [Linked Accident Report Documents]		Load JPG	☒				
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print				
1	01/07/19 09:35	General View		Load JPG	☒				
2	01/07/19 09:35	General View		Load JPG	☒				
3	01/07/19 09:35	General View		Load JPG	☒				
4	01/07/19 09:35	General View		Load JPG	☒				
5	01/07/19 09:35	General View		Load JPG	☒				
6	01/07/19 09:35	Odometer Reading		Load JPG	☒				
7	01/07/19 09:35	General View		Load JPG	☒				
8	01/07/19 09:35	General View		Load JPG	☒				
9	01/07/19 09:35	General View		Load JPG	☒				
10	01/07/19 09:35	General View		Load JPG	☒				
11	01/07/19 09:35	General View		Load JPG	☒				
12	01/07/19 09:35	General View		Load JPG	☒				
13	01/07/19 09:35	General View		Load JPG	☒				
14	01/07/19 09:35	General View		Load JPG	☒				
15	01/07/19 09:35	General View		Load JPG	☒				
16	01/07/19 09:35	General View		Load JPG	☒				
17	01/07/19 09:35	General View		Load JPG	☒				
18	01/07/19 09:35	General View		Load JPG	☒				
19	01/07/19 09:35	General View		Load JPG	☒				
20	01/07/19 09:35	General View		Load JPG	☒				
21	01/07/19 09:35	General View		Load JPG	☒				

Assessment Reports			1 per page	☒
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)	Thumbnail	Print
22	01/07/19 09:35	General View		☒
23	01/07/19 09:35	General View		☒
24	01/07/19 09:35	General View		☒
25	01/07/19 09:35	General View		☒
26	01/07/19 09:35	General View		☒
27	01/07/19 09:35	General View		☒
28	01/07/19 09:35	General View		☒
29	01/07/19 09:35	General View		☒
30	01/07/19 09:35	General View		☒
31	01/07/19 09:35	General View		☒
32	01/07/19 09:35	General View		☒
33	01/07/19 09:35	General View		☒
34	01/07/19 09:35	General View		☒
35	01/07/19 09:35	General View		☒
36	01/07/19 09:35	General View		☒
37	01/07/19 09:35	General View		☒
38	01/07/19 09:35	General View		☒
39	01/07/19 09:35	General View		☒
40	01/07/19 09:35	General View		☒
41	01/07/19 09:35	General View		☒
42	01/07/19 09:35	General View		☒
43	01/07/19 09:35	General View		☒
44	01/07/19 09:35	General View		☒
45	01/07/19 09:35	General View		☒
46	01/07/19 09:35	General View		☒
47	01/07/19 09:35	General View		☒
48	01/07/19 09:35	General View		☒
49	01/07/19 09:35	General View		☒
50	01/07/19 09:35	General View		☒
51	01/07/19 09:35	General View		☒
52	01/07/19 09:35	General View		☒
53	01/07/19 09:35	General View		☒
54	01/07/19 09:35	General View		☒
55	01/07/19 09:35	General View		☒
56	01/07/19 09:35	General View		☒
57	01/07/19 09:35	General View		☒
58	01/07/19 09:35	General View		☒
59	01/07/19 09:35	General View		☒
60	01/07/19 09:35	General View		☒
61	01/07/19 09:35	General View		☒
62	01/07/19 09:35	General View		☒
63	01/07/19 09:35	General View		☒
64	01/07/19 09:35	General View		☒
65	01/07/19 09:35	General View		☒
66	01/07/19 09:35	Chassis Number		☒
67	01/07/19 09:35	General View		☒
68	01/07/19 09:35	General View		☒
69	01/07/19 09:35	General View		☒
70	01/07/19 09:35	General View		☒
71	01/07/19 09:35	General View		☒

Assessment Reports			1 per page	☒
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)	Thumbnail	Print
72	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
73	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
74	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
75	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
76	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
77	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
78	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
79	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
80	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
81	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
82	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
83	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
84	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
85	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
86	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
87	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
88	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
89	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
90	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
91	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
92	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
93	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
94	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
95	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
96	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
97	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
98	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
99	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
100	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
101	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
102	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
103	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
104	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
105	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
106	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
107	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
108	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
109	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
110	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
111	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
112	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
113	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
114	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
115	26/07/19 08:41	Reinspection Photo	 Load JPG	☒
Documentation			1 per page	☒
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)	Thumbnail	Print
1	25/06/19 15:09	E-filed GIA report	 Load PDF	
2	27/06/19 14:15	Audatex report	 Load PDF	
3	07/08/19 16:18	Repairer's Bill	 Load PDF	
4	07/08/19 16:18	Signed DV	 Load PDF	

Assessment Reports			1 per page	☒
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)	Thumbnail	Print
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	27/06/19 19:38	Valid DL	Load PDF	
2	27/06/19 19:38	Valid Road Tax	Load PDF	
3	27/06/19 19:47	COE / PARF Value	Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	01/07/19 11:34	ESTIMATE	Load PDF	
2	07/08/19 11:09	supplementary	Load PDF	
3	07/08/19 11:09	estimate marking	Load PDF	
4	21/08/19 15:34	Parts Invoice	Load PDF	

Linked Accident Report Documents

Assessment Reports			1 per page	☒
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)	Thumbnail	Print
1	24/06/19 17:35	Accident Statement	Load HTM	
Photos/Images			3 per page	☒
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)	Thumbnail	Print
1	24/06/19 17:33	Accident Photo	Load JPG	☒
2	24/06/19 17:33	Accident Photo	Load JPG	☒
3	24/06/19 17:33	Accident Photo	Load JPG	☒
4	24/06/19 17:33	Accident Photo	Load JPG	☒
5	24/06/19 17:33	Accident Photo	Load JPG	☒
6	24/06/19 17:33	Accident Photo	Load JPG	☒
7	24/06/19 17:33	Accident Photo	Load JPG	☒
Documentation			1 per page	☒
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)	Thumbnail	Print
1	24/06/19 17:35	Accident Sketch Plan	Load TIF	
2	24/06/19 17:35	Accident Sketch Plan	Load TIF	
3	24/06/19 17:35	NRIC & DL	Load TIF	
4	24/06/19 17:35	CI	Load TIF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) 			
Show Remarks To: ☐ Repairer ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.			

LKK Auto Consultants Pte Ltd (Co. Reg No: 199607196R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way, #21-01 SGX Centre 2
Singapore 068807

Our File No: CS/MSG19011455/ETD3E2

Date: 21/08/2019

REFERENCE

Insured/Claimant: KOH BOON CHYE Policy No: MSD/VPCB/19-000490
Date of Loss: 23/06/2019 Nature of Claim: OD Claim No: MSC/V/19-000739

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLC1327T**
Make & Model: MAZDA 5, 2.0 SkyActiv SP (A) Engine No: PE10337721
Reg. Date: 29/04/2016 (Man. Year: 2016) Chassis No: JM6CW1071G0123683
Colour: Silver Odometer: 0 km
Engine Capacity: 1998 cc
Market Value/New Car Price: S\$73,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/55Z R16 Rear Tyre Size: 205/55Z R16
Front Left Side: Michelin 6 mm Rear Left Side: Michelin 6 mm
Front Right Side: Michelin 6 mm Rear Right Side: Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	14,064.60	10,936.20	3,128.40	22.24
Miscellaneous Items	648.00	480.00	168.00	25.93
Labour	1,671.42	1,530.42	141.00	8.44
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	16,384.02	12,946.62	3,437.40	20.98
- Excess (S\$)	700.00	700.00	0.00	0.00
(S\$)	15,684.02	12,246.62	3,437.40	21.92
+ GST 7.00/7.00% (S\$)	1,097.88	857.26	240.62	21.92
Nett Amount (S\$)	16,781.90	13,103.88	3,678.02	21.92

INSPECTION

Date of Assignment: 28/06/2019 Present Location: Kan Fook Sing Motor Workshop (Defu)
Date Inspected: 28/06/2019 Inspected At: Kan Fook Sing Motor Workshop (Defu)
No. 61 Defu Lane 12
Singapore 539147
Estimated Period of Repair: 10.0 days

Adjuster: CHEN TSUE YEE

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 21 Aug 2019)
Parts:	M1-MPV	MAZDA 5 2.0 SkyActiv SP (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLC1327T)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*MANUFACTURER BADGE (WCP)	Necessary	-	*18.00 F
2	1	NA	*AIRBAG CONTROL UNIT (WCP)	Not Necessary	500.00 F	*- F
3	1	NA	*AIRBAG SPRING (WCP)	Necessary	110.00 F	*110.00 F
4	1	NA	*AIRBAG SYSTEM (WCP)	Necessary	1,350.00 F	*1,250.00 F
5	1	NA	*AIR FILTER HOUSING (WCP)	Broken	65.00 F	*65.00 F
6	1	NA	*BATTERY BOX COVER (WCP)	Not Necessary	85.00 F	*- F
7	1	NA	*BONNET (WCP)	Dented	450.00 F	*450.00 F
8	1	NA	*BONNET INSULATION (WCP)	Crushed	50.00 F	*55.00 F
9	1	NA	*BONNET LOCK (WCP)	Bent	75.00 F	*90.00 F
10	1	NA	*BONNET OPENER (WCP)	Not Necessary	25.00 F	*- F
11	1	NA	*BONNET STAY (WCP)	Not Necessary	25.00 F	*- F
12	1	NA	*COMPR/CONDENSER HOSE (WCP)	Not Necessary	130.00 F	*- F
13	1	NA	*COMPR/EVAP HOSE (WCP)	Not Necessary	130.00 F	*- F
14	1	NA	*COND/EVAPORATOR HOSE (WCP)	Not Necessary	110.00 F	*- F
15	1	NA	*CONDENSER (WCP)	Dented	300.00 F	*290.00 F
16	1	NA	*FILTER ELEMENT (WCP)	Crushed	32.00 F	*32.00 F
17	1	NA	*FILTER INLET HOSE (WCP)	Not Necessary	60.00 F	*- F
18	1	NA	*FILTER OUTLET HOSE (WCP)	Not Necessary	48.00 F	*- F
19	1	NA	*FRONT AIRBAG SENSOR (WCP)	Not Necessary	220.00 F	*- F
20	1	NA	*FRONT BONNET SEAL (WCP)	Not Necessary	28.00 F	*- F
21	1	NA	*FRONT BUMPER (WCP)	Broken	400.00 F	*400.00 F
22	1	NA	*FRONT COVER PANEL (WCP)	Not Necessary	110.00 F	*- F
23	1	NA	*FRONT PANEL (WCP)	Broken	220.00 F	*210.00 F
24	1	NA		Broken	38.00 F	*38.00 F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
			*FRT BUMP ABSORBER (WCP)			
25	1	NA	*FRT BUMPER GRILLE (WCP)	Broken	240.00 F	*240.00 F
26	1	NA	*FRT BUMPER SUPPORT (WCP)	Dented	200.00 F	*200.00 F
27	1	NA	*FRT CTR BUMPER BRKT (WCP)	Not Necessary	70.00 F	*- F
28	1	NA	*GEARBOX RUBBER MNTG (WCP)	Not Necessary	110.00 F	*- F
29	1	NA	*GEARBOX SUPPORT (WCP)	Not Necessary	55.00 F	*- F
30	1	NA	*INSTRUMENT PANEL (WCP)	Broken	700.00 F	*700.00 F
31	1	NA	*INSULATION MNTG KIT (WCP)	Necessary	25.00 F	*25.00 F
32	1	NA	*INTAKE MANIFOLD (WCP)	Broken	380.00 F	*380.00 F
33	1	NA	*L/BONNET HINGE (WCP)	Dented	25.00 F	*25.00 F
34	1	NA	*L/F BUMPER BRACKET (WCP)	Broken	13.00 F	*12.00 F
35	1	NA	*L/F BUMPER COVER (WCP)	Not Necessary	40.00 F	*- F
36	1	NA	*L/F HEADLAMP (WCP)	Broken	450.00 F	*450.00 F
37	1	NA	*L/F INN BUMPER BRKT (WCP)	Missing	25.00 F	*16.00 F
38	1	NA	*L/F SEAT BELT (WCP)	Jammed	650.00 F	*680.00 F
39	1	NA	*L/F WHEELHOUSE COVER (WCP)	Repair	75.00 F	*- F
40	1	NA	*L/F WING (WCP)	Dented	125.00 F	*125.00 F
41	1	NA	*L/F WING CLAMP KIT (WCP)	Necessary	25.00 F	*12.50 F
42	1	NA	*L/RAD GRILLE MNTG (WCP)	Not Necessary	85.00 F	*- F
43	1	NA	*L/UPP RADIATOR HOSE (WCP)	Crushed	85.00 F	*50.00 F
44	1	NA	*LOCK CARR CTR SUPP (WCP)	Dented	18.00 F	*18.00 F
45	1	NA	*MODULE BOX COVER (WCP)	Broken	35.00 F	*35.00 F
46	1	NA	*MOUNTING CLAMP (WCP)	Not Necessary	25.00 F	*- F
47	1	NA	*PASSENGER AIRBAG (WCP)	Broken	1,380.00 F	*1,380.00 F
48	1	NA	*R/BONNET HINGE (WCP)	Dented	25.00 F	*25.00 F
49	1	NA	*R/F BUMPER BRACKET (WCP)	Broken	13.00 F	*12.00 F
50	1	NA	*R/F HEADLAMP (WCP)	Broken	450.00 F	*450.00 F
51	1	NA	*R/F INN BUMPER BRKT (WCP)	Not Necessary	25.00 F	*- F
52	1	NA	*R/F SEAT BELT (WCP)	Jammed	650.00 F	*680.00 F
53	1	NA	*R/F WHEELHOUSE COVER (WCP)	Not Necessary	75.00 F	*- F
54	1	NA	*R/F WING (WCP)	Dented	125.00 F	*125.00 F
55	1	NA	*R/F WING CLAMP KIT (WCP)	Necessary	25.00 F	*12.50 F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
56	1	NA	*R/LWR RADIATOR HOSE (WCP)	Not Necessary	50.00 F	*- F
57	1	NA	*R/RAD GRILLE MNTG (WCP)	Not Necessary	85.00 F	*- F
58	1	NA	*R/RUBBER BUSH (WCP)	Not Necessary	125.00 F	*- F
59	1	NA	*RADIATOR (WCP)	Dented	300.00 F	*160.00 F
60	1	NA	*RADIATOR SHROUD CPL (WCP)	Broken	480.00 F	*480.00 F
61	1	NA	*UPP AIR FILTER COVER (WCP)	Broken	45.00 F	*45.00 F
62	1	NA	*VALVE COVER (WCP)	Not Necessary	320.00 F	*- F
Supplementary #1						
63	1		*FRT BUMPER CLAMP KIT (WCP)	Necessary	25.00 F	*25.00 F
64	1		*AIR INTAKE GRILLE (WCP)	Broken	70.00 F	*70.00 F
65	1		*WATER HOSE (WCP)	Torn	20.00 F	*20.00 F
66	1		*L/RADIATOR SEAL (WCP)	Missing	18.00 F	*18.00 F
67	1		*R/RADIATOR SEAL (WCP)	Missing	18.00 F	*18.00 F
68	1		*THROTTLE BODY (WCP)	Broken	350.00 F	*350.00 F
69	1		*INTAKE AIR SENSOR (WCP)	Broken	95.00 F	*95.00 F

F=Franchise part.

Sub Total (S\$)	12,786.00	9,942.00
+ Margin on L,N Items 10.00/10.00% (S\$)	1,278.60	994.20
Total Parts (S\$)	14,064.60	10,936.20

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
Miscellaneous Items				
1	1	AIR CON GAS (NECESSARY)	100.00	100.00
2	1	BATTERY (NOT NECESSARY)	168.00	0.00
3	1	FRT NUMBER PLATE (BROKEN)	30.00	30.00
Supplementary #1				
4	1	CALIBRATE AIRBAG ECU (NECESSARY)	350.00	350.00
Sub Total (S\$)			648.00	480.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	Total Paint Labour	New	555.00	535.00
2	Total Paint Materials	New	251.42	250.42
3	Total Panel/Mechanical Labour	New	865.00	745.00
Gross Labour Cost (S\$)			1,671.42	1,530.42

Report was unsubmitted during this print-out.

< END OF ESTIMATES >