

REF: CC3/A36 19011746 / Agf3n2

MURKIN

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

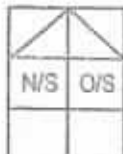
Insured: _____

Policy No. 1800042841Claims No. 076100109855Sum Insured: _____ Excess: 600 10/7/19

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 95K

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 13 868 days Res: Yes or No

Lum Sum: _____ % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SL2754D Yr Regn: 2018 AprilType: M ☒ Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Audi A3 Sedan cc 999Colour: White A/C: Insured / Std / NI / NASp. Reading: 2485 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WAU2Z280J1056451Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt orModi: Nil / ☒ STD A/Rim orTyre Size: F: 205/55R16R: 205/55R16BS / DUN / EXNOVA / GY / FS / LIZA / ☒ MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal. 06 mm R/Bal. 06 mmL/Bal. 06 mm L/Bal. 06 mmD.O.A. _____ D.O.I. 05/07/19Survey held at PremiumDes. of Damages: Frt / Rear ☒ O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

GD ALGSE = 79410 X05/07/19 @ 5.50pm report to Victor via Messenger.05/07/19 @ 5.11pm Victor informed via Messenger.MV:PV:Nett:10/07/19 @ 11.40am informed Kevin via Ex: Eked by email.04/10/19 @ 4.20pm confirmed with Carvine final fig & 13942.32, 13 days.(Red & 11653.68, 46%.)

Date/Time, File Pass to?

11/3/10 Invoice3)2)1)

Prof. Report:

Final Report:

Date/Time, File Return to?

2)4)6)

Part Prices Check:

IN

OUT

Survey Fee:

Basic & Add.

S + RS, SI

Photos

Others

TOTAL

Date:

20011211

RECEIVED 3 OCT 2019

Note: This document has not been finalised.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn:

Date: 05 Jul 2019

Preliminary Advice

Vehicle No	: SLZ754D	Accident Date	: 04/07/2019
Make	: AUDI A3	Policy No.	: 1800042841
Assignment Date	: 05/07/2019	Excess	: S\$0.00
Date of Inspection	: 05/07/2019	Est. Duration of Repair	: 13.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (UBI) 55 UBI ROAD 1 SINGAPORE 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages o/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	25,596.00
Revised Amount	:S\$	14,650.00
Check Items (Estimated)	:S\$	500.00
Total	:S\$	15,150.00

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	95,000.00
COE / PARF Rebate	:S\$	52,496.00
Salvage Value	:S\$	
Margin for Repair	:S\$	42,504.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

Claim Audit

AUDIT TRAIL				
No.	On	Audit	Remarks	By
1	04 Jul 2019 17:42	Cim Veh Model Changed		[] Merimen Administrator
2	04 Jul 2019 17:42	Cim Created	Reg No: SLZ754D, Policy No: 1800042841, Acct Date: 2019/07/04, Claim Type: S C, Insurer: AIG Asia Pacific Insurance Pte. Ltd. (SG), Ins.Status => Notification, Created from SAS:MPA119087305	[I] Merimen Administrator
3	05 Jul 2019 17:07	Cim Registration Modified	Setl.Type:3->0, Claim Type:SC->OD.	[] LEE SU THING
4	05 Jul 2019 17:07	Adj Cim Retrieved	Adj: LKK Auto Consultants Pte Ltd (HQ)	[] LEE SU THING
5	05 Jul 2019 17:07	Adj Co Assigned	LKK Auto Consultants Pte Ltd (HQ):	[A] LEE SU THING
6	05 Jul 2019 17:07	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2019/07/16	[A] LEE SU THING
7	05 Jul 2019 17:07	Adj Mandate Set	Approved:8000.00,Reinsp:Adj decides.	[A] LEE SU THING
8	05 Jul 2019 17:07	Cim Registration Modified	Rep:1137->200611.	[A] LEE SU THING
9	05 Jul 2019 17:07	Cim Veh Model Changed	(206113) AUDI A3 999cc SEDAN TFSI (A).	[A] LEE SU THING
10	05 Jul 2019 17:07	Adj Adjuster Assigned	[None] -> ADRIAN LING	[A] LEE SU THING
11	05 Jul 2019 17:45	Adj Rpt Initiated		[A] SHIAU CHAN
12	05 Jul 2019 17:45	Cim Dtl Modified	JPJ Reg. Date: -> 2018/04/23.	[A] SHIAU CHAN
13	05 Jul 2019 17:45	Cim Details Notified		[A] SHIAU CHAN
14	05 Jul 2019 17:48	Adj Im. Advice Submitted	Next Rpt:Final Rpt.Due Date:2019/07/16	[A] SHIAU CHAN
15	05 Jul 2019 17:49	Adj Mandate Request	Cur.Req:15150.00:DAMAGES CONSISTENT. REPAIR COST ECONOMICAL. WE HAVE NOT AUTHORISE REPAIR.	[A] SHIAU CHAN
16	08 Jul 2019 15:10	Cim Registration Modified	Init.Est.:> 5,000 - 6,000, Excess: -> 600.00, 2F Remarks: -> Not Applicable. GST: -> 7.00.	[I] Nadaraja, Deeban
17	08 Jul 2019 15:10	Label Added	(20226):Coverage Confirmed.	[A] Merimen Administrator
18	09 Jul 2019 17:11	Adj Next Rpt Changed	Next Rpt:Final Rpt.Due Date:2019/07/16, Mandate Remarks: Re-inspection to be done for damage check and supplementary items / labour.	[I] Koh, Victor-CK
19	09 Jul 2019 17:11	Adj Mandate Set	Approved:14650.00:Re-inspection to be done for damage check and supplementary items / labour, Reinsp:Yes.	[I] Koh, Victor-CK

Date From



Date To



Audit Type None

Go

ACTIVITY

No record

Merimen Billing for this case - Transaction History

Bill Ref No	Bill Date	Acc Type	Acc Name	Co Name (Branch)	Ref 1	Ref 2	Amount
2202594	05/07/2019 17:45	Motor	LKK Auto Consultants Pte Ltd	LKK Auto Consultants Pte Ltd (HQ)	SLZ754D		11.77

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Friday, 4 October 2019 4:20 PM
To: Carrine Leong
Cc: SUR
Subject: RE: FINAL REVISION - SLZ754D - OD AIG - SURVEYED 5 JULY 19

Dear Carrine,

WITHOUT PREJUDICE

Confirm final fig \$13,942.32 before excess \$600.00 & GST and 13 repair days.

Kindly expedite the discharge voucher and tax invoice to us for close case.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Carrine Leong <carrine.leong@premiumauto.com.sg>
Sent: Monday, 23 September 2019 4:46 PM
To: Shiau Chan (LKKAUTO) <siewsc@lkkauto.com>
Subject: FW: FINAL REVISION - SLZ754D - OD AIG - SURVEYED 5 JULY 19

Hi Adrian and all,

Revised estimate and photographs is attached.

Please confirm repair cost of \$13,942.32 @ 13 days exclude 2 Sundays.

Your early closure is well appreciated.

Thanks & Best Regard
JiaYee Yap
Claims Administrator

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9925 f. +65 6841 1183
e. jiajee.yap@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

Shiau Chan (LKKAuto)

From: Shiau Chan (LKKAuto)
Sent: Wednesday, 10 July 2019 11:40 AM
To: claims@premiumauto.com.sg; SUR
Subject: RE: OD CLAIM FOR SLZ 754 D

Dear Kelvin,

As instructed by our client, please proceed to repair the insured vehicle **SLZ 754D (Excess \$600/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims <claims@premiumauto.com.sg>
Sent: Wednesday, 10 July 2019 11:35 AM
To: Shiau Chan (LKKAuto) <siewsc@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: claims@premiumauto.com.sg
Subject: RE: OD CLAIM FOR SLZ 754 D

Dear Shiau Chan,

Any update on insurance approval ?

Thank you.

Best Regards,
Kelvin Khoo
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	9311J
Vehicle Details	
Vehicle No.:	SLZ754D
Vehicle to be Exported:	No
Intended Deregistration Date:	05 Jul 2019
Vehicle Make:	AUDI
Vehicle Model:	A3 SEDAN 1.0 TFSI S TRONIC (LED)
Primary Colour:	White
Manufacturing Year:	2018
Engine No.:	CHZ905146
Chassis No.:	WAUZZZ8V0J1056451
Maximum Power Output:	85.0 kW (113 bhp)
Open Market Value:	\$24,712.00
Original Registration Date:	23 Apr 2018
First Registration Date:	23 Apr 2018
Transfer Count:	0
Actual ARF Paid:	\$26,597.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	22 Apr 2028
PARF Rebate Amount:	\$19,947.00
Intended COE Rebate Details	
COE Expiry Date:	22 Apr 2028
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$37,000.00
COE Rebate Amount:	\$32,549.00
Total Rebate Amount:	\$52,496.00

The information contained herein is correct as at 05 Jul 2019

OK

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate	:	Accident Repairs
Workshop	:	Ubi Road 1
Contact No	:	6366 2323
Fax No	:	6841 1183
Reference	:	PA/OD/0825/2019/KK
Date	:	4-Jul-19

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name	:	Mr. Peh Yew Meng
Address	:	58 Huddington Avenue Singapore 557628
Telephone	:	(HP) +65 97614860
Type of Claim	:	Own Damage Claims
Policy No.	:	1800045841
Vehicle No	:	SLZ 754 D
Model Code	:	Audi A3 SEDAN 1.0 TFSI 8W
Model / Year	:	23/4/2018
Engine No	:	CHZ 905146
Chassis No	:	WAUZZZ8V0J1056451
Mileage	:	
Date In	:	
Liability	:	-
Excess Cost	:	-
Estimated By	:	Johnny Boo / Allan Wu
Accident Date	:	4-Jul-19
Place of Accident	:	Jing Shan Primary School Carpark

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle. SLZ 754 D

S/n	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To remove and reinstall rear parking aid.	S/N	\$ 280.00	✓
2	To renew rhs 1/4 glass and rear windscreen to facilitate fender renewal.	S/N	\$ 600.00	✓
3	To remove and transfer rhs rear door's multi-lock system and power window devices. Inspect for damages.	S/N	\$ 280.00	X
4	To dislodge and reinstall rear wire harness for lights, battery manager, fuse and relay trays, electrical and audio equipment.	S/N	\$ 1,400.00	✓
5	To remove and reinstall rear seat, back seat, hat tray, abcd pillar trims, luggage compartment trims. Dislodge roof liner and disengage curtain airbag etc.	S/N	\$ 1,400.00	✓
SUB LABOUR CHARGES		:	\$ 3,960.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle. SLZ 754 D

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
	To dismantle rear bumper, rear lid and rhs rear door. Cut out and weld rhs rear fender and rhs sill panel.		
6	To renew rhs rear door. Re-organize rear crash management components. Reinstall all parts removed.	\$ 7,700.00	3500,
7	To respray rhs rear fendr, rhs inner panel, rhs sill panel, rhs rear door, door entrances, roof channel, drian panel and end panelling. To carry out stone chip treatment and joint sealer works.	\$ 5,500.00	2750,
8	To carry out diagnostic check.	S/N \$ 192.00	//
TOTAL LABOUR CHARGES		: \$ 17,352.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLZ 754 D**

S/N	Parts Description	<u>Damaged Parts & Prices</u>	
		S/Nett	Remark
1	REAR FENDER - RHS <i>Dented</i>	\$ 2,110.00	✓ 1658
2	REAR REINFORCEMENT C-PILLAR - RHS <i>Reps</i>	\$ 176.00	+
3	REAR DOOR - RHS <i>Reps</i>	\$ 2,278.00	+
4	REAR OUTER DOOR SEAL - RHS <i>new</i>	\$ 146.00	+
5	BONDING AGENT <i>?</i>	\$ 45.00	+
6	CLEANING SOLUTION <i>new</i>	\$ 65.00	+
7	REAR DOOR CATCH	\$ 85.00	→
8	REAR DOOR ATTACHMENT PARTS - RHS <i>new</i>	\$ 117.00	+
9	WHEEL HOUSING LINER <i>new</i>	\$ 223.00	+
10	WHEEL HOUSING LINER ATTACHMENT PARTS <i>new</i>	\$ 81.00	+
11	REAR WINDOW <i>Mr</i>	\$ 742.00	✓ 593.20
12	PRIMER <i>new</i>	2 \$ 76.00	✓ 29.76
13	SIDE WINDOW - RHS <i>new</i>	\$ 520.00	✓ 415.60
14	ACRYLIC SEALANT <i>?</i>	\$ 180.00	✓
15	CAVITY WAX <i>new</i>	\$ 140.00	✓
16	STONE CHIP	\$ 180.00	✓
17	METAL FILLER POWDER <i>?</i>	\$ 280.00	✓
18	REAR W/S SEALANT <i>new</i>	\$ 200.00	✓
19	1/4 GLASS SEALANT	\$ 100.00	✓
20	SUNDRIES <i>Nec.</i>	\$ 500.00	? 13.76 ✓
TOTAL SPARE PARTS		\$ 8,244.00	
TOTAL LABOUR CHARGES		\$ 17,352.00	
GRAND TOTAL		\$ 25,596.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name : Adrian Lij
Surveyed Date : 05/07/19
Authorised Date :
Excess Cost :
Liability :
Remarks : Not Authorised, 13 Days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0825/2019/KK
Date : 04-Jul-19

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120

Hi Adrian,

13 days exclude 2 sundays -
ok - Jy - 29 Aug 19

Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Mr. Peh Yew Meng
Address : 58 Huddington Avenue
Singapore 557628
Telephone : (HP) +65 97614860
Type of Claim : Own Damage Claims
Policy No. : 1800045841
Vehicle No : **SLZ 754 D**
Model Code : Audi A3 SEDAN 1.0 TFSI 8W
Model / Year : 23/04/2018
Engine No : CHZ 905146
Chassis No : WAUZZZ8V0J1056451
Mileage :
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 04-Jul-19
Place of Accident : Jing Shan Primary School Carpark

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle. SLZ 754 D

S/n	Nature of Jobs		Estimated Charges	Surveyor's Reccomendation
1	To remove and reinstall rear parking aid.	S/N	\$ 280.00	\$ 280.00
2	To renew rhs 1/4 glass and rear windscreen to facilitate fender renewal.	S/N	\$ 600.00	\$ 600.00
3	To remove and transfer rhs rear door's multi-lock system and power window devices. inspect for damages	S/N	\$ 280.00	
4	To dislodge and reinstall rear wire harness for lights, battery manager, fuse and relay trays, electrical and audio equipment	S/N	\$ 1,400.00	\$ 1,400.00
5	To remove and reinstall rear seat, back seat, hat tray, abcd pillar trims, luggage compartment trims. Dislodge roof liner and disengage curtain	S/N	\$ 1,400.00	\$ 1,400.00
SUB LABOUR CHARGES		:	<u>\$ 3,960.00</u>	<u>\$ 3,680.00</u>

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle. SLZ 754 D

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
			\$ 3,680.00
6	to dismantle rear bumper, rear lid and rhs rear door. Cut out and weld rhs rear fender and rhs sill panel. To renew rhs rear door. Re-organize rear crash management components. Reinstall	\$ 7,700.00	\$ 3,500.00
7	to respray rhs rear fender, rhs inner panel, rhs sill panel, rhs rear door, door entrances, roof channel, drian panel and end panelling. To carry out stone chin treatment and joint sealer	\$ 5,500.00	\$ 2,750.00
8	To carry out diagnostic check.	S/N \$ 192.00	\$ 192.00
TOTAL LABOUR CHARGES		: \$ 17,352.00	\$ 10,122.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SLZ 754 D**

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	REAR FENDER - RHS	\$ 2,110.00	\$ 1,688.00
2	REAR REINFORCEMENT C-PILLAR - RHS	\$ 176.00	
3	REAR DOOR - RHS	\$ 2,278.00	
4	REAR OUTER DOOR SEAL - RHS	\$ 146.00	
5	BONDING AGENT	\$ 45.00	
6	SLEANNING SOLUTION	\$ 65.00	
7	REAR DOOR CATCH	\$ 85.00	
8	REAR DOOR ATTACHMENT PARTS - RHS	\$ 117.00	
9	WHEEL HOUSING LINER	\$ 223.00	
10	WHEEL HOUSING LINER ATTACHMENT PARTS	\$ 81.00	
11	REAR WINDOW	\$ 742.00	\$ 593.20
12	PRIMER	2 \$ 76.00	\$ 29.76
13	SIDE WINDOW - RHS	\$ 520.00	\$ 415.60
14	ACRYLIC SEALANT	\$ 180.00	\$ 180.00
15	CAVITY WAX	\$ 140.00	\$ 140.00
16	STONE CHIP	\$ 180.00	\$ 180.00
17	METAL FILLER POWDER	\$ 280.00	\$ 280.00
18	REAR W/S SEALANT	\$ 200.00	\$ 200.00
19	1/4 GLASS SEALANT	\$ 100.00	\$ 100.00
20	SUNDRIES	\$ 500.00	\$ 13.76
TOTAL SPARE PARTS		\$ 8,244.00	\$ 3,820.32
TOTAL LABOUR CHARGES		\$ 17,352.00	\$ 10,122.00
GRAND TOTAL		\$ 25,596.00	\$ 13,942.32

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SLZ 754 D

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/0825/2019/NH

24 October 2019

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

RE: INSURANCE CLAIM FOR SLZ 754 D, Audi A3 SEDAN 1.0 TFSI.

total pages

With reference to the above-mentioned vehicle, no. **SLZ 754 D**, claimant, **Mr. Peh Yew Meng**, please find the related document per attached.

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

1. A copy of the Original invoice no. 85014400 – S\$ 14,276.28.
2. A copy of the Discharge Voucher duly signed by client.

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept

Encl
AIG – SLZ 754 D

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6388 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 1 14:40

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120		Invoice No: 85014400	Account: A0006 (T 0)		
		Date : 24/10/2019	AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120		
		Order : SLZ0754D			
		Term : 30			

Regn No: SLZ0754D (V 37448)	Regn Date: 23/04/2018	Mileage: 2487	WIP No.: 59438
Model: A3 SEDAN 1.0 TFSI 8VMANG	Chassis: WAUZZZ8V0J1056451	Engine: CHE 905146	Dept: U
You have been assisted by :- UB-Kelvin Khoo (138)			

		Details	Qty	Unit Price	Amount
Q	EXC	M: 8888 Insurance Excess/Liability	-600.00	1.00	-600.00
S	BODYWORK	M: TO REMOVE AND REINSTALL REAR PARKING AID.	280.00	1.00	280.00
S	BODYWORK	M: TO RENEW RHS 1/4 GLASS AND REAR WINDSCREEN TO FACILITATE	600.00	1.00	600.00
S	BODYWORK	M: TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS,BATTERY MANAGER,FUSE AND RELAY TRAYS,ELECTRICAL AND AUDIO EQUIPMENT	1400.00	1.00	1,400.00
S	BODYWORK	M: TO REMOVE AND REINSTALL REAR SEAT,BACK REST, HAT TRAY,ABCD PILLAR TRIM,LUGGAGE COMPARTMENT TRIMS.DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAG ETC	1400.00	1.00	1,400.00
S	BODYWORK	M: TO DISMANTLE REAR BUMPER,REAR LID AND RHS RREAR DOOR.CUT OUT AND WELD RHS REAR FENDER AND RHS SILL PANEL.TO REPAIR RHS REAR DOOR. REORGANISE REAR CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	3500.00	1.00	3,500.00
S	BODYWORK	M: TO RESPRAY RHS REAR FENDER,RHS SILL PANEL, RHS REAR DOOR,DRAIN PANEL AND END PANELLING. TO CARRY OUT STONE CHIP TREATMENT AND JOINT SEALER WORK	2750.00	1.00	2,750.00
S	BODYWORK	M: TO CARRY OUT DIAGNOSTIC CHECK	192.00	1.00	192.00
S	BODYWORK	M: TO SUPPLY ACRYLIC SEALANT,CAVITY WAX,STONE CHIP,METAL FILLER POWDER,REAR WINDSCREEN SEALANT AND 1/4 GLASS SEALANT	1080.00	1.00	1,080.00
X	ABV5809838	(SK) SUBPART (SHARE) Less 020%	1.00	2110.00	1,688.00

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6386 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6386 2323
24-hour Breakdown Service 9826 1233
Email: customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 2 14:40

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120		Invoice No: 85014400	Account: A0006 (T 0)
		Date : 24/10/2019	AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
		Order : SLZ0754D	
		Term : 30	

Regn No: SLZ0754D (V 37448)	Regn Date: 23/04/2018	Mileage: 2487	WIP No.: 59438
Model: A3 SEDAN 1.0 TFSI 6VMANG	Chassis: WAUZZZ8V0J1056451	Engine: CHZ 905146	Dept: U
You have been assisted by :- UB-Kelvin Khoo [138]			

		Details	Qty	Unit Price	Amount	
X	ABV5845298K NVB	SIDE WINDO(SHARE)	Less 020%	1.00	519.50	415.60
X	ABV5845501E NVB	REARWINDOW(LAST)	Less 020%	1.00	741.50	593.20
X	ABK9805673C	SPEED NUT	Less 020%	2.00	1.20	1.92
X	AD 00920002	PRIMER (DG)	Less 020%	2.00	18.60	29.76
X	AN 91233601	NUT	Less 020%	4.00	1.00	3.20
X	AN 10621301	NUT	Less 020%	6.00	1.80	8.64

Parts 2,740.32
Labour 0.00
Sublet 11,202.00
Menus 0.00
Lubricant 0.00



Sub-Total 13,342.32
7% GST 933.96
Grand Total 14,276.28

Received by

For & on behalf of
Premium Automobiles Pte Ltd

Premium Automobiles

Telefax

to AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SLZ 754 D

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/0825/2019/KK
23 July 2019

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

RE: CLAIM - OWNER'S SATISFACTION/DISCHARGE VOUCHER

1

total pages

Make & Model : Audi A3 SEDAN 1.0 TFSI
Vehicle Chassis No. : WAUZZZ8V0J1056451
Vehicle Regn No. : SLZ 754 D
Vehicle Mileage : 2487 KM
Vehicle Owner : Mr. Peh Yew Meng
Certificate No : 1800042841
Own Damage Excess : \$642.00 (Incl. 7% GST)
Accident Date : 4 July 2019
Place : Jung Shan Primary School Carpark
Repair Cost : S 14,276.28
WIP No. : 59438
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6386 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature : 
Time : 2.54pm
Date : 23/7/19

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	05 Jul 2019 17:45		05 Jul 2019 17:07 Edit Adj Rpt	S\$13,942.32 Edit Estimates	S\$13,942.32 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
------	-----------	---------------	-----------	----------

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	PEH YEW MENG, ID: S70293111, Tel: +6597614860, Email: PEH-YEW-MENG@MOE.EDU.SG		
Vehicle Reg. No.:	SLZ754D	Date of Loss:	04/07/2019 07:00 - :59 [14 Months and 11 Days From LTA Reg Date (Man Yr)]
Claim Type:	OD / 0761001098SG	Policy/Cover Note No.:	1800042841 (Comprehensive)
		Excess:	S\$600.00
Repairer:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911		
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Nadaraja, Deeban] Deeban@nadaraja.Nadaraja@aig.com		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6258-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 16/07/2019]		
Driver/Custodian:	PEH YEW MENG (48 / Male) , NRIC: S70293111, Tel: +6597614860 Email: PEH-YEW-MENG@MOE.EDU.SG		

ASSOCIATED MAIL RECEIVED

[View All](#)[Compose Case Mail](#)

- AIG_SG (09/07/2019): Alert - Adj Mandate Approved (S\$14650.00) - SLZ754D - Claim Handler: Nadaraja, D...
- AIG_SG (08/07/2019): SLZ754D / OD / 04/07/2019 / Coverage & Excess update



ALL ASSOCIATED TASKS

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

*SLZ754D (0761001098SG)
OD
Jul 4 2019 7:55AM
[PEH YEW MENG]
Premium Automobiles Pte Ltd

Linked Accident Report Documents

<https://singapore.merimen.com/claims/index.cfm?fusebox=MTRdoc&fuseaction=dsp> ... 6/11/2019

Documentation			1 per page	
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	04/07/19 17:38	Sketch Plan		Load JPG
2	04/07/19 17:38	Sketch Plan #2		Load JPG
3	04/07/19 17:39	POLICE REPORT		Load JPG
4	04/07/19 17:39	POLICE REPORT		Load JPG
5	04/07/19 17:39	POLICE REPORT		Load JPG
6	04/07/19 17:39	POLICE REPORT		Load JPG

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) Show Remarks To: ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #08-16
Singapore 079120

Our File No: CC3/AIG19011946/AQF3N2

Date: 06/11/2019

REFERENCE

Insured/Claimant:	PEH YEW MENG	Policy No:	1800042841	
Date of Loss:	04/07/2019	Nature of Claim:	OD	Claim No: 0761001098SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLZ754D		
Make & Model:	AUDI A3, 999cc SEDAN TFSI (A)	Engine No:	CHZ905146
Reg. Date:	23/04/2018 (Man. Year: 2018)	Chassis No:	WAUZZZ8V0J1056451
Colour:	White	Odometer:	2485 km
Engine Capacity:	999 cc		
Market Value/New Car Price:	S\$95,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	Michelin 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Michelin 6 mm	Rear Right Side:	Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	8,244.00	3,820.32	4,423.68	53.66
Miscellaneous Items	0.00	0.00	0.00	
Labour	17,352.00	10,122.00	7,230.00	41.67
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	25,596.00	13,942.32	11,653.68	45.53
- Excess (S\$)	600.00	600.00	0.00	0.00
(S\$)	24,996.00	13,342.32	11,653.68	46.62
+ GST 7.00/7.00% (S\$)	1,749.72	933.96	815.76	46.62
Nett Amount (S\$)	26,745.72	14,276.28	12,469.44	46.62

INSPECTION

Date of Assignment:	05/07/2019	
Date Inspected:	05/07/2019	Inspected At: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699
Estimated Period of Repair:	13.0 days	

Adjuster: ADRIAN LING

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*REAR FENDER - RHS	Dented	2,110.00 FS	*1,688.00 FS
2	1	*REAR REINFORCEMENT C-PILLAR - RHS	Repair	176.00 FS	*- FS
3	1	*REAR DOOR - RHS	Repair	2,278.00 FS	*- FS
4	1	*REAR OUTER DOOR SEAL - RHS	Not Necessary	146.00 FS	*- FS
5	1	*BONDING AGENT	Not Necessary	45.00 FS	*- FS
6	1	*SLEADING SOLUTION	Not Necessary	65.00 FS	*- FS
7	1	*REAR DOOR CATCH	Not Necessary	85.00 FS	*- FS
8	1	*REAR DOOR ATTACHMENT PARTS - RHS	Not Necessary	117.00 FS	*- FS
9	1	*WHEEL HOUSING LINER	Not Necessary	223.00 FS	*- FS
10	1	*WHEEL HOUSING LINER ATTACHMENT PARTS	Not Necessary	81.00 FS	*- FS
11	1	*REAR WINDOW	Necessary	742.00 FS	*593.20 FS
12	2	*PRIMER	Necessary	76.00 FS	*29.76 FS
13	1	*SIDE WINDOW - RHS	Necessary	520.00 FS	*415.60 FS
14	1	*ACRYLIC SEALANT	Necessary	180.00 FS	*180.00 FS
15	1	*CAVITY WAX	Necessary	140.00 FS	*140.00 FS
16	1	*STONE CHIP	Necessary	180.00 FS	*180.00 FS
17	1	*METAL FILLER POWDER	Necessary	280.00 FS	*280.00 FS
18	1	*REAR W/S SEALANT	Necessary	200.00 FS	*200.00 FS
19	1	*1/4 GLASS SEALANT	Necessary	100.00 FS	*100.00 FS
20	1	*SUNDRIES	Necessary	500.00 FS	*13.76 FS
Total Parts (\$\$)				8,244.00	3,820.32

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND INSTALL REAR PARKING AID.	New	280.00	280.00
2	TO RENEW RHS 1/4 GLASS AND REAR WINDSCREEN TO FACILITATE FENDER RENEWAL.	New	600.00	600.00
3	TO REMOVE AND TRANSFER RHS REAR DOORS MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES.	New	280.00	0.00
4	TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT.	New	1,400.00	1,400.00
5	TO REMOVE AND REINSTALL REAR SEAT, BACK SEAT HAT TRAY, ABCD PILLAR TRIMS, LUGGAGE COMPARTMENT TRIMS. DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAG ETC.	New	1,400.00	1,400.00
6	TO DISMANTLE REAR BUMPER, REAR LID AND RHS REAR DOOR. CUT OUT AND WELD RHS REAR FENDER AND RHS SILL PANEL. TO RENEW RHS REAR DOOR. RE-ORGANIZE REAR CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	New	7,700.00	3,500.00
7	TO RESPRAY RHS REAR FENDER, RHS INNER PANEL, RHS SILL PANEL, RHS REAR DOOR, DOOR ENTRANCES, ROOF CHANNEL, DRIAN PANEL AND END PANELLING. TO CARRY OUT STONE CHIP TREATMENT AND JOINT SEALER WORKS.	New	5,500.00	2,750.00
8	TO CARRY OUT DIAGNOSTIC CHECK.	New	192.00	192.00
Gross Labour Cost (S\$)			17,352.00	10,122.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >