



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

EQ INSURANCE COMPANY LTD

INV No. AC2105171

5 MAXWELL ROAD  
#17-00 TOWER BLOCK  
MND COMPLEX  
SINGAPORE 069110

INV Date 26/07/2021  
Reference CC6/EQI19012140/Upa3q2  
Code EQI

### PROFESSIONAL SERVICE FEE

Vehicle No. SLP 5326B  
Insured Veh. YN 8401D  
Claim No. DM19HO01955/JT  
Policy No. DMCPHQ18-004013  
Accident Date 09/07/2019  
Inspection Date 09/07/2019

| Description         | Total         |
|---------------------|---------------|
| Survey Inspection   | 300.00        |
| Resurvey Inspection |               |
| Digital Photographs |               |
| Transportation      |               |
| <b>Subtotal</b>     | <b>300.00</b> |
| <b>GST (7%)</b>     | <b>21.00</b>  |
| <b>Grand Total</b>  | <b>321.00</b> |

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

| Affiliated to Federation Internationale Des Experts En Automobile                                                                      |                                                                                           |                                                              |            |
|----------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------|--------------------------------------------------------------|------------|
| EQ INSURANCE COMPANY LTD<br>5 MAXWELL ROAD<br>#17-00 TOWER BLOCK<br>MND COMPLEXSINGAPORE 069110                                        |                                                                                           | Ref: CC6/EQI19012140/Upa3q2<br>Date: 26/07/2021<br>Code: EQI |            |
| <b>1. Policy Particulars :- THIRD PARTY CLAIM</b>                                                                                      |                                                                                           |                                                              |            |
| Insured Veh.                                                                                                                           | YN 8401D                                                                                  | Veh. Inspected                                               | SLP 5326B  |
| Policy No.                                                                                                                             | DMCPHQ18-004013                                                                           | Coverage (\$)                                                | 0.00       |
| Claim No.                                                                                                                              | DM19HO01955/JT                                                                            | Excess (\$)                                                  | 0.00       |
| Assign From                                                                                                                            |                                                                                           | Assign Date                                                  | 09/07/2019 |
| <b>2. Vehicle Particulars &amp; Condition</b>                                                                                          |                                                                                           |                                                              |            |
| Make & Model                                                                                                                           | BMW 640 (A)                                                                               | c.c                                                          | 2979       |
| Engine No.                                                                                                                             | HIDDEN                                                                                    | Year of Reg.                                                 | 2012       |
| Chassis No.                                                                                                                            | WBALW32040DW91193                                                                         | Colour                                                       | WHITE      |
| Odometer                                                                                                                               | 101330 KM                                                                                 | Steering                                                     | IN ORDER   |
| Brakes                                                                                                                                 | IN ORDER                                                                                  | Modification                                                 | SPORTS RIM |
| General                                                                                                                                | GOOD                                                                                      |                                                              |            |
| <b>3. Conditions of Tyres</b>                                                                                                          |                                                                                           |                                                              |            |
|                                                                                                                                        | Size                                                                                      | Make                                                         | Balance    |
| R/H Front Tyre                                                                                                                         | 255/35 ZR20                                                                               | MICHELIN                                                     | 6 mm       |
| L/H Front Tyre                                                                                                                         | 255/35 ZR20                                                                               | MICHELIN                                                     | 6 mm       |
| R/H Rear Tyre                                                                                                                          | 285/30 ZR20                                                                               | MICHELIN                                                     | 6 mm       |
| L/H Rear Tyre                                                                                                                          | 285/30 ZR20                                                                               | MICHELIN                                                     | 6 mm       |
| <b>4. Description of Damages</b>                                                                                                       |                                                                                           |                                                              |            |
| THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.<br>DAMAGES SEE DETAILS.                                                             |                                                                                           |                                                              |            |
| <b>5. General Information</b>                                                                                                          |                                                                                           |                                                              |            |
| Accident Date                                                                                                                          | 09/07/2019                                                                                | Inspection Date                                              | 09/07/2019 |
| Survey held at                                                                                                                         | FASTECH AUTO PTE LTD<br>1 KAKI BUKIT AVENUE 6<br>#01-46/48/50 AUTOBAY<br>SINGAPORE 417883 |                                                              |            |
| <b>5a. Remarks</b>                                                                                                                     |                                                                                           |                                                              |            |
| A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.<br>B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS. |                                                                                           |                                                              |            |
| <b>5b. Estimate Days of Repair</b>                                                                                                     |                                                                                           |                                                              |            |
| ESTIMATED NORMAL PERIOD FOR REPAIR:                                                                                                    |                                                                                           | 8 Working Days                                               |            |



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLP 5326B

| Qty | Description of Parts                      | Condition            | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|-------------------------------------------|----------------------|---------------------------|-------------------|
|     | <b><u>REPLACEMENT OF PARTS</u></b>        |                      |                           |                   |
| 1   | BOOTLID                                   | WARPED / CRACKED     | 3,500.00                  | 2,866.00          |
| 1   | BOOTLID REAR LOGO                         | NECESSARY            | 86.60                     | 86.60             |
| 1   | BOOTLID WEATHERSTRIP                      | TWISTED              | 245.35                    | 245.35            |
| 1   | BOOTLID INNER LOCK                        | TWISTED / SHORTED    | 302.10                    | 302.10            |
| 2   | BOOTLID REFLECTORS @\$850.00              | NOT NECESSARY        | 1,700.00                  | -                 |
| 1   | BOOTLID LOCK PUMP                         | DAMAGED / SHORTED    | 680.00                    | 680.00            |
| 1   | BOOTLID THIRD BRAKE LIGHT                 | NOT NECESSARY        | 295.00                    | -                 |
| 1   | BOOTLID INNER TRIM                        | NOT NECESSARY        | 485.00                    | -                 |
| 1   | SET BOOTLID INNER TRIM CLIPS              | NOT NECESSARY        | 50.00                     | -                 |
| 2   | TAILLAMPS @\$880.00                       | CRACKED              | 1,760.00                  | 1,760.00          |
| 1   | REAR BUMPER                               | DISTORTED            | 2,800.10                  | 1,812.00          |
| 1   | REAR BUMPER LOWER SKIRTING                | TO REPAIR SEE LABOUR | 820.00                    | -                 |
| 2   | REAR BUMPER SIDE HOLDER @\$155.00         | BENT / CRACKED       | 310.00                    | 310.00            |
| 1   | SET REAR BUMPER CLIPS                     | NECESSARY            | 60.00                     | 60.00             |
| 1   | REAR BUMPER LOWER TRAY                    | CRACKED              | 166.50                    | 166.50            |
| 1   | REAR BUMPER REINFORCEMENT                 | BENT                 | 781.20                    | 781.20            |
| 4   | REAR BUMPER PDC SENSORS @\$266.00         | SHORTED (2 PCS ONLY) | 1,064.00                  | 532.00            |
| 1   | REAR BUMPER PDC SENSOR WIRE               | NOT NECESSARY        | 313.54                    | -                 |
| 1   | REAR BUMPER TOP GUIDE                     | CRACKED              | 199.50                    | 199.50            |
| 2   | REAR BUMPER REFLECTORS @\$60.00           | CRACKED              | 120.00                    | 120.00            |
| 2   | REAR BUMPER LICENCE PLATE LAMPS @\$150.00 | NOT NECESSARY        | 300.00                    | -                 |
| 1   | REAR BUMPER INNER PAD                     | CRACKED              | 288.20                    | 288.20            |
| 1   | REAR END PANEL                            | BADLY DENTED         | 1,018.12                  | 1,018.12          |
| 1   | REAR END PANEL TOP GARNISH                | TWISTED              | 366.00                    | 366.00            |
| 1   | REAR FLOOR PANEL                          | TO REPAIR SEE LABOUR | 899.00                    | -                 |
| 1   | REAR FLOOR PANEL TOP BOARD                | NOT NECESSARY        | 422.00                    | -                 |
| 2   | SEATBELT BUCKLES @\$450.00                | NOT NECESSARY        | 900.00                    | -                 |

Report Ref No. CC6/EQI19012140/Upa3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

| Qty                | Description of Parts                                                                                                                                             | Condition            | Estimate By Workshop (\$) | Our Adjusted (\$) |
|--------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------|-------------------|
| 1                  | DRIVER SEAT                                                                                                                                                      | TO REPAIR SEE LABOUR | 3,800.00                  | -                 |
| 2                  | FRONT HEADREST RESTRAINT REPAIR KITS @\$305.00                                                                                                                   | ACTIVATED            | 610.00                    | 420.00            |
| 1                  | REAR EXHAUST N/S                                                                                                                                                 | TO REPAIR SEE LABOUR | 1,850.00                  | -                 |
| 1                  | REAR FENDER                                                                                                                                                      | TO REPAIR SEE LABOUR | 1,899.00                  | -                 |
|                    | LESS 5% DISCOUNT                                                                                                                                                 |                      | -                         | -600.68           |
|                    |                                                                                                                                                                  |                      | 28,091.21                 | 11,412.89         |
|                    | <b><u>SPECIAL NETT ITEMS</u></b>                                                                                                                                 |                      |                           |                   |
| 1                  | REAR LICENCE PLATE W/HOLDER (SN)                                                                                                                                 | CRACKED              | 50.00                     | 40.00             |
| 1                  | REAR END PANEL SEALANT (SN)                                                                                                                                      | NECESSARY            | 50.00                     | 50.00             |
| 1                  | SETS REAR EXHAUST CHROME (SN)                                                                                                                                    | DENTED               | 180.00                    | 180.00            |
|                    |                                                                                                                                                                  |                      | 280.00                    | 270.00            |
|                    | <b><u>LABOUR</u></b>                                                                                                                                             |                      |                           |                   |
|                    | TO CHECK WIRING.                                                                                                                                                 |                      | 80.00                     | 30.00             |
|                    | TO DISMANTLE & REPLACING PDC SENSOR.                                                                                                                             |                      | 100.00                    | 50.00             |
|                    | TO TRANSFER BOOTLID MECHANISM.                                                                                                                                   |                      | 120.00                    | 80.00             |
|                    | TO DISMANTLE & REFIX REAR EXHAUST.                                                                                                                               |                      | 180.00                    | 40.00             |
|                    | TO DISMANTLE & REFIX PETROL TANK .                                                                                                                               | NOT NECESSARY        | 100.00                    | -                 |
|                    | TO DISMANTLE & REFIX SEAT ,CUSHION UPHOLSTERY.                                                                                                                   |                      | 150.00                    | 100.00            |
|                    | TO RESET & REPROGRAM ERROR CODE.                                                                                                                                 |                      | 300.00                    | 200.00            |
|                    | TO SPRAY RUST PROOFING.                                                                                                                                          |                      | 100.00                    | 50.00             |
|                    | LABOUR FOR PANEL BEATING & REPLACING PARTS.INCLUSIVE OF THE REPAIR OF REAR BUMPER LOWER SKIRTING,REAR FLOOR PANEL,DRIVER SEAT ,REAR EXHAUST N/S AND REAR FENDER. |                      | 2,000.00                  | 800.00            |
|                    | TO PUTTY & SPRAY PAINTING.                                                                                                                                       |                      | 1,500.00                  | 1,080.00          |
|                    |                                                                                                                                                                  |                      | 4,630.00                  | 2,430.00          |
| <b>GRAND TOTAL</b> |                                                                                                                                                                  |                      | <b>33,001.21</b>          | <b>14,112.89</b>  |

Report Ref No. CC6/EQI19012140/Upa3q2



|                                                                                 |  |  |                  |
|---------------------------------------------------------------------------------|--|--|------------------|
| <b>RECOMMENDED COST OF LUMP SUM REPAIRS<br/>(TO ITS PRE-ACCIDENT CONDITION)</b> |  |  | <b>11,200.00</b> |
|---------------------------------------------------------------------------------|--|--|------------------|

Report Ref No. CC6/EQI19012140/Upa3q2

**CHUA KANG SENG**

**Licensed Appraiser**

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.**

**No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.**



## LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. SLP 5326B

### INSPECTION

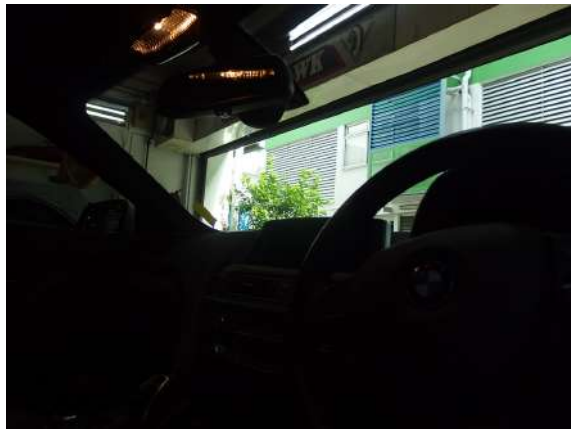



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

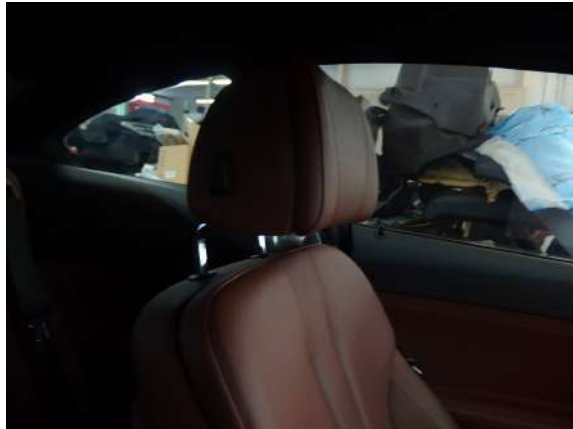





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

**PHOTOGRAPHS FOR VEHICLE NO. SLP 5326B**

**RE-INSPECTION**





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLP 5326B

RE-INSPECTION





## **LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. SLP 5326B

### RE-INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

