

ASS. REC. BY:

REF: CS/INC19012149/BSF302

Special Instruction:

Surveyor: MF-HM

ASSIGNMENT (Office)

From (Person): Cynthia Ang

of

INC

Date/Time: 9/7/19 @ 10.09am

Estimated Cost:

Bill to:

OD ☒ TP FWS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SLU 1663C

Insured:

SGS 3819C

at Workshop m/s Team Autopro

Tel:

62581955.

of 10 Sir Ming Ind. Est. Sec. C # 01-20

Policy No:

Claim No:

MT/1052486-001

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

6/7/2019

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time: 10:11am @ 9/7/19

Person Contacted:

Michelle

Vehicle ☒ IN ☐ OUT

Date/Time

Action/Instruction

Schmidt

SGS 3819C : X

SLU 1663C : X

RECEIVED 11 DEC 2019

ASS. REC. BY:

REF: INC

ASSIGNMENT

From:

Date:

9/7/19

Estimated Cost:

OD ☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

SLU 1663C

at Workshop m/s

Team Autopro

of

10 Sin Ming Ind. Est. & C. # 01-20

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

133,000/2

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

25

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS (up)

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SLU 1663C

Yr Regn: 24/11/2017

Type: ☒ M.Car / ☐ M.Cycle / ☐ Bus / ☐ Van / ☐ Lorry / ☐ Taxi / ☐ Prime Mover /

Truck / Trailer or

Make:

Toyota Estima

c.c 2363

Colour:

Brown

A/C: Insured / Std / NI / NA

Sp. Reading

30887

T/Radio: Insured / Std / NI / NA

Eng/No:

2AZL016295

C/No:

ACR507147924

Gen. Cond: Good / Fair / ☒ Poor / BurntSteering: ☒ Inorder / Jammed / Leaked / Burnt orBrake: ☒ Inorder / Jammed / Leaked / Burnt orModi: Nil / ☒ S/Rim / STD A/Rim or

Tyre Size:

F: 225/50/18

R: 225/50/18

BS ☒ DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

7

mm

R/Bal.

7

mm

L/Bal.

7

mm

L/Bal.

7

mm

D.O.A.

6/7/19

D.O.I.

9/7/19

0302PM

Survey held at

Team Autopro

Des. of Damages: Frt / Rear / ☒ O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	LIM 1 PLS SEE my remarks
	(\$ 19,812.08 Red - 47%)
	Cost of repair \$ 22,425.43 TCRim 11/19 15/10/19
	+ 40000
	MV 133,000/2 22,825.43 Finalized with Jha ka on 3/12/19
	PV 80,186/2 at 22825.43 with 25 days TCRim 11/19
	NV 52,814/2 for repair TCRim 11/19 10/7/19

Date/Time, File Pass to?

11/2/19



Preli. Report



Final Report

1)

Type 4

Date/Time, File Return to?

2)

Days Of Repair:

4/12/19
25

Resurvey No. of Trip:

4

Add Fee:



Site Insp (\$



Interview (\$



Tech. Invs (\$



Weekend (\$

Survey Fee:

290

Transportation:

S + RS. \$

Photos

Others

TOTAL

290

Report Format:

Lump Sum / L&A (\$

22,825.43 p/h

Nivitha (LKK Auto)

From: Cynthia Ang <Cynthia.Ang@income.com.sg>
Sent: Tuesday, 9 July 2019 3:44 PM
To: 'assignments@lkkauto.com'; Admin-D (LKKAuto)
Subject: RE: TP CASES FARMED OUT TO LKK ON 09/07/2019

Dear LKK,

Resend with the following details.

Thank you.

With Regards

Cynthia Ang
Admin Assistant
Motor Insurance
T +65 6430 7900
www.income.com.sg



At Income, we are 'In with You' on Performance, Growth, Innovation and Impact. These attributes reflect what we promise as an employer and what we want our people to exemplify.
Find out more at Income.com.sg/careers

in with
you

PLEASE CONSIDER OUR ENVIRONMENT BEFORE YOU PRINT THIS EMAIL...

From: Cynthia Ang
Sent: Tuesday, 9 July 2019 10:09 AM
To: 'assignments@lkkauto.com' <assignments@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>
Cc: Clarence Richard Anthony <clarence.anthony@income.com.sg>; Thio Tse Kiat <tsekiat.thio@income.com.sg>
Subject: TP CASES FARMED OUT TO LKK ON 09/07/2019

Dear LKK,

Please assist to survey the following vehicles as per Mr Teng's instruction :-

SN	OIC	Claim No.	Vehicle	WorkShop Name	WorkShop Address	WorkShop Contact	Survey Time	OI VEH	DOA	Additional Remarks
1	Eng Huey Huey	MT/1052486-001	SLU1663C	TEAM AUTOPRO PTE LTD	10 SIN MING INDUSTRIAL ESTATE SECTOR C #01-20 SINGAPORE 575645	Peach Ang / 6258 1955		SGS3819C	06/07/2019	
2	Chryllis Quah	MT/1052455-001	SJ1671S	THIAM HENG HUAT PTE LTD	176 SIN MING DRIVE #05-14 SIN MING AUTOCARE	Steven / 82636295		SGK2950D	06/07/2019	
3		Pending advice	SML1145S	THIAM HENG HUAT PTE LTD	176 SIN MING DRIVE #05-14 SIN MING AUTOCARE	Steven / 82636295				
4	Eric Tang	MT/1049590-002	SLE2735G	THIAM HENG HUAT PTE LTD	176 SIN MING DRIVE #05-14 SIN MING AUTOCARE	Steven / 82636295		SLW1005S	31/05/2019	
5	Eng Huey Huey	MT/1052137-002	SME1876C	SK AUTOMOBILE PTE LTD	8 KAKI BUKIT AVENUE 4 #08-46 PREMIER@KAKI BUKIT	Chris / 6702 1555		FBP8126K	05/07/2019	
6	Jared Liu	MT/1052296-002	SJT8373Y	TORQUE 5 PTE LTD	8 KAKI BUKIT AVE 4 #01-50 PREMIER @ KAKI BUKIT	Lucas / 8131 6318		WC5674J	06/07/2019	
7	Chryllis Quah	MT/1052398-002	SBM131M	VISION AUTOWORK PTE. LTD.	KAKI BUKIT AVENUE 4 #08-09 PREMIER @ KAKI BUKIT	Michelle / 6341 6789		SJF4431M	06/07/2019	
8	Azhari	MT/1033901-001	FBL7115U	HOME ADDRESS	25 KAKI BUKIT ROAD 4 #01-68 SYNERGY @ KB SINGAPORE 417800	Li Tian / 90054320		SKM1972P	17/02/2019	WORKSHOP NAME IS TUCK LIFE
9	Muhammad Airwan	MT/1050613-002	SJB9855L	PRO-JEX V2D MOTOR PTE LTD	25 KAKI BUKIT ROAD 4 #03-93 SYNERGY @ KB	Edmund / 8668-7666		FBM4589A	24/06/2019	
10	Chryllis Quah	MT/1034631-002	FBK8414E	PRO-JEX V2D MOTOR PTE LTD	25 KAKI BUKIT ROAD 4 #03-93 SYNERGY @ KB	Edmund / 8668-7666		SJW8544E	01/03/2019	
11		Pending advice	GP3838M	SM AUTOMOTIVE	BLOCK C, 1 KAKI BUKIT AVENUE 6 #01-43 SINGAPORE 417883	Sukyi Chong / 6747 9241				

12	Pending advice	SKQ7188B	ZOOM AUTOWERKS PTE LTD	15 KAKI BUKIT ROAD 4, BARTLEY BIZ CENTRE, #01-53	Elin Cai / 9450 7920				
----	----------------	----------	------------------------	--	----------------------	--	--	--	--

Please contact workshops.

Please revert to officer-in-charge after survey.

Thank you.

With Regards

Cynthia Ang
Admin Assistant
Motor Insurance
T +65 6430 7900
www.income.com.sg

income
made different



At Income, we are 'In with You' on Performance, Growth, Innovation and Impact. These attributes reflect what we promise as an employer and what we want our people to exemplify.
Find out more at Income.com.sg/careers

in with you

PLEASE CONSIDER OUR ENVIRONMENT BEFORE YOU PRINT THIS EMAIL...

Disclaimer

This e-mail contains privileged or confidential information which is intended only for the use of the recipient(s) named above. If you have received this message in error, please notify the sender immediately and delete all copies of it. Thank you.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT	
Date Of Report	08/07/2019 17:16
Date Of Accident	06/07/2019 20:15
Exact Location Of Accident	ALONG PASIR RIS DR 3
Country/State of Loss	SINGAPORE
DETAILS OF OWN VEHICLE	
Vehicle Registration Number	SLU1663C
Insured/Policyholder	
Name Of Registered Owner	HAMZAH BIN MUHIT
NRIC No	S1695273G
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-96411541
Alternative Phone No	OFFICE-96411541
Vehicle Particulars	
Manufacturer	TOYOTA
Model	ESTIMA
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR
Insurance Company	
Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	GA295519/1
Cover Note Number	
Driver	
Name of Driver	HAMZAH BIN MUHIT
NRIC No	S1695273G
Date Of Birth	28/08/1965
Occupation	INDOOR
Date Of Driving Pass	17/08/1993
Driving Experience	25 YEARS AND 10 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-96411541
Fax Number	
Contact Number	OFFICE-96411541
EEmail Address	NOEMAIL

Address	APT BLK 533 PASIR RIS DR 1 #13-254
Postcode	510533
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO ATTACHED

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SGS3819C
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	TIA LEE TECK ALEX
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	


SKETCH PLAN

IMPORTANT NOTICE

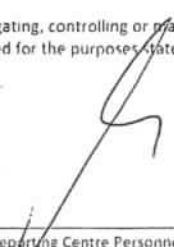
1. Please report correctly the details of the accident to speed up the claims process
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

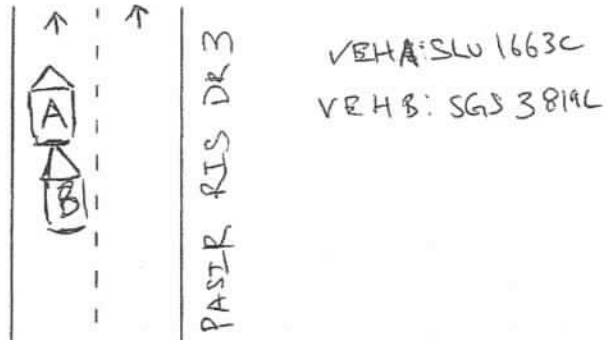
- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes, and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


Policyholder's Signature
Date & Time

Driver's Signature
(If driver is not the policyholder)
Date & Time


Reporting Centre Personnel's Signature
Name
NRIC/FIN No.

SKETCH PLAN





DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

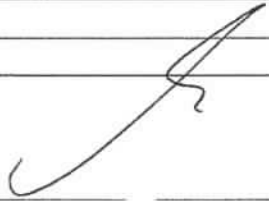
On the above stated date and time. I VEH A SLV1663C was stationary on Pasir Ris Dr 3. I was in the mosque next to my park vehicle. Suddenly I heard a loud bang. I came out to check what has happen and found out that a vehicle bearing car plate number SGS 3819 C (VEH B) have collided into my vehicle rear portion.

DECLARATION

I/We declare the foregoing particulars are true in every respect


Policyholder's Signature
Date & Time:


Driver's Signature
(If driver is not the policyholder)
Date & Time:


Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

TEAM AUTOPRO PTE LTD

385 SING MING DRIVE
#01-02 VICOM INSPECTOM CENTRE
SINGAPORE 575718
TEL : 82699999
EMAIL : TEAMAUTOPL@GMAIL/TEAMAUTOOFFICE@GMAIL.COM

Vehicle:	SLU 1663 C
Model:	TOYOTA ESTIMA
Chassis:	

NO	DESCRIPTION	QTY	LIST	DISC	PRICE	SURVEYORS MARKING
1	TAIL GATE DD✓	1		25%	\$ -	
2	TAIL GATE EMBLEM LOGO } NEC✓	1		25%	\$ -	
3	TAIL GATE EMBLEM ESTIMA } NEC✓	1		25%	\$ -	
4	TAIL GATE GARNISH BR✓	1		25%	\$ -	
5	TAIL GATE HINGE LH } ? BT✓	1		25%	\$ -	
6	TAIL GATE HINGE RH } ? BT✓	1		25%	\$ -	
7	TAIL GATE ABSORBER LH } ? NEC✓	1		25%	\$ -	
8	TAIL GATE ABSORBER RH } ? NEC✓	1		25%	\$ -	
9	TAIL GATE LOCK } JM✓	1		25%	\$ -	
10	TAIL GATE LOCK CATCH } JM✓	1		25%	\$ -	
11	TAIL GATE LOCK CATCH COVER ? DIS✓	1		25%	\$ -	
12	TAIL GATE PLATE LAMP LH } BR✓	1		25%	\$ -	
13	TAIL GATE PLATE LAMP RH } BR✓	1		25%	\$ -	
14	TAIL GATE LAMP LH } BR✓	1		25%	\$ -	
15	TAIL GATE LAMP RH } BR✓	1		25%	\$ -	
16	TAIL GATE CENTER GARNISH BR✓	1		25%	\$ -	
17	TAIL GATE WHEATHER STRIP ? TN✓	1		25%	\$ -	
18	TAIL GATE INNER TRIM BR✓	1		25%	\$ -	
19	RR WINDSCREEN MLDG NEC✓	1		25%	\$ -	
20	TAIL LAMP LH ? NNX	1		25%	\$ -	
21	TAIL LAMP RH BR✓	1		25%	\$ -	
22	TAIL LAMP PANEL LH NNX	1		25%	\$ -	
23	TAIL LAMP PANEL RH DD✓	1		25%	\$ -	
24	RR BUMPER BR✓	1		25%	\$ -	
25	RR BUMPER RETAINER LH LONG } BR	1		25%	\$ -	
26	RR BUMPER RETAINER RH LONG } BR	1		25%	\$ -	
27	RR BUMPER RETAINER LH SHORT } BR	1		25%	\$ -	
28	RR BUMPER RETAINER RH SHORT } BR	1		25%	\$ -	
29	RR TOWING COVER CUT✓	1		25%	\$ -	
30	RR BUMPER REFLECTOR LH NNX	1		25%	\$ -	
31	RR BUMPER REFLECTOR RH BR✓	1		25%	\$ -	
32	RR BUMPER SPONGE LH } ? NNX	1		25%	\$ -	
33	RR BUMPER SPONGE RH } ? BR✓	1		25%	\$ -	
34	REVERSE SENSOR DL✓	1		25%	\$ -	
35	RR FENDER RH DD✓	1		25%	\$ -	
36	RR FENDER QUARTER GLASS RH BR✓	1		25%	\$ -	
37	RR FENDER QUARTER GLASS MLDG NEL✓	1		25%	\$ -	
38	RR FENDER INNER SHIELD RH BR✓	1		25%	\$ -	
39	RR FENDER INNER TRIM RH LOWER BT✓	1		25%	\$ -	
40	RR FENDER INNER TRIM RH MID BT✓	1		25%	\$ -	
41	RR RH CENTER PILLAR GARNISH } BT✓	1		25%	\$ -	
42	RR RH FENDER PILLAR GARNISH } BT✓	1		25%	\$ -	
43	RR CUP HOLDER GARNISH BT✓	1		25%	\$ -	
44	RR FENDER INNER TRIM SIDE COVER BT✓	1		25%	\$ -	
45	RR FENDER INNER DECK PANEL ? DIS✓	1		25%	\$ -	

46	RR WHEEL HOUSE RH	BT✓	1	25%	\$	-	
47	RR RIM RH	?	1	25%	\$	-	
48	RR CHASSIS RH	? BT✓	1	25%	\$	-	
49	RR END PANEL	DD✓	1	25%	\$	-	
50	RR END PANEL TOP GARNISH	DL✓	1	25%	\$	-	
51	REAR FLOOR PANEL	? DD✓	1	25%	\$	-	
52	LUGGAGE COMPARTMENT	? DD✓	1	25%	\$	-	
53	LUGGAGE COMPARTMENT TOP BOARD	BR✓	1	25%	\$	-	
54	RR AXLE BEAM	?	1	25%	\$	-	
55	RR ABSORBER LH	} ?	1	25%	\$	-	
56	RR ABSORBER RH	} ?	1	25%	\$	-	
57	RR WHEEL HUB LH	} ?	1	25%	\$	-	
58	RR WHEEL HUB RH	} ?	1	25%	\$	-	
59	RR SLIDING DOOR RH	DD✓	1	25%	\$	-	
60	RR SLIDING DOOR RH HINGE UPPER	} ?	1	25%	\$	-	
61	RR SLIDING DOOR RH HINGE LOWER	} ?	1	25%	\$	-	
62	RR WS INNER SIDE GARNISH LH	NNX	1	25%	\$	-	
63	RR WS INNER SIDE GARNISH RH	DD✓	1	25%	\$	-	
64	RR WS INNER UPPER GARNISH RH	NNX	1	25%	\$	-	
65	RR FENDER RH AIR VENT	Rubber ?	1	25%	\$	-	
66	RR EXHAUST MUFFLER	? BT✓	1	25%	\$	-	
67	RR EXHAUST MUFFLER MLDG	? DIS✓	3	25%	\$	-	
68	RR EXHAUST MUFFLER GASKET	? NEL✓	1	25%	\$	-	
69	RR EXHAUST CENTER PIPE	?	1	25%	\$	-	
70	BEZEL, POWER OUTLET SOCKET	?	1	25%	\$	-	
71	RR DECK INNER LAMP RH	? NNX	1	25%	\$	-	
72	RR SEAT BELT RH	JAM✓	1	25%	\$	-	
73	CENTER SEAT BELT RH	NNX JAM✓	1	25%	\$	-	
74	AIGBAG ECU	Activated	1	25%	\$	-	
75	RR IMPACT SENSOR	Activated	1	25%	\$	-	
76	CENTER STEP GARNISH RH	?	1	25%	\$	-	
77	REAR SEAT RH	} ?	1	25%	\$	-	
78	REAR SEAT LH	} ?	1	25%	\$	-	
				TOTAL:	\$	-	

	SPECIAL NETT	QTY	PRICE	SURVEYOR MARKING
1	RR BUMPER CLIP	1	\$ 30.00 45.00	
2	RR END PANEL TOP GARNISH CLIP	1	\$ 30.00 45.00	
3	RR TAIL GATE INNER TRIM CLIP	1	\$ 30.00 45.00	
4	RR FENDER INNER SHIELD CLIP LH	1	\$ 30.00 45.00	
5	RR FENDER INNER SHIELD CLIP RH	1	\$ 30.00 45.00	
6	RR FENDER QUARTER GLASS SEALANT	1	\$ 60.00	

7	RR WINDSCREEN DAMPER	?NECV	1	\$	50.00	
8	RR WINDSCREEN SEALANT	NECV	1	\$	60.00	
9	RR WINDSCREEN PRIMER	NA X	1	\$	40.00	
10	RR END PANEL SEALANT	NECV	1	\$	60.00	
11	RR SPARE TYRE PANEL SEALANT	?NECV	1	\$	60.00	
12	RR FENDER SEALANT RH	NECV	1	\$	60.00	
13	RR SLIDING DOOR INNER TRIM CLIP RH	NECV	1	\$	30.00 40.00	
14	RR TYRE RH	BRV	1	\$	450.00	
15	RR WS INNER TRIM CLIPS(LH/RH/UPPER)	NECV	1	\$	90.00 120.00	
16	RR WINDSCREEN TINTED	NECV	1	\$	350.00	
17	RR FENDER QUARTER GLASS TINTED	NECV	1	\$	350.00	
				\$	1,575.00	

	LABOUR	PRICE	SURVEYOR MARKING
1	TO STRAIGHTEN AND PANEL BEAT ON ACCIDENT AREAS	\$ 3,500.00	3000.00
2	R&R REAR WINDSCREEN	\$ 180.00	120.00
3	R&R SPARE TYRE BOARD ,CARPET,INNER TRIM	\$ 250.00	50.00
4	R&R REAR SEAT AND RR SEAT BELT RH	\$ 200.00	120.00
5	R&R MID SEAT ,CARPET AND SEAT BELT RH	\$ 200.00	120.00
6	R&R TAIL GATE COMPONENTS	\$ 200.00	120.00
7	R&R SLIDING DOOR COMPONENTS	\$ 200.00	120.00
8	R&R ROOF TOP LINING TO ASSIST REPLACE RR FENDER	\$ 350.00	200.00
9	R&R RR FENDER QUARTER GLASS	\$ 350.00	80.00
10	R&R RR ALXE	\$ 350.00	200.00
11	R&R REAR SUSPENSION AND REPLACE WHEEL BEARING	\$ 250.00	120.00
12	R&R FUEL TANK	\$ 350.00	150.00
13	ALL WHEEL ALIGNMENT	\$ 180.00	60.00
14	MOUNT WORKBENCH	\$ 300.00	200.00
15	ALIGNMENT RR CHASSIS	\$ 300.00	200.00
16	CONDUCT AND TEST WATER LEAKING	\$ 180.00	NA X
17	TO PUTTY AND SPRAY ON RR BUMPER ,TAIL GATE INNER ,TAIL GATE OUTER ,RR END PANEL ,SPARE TYRE PANEL , RR FENDER RH ,RR FENDER LH,RR FENDER INNER DECK PANEL ,RR WHEEL HOUSE RH , RR SLIDING DOOR RH , FRONT DOOR RH	\$ 3,000.00	1800.00
18	R&R SIDE STEP GARNISH TO REPLACE GARNISH	\$ 180.00	50.00
19	R&R SLIDING DOOR MOTOR TO REPLACE SLIDING DOOR	\$ 250.00	80.00
20	R&R DASHBOARD AND CONSOLE TO REPLACE AIRBAG ECU	\$ 250.00	100.00
21	TO CLEAN UP AND VACUUM QUARTER GLASS	\$ 150.00	NA X
22	RUSH PROOFING	\$ 100.00	60.00
23	TO CHECK WIRING AND TEST ALL DISMANTLE ELECTRICAL PART	\$ 200.00	50.00
24	TO RESETTING AND RECODE AIRBAG ECU	\$ 180.00	100.00
25	TO CHECK FAULT CODE AND RESET FAULT CODE	\$ 180.00	NA X
	TOTAL:	\$ 11,830.00	

Survey on 9/7/19
 @ 1600hrs
 TGTlin
 part by part repair
 SREF


PARTS	\$	-
LABOUR	\$	11,830.00
SPECIAL NETT	\$	1,575.00
TOTAL	\$	13,405.00

Resurvey on 17/7/19
 1610 hrs
 TGTlin lin
 Repair days 25

7	Rear gate stopper bracket	2	\$ 186.70	\$ 373.40	BT ✓
8	Rear gate reflector	2	\$ 28.50	\$ -57.00	SVC ✓
	Coolant tank	1	\$ 156.00	\$ 156.00	} SVC ✓
	Fuel tank	1	\$ 345.00	\$ 345.00	

Parts Sub Total :	\$ 22,688.20
20% Discount	\$ 4,537.64
PARTS TOTAL :	\$ 18,150.56

Nos.	SPECIAL NETT	Qty	Unit S\$	TOTAL S\$	
1	Front door inner board clips Rh	1	\$ 50.00	\$ 50.00	NDMA
2	Front door inner pillar cover clips Rh	3	\$ 7.00	\$ 21.00	NECV
3	Front door LTA sticker	1	\$ 40.00	\$ 40.00	NECV
4	Brake fluid	1	\$ 18.00	\$ 18.00	SVC ✓
2	Rear Gate sticker '70km/h'	1	\$ 30.00	\$ 30.00	} N/A
3	Rear gate sticker '10 pax'	1	\$ 30.00	\$ 30.00	
7	Rear canopy	1	\$ 2,800.00	\$ 2,800.00	SVC ✓
13	Cabin rear panel glass moulding	1	\$ 100.00	\$ 100.00	?
5				\$ -	
SPECIAL NETT TOTAL :				\$ 3,089.00	

Nos.	LABOUR	S\$	
1	Panel beating	\$ 200.00	2,000.00
2	Spray painting	\$ 200.00	2,000.00
3	Apply putty and anti-corrosion to affected areas	\$ 60.00	250.00
4	R&R Brake booster pump and bleed system	\$	150.00
5	Check wiring	\$ 30.00	100.00
6	R&R upholstery to facilitate repair	\$ 50.00	150.00
7	R&R door mechanism to new door	\$ 50.00	150.00
6	R&R cabin assy	\$ 50.00	100.00
7	R&R door component	\$	80.00
8	R&R Rear flat bed	\$	250.00
9	R&R Rear gate component	\$	80.00
12	R&R Rear canopy	\$	200.00
8			
LABOUR TOTAL :		\$ 5,510.00	

? Photo

Lump sum repair
Repair days 5

PARTS TOTAL :	\$ 18,150.56
SPECIAL NETT TOTAL :	\$ 3,089.00
LABOUR TOTAL :	\$ 5,510.00
GRAND TOTAL :	\$ 26,749.56

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Tan Min
3/10/19
1425 hrs

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	5273G
Vehicle Details	
Vehicle No.:	SLU1663C
Vehicle to be Exported:	No
Intended Deregistration Date:	10 Jul 2019
Vehicle Make:	TOYOTA
Vehicle Model:	ESTIMA AERAS 2.4 A
Primary Colour:	Brown
Manufacturing Year:	2017
Engine No.:	2AZL016295
Chassis No.:	ACR507147924
Maximum Power Output:	125.0 kW (167 bhp)
Open Market Value:	\$36,649.00
Original Registration Date:	24 Nov 2017
First Registration Date:	24 Nov 2017
Transfer Count:	0
Actual ARF Paid:	\$43,309.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	23 Nov 2027
PARF Rebate Amount:	\$32,481.00
Intended COE Rebate Details	
COE Expiry Date:	23 Nov 2027
COE Category:	E - Open - all except motorcycle
COE Period(Years):	10
QP Paid:	\$57,000.00
COE Rebate Amount:	\$47,705.00
Total Rebate Amount:	\$80,186.00

The information contained herein is correct as at 10 Jul 2019

OK

MV 133,000/2
 PV 80,186/2
 NV 52,814/2

TTCim
 10/7/19

EXPERIENCE AMAZING WITH LEXUS

LUXURY REIMAGINED


[BOOK A TEST DRIVE](#)

Post an Advertisement
Sell it yourself! Advertise it at just
\$58 until it's SOLD!

[Post an Ad](#)
[Advertiser Login](#)
[Ways of Selling](#)

New 5 Years Renewal Coe Honda Stream 1.8A



3.18% P.A \$0 Admin Fees At GV
Finance. 2 Years Warranty.
Monthly From \$688
GV Credit Pte Ltd StarAd



VALUE FOR MONEY
VALUE FOR TIME
A PEACE OF MIND

HOTLINE: 6741 9997

[view our cars](#)
[Browse by Category](#)
[Sort by Reg. Date](#)
[20 results/page](#)

9 vehicles

Toyota Estima

[Advanced Search](#)

	Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Search Selection	Toyota Estima		Any	Any	2017	Any	Any	Any	All
	Toyota	Estima 2.4A Aeras	\$145,000	\$14,950 /yr	01-Dec-2017	2,362 cc	-	MPV	Available
As Good As New. Well Maintained. Mileage On Ask. Visit Our Showroom To View This Car.									
F1 Auto Cars Pte Ltd									
Posted: 23-Jun-2019 Tags: 2017 Toyota Estima, 2017 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota									
	Toyota	Estima 2.4A Aeras Premium Moonroof	-	N.A	13-Nov-2017	2,362 cc	-	MPV	SOLD
Lowest Depreciation In Town, 1 Expat Owner Leaving Town. Kept Like New. 100% Loan Available For Grab And Personal Use. 5-Years Warranty By In-House Service Centre Or 100,000km. Don't Miss!									
Car Times Automobile Pte Ltd									
Posted: 24-Jun-2019 Tags: 2017 Toyota Estima, 2017 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota									
	Toyota	Estima 2.4A Aeras 8-Seater	\$134,800	\$13,730 /yr	06-Nov-2017	2,362 cc	27,000 km	MPV	Available
1 Owner! Interior And Exterior In Well Kept Condition. Original Paintwork. Road Tax Till Nov 19. Warranty Will Be Provided For Peace Of Mind. High Loan/Trade In Can Be Arranged. Call For More Information.									
Apex Trading Pte Ltd									
Posted: 04-Jul-2019 Tags: 2017 Toyota Estima, 2017 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota									
	Toyota	Estima 2.4A Aeras	\$136,888	\$14,170 /yr	19-Oct-2017	2,362 cc	16,000 km	MPV	Available
Full Original Bodykit. Condition As Good As New! Very Well Maintained By Owner. Always Parked Under Shade. Comes With High-grade Solar Film, Magnetic Sunshade And New Tyres. High Loans Up To 80% With Lowest Interest Rates From 2.28%. Trade In Welcome. Call...									
Posted: 27-Jun-2019 Tags: 2017 Toyota Estima, 2017 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota									
	Toyota	Camry							
Toyota Camry takes on Volkswagen's Passat									
The Toyota Camry offers more legroom for rear passengers, is sportier around corners and has more safety systems but the Volkswagen Passat is more affordable and feels more premium overall.									
Find out more!									
	Toyota	Estima 2.4A Aeras Premium Moonroof	-	N.A	03-Aug-2017	2,362 cc	-	MPV	SOLD
Graded A by 									
100% Loan Approval With Lowest Interest Rate! High Paper Value At \$69K, STA Evaluation Done Accident Free Unit, Lowest Mileage Unit Done At 15,000km Yearly, Not The Cheapest But Sure Quality Unit, Superb Condition To Own, Low Depreciation Of \$13K Plus Only, Incl...									
Posted: 24-Jun-2019 Tags: 2017 Toyota Estima, 2017 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota									
	Toyota	Estima 2.4A Aeras	-	N.A	22-Jun-2017	2,362 cc	-	MPV	SOLD
Excellent Condition. Very Well Maintained By Previous Owner. View To Believe. Bank Loan/Loan/In House Loan Available! Trade In Most Welcome! Call/SMS/WhatsApp Our Friendly Sales Reps Today To Arrange For Viewing And Test Drive.									
Posted: 21-May-2019 Tags: 2017 Toyota Estima, 2017 toyota estima, Toyota Estima, toyota estima, Toyota, Estima, estima, Used Toyota									
	Toyota	Estima 2.4A Aeras Premium Moonroof	\$132,800	\$14,260 /yr	30-May-2017	2,362 cc	21,000 km	MPV	Available

[Compare](#)

TEAM AUTOPRO PTE LTD

385 SING MING DRIVE
#01-02 VICOM INSPECTOR CENTRE
SINGAPORE 575718
TEL : 82699999

EMAIL : TEAMAUTOPL@GMAIL/TEAMAUTOOFFICE@GMAIL.COM

Vehicle:	SLU 1663 C
Model:	TOYOTA ESTIMA
Chassis:	

HCR5

NO	DESCRIPTION	QTY	LIST	DISC	PRICE	SURVEYORS MARKING
1	TAIL GATE DD✓	1	1895.75	25%	\$ 1593.00 -	
2	TAIL GATE EMBLEM LOGO } NEC✓	1	59.60	25%	\$ 55.80 -	
3	TAIL GATE EMBLEM ESTIMA } NEC✓	1	59.60	25%	\$ ✓ -	
4	TAIL GATE GARNISH BR✓	1	280.20	25%	\$ ✓ -	
5	TAIL GATE HINGE LH } ? BT✓	1	75.40	25%	\$ 7 -	
6	TAIL GATE HINGE RH } ? BT✓	1	75.40	25%	\$ 136.00 -	
7	TAIL GATE ABSORBER LH } ? NEC✓	1	313.70	25%	\$ 540.00 -	X SIC Δ
8	TAIL GATE ABSORBER RH } ? NEC✓	1	313.70	25%	\$ 540.00 -	X SIC Δ
9	TAIL GATE LOCK } JM✓	1	490.40	25%	\$ 195.00 -	
10	TAIL GATE LOCK CATCH } JM✓	1	52.70	25%	\$ 45.00 -	
11	TAIL GATE LOCK CATCH COVER ? DIS✓	1	69.22	25%	\$ 32.40 -	
12	TAIL GATE PLATE LAMP LH } BR✓	1	56.70	25%	\$ ✓ -	
13	TAIL GATE PLATE LAMP RH } BR✓	1	56.70	25%	\$ ✓ -	
14	TAIL GATE LAMP LH } BR✓	1	697.40	25%	\$ 425.50 -	
15	TAIL GATE LAMP RH } BR✓	1	697.40	25%	\$ 425.50 -	
16	TAIL GATE CENTER GARNISH BR✓	1	357.40	25%	\$ 271.30 -	
17	TAIL GATE WHEATHER STRIP ? TN✓	1	396.40	25%	\$ ✓ -	
18	TAIL GATE INNER TRIM BR✓	1	501.74	25%	\$ ✓ -	
19	RR WINDSCREEN MLDG NEC✓	1	137.20	25%	\$ 90.00 -	
20	TAIL LAMP LH ? NDMX	1	618.40	25%	\$ -	
21	TAIL LAMP RH BR✓	1	618.40	25%	\$ ✓ -	
22	TAIL LAMP PANEL LH ? NDMX	1	201.70	25%	\$ -	
23	TAIL LAMP PANEL RH DD✓	1	201.70	25%	\$ 125.00 -	
24	RR BUMPER BR✓	1	676.40	25%	\$ ✓ -	
25	RR BUMPER RETAINER LH LONG } BR	1	90.70	25%	\$ 55.00 -	
26	RR BUMPER RETAINER RH LONG } BR	1	90.70	25%	\$ 55.00 -	
27	RR BUMPER RETAINER LH SHORT } BR	1	88.40	25%	\$ 55.00 -	
28	RR BUMPER RETAINER RH SHORT } BR	1	88.40	25%	\$ 55.00 -	
29	RR TOWING COVER CWT✓	1	29.02	25%	\$ ✓ -	
30	RR BUMPER REFLECTOR LH NDMX	1	62.90	25%	\$ -	
31	RR BUMPER REFLECTOR RH BR✓	1	62.90	25%	\$ ✓ -	
32	RR BUMPER SPONGE LH ? NDMX	1	81.90	25%	\$ -	
33	RR BUMPER SPONGE RH } BR✓	1	81.90	25%	\$ 65.00 -	
34	REVERSE SENSOR DL✓	1	389.70	25%	\$ 200.00 -	
35	RR FENDER RH DD✓	1	1244.70	25%	\$ 1201.00 -	
① 36	RR FENDER QUARTER GLASS RH BR✓	1	989.70	25%	\$ ✓ -	
37	RR FENDER QUARTER GLASS MLDG NDMX	1	175.70	25%	\$ NS -	X NS Δ
38	RR FENDER INNER SHIELD RH BR✓	1	142.70	25%	\$ ✓ -	
② 39	RR FENDER INNER TRIM RH LOWER BT✓	1	884.94	25%	\$ 680.00 -	
40	RR FENDER INNER TRIM RH MID BT✓	1	245.70	25%	\$ ✓ -	
41	RR RH CENTER PILLAR GARNISH } BT✓	1	229.70	25%	\$ 198.00 -	
42	RR RH FENDER PILLAR GARNISH } BT✓	1	187.60	25%	\$ ✓ -	
43	RR CUP HOLDER GARNISH BT✓	1	75.70	25%	\$ ✓ -	
44	RR FENDER INNER TRIM SIDE COVER BT✓	1	166.70	25%	\$ 107.40 -	
45	RR FENDER INNER DECK PANEL ? DIS✓	1	425.70	25%	\$ ✓ -	

10776.17

10876.26 ✓
8660.98
1950.00
21487.24

46	RR WHEEL HOUSE RH	BT✓	1	324.70	25%	\$ ✓ -	
47	RR RIM RH	? NDMX	1	1919.40	25%	\$ -	
48	RR CHASSIS RH	? BT✓	1	411.70	25%	\$ 418.90 -	
49	RR END PANEL	DD✓	1	781.70	25%	\$ 681.00 -	
50	RR END PANEL TOP GARNISH	DL✓	1	298.40	25%	\$ 266.50 -	
51	REAR FLOOR PANEL	? DD✓	1	890.90	25%	\$ ✓ -	
④ 52	LUGGAGE COMPARTMENT	? DD✓	1	650.00	25%	\$ 575.28 -	
53	LUGGAGE COMPARTMENT TOP BOARD	PR	1	1148.90	25%	\$ 983.70 -	
54	RR AXLE BEAM	? NDMX	1	2435.70	25%	\$ -	
55	RR ABSORBER LH	? NDMX	1	181.70	25%	\$ -	
56	RR ABSORBER RH	? NDMX	1	181.40	25%	\$ -	
57	RR WHEEL HUB LH	? NDMX	1	672.40	25%	\$ -	
58	RR WHEEL HUB RH	? NDMX	1	672.40	25%	\$ -	
59	RR SLIDING DOOR RH	i - RX	1	672.40	25%	\$ -	RX
60	RR SLIDING DOOR RH HINGE UPPER	? NDMX	1	115.40	25%	\$ -	
61	RR SLIDING DOOR RH HINGE LOWER	? NDMX	1	215.40	25%	\$ -	
62	RR WS INNER SIDE GARNISH LH	NDMX	1	148.30	25%	\$ -	
63	RR WS INNER SIDE GARNISH RH	DD✓	1	148.30	25%	\$ ✓ -	
64	RR WS INNER UPPER GARNISH RH	NDMX	1	188.30	25%	\$ -	
65	RR FENDER RH AIR VENT	Rubber ?	1	154.70	25%	\$ 125.80 -	DL
66	RR EXHAUST MUFFLER	? BT✓	1	1403.30	25%	\$ 1091.70 -	
67	RR EXHAUST MUFFLER MLDG	? DISV	3	75X3=225	25%	\$ 46.00 -	
68	RR EXHAUST MUFFLER GASKET	? NECV	1	125.00	25%	\$ 50.00 -	
69	RR EXHAUST CENTER PIPE	? NDMX	1	3070.75	25%	\$ -	SVC X Δ
70	BEZEL, POWER OUTLET SOCKET	? NDMX	1	14.75	25%	\$ -	
71	RR DECK INNER LAMP RH	? NDMX	1	45.75	25%	\$ -	
⑤ 72	RR SEAT BELT RH	JAM✓	1	715.70	25%	\$ 680.75 -	
73	CENTER SEAT BELT RH	NIX JAM✓	1	828.30	25%	\$ 680.75 -	
74	AIGBAG ECU	Activated ✓	1	1249.70	25%	\$ 1211.80 -	
75	RR IMPACT SENSOR	Activated ✓	1	484.90	25%	\$ ✓ -	
76	CENTER STEP GARNISH RH	? NDMX	1	485.51	25%	\$ -	
77	REAR SEAT RH	? NDMX	1	-	25%	\$ -	
78	REAR SEAT LH	? NDMX	1	-	25%	\$ -	
TOTAL:						\$ 36682.03 -	8660.98 1950.00

	SPECIAL NETT	QTY	PRICE	SURVEYOR MARKING
1	RR BUMPER CLIP	1	\$ 30.00 45.00	X NECV
2	RR END PANEL TOP GARNISH CLIP	1	\$ 30.00 45.00	X NECV
3	RR TAIL GATE INNER TRIM CLIP	1	\$ 30.00 45.00	X NECV
4	RR FENDER INNER SHIELD CLIP LH	1	\$ 30.00 45.00	NDMX
5	RR FENDER INNER SHIELD CLIP RH	1	\$ 30.00 45.00	X NECV
6	RR FENDER QUARTER GLASS SEALANT	1	\$ 30.00 60.00	X NECV

150.00

21487.24

@ 25%

5371.81

16115.43

7	RR WINDSCREEN DAMPER	NAX ?NECV	1	\$ 50.00	
8	RR WINDSCREEN SEALANT	NECV	1	\$ 30.00 60.00	
9	RR WINDSCREEN PRIMER	NAX	1	\$ 40.00	
10	RR END PANEL SEALANT	NECV	1	\$ 30.00 60.00	
11	RR SPARE TYRE PANEL SEALANT	?NECV	1	\$ 30.00 60.00	
12	RR FENDER SEALANT RH	NECV	1	\$ 30.00 60.00	
13	RR SLIDING DOOR INNER TRIM CLIP RH	NECV	1	\$ 30.00 40.00	
14	RR TYRE RH	BRV	1	\$ 450.00	300.00
15	RR WS INNER TRIM CLIPS(LH/RH/UPPER)	NECV	1	\$ 90.00 120.00	60.00
16	RR WINDSCREEN TINTED	NECV	1	\$ 350.00	100.00
17	RR FENDER QUARTER GLASS TINTED	NECV	1	\$ 350.00	80.00
				\$ 1,575.00	

1925 660

Invoice
proof

	LABOUR	PRICE	SURVEYOR MARKING	
1	TO STRAIGHTEN AND PANEL BEAT ON ACCIDENT AREAS	\$ 3,500.00	300.00	+200.00
2	R&R REAR WINDSCREEN	\$ 180.00	120.00	2,500.00
3	R&R SPARE TYRE BOARD ,CARPET,INNER TRIM	\$ 250.00	50.00	
4	R&R REAR SEAT AND RR SEAT BELT RH	\$ 200.00	120.00	80.00
5	R&R MID SEAT ,CARPET AND SEAT BELT RH	\$ 200.00	120.00	80.00
6	R&R TAIL GATE COMPONENTS	\$ 200.00	120.00	80.00
7	R&R SLIDING DOOR COMPONENTS	\$ 200.00	120.00	80.00
8	R&R ROOF TOP LINING TO ASSIST REPLACE RR FENDER	\$ 350.00	200.00	100.00
9	R&R RR FENDER QUARTER GLASS	\$ 350.00	80.00	
10	R&R RR ALXE	\$ 350.00	200.00	X
11	R&R REAR SUSPENSION AND REPLACE WHEEL BEARING	\$ 250.00	120.00	80.00
12	R&R FUEL TANK	\$ 350.00	150.00	PA D
13	ALL WHEEL ALIGNMENT	\$ 180.00	60.00	
14	MOUNT WORKBENCH	\$ 300.00	200.00	100.00
15	ALIGNMENT RR CHASSIS	\$ 300.00	200.00	100.00
16	CONDUCT AND TEST WATER LEAKING	\$ 180.00		X
17	TO PUTTY AND SPRAY ON RR BUMPER ,TAIL GATE INNER ,TAIL GATE OUTER ,RR END PANEL ,SPARE TYRE PANEL , RR FENDER RH ,RR FENDER LH,RR FENDER INNER DECK PANEL ,RR WHEEL HOUSE RH , RR SLIDING DOOR RH , FRONT DOOR RH	\$ 3,000.00	1800.00	+200.00
18	R&R SIDE STEP GARNISH TO REPLACE GARNISH	\$ 180.00	50.00	X
19	R&R SLIDING DOOR MOTOR TO REPLACE SLIDING DOOR	\$ X 250.00	80.00	X D
20	R&R DASHBOARD AND CONSOLE TO REPLACE AIRBAGCU	\$ 250.00	100.00	
21	TO CLEAN UP AND VACUUM QUARTER GLASS	\$ 150.00		X
22	RUSH PROOFING	\$ 100.00	60.00	
23	TO CHECK WIRING AND TEST ALL DISMANTLE ELECTRICAL PART	\$ 200.00	50.00	
24	TO RESETTING AND RECODE AIRBAG ECU	\$ 180.00	100.00	50.00
25	TO CHECK FAULT CODE AND RESET FAULT CODE	\$ 180.00		X
	TOTAL:	\$ 11,830.00		

5650.00

Surrey on 9/7/19

@ 1600hrs

TGLim

part by part repair

STRT

97361577

Teowguan@Lkta.com

PARTS	\$ -	16115.43
LABOUR	\$ 11,830.00	5650.00
SPECIAL NETT	\$ 1,575.00	660.00
TOTAL	\$ 13,405.00	22425.43

Re: Surrey on 17/7/19

1610 hrs

TGLim Lim

Repair days 25

42,637.51

42987.51

22/10/19

Parts Supplementary & Quotation Form

Attention:		Works Order Number:	
Vehicle Number: SLV1663C		Our Reference Number:	
Make & Model: Toyota Estima			

S/NO	PART NUMBER	PARTS DESCRIPTION	QTY	UNIT PRICE	SURVEYOR REMARK	W/S REMARK
1	(3)	Rear Cooling Assy (Blower)	1	2289.65	BRV	
2				1950.00		
3						
4						
5						
6						
7						
8						
9						
10						
11						
12						
13						
14						
15						

approved by
Surgeon
as written
by Feng

SURVEYOR: T. G. M. M.

ESTIMATOR: _____

Parts	11281.96
	9728.98
	1950.00
	22960.94
Parts	17220.71
SN	840.00
Labour	1800.00
	19860.71
@ 25%	5740.24
	17220.71

41220.2725



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

DAMAGE ASSESSMENT REPORT

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: CS/INC19012149/Bsf3e2

73 BRAS BASAH ROAD

Date: 16-12-2019

#05-01 NTUC TRADE UNION HOUSESINGAPORE

189556



ATTN : ENG HUEY HUEY

Code: INC

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SGS 3819C	Veh. Inspected	SLU 1663C
Policy No.		Coverage (\$)	0.00
Claim No.	MT/1052486-001	Excess (\$)	0.00
Assign From	CYNTHIA ANG	Assign Date	09/07/2019

2. Vehicle Particulars & Condition

Make & Model	TOYOTA ESTIMA	c.c	2362
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	ACR507147924	Colour	BROWN
Odometer	30887 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	POOR		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	225/50 R18	DUNLOP	7 mm
L/H Front Tyre	225/50 R18	DUNLOP	7 mm
R/H Rear Tyre	225/50 R18	DUNLOP	7 mm
L/H Rear Tyre	225/50 R18	DUNLOP	7 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY AND REAR PORTION. DAMAGES SEE DETAILS.

5. General Information

Accident Date	06/07/2019	Inspect Date / Time	09/07/2019 (03:42 PM)
Survey held at	10 SIN MING IND EST SECTOR C #01-20		
Repairer	TEAM AUTOPRO PTE LTD		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	25 Working Days
-------------------------------------	-----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLU 1663C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	TAIL GATE	DENTED	1,895.75	1,593.00
1	TAIL GATE EMBLEM LOGO	NECESSARY	59.60	55.00
1	TAIL GATE EMBLEM ESTIMA	NECESSARY	59.60	59.60
1	TAIL GATE GARNISH	BROKEN	280.20	280.20
1	TAIL GATE HINGE LH }	BENT	75.70	136.00
1	TAIL GATE HINGE RH }		75.70	-
1	TAIL GATE ABSORBER LH	SERVICEABLE	313.70	-
1	TAIL GATE ABSORBER RH	SERVICEABLE	313.70	-
1	TAIL GATE LOCK	JAMMED	490.40	195.00
1	TAIL GATE LOCK CATCH	JAMMED	52.70	45.00
1	TAIL GATE LOCK CATCH COVER	DISTORTED	69.22	32.40
1	TAIL GATE PLATE LAMP LH	BROKEN	56.70	56.70
1	TAIL GATE PLATE LAMP RH	BROKEN	56.70	56.70
1	TAIL GATE LAMP LH	BROKEN	697.40	425.50
1	TAIL GATE LAMP RH	BROKEN	697.40	425.50
1	TAIL GATE CENTER GARNISH	BROKEN	382.40	271.30
1	TAIL GATE WEATHER STRIP	TORN	396.40	396.40
1	TAIL GATE INNER TRIM	BROKEN	501.74	501.74
1	RR WINDSCREEN MLDG	NECESSARY	137.20	90.00
1	TAIL LAMP LH	NOT DAMAGED	618.40	-
1	TAIL LAMP RH	BROKEN	618.40	618.40
1	TAIL LAMP PANEL LH	NOT DAMAGED	201.70	-
1	TAIL LAMP PANEL RH	DENTED	201.70	125.00
1	RR BUMPER	BROKEN	676.40	676.40
1	RR BUMPER RETAINER LH LONG	BROKEN	90.70	55.00
1	RR BUMPER RETAINER RH LONG	BROKEN	90.70	55.00
1	RR BUMPER RETAINER LH SHORT	BROKEN	88.40	55.00
1	RR BUMPER RETAINER RH SHORT	BROKEN	88.40	55.00
1	RR TOWING COVER	CUT	29.02	29.02
1	RR BUMPER REFLECTOR LH	NOT DAMAGED	68.90	-
1	RR BUMPER REFLECTOR RH	BROKEN	68.90	68.90

Report Ref No. CS/INC19012149/Bsf3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RR BUMPER SPONGE LH	NOT DAMAGED	81.90	-
1	RR BUMPER SPONGE RH	BROKEN	81.90	65.00
1	REVERSE SENSOR	DISLODGE	389.70	200.00
1	RR FENDER RH	DENTED	1,244.70	1,201.00
1	RR FENDER QUARTER GLASS RH	BROKEN	989.70	989.70
1	RR FENDER QUARTER GLASS MLDG	NO SUCH PARTS	175.70	-
1	RR FENDER INNER SHIELD RH	BROKEN	142.70	142.70
1	RR FENDER INNER TRIM RH LOWER	BENT	884.94	680.00
1	RR FENDER INNER TRIM RH MID	BENT	245.70	245.70
1	RR RH CENTER PILLAR GARNISH	BENT	229.70	198.00
1	RR RH FENDER PILLAR GARNISH	BENT	187.60	187.60
1	RR CUP HOLDER GARNISH	BENT	75.70	75.70
1	RR FENDER INNER TRIM SIDE COVER	BENT	166.70	107.40
1	RR FENDER INNER DECK PANEL	DISTORTED	425.70	425.70
1	RR WHEEL HOUSE RH	BENT	324.70	324.70
1	RR RIM RH	NOT DAMAGED	1,919.40	-
1	RR CHASSIS RH	BENT	1,411.70	418.90
1	RR END PANEL	DENTED	781.70	681.00
1	RR END PANEL TOP GARNISH	DISLODGE	298.40	266.50
1	REAR FLOOR PANEL	DENTED	890.90	890.90
1	LUGGAGE COMPARTMENT	DENTED	650.00	575.28
1	LUGGAGE COMPARTMENT TOP BOARD	BROKEN	1,148.90	983.70
1	RR AXLE BEAM	NOT DAMAGED	2,435.70	-
1	RR ABSORBER LH	NOT DAMAGED	181.70	-
1	RR ABSORBER RH	NOT DAMAGED	181.70	-
1	RR WHEEL HUB LH	NOT DAMAGED	672.40	-
1	RR WHEEL HUB RH	NOT DAMAGED	672.40	-
1	RR SLIDING DOOR RH	TO REPAIR SEE LABOUR	1,672.40	-
1	RR SLIDING DOOR RH HINGE UPPER	NOT DAMAGED	165.40	-
1	RR SLIDING DOOR RH HINGE LOWER	NOT DAMAGED	215.40	-
1	RR WS INNER SIDE GARNISH LH	NOT DAMAGED	148.30	-
1	RR WS INNER SIDE GARNISH RH	DENTED	148.30	148.30



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RR WS INNER UPPER GARNISH RH	NOT DAMAGED	188.30	-
1	RR FENDER RH RUBBER	DISLODGE	154.70	125.80
1	RR EXHAUST MUFFLER	BENT	1,403.30	1,091.70
3	RR EXHAUST MUFFLER MLDG @\$75.00	DISTORTED	225.00	46.00
1	RR EXHAUST MUFFLER GASKET	NECESSARY	125.00	50.00
1	RR EXHAUST CENTER PIPE	SERVICEABLE	2,020.75	-
1	BEZEL, POWER OUTLET SOCKET	NOT DAMAGED	14.75	-
1	RR DECK INNER LAMP RH	NOT DAMAGED	95.75	-
1	RR SEAT BELT RH	JAMMED	715.70	680.75
1	CENTER SEAT BELT RH	JAMMED	828.30	680.75
1	AIRBAG ECU	ACTIVATED	1,249.70	1,211.80
1	RR IMPACT SENSOR	ACTIVATED	484.90	484.90
1	CENTER STEP GARNISH RH	NOT DAMAGED	485.31	-
1	REAR SEAT RH (NPA)	NOT DAMAGED	-	-
1	REAR SEAT LH (NPA)	NOT DAMAGED	-	-
1	REAR COOLING ASSY (BLOWER) (ADDITIONAL)	BROKEN	2,289.65	1,950.00
	LESS 25% DISCOUNT		-9,744.17	-5,371.81
			29,232.51	16,115.43
<u>SPECIAL NETT ITEMS</u>				
1	RR BUMPER CLIP (SN)	NECESSARY	45.00	30.00
1	RR END PANEL TOP GARNISH CLIP (SN)	NECESSARY	45.00	30.00
1	RR TAILGATE INNER TRIM CLIP (SN)	NECESSARY	45.00	30.00
1	RR FENDER INNER SHIELD CLIP LH (SN)	NOT DAMAGED	45.00	-
1	RR FENDER INNER SHIELD CLIP RH (SN)	NECESSARY	45.00	30.00
1	RR FENDER QUARTER GLASS SEALANT (SN)	NECESSARY	60.00	30.00
1	RR WINDSCREEN DAMPER (SN)	NOT APPLICABLE	50.00	-
1	RR WINDSCREEN SEALANT (SN)	NECESSARY	60.00	30.00
1	RR WINDSCREEN PRIMER (SN)	NOT APPLICABLE	40.00	-
1	RR END PANEL SEALANT (SN)	NECESSARY	60.00	30.00
1	RR SPARE TYRE PANEL SEALANT (SN)	NECESSARY	60.00	30.00
1	RR FENDER SEALANT RH (SN)	NECESSARY	60.00	30.00
1	RR SLIDING DOOR INNER TRIM CLIP RH (SN)	NECESSARY	40.00	30.00
1	RR TYRE RH (SN)	BROKEN	450.00	300.00

Report Ref No. CS/INC19012149/Bsf3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RR WS INNER TRIM CLIPS (LH/RH/UPPER) (SN)	NECESSARY	120.00	60.00
1	RR WINDSCREEN TINTED (SN)	NOT APPLICABLE	350.00	-
1	RR FENDER QUARTER GLASS TINTED (SN)	NOT APPLICABLE	350.00	-
			1,925.00	660.00
	LABOUR			
	TO STRAIGHTEN AND PANEL BEAT ON ACCIDENT AREAS. INCLUSIVE OF THE REPAIR OF RR SLIDING DOOR RH.		3,500.00	2,700.00
	R&R REAR WINDSCREEN.		180.00	120.00
	R&R SPARE TYRE BOARD, CARPET, INNER TRIM.		250.00	50.00
	R&R REAR SEAT AND RR SEAT BELT RH.		200.00	80.00
	R&R MID SEAT, CARPET AND SEAT BELT RH.		200.00	80.00
	R&R TAIL GATE COMPONENTS.		200.00	80.00
	R&R SLIDING DOOR COMPONENTS.		200.00	80.00
	R&R ROOF TOP LINING TO ASSIST REPLACE RR FENDER.		350.00	100.00
	R&R RR FENDER QUARTER GLASS.		350.00	80.00
	R&R RR AXLE.	NOT NECESSARY	350.00	-
	R&R REAR SUSPENSION AND REPLACE WHEEL BEARING.		250.00	80.00
	R&R FUEL TANK.		350.00	80.00
	ALL WHEEL ALIGNMENT.		180.00	60.00
	MOUNT WORKBENCH.		300.00	100.00
	ALIGNMENT RR CHASSIS.		300.00	100.00
	CONDUCT AND TEST WATER LEAKING.	NOT NECESSARY	180.00	-
	TO PUTTY AND SPRAY ON RR BUMPER, TAIL GATE INNER, TAIL GATE OUTER, RR END PANEL, SPARE TYRE PANEL, RR FENDER RH, RR FENDER LH, RR FENDER INNER DECK PANEL, RR WHEEL HOUSE RH, RR SLIDING DOOR RH, FRONT DOOR RH.		3,000.00	2,000.00
	R&R SIDE STEP GARNISH TO REPLACE GARNISH.	NOT NECESSARY	180.00	-
	R&R SLIDING DOOR MOTOR TO REPLACE SLIDING DOOR.	REPEATED	250.00	-
	R&R DASHBOARD AND CONSOLE TO REPLACE AIRBAG ECU.		250.00	100.00
	TO CLEAN UP AND VACUUM QUARTER GLASS.	NOT NECESSARY	150.00	-

Report Ref No. CS/INC19012149/Bsf3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	RUST PROOFING.		100.00	60.00
	TO CHECK WIRING AND TEST ALL DISMANTLE ELECTRICAL PART.		200.00	50.00
	TO RESETTING AND RECODE AIRBAG ECU.}		180.00	50.00
	TO CHECK FAULT CODE AND RSET FAULT CODE.}		180.00	-
			11,830.00	6,050.00
GRAND TOTAL			42,987.51	22,825.43
RECOMMENDED COST OF REPAIRS (CONFIRMED)				22,825.43

Report Ref No. CS/INC19012149/Bsf3e2

LIM TEOW GUAN

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,
MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.