



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

NTUC INCOME INSURANCE CO-OPERATIVE LTD INV No. AC2003414
73 BRAS BASAH ROAD
#05-01 NTUC TRADE UNION HOUSE INV Date 24/04/2020
SINGAPORE 189556 Reference CS/INC19012159/Gsf3n2
ATTN: FIONA SHEN Code INC



PROFESSIONAL SERVICE FEE

Vehicle No. SML 1145S
Insured Veh. YL 7845Z
Claim No. MT/1052031-002
Policy No.
Accident Date 04/07/2019
Inspection Date 10/07/2019

Description	Total
Damage Assessment	250.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	250.00
GST (7%)	17.50
Grand Total	267.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

DAMAGE ASSESSMENT REPORT

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: CS/INC19012159/Gsf3n2

73 BRAS BASAH ROAD
#05-01 NTUC TRADE UNION HOUSESINGAPORE
189556

Date: 24-04-2020



ATTN: FIONA SHEN

Code: INC

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	YL 7845Z	Veh. Inspected	SML 1145S
Policy No.		Coverage (\$)	0.00
Claim No.	MT/1052031-002	Excess (\$)	0.00
Assign From	CYNTHIA ANG	Assign Date	09/07/2019

2. Vehicle Particulars & Condition

Make & Model	OPEL INSIGNIA	c.c	1598
Engine No.	HIDDEN	Year of Reg.	2019
Chassis No.	W0VZM6EF9K1035229	Colour	SILVER
Odometer	12553 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	225/55 R17	BRIDGESTONE	8 mm
L/H Front Tyre	225/55 R17	BRIDGESTONE	8 mm
R/H Rear Tyre	225/55 R17	BRIDGESTONE	8 mm
L/H Rear Tyre	225/55 R17	BRIDGESTONE	8 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	04/07/2019	Inspect Date / Time	10/07/2019 (04:30 PM)
Survey held at	THIAM HENG HUAT PTE LTD 176 SIN MING DRIVE #05-14 SINGAPORE 575721		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **7 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SML 1145S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT DOOR N/S	TO REPAIR SEE LABOUR	1,980.00	-
1	FRONT DOOR TOP HINGE N/S	NOT NECESSARY	136.00	-
1	FRONT DOOR LOWER HINGE N/S	NOT NECESSARY	136.00	-
1	FRONT DOOR INNER TRIM BOARD N/S	NOT NECESSARY	683.00	-
1	FRONT DOOR OUTER HANDLE N/S	NOT NECESSARY	296.00	-
1	FRONT DOOR OUTER HANDLE LOCK SWITCH N/S	NOT NECESSARY	195.00	-
1	FRONT DOOR LOCK N/S	NOT NECESSARY	285.00	-
1	FRONT DOOR LOCK STRIKER N/S	NOT NECESSARY	69.00	-
1	FRONT DOOR WINDOW REGULATOR N/S	NOT NECESSARY	336.00	-
1	FRONT DOOR WINDOW MOTOR N/S	NOT NECESSARY	286.00	-
1	FRONT DOOR WINDOW OUTER CHANNEL N/S	NOT NECESSARY	113.00	-
1	FRONT DOOR WINDOW OUTER CHROME MOULDING N/S	NOT NECESSARY	265.00	-
1	REAR DOOR N/S	BUCKLED	1,895.00	1,895.00
1	REAR DOOR TOP HINGE N/S	NOT NECESSARY	136.00	-
1	REAR DOOR LOWER HINGE N/S	NOT NECESSARY	136.00	-
1	REAR DOOR INNER TRIM BOARD N/S	NOT NECESSARY	694.00	-
1	REAR DOOR OUTER HANDLE N/S	NOT NECESSARY	296.00	-
1	REAR DOOR OUTER HANDLE LOCK SWITCH N/S	NOT NECESSARY	195.00	-
1	REAR DOOR LOCK N/S	NOT NECESSARY	385.00	-
1	REAR DOOR LOCK STRIKER N/S	NOT NECESSARY	88.00	-
1	REAR DOOR WINDOW REGULATOR N/S	NOT NECESSARY	436.00	-
1	REAR DOOR WINDOW MOTOR N/S	NOT NECESSARY	386.00	-
1	REAR DOOR WINDOW OUTER CHROME N/S	NOT NECESSARY	145.00	-
1	REAR DOOR WINDOW OUTER CHROME MOULDING N/S	NOT NECESSARY	295.00	-
1	REAR FENDER N/S	BUCKLED	1,129.00	1,129.00
1	REAR FENDER COWLING N/S	NOT NECESSARY	237.00	-
1	REAR SHOCK ABSORBER N/S	NOT NECESSARY	467.00	-
1	REAR SHOCK ABSORBER MOUNTING N/S	NOT NECESSARY	102.00	-
1	REAR LOWER ARM N/S	NOT NECESSARY	387.00	-
1	REAR WHEEL KNUCKLE N/S	NOT NECESSARY	469.00	-

Report Ref No. CS/INC19012159/Gsf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR WHEEL BEARING N/S	NOT NECESSARY	214.00	-
1	REAR BUMPER	NOT NECESSARY	893.00	-
2	REAR BUMPER SIDE RETAINER @\$75.00	NOT NECESSARY	150.00	-
1	TAILLAMP N/S	NOT NECESSARY	685.00	-
1	ROCKER PANEL N/S	NOT NECESSARY	884.00	-
1	ROCKER PANEL RUBBER STRIP N/S	NOT NECESSARY	318.00	-
	LESS 10% DISCOUNT		-1,580.20	-302.40
			14,221.80	2,721.60
	<u>SPECIAL NETT ITEMS</u>			
12	FRONT DOOR INNER TRIM BOARD CLIPS N/S @\$6.50 (SN)	NOT NECESSARY	78.00	-
12	REAR DOOR INNER TRIM BOARD CLIPS N/S @\$6.50 (SN)	NECESSARY	78.00	30.00
8	REAR FENDER COWLING CLIPS N/S @\$6.50 (SN)	NECESSARY	52.00	20.00
10	REAR BUMPER CLIPS @\$6.50 (SN)	NECESSARY	65.00	40.00
1	ROCKER PANEL SEALANT N/S (SN)	NOT NECESSARY	100.00	-
1	REAR BUMPER SIDE SENSOR N/S (SN)	NOT NECESSARY	380.00	-
1	REAR BUMPER SIDE SENSOR HOLDER N/S (SN)	NOT NECESSARY	47.00	-
1	REAR ALLOY WHEEL 17" (LOCAL REPAIR)(SN)	SCRATCHED	550.00	100.00
1	REAR TYRE 225/55 R17 (SN)	NOT NECESSARY	380.00	-
1	SUNDRIES (SN)	NOT NECESSARY	50.00	-
			1,780.00	190.00
	<u>LABOUR</u>			
	TO DISMANTLE/RENEW ACCIDENT DAMAGED PORTION.TO PANEL BEAT,RESHAPE,STRAIGHTEN, ORIENTATE AND ALIGN REPAIR/REPLACEMENT PARTS.INCLUSIVE OF THE REPAIR OF FRONT DOOR N/S.		1,600.00	800.00
	TO REMOVE AND REFIT N/S DOORS COMPONENTS TO REPLACE BOTH N/S DOORS,CHECK ALIGNMENT. }		200.00	60.00
	TO DISCONNECT N/S DOORS WIRE HARNESS OF ELECTRICAL COMPONENTS TO FACILITATE REPAIRS,RECONNECT AND CHECK FUNCTIONS OF POWER WINDOWS. }		100.00	-
	TO REMOVE AND REFIT N/S REAR FENDER GLASS TO FACILITATE REPAIR.		150.00	40.00

Report Ref No. CS/INC19012159/Gsf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND REPLACE N/S REAR TYRE & RIM.TO PERFORM TYRE BALANCING.	NOT NECESSARY	50.00	30.00
	TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT.		150.00	60.00
	TO REMOVE AND REFIT N/S REAR UNDERCARRIAGE FOR REPLACEMENT OF PARTS.		200.00	-
	SUPPLY SPRAY PAINT MATERIAL AND NECESSARY ITEMS TO RESPRAY BOTH N/S DOORS,N/S REAR FENDER,N/S ROCKER PANEL,REAR BUMPER AND OTHER AFFECTED AREA/PANEL.		1,600.00	800.00
	TO RUST PROOF ALL AFFECTED PORTIONS AFTER REPAIR.		100.00	60.00
			4,150.00	1,850.00
GRAND TOTAL			20,151.80	4,761.60
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)				3,800.00

Report Ref No. CS/INC19012159/Gsf3n2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,
MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SML 1145S

INSPECTION

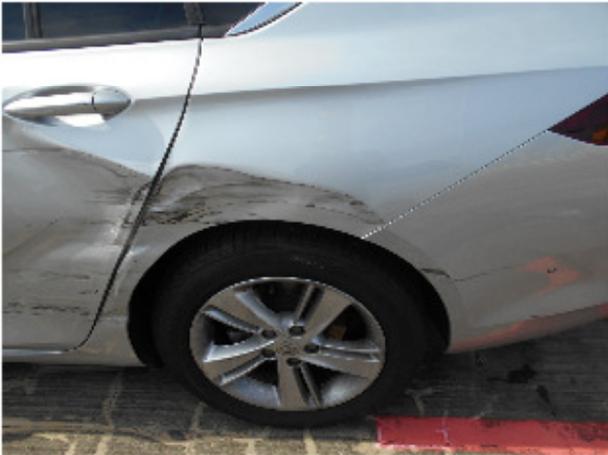



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

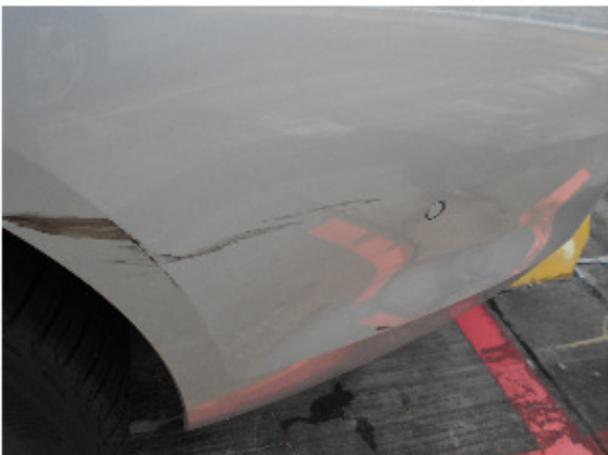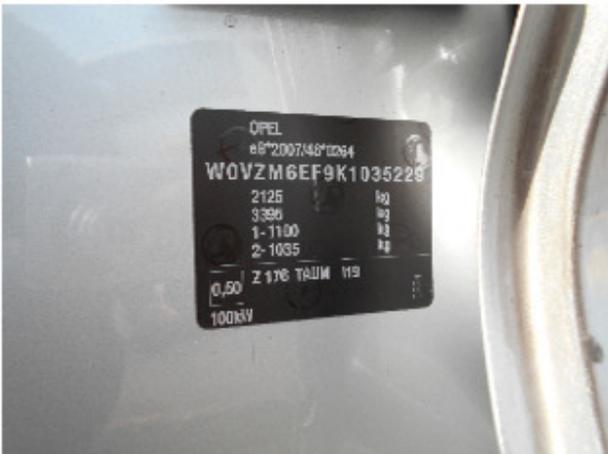



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SML 1145S

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SML 1145S

RE-INSPECTION

