

STEN

REF: NS/INC19013166/EP302

ASSIGNMENT

From: _____ Date: _____
Estimated Cost: _____
OD TP WS / TP RES / OD RES / EVA / INV / MV
To Inspect Vehicle No: _____
at Workshop mis: _____
of: _____
Insured: _____
Policy No: _____
Claims No: _____
Sum Insured: _____ Excess: _____
(Client's Record)
Make of Veh: _____

(Policy Condition)
Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____
IDAC Accident Rpt: _____ Consistent? : Yes or No
GIA / PR Seen: _____ Consistent? : Yes or No
Est. Repairs: _____ days Res.: Yes or No
Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS
Date: _____ Person Contacted: _____
Vehicle: IN / OUT

Veh No: SHIC 4384E Yt Regn: 12/12/17
Type: M.Car / M.Cycle / Bus / Van / Lorry / (Taxi) / Prime Mover /
Truck / Trailer or
Make: Toyota Plus C.C. 1798
Colour: Maroon A/C Insured / Std / N
Sp. Reading: 219671 T/Radio: Insured / Std / N
Eng/No: _____
C/No: JTD KB3FU 7035 76195
Gen. Cond: Good / Fair / Poor / Burnt
Steering: Inorder / Jammed / Leaked / Burnt or
Brake: Inorder / Jammed / Leaked / Burnt or
Modi: Nil / S/Rim / STD A/Rim or
Tyre Size: F: 195/55R15
R: _____
BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or worst/late
Front _____ Rear _____
R/Bal. _____ mm R/Bal. _____
L/Bal. _____ mm L/Bal. _____
D.O.A. 24/7/19 D.O.I. 25/7/19
Survey held at SMRT
Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or
The UIC / Chassis frame / Body Structure affected due to col

Date / Time	Action / Instruction
13/8/19	Finalize location \$3690.03, 4 rep. days (Poh Suan) (Red 6688.37, 6490)
07/19/2019	SMG 7822H1

RECEIVED 15 AUG 2019

Date/Time, File Pass to? ☐ : Procl. Report
1) ☐ : Final Report
Date/Time, File Return to?
2) 15/8 - typist
Report Format: TP
Lump Sum / I.B.I. (\$) 3690.03
Days Of Repair: 4
Resurvey No. of Trip: 1
Add Fee: ☐ : Site Insp (\$)
☐ : Interview (\$)
☐ : Tech Invs (\$)
☐ : Weekend (\$)
Survey Fee: 160
Transportation: 160
S + RS: 160
Photos: 160
Other: 160

TP Claims against NTUC Income: Follow-Through Survey

Date : 14/08/2019

S/No	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle No.	Date of Accident	Time of Accident	Estimate
1	MT/1057309-002	COMFORT TRANSPORTATION PTE LTD	SHC 8632M	SLT 902A	06/08/2019	14:40	\$ 1,452.40
2	MT/1056863-002	COMFORT TRANSPORTATION PTE LTD	SH 9234R	GBG 6433J	06/08/2019	11:20	\$ 3,064.85
3	MT/1054877-002	SMRT TAXIS PTE LTD	SHC 4384E	SMG 7822H	24/07/2019	12:30	\$ 10,378.40

Hello, NAC_PAYA_UBI_800601

[Change Language](#)[Change Password](#)[Log Out](#)[My Desktop](#)[Notice of Loss](#)

Policy Query

Policy No.	<input type="text"/>	Date of Accident	<input type="text" value="24/07/2019 09:39"/>
Vehicle No.(For Motor)	<input type="text" value="SMG7822H"/>	Certificate Number	<input type="text"/>

Select	Policy No.	Certificate Number	Policyholder Name	Policyholder NRIC	Product	Cover Type	Vehicle No.	Insured Object	Commence Date	Expiry Date
<input type="radio"/>	5106760502		GOH SWEE KHENG	S1722525A	GPC	drivo CLASSIC	SMG7822H	SMG7822H	02/01/2019	28/01/2020

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	369K
Vehicle Details	
Vehicle No.:	SHC4384E
Vehicle to be Exported:	No
Intended Deregistration Date:	25 Jul 2019
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS HYBRID 1.8 CVT
Primary Colour:	Maroon
Manufacturing Year:	2017
Engine No.:	2ZRS111852
Chassis No.:	JTDKB3FU703576195
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$29,007.00
Original Registration Date:	12 Dec 2017
First Registration Date:	12 Dec 2017
Transfer Count:	0
Actual ARF Paid:	\$5,000.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	11 Dec 2025
PARF Rebate Amount:	\$3,750.00
Intended COE Rebate Details	
COE Expiry Date:	11 Dec 2025
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$34,159.00
COE Rebate Amount:	\$27,228.00
Total Rebate Amount:	\$30,978.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 25 Jul 2019

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	25/07/2019 09:53
Date Of Accident	24/07/2019 12:30
Exact Location Of Accident	SLIP ROAD HOUGANG AVE 8 AND HOUGANG AVE 4
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB4384E
Insured/Policyholder	C
Name Of Registered Owner	SMRT TAXIS PTE LTD
Co Reg No	198905369K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-80000000

Vehicle Particulars

Manufacturer	TOYOTA
Model	PRIUS TAXI-1.8 (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	MS FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-19093197MFSH
Cover Note Number	

Driver

Name of Driver	ANG SOON HAI
NRIC No	S1769099Z
Date Of Birth	04/03/1966
Occupation	OUTDOOR
Date Of Driving Pass	21/01/1992
Driving Experience	27 YEARS AND 6 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-80000000
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	11
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - RELIEF
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : UNKNOWN
	GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

AS I WAS TRAVELLING ALONG THE SLIP ROAD OF HOUGANG AVE 8 AND HOUGANG AVE 4 WITH 1 FEMALE PASSENGER ON BOARD, AS I APPROACHED AND STOPPED FOR THE PEDESTRIAN TO CROSS AT THE ZEBRA CROSSING, SUDDENLY I FELT AN IMPACT FROM MY REAR OF MY TAXI, I ALIGHTED AND CHECKED THE VEHICLE SMG7822H HAD HIT ONTO MY REAR OF MY TAXI.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	FILE TOO BIG
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SMG7822H
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	KEE CHOON HOCK
NRIC/Passport Number	
Contact Number	
Address	
Postcode	

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

DETAILS OF INJURED PERSON 1

Name ANG SOON HAI

Approximate Age

Injuries Sustain

Injured person in which vehicle? SHB4384E


Were seat belts worn?

Was this injured conveyed to hospital by ambulance? NO

Address

Postcode

SKETCH PLAN

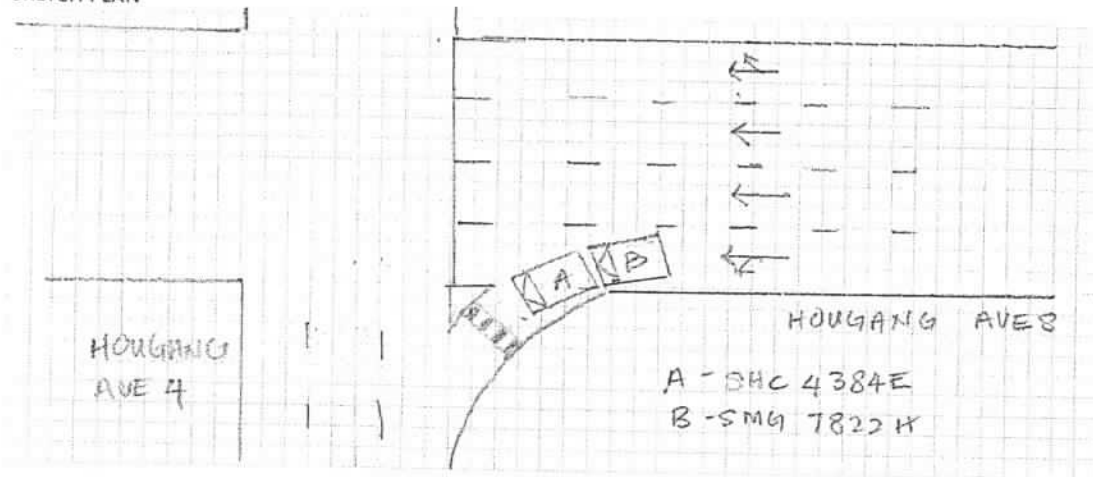

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

DECLARATION

DECLARATION:

I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

NRIC/FIN No.:

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all Insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.



Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd

60 Woodlands Industrial Park E4, Singapore 757705

FAX Number : 63685592

Estimator Telephone Number : 68662623

Accident Reporting Number : 68662672



Date Generated : 25/07/2019

User ID : TuckFoo

Section A - Accident Details

Registration Number	SHC4384E
Case Reference Number	TAX/07/19/2092
Registration Date	12/12/2017
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS4
Name of Driver	ANG SOON HAI
Type of Accident	Head to Rear
Accident Date and Time	7/24/2019 12:30 PM
Accident Reported Date and Time	7/24/2019 1:14 PM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24102540
Special Instruction to ARC, if any	REAR / RIGHT PORTION
Prepared Date and Time	7/25/2019 2:29 PM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

Section B - Summary of Repair Estimates

Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$845.00	\$400.00
Total Spray Cost	\$1,854.00	\$860.00
Total Spare Part Cost	\$5,404.88	\$2,329.98
Total Other Cost	\$780.00	\$100.00
TOTAL COST	\$8,883.88	\$3,689.98
Lump Sum Total	\$0.00	\$0.00
Number of Repair Days	6.0	4.0
Prepared / Adjusted By	Tuck Foo Kok	STEVE CHEN
ARC / Surveyor Sign Off Date	25/07/2019 2:55 PM	25/07/2019 3:41 PM
Signature		
Remarks	P/P repair, take before spray. Finalize sent to stevechen@lkkauto.com.	

Section C - Quotation and Accident Invoice Details

Quotation Number		Invoice Number	
Quotation Date		Invoice Date	
Invoice Amount		Prepared Date	

LKK Auto Consultants hence notify

the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
60 Woodlands Industrial Park E4, Singapore 757705
FAX Number : 63685592
Estimator Telephone Number : 68662623
Accident Reporting Number : 68662672

Date Generated : 25/07/2019

User ID : TuckFoo

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		52461470 10	PAD, RR BUMPER, CTR	3.00	\$2.20	25.00	\$4.95	Replace	Replace
		81581470 10	LENS & BODY ASSY, RR BUMPER, RH	1.00	\$486.80	10.00	\$438.12	Replace	Replace
		58398470 50	COVER, REAR FLOOR UNDER, RH	0.00	\$169.50	0.00	\$0.00	Replace	Not Given
		76801471 10A1	TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-ASSY	1.00	\$891.20	25.00	\$668.40	Replace	Replace
		67005474 40	TAIL GATE PANEL SUB-ASSY, BACK DOOR	1.00	\$929.60	100.00	\$0.00	Replace	Repair
		75441470 90	NAME PLATE (HYBRID), LUGGAGE COMPARTMENT DOOR	1.00	\$52.30	25.00	\$39.23	Replace	Replace
		75442471 30	NAME PLATE (PRIUS), LUGGAGE COMPARTMENT DOOR	1.00	\$52.30	25.00	\$39.23	Replace	Replace
		75403480 10	EMBLEM SUB-ASSY REAR	1.00	\$46.30	25.00	\$34.73	Replace	Replace
			SMRT LOGO	1.00	\$7.80	0.00	\$7.80	Replace	Replace
			STICKER DECAL 6555 8888	1.00	\$21.60	0.00	\$21.60	Replace	Replace
		58307470 90	END PANEL SUBASSY, BODY LOWER BACK	1.00	\$629.80	100.00	\$0.00	Replace	Repair
			SEALANT SIKAFLEX	0.00	\$37.00	0.00	\$0.00	Replace	Not Given
		81551472 81	LENS & BODY, REAR COMBINATION LAMP, RH	0.00	\$438.10	0.00	\$0.00	Replace	Check
		61601471 50	PANEL SUB-ASSY, FENDER REAR RH	0.00	\$824.80	0.00	\$0.00	Replace	Check
		62940470 10	DUCT ASSY, QUARTER VENT, RH & LH	0.00	\$65.00	0.00	\$0.00	Replace	Not Given
		65637470 60	LINER, REAR FENDER, RH	0.00	\$135.80	0.00	\$0.00	Replace	Not Given
Total					\$6,799.10		\$2,329.98		

Added Spare Parts / Material Usage After Surveyor Signed off



Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
Total									

Section A - Accident Details

Registration Number	SHC4384E
Case Reference Number	TAX/07/19/2092
Registration Date	12/12/2017
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS4
Name of Driver	ANG SOON HAI
Type of Accident	Head to Rear
Accident Date and Time	24/7/2019 12:30 PM
Accident Reported Date and Time	24/7/2019 1:14 PM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24102540
Special Instruction to ARC, if any	REAR / RIGHT PORTION
Prepared Date and Time	25/7/2019 2:29 PM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

Section B - Summary of Repair Estimates

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$845.00	\$400.00
Total Spray Cost	\$1,854.00	\$860.00
Total Spare Part Cost	\$5,404.88	\$2,330.03
Total Other Cost	\$780.00	\$100.00
TOTAL COST	\$8,883.88	\$3,690.03 (P/P)
Lump Sum Total	\$0.00	\$0.00
Number of Repair Days	6.0	4.0
Prepared / Adjusted By	Tuck Foo Kok	STEVE CHEN (LKK) / NTUC
ARC / Surveyor Sign Off Date	25/07/2019 2:55 PM	25/07/2019 3:41 PM
Signature		
Remarks		P/P repair, take before spray. Finalize sent to stevechen@ikkauto.com.

Section C - Quotation and Accident Invoice Details

Quotation Number	QN-1908-0091	Invoice Number	
Quotation Date	07.08.2019	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR RH REAR PORTION	\$845.00	\$400.00
Total Labour	\$845.00	\$400.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY REAR BUMPER	\$378.00	\$200.00
TO RESPRAY BUMPER BEAM	\$180.00	\$0.00
TO RESPRAY FILLER RR BUMPER RH	\$180.00	\$80.00
TO RESPRAY REAR PANEL	\$180.00	\$80.00
TO RESPRAY TAIL GATE	\$378.00	\$200.00
TO RESPRAY TAILGATE OUTSIDE GARNISH	\$180.00	\$100.00
TO RESPRAY REAR FENDER RH	\$378.00	\$200.00
Total Spray Painting & Panel Beating	\$1,854.00	\$860.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$20.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$100.00	\$20.00
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	\$120.00	\$0.00
TO REMOVE AND REFIT WIRE HARDESS	\$200.00	\$20.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00	\$20.00
TO REPLACE SUNDRY PARTS	\$100.00	\$20.00
TO WASH AND VACUUM	\$60.00	\$0.00
Total Other Costs	\$780.00	\$100.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		5215947913	COVER, RR BUMPER ASSY	1.00	\$423.90	25.00	\$317.93	Replace	Replace
		5216116010	CLIPS PIECE, FRT & RR BUMPER	10.00	\$1.50	25.00	\$11.25	Replace	Replace
		5246247030	PAD, RR BUMPER, RH & LH, 1	2.00	\$3.80	25.00	\$5.70	Replace	Replace
		5246247020	PAD, RR BUMPER, RH & LH, 2	2.00	\$3.80	25.00	\$5.70	Replace	Replace
		5246247010	PAD, RR BUMPER, RH & LH, 3	2.00	\$3.80	25.00	\$5.70	Replace	Replace
		5219147030	SEAL, RR BUMPER ARM, RH & LH	2.00	\$11.00	25.00	\$16.50	Replace	Replace
		5256547900	FILLER, RR BUMPER, RH	1.00	\$119.90	25.00	\$89.93	Replace	Replace
		5202347030	REAR BUMPER REINFORCEMENT	0.00	\$318.80	0.00	\$0.00	Replace	Check

		SENSOR REVERSE	0.00	\$180.00	0.00	\$0.00	Replace	Check	X	NN
		PIXEL STICKER	2.00	\$60.00	126	\$120.00	Replace	Replace	/	nrc
	52576470	RETAINER, RR BUMPER, LH	0.00	\$111.50	0.00	\$0.00	Replace	Not Given	X	NN
	52575470	RETAINER, RR BUMPER, RH	1.00	\$112.70	25.00	\$84.53	Replace	Replace	/	BR
	52591470	SEAL, RR BUMPER, RH	0.00	\$85.20	0.00	\$0.00	Replace	Not Given	X	NN
	52453470	GUARD, RR BUMPER, LOWER	1.00	\$558.30	25.00	\$418.73	Replace	Replace	/	BR
	52169470	COVER, GUARD RR BUMPER LOWER	0.00	\$14.80	0.00	\$0.00	Replace	Not Given	X	NN
	52461470	PAD, RR BUMPER, CTR	3.00	\$2.20	660	\$4.95	Replace	Replace	/	nrc
	81581470	LENS & BODY ASSY, RR BUMPER, RH	1.00	\$486.80	10.00	\$438.12	Replace	Replace	/	cut
	58398470	COVER, REAR FLOOR UNDER, RH	0.00	\$169.50	0.00	\$0.00	Replace	Not Given	X	NN
	76801471	TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-	1.00	\$891.20	25.00	\$668.40	Replace	Replace	/	BR
	67005474	TAIL GATE PANEL SUB-ASSY, BACK DOOR	1.00	\$929.60	100.00	\$0.00	Replace	Repair	/	
	75441470	NAME PLATE (HYBRID), LUGGAGE COMPARTMENT	1.00	\$52.30	25.00	\$39.23	Replace	Replace	/	nrc
	75442471	NAME PLATE (PRIUS), LUGGAGE COMPARTMENT	1.00	\$52.30	25.00	\$39.23	Replace	Replace	/	nrc
	75403480	EMBLEM SUB-ASSY REAR	1.00	\$46.30	25.00	\$34.73	Replace	Replace	/	nrc
		SMRT LOGO	1.00	\$7.80	0.00	\$7.80	Replace	Replace	/	nrc
		STICKER DECAL 6555 8888	1.00	\$21.60	0.00	\$21.60	Replace	Replace	/	nrc
	58307470	END PANEL SUBASSY, BODY LOWER BACK	1.00	\$629.80	100.00	\$0.00	Replace	Repair	/	
		SEALANT SIKAFLEX	0.00	\$37.00	0.00	\$0.00	Replace	Not Given	X	NN
	81551472	LENS & BODY, REAR COMBINATION LAMP, RH	0.00	\$438.10	0.00	\$0.00	Replace	Check	X	NN
	61601471	PANEL SUB-ASSY, FENDER REAR RH	0.00	\$824.80	0.00	\$0.00	Replace	Check	X	NN
	62940470	DUCT ASSY, QUARTER VENT, RH & LH	0.00	\$65.00	0.00	\$0.00	Replace	Not Given	X	NN
	65637470	LINER, REAR FENDER, RH	0.00	\$135.80	0.00	\$0.00	Replace	Not Given	X	NN
Total				\$6,799.10		\$2,330.03				

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
Total									

2330.03
+ 400.00
+ 960.00

3690.03

Veron Chen (LKKAuto)

From: Yeo Poh Suan (Auto Svcs/ARC/AR & SC/Taxis) <YeoPohsuan@smrt.com.sg>
Sent: Wednesday, 14 August 2019 8:36 AM
To: Steve Chen (LKK Auto)
Cc: SUR; CS A Team
Subject: RE: SHC4384E

Hi,

Amount confirmed as per your recommendation, thanks.

Regards
Poh Suan

-----Original Message-----

From: Steve Chen (LKK Auto) [mailto:SteveChen@lkkauto.com]
Sent: Tuesday, 13 August 2019 6:09 PM
To: Yeo Poh Suan (Auto Svcs/ARC/AR & SC/Taxis)
Subject: SHC4384E

Dear Poh Suan,

We confirm the finalize \$3,690.03 (P/P, before GST). 4 repair days.

Thanks

Best Regards,
Steve Chen | Assistant Automotive Assessor

LKK Auto Consultants

Phone: 6256 3561 | Email: SteveChen@lkkauto.com | fax: 6256-4315 Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

-----Original Message-----

From: Yeo Poh Suan (Auto Svcs/ARC/AR & SC/Taxis) [mailto:YeoPohsuan@smrt.com.sg]
Sent: Saturday, August 10, 2019 9:53 AM
To: Steve Chen (LKK Auto)
Subject: SHC4384E

Hi Steve,

Attached herewith the repair estimate of SHC 4384E having Case No: TAX/07/19/2092.

There is no change to the approved amount of \$3,690.03 @ 4 working days under part by part repair.

Cost of Repair invoice will be generated as approved.

Please finalize with me within 7 working day, thanks.

Thanks & Regards
Poh Suan

-----Original Message-----

From: Yeo Poh Suan (Auto Svcs/ARC/AR & SC/Taxis)
Sent: Saturday, 10 August 2019 9:56 AM
To: Yeo Poh Suan (Auto Svcs/ARC/AR & SC/Taxis)
Subject: Scan Data from FX-D421D6



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC19013166/Evf3e2				
73 BRAS BASAH ROAD #05-01 NTUC TRADE UNION HOUSESINGAPORE 189556			Date: 19-08-2019	
Code: INC4				
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SMG 7822H	Veh. Inspected	SHC 4384E	
Policy No.	5106760502	Coverage (\$)	0.00	
Claim No.	MT/1054877-002	Excess (\$)	0.00	
Assign From		Assign Date	25/07/2019	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	JTDKB3FU703576195	Colour	MAROON	
Odometer	219671	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/55 R15	WEST LAKE	5 mm	
L/H Front Tyre	195/55 R15	WEST LAKE	5 mm	
R/H Rear Tyre	195/55 R15	WEST LAKE	5 mm	
L/H Rear Tyre	195/55 R15	WEST LAKE	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	24/07/2019	Inspection Date	25/07/2019	
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days		

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 4384E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	COVER, RR BUMPER ASSY (DISC 25%)	DENTED	423.90	317.93
10	CLIPS PIECE, FRT & RR BUMPER @\$1.50 (DISC 25%)	NECESSARY	15.00	11.25
2	PAD, RR BUMPER, RH & LH, 1 @\$3.80 (DISC 25%)	NECESSARY	7.60	5.70
2	PAD, RR BUMPER, RH & LH, 2 @\$3.80 (DISC 25%)	NECESSARY	7.60	5.70
2	PAD, RR BUMPER, RH & LH, 3 @\$3.80 (DISC 25%)	NECESSARY	7.60	5.70
2	SEAL, RR BUMPER ARM, RH & LH @\$11.00 (DISC 25%)	NECESSARY	22.00	16.50
1	FILLER, RR BUMPER, RH (DISC 25%)	NECESSARY	119.90	89.93
1	RETAINER, RR BUMPER, RH (DISC 25%)	BROKEN	112.70	84.53
1	GUARD, RR BUMPER, LOWER (DISC 25%)	BROKEN	558.30	418.73
3	PAD, RR BUMPER, CTR @\$2.20 (DISC 25%)	NECESSARY	6.60	4.95
1	TAIL GATE BACK DOOR OUTSIDE GARNISH SUB- (DISC 25%)	BROKEN	891.20	668.40
1	NAME PLATE (HYBRID), LUGGAGE COMPARTMENT (DISC 25%)	NECESSARY	52.30	39.23
1	NAME PLATE (PRIUS), LUGGAGE COMPARTMENT (DISC 25%)	NECESSARY	52.30	39.23
1	EMBLEM SUB-ASSY REAR (DISC 25%)	NECESSARY	46.30	34.73
1	LENS & BODY ASSY, RR BUMPER, RH (DISC 10%)	CUT	486.80	438.12
2	PIXEL STICKER @\$60.00 (SN)	NECESSARY	120.00	120.00
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 6555 8888 (SN)	NECESSARY	21.60	21.60
1	REAR BUMPER REINFORCEMENT	NOT NECESSARY	318.80	-
1	SENSOR REVERSE	NOT NECESSARY	180.00	-
1	RETAINER, RR BUMPER, LH	NOT NECESSARY	111.50	-
1	SEAL, RR BUMPER, RH	NOT NECESSARY	85.20	-
1	COVER, GUARD RR BUMPER LOWER	NOT NECESSARY	14.80	-
1	COVER, REAR FLOOR UNDER, RH	NOT NECESSARY	169.50	-
1	SEALANT SIKAFLEX	NOT NECESSARY	37.00	-
1	LENS & BODY, REAR COMBINATION LAMP, RH	NOT NECESSARY	438.10	-
1	PANL SUB-ASSY, FENDER REAR RH	NOT NECESSARY	824.80	-
2	DUCT ASSY, QUARTER VENT, RH & LH	NOT NECESSARY	65.00	-

Report Ref No. NS/INC19013166/Evf3e2



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	LINER, REAR FENDER, RH	NOT NECESSARY	135.80	-
1	TAIL GATE PANEL SUB-ASSY, BACK DOOR	TO REPAIR SEE LABOUR	929.60	-
1	END PANEL SUBASSY, BODY LOWER BACK	TO REPAIR SEE LABOUR	629.80	-
			6,899.40	2,330.03
	LABOUR			
	PANEL BEATING & BODY WORK. INCLUSIVE OF THE REPAIR OF TAIL GATE PANEL SUB-ASSY, BACK DOOR AND END PANEL SUBASSY, BODY LOWER BACK.		845.00	400.00
	SPRAY PAINT.		1,854.00	860.00
	TO CHECK WIRING AND SYSTEM FUNCTION.		80.00	20.00
	TO APPLY RUST-PROOFING ON AFFECTED AREA.		100.00	20.00
	TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	NOT NECESSARY	120.00	-
	TO REMOVE AND REFIT WIRE HARDESS.		200.00	20.00
	TO TEST AND REFIX REVERSE SENSOR SYSTEM.		120.00	20.00
	TO REPLACE SUNDRY PARTS.		100.00	20.00
	TO WASH AND VACUUM.	NOT NECESSARY	60.00	-
			3,479.00	1,360.00
GRAND TOTAL			10,378.40	3,690.03
RECOMMENDED COST OF REPAIRS (CONFIRMED)				3,690.03

Report Ref No. NS/INC19013166/Evf3e2

CHEN TSUE YEE

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,
MinstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.