

ASS. REC. BY:

REF:

CS3/AWA/19013213/R1/H3

Instruction:

Survey: RasulASSIGNMENT (Office)From (Person): Stella Goh

of

AWAC

Date/Time:

26/7/19 @ 2:21pm

Estimated Cost:

Bill to:

OD TP WS/TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SKN 5811P

Insured:

GBG 474E

at Workshop m/s

Master Car Spray

Tel:

9384 8322

of

40 Joh Guan Road East # 01-67

Policy No:

Claim No:

NSV1900378/kw

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A

21/7/19

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time: 3:24pm @ 26/7/19

Person Contacted:

shifuVehicle IN / OUT

Date/Time	Action/Instruction
	Vehicle (X)
	SKN 5811P X
	GBG 474E X
	Dismantle: 26/7/2019
	After repair: 31/7/2019
	Submit PPS & paper survey

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: *SKN 5811P*
 at Workshop n/s: *MMSTR SPRAY*
 of: *40, Tottum RD Cmt #01-67*
 Insured: *PRG*

Policy No: _____

Claims No: _____


Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

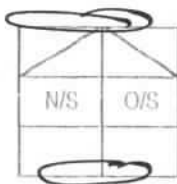

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res: Yes or No

Lum Sum: _____ % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: *SKN 5811P* Yr Regn: *2014 / Jun*
 Type: *C* / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or

Make: *Subaru XV 1.6i* c.c. *1600*Colour: *BLACK* A/C: *Insured / Std / NI / NA*Sp. Reading: *099974* T/Radio: *Insured / Std / NI / NA*

Eng/No: _____

C/No: *2F1GP 3KC 5CH 008303*

Gen. Cond: Good / Fair / Poor / Burnt

Steering: *8* / Jammed / Leaked / Burnt orBrake: *8* / Jammed / Leaked / Burnt orModi: *Nil* / STD A/Rim orTyre Size: F: *225/55R17*

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. *6* mm R/Bal. *6* mmL/Bal. *6* mm L/Bal. *6* mmD.O.A. *24/07/19* D.C.I. *26/07/19*Survey held at *MMSTR SPRAY*Des. of Damages: *C* / *C* / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

~~Estimate Range of Repair - (\$K-6K) / 7 days~~

Lump Sum *\$5750* Submit, 5 days
 (Red: 1850, 24%)

9/12/2019

RECEIVED 10 DEC 2019

Date/Time, File Pass to?

1) *9/12 TYPIST*

Date/Time, File Return to?

2)

Report Format: *PRG*Lump Sum / I.B.I. (\$) *5750*Days Of Repair: *7*Resurvey No. of Trip: *2*Add Fee: ☐ Site Insp (\$)☐ Interview (\$)☐ Tech. Invs (\$)☐ Weekend (\$)

Survey Fee:

Transportation:

\$ + RS. \$1

Photos

Others

TOTAL

200

200

Nivitha (LKK Auto)

From: Wong, Kin <Kin.Wong@awac.com> on behalf of Motorsurvey <Motorsurvey@awac.com>
Sent: Wednesday, 27 November 2019 9:14 AM
To: 'Admin-D (LKKAuto)'; 'assignments'
Cc: 'SUR'
Subject: RE: TP Survey assignment for SKN5811P DOA: 24.07.2019 Our ref: NSV1900378/KW
Attachments: 27112019085156-0001.docx

Hi all

Re-sending in word format as our PDF couldn't reaches your email.

Thank you.

Regards,

Kin Wong (Mr.)
Asia-Pacific Claims Group

Allied World Assurance Company, Ltd.
60 Anson Road #08-01
Singapore 079914
T: +65 6423 0894
F: +65 6423 0864
E: kin.wong@awac.com
W: www.awac.com

From: Wong, Kin **On Behalf Of** Motorsurvey
Sent: Wednesday, 27 November 2019 9:03 AM
To: Admin-D (LKKAuto) <admin-d@lkkauto.com>; assignments <assignments@lkkauto.com>
Cc: SUR <sur@lkkauto.com>
Subject: RE: TP Survey assignment for SKN5811P DOA: 24.07.2019 Our ref: NSV1900378/KW

Dear all

We refer to this PRS which we have not received the report.

Meanwhile, please proceed to conduct a paper re based on third party independent survey.

Thank you.

Regards,

Kin Wong (Mr.)
Asia-Pacific Claims Group

Allied World Assurance Company, Ltd.

60 Anson Road #08-01
Singapore 079914
T: +65 6423 0894
F: +65 6423 0864
E: kin.wong@awac.com
W: www.awac.com

From: Admin-D (LKKAuto) <admin-d@lkkauto.com>
Sent: Friday, 26 July 2019 4:00 PM
To: Motorsurvey <Motorsurvey@awac.com>; assignments <assignments@lkkauto.com>
Cc: SUR <sur@lkkauto.com>; Goh, Stella <stella.goh@awac.com>
Subject: RE: TP Survey assignment for SKN5811P DOA: 24.07.2019 Our ref: NSV1900378/KW

Dear Sir/Mdm,

Thank you for the assignment.

Best Regards

G.NIVITHA

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Goh, Stella [<mailto:stella.goh@awac.com>] **On Behalf Of** Motorsurvey
Sent: Friday, 26 July 2019 2:21 PM
To: assignments@lkkauto.com
Cc: sur@lkkauto.com; lhling@tcmg.com.sg; jjin@tcmg.com.sg
Subject: TP Survey assignment for SKN5811P DOA: 24.07.2019 Our ref: NSV1900378/KW

The above captioned accident refers.

Pursuant to the Practice Directions Amendment No. 1 of 2016 which was effective on 1 April 2016, we like to advise that the third party claimant and us **do not** have consensus in the appointment of **LKK AUTO CONSULTANT PTE LTD** as the Single Joint Expert to conduct the pre-repair survey of the third party claimant's vehicle.

Please conduct "THIRD PARTY" survey on without prejudice basis. The information as are follows:

3 rd Party Vehicle	:	SKN5811P
Insured Vehicle	:	GBG474E
Policy Number	:	AVCPSB0096631900
Name of Workshop	:	MASTER CAR SPRAY SERVICE
Contact Number	:	9384 8322 / 9856 8137
Person to Contact	:	SHI FU

Estimated Cost of
repairs

NA

Regards,
Claims Division


Copy to Tommy Choo, Mark Go LLC (Your Ref: TCMG/SKN5811P P/0719/MCS) via Email.

Note -

- (X)
1. This is to keep you informed that we have appointed surveyors to conduct inspection to your client's damaged vehicle on a without prejudice basis.
 2. **Please keep our motor surveyor and us informed so as to enable the surveyor to conduct a post repair inspection once your client's vehicle has been repaired and before returning the repaired vehicle to your customer.**
 3. Please quantify your client's claim with all relevant supporting documents once your client's vehicle has been repaired.
 4. Please do not construe this appointment of surveyor and our above request as an admission of liability.

Regards
Motor Claims
Claims Group
Global Market

The information contained in this e-mail and any attachments hereto is confidential. If you are not the intended recipient, you must not use or disseminate any of this information. If you have received this e-mail in error, please immediately notify the sender by reply e-mail and permanently delete the original e-mail (and any attachments hereto) and any copies or printouts thereof. Although this e-mail and any attachments hereto are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by Allied World Assurance Company Holdings, GmbH or its subsidiaries or affiliates, either jointly or severally, for any loss or damage arising in any way from its use.

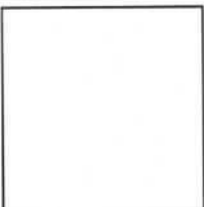

This email has been checked for viruses by AVG antivirus software.
www.avg.com

Nivitha (LKK Auto)

From: Goh, Stella <stella.goh@awac.com> on behalf of Motorsurvey <Motorsurvey@awac.com>
Sent: Friday, 26 July 2019 2:21 PM
To: assignments@lkkauto.com
Cc: sur@lkkauto.com; lhling@tcmg.com.sg; jin@tcmg.com.sg
Subject: TP Survey assignment for SKN5811P DOA: 24.07.2019 Our ref: NSV1900378/KW

The above captioned accident refers.

Pursuant to the Practice Directions Amendment No. 1 of 2016 which was effective on 1 April 2016, we like to advise that the third party claimant and us **do not** have consensus in the appointment of **LKK AUTO CONSULTANT PTE LTD** as the Single Joint Expert to conduct the pre-repair survey of the third party claimant's vehicle.

Please conduct "THIRD PARTY" survey on without prejudice basis. The information as are follows:

3 rd Party Vehicle	:	SKN5811P
Insured Vehicle	:	GBG474E
Policy Number	:	AVCPSB0096631900
Name of Workshop	:	MASTER CAR SPRAY SERVICE
Contact Number	:	9384 8322 / 9856 8137
Person to Contact	:	SHI FU
Estimated Cost of repairs	:	NA

Regards,
Claims Division

Copy to Tommy Choo, Mark Go LLC (Your Ref: TCMG/SKN5811P P/0719/MCS) via Email.

Note -

- (X)
1. This is to keep you informed that we have appointed surveyors to conduct inspection to your client's damaged vehicle on a without prejudice basis.
 2. **Please keep our motor surveyor and us informed so as to enable the surveyor to conduct a post repair inspection once your client's vehicle has been repaired and before returning the repaired vehicle to your customer.**
 3. Please quantify your client's claim with all relevant supporting documents once your client's vehicle has been repaired.
 4. Please do not construe this appointment of surveyor and our above request as an admission of liability.

Regards
Motor Claims
Claims Group

The information contained in this e-mail and any attachments hereto is confidential. If you are not the intended recipient, you must not use or disseminate any of this information. If you have received this e-mail in error, please immediately notify the sender by reply e-mail and permanently delete the original e-mail (and any attachments hereto) and any copies or printouts thereof. Although this e-mail and any attachments hereto are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by Allied World Assurance Company Holdings, GmbH or its subsidiaries or affiliates, either jointly or severally, for any loss or damage arising in any way from its use.

PRO-OPTION SERVICES

Mailing address: 81k 1898 Rivervale Drive, #04-1004, Singapore 542189

Tel: 6315 1239, Fax: 6315 3298, Mobile: 9061 0543

ACCIDENT VEHICLE INSPECTION REPORT

Report no : 292M0719.MCS
Vehicle no : SKN5811P

1 REFERENCE

Date of inspection : 26 July 2019
Requested by : Ang Chin Chin
19 Bedok Reservoir View
#04-01
Singapore 478935
Type of survey : Independent
Repairer : Master Car Spray Service
Blk 40 Toh Guan Road East, #01-67 Enterprise Hub, Singapore 608582
Date of accident : 24 July 2019

2 VEHICLE DATA

Make/model : SUBARU XV 1.61 AWD CVT ABS AIRBAGS 5DR
Chassis no : JF1GP3KC5CG008303
Engine no : FB16R300483
Date of registration : 27 Jun 2014
Engine capacity : 1600 cc
Odometer reading : 099974 km
Colour : Black

3 STATIC CONDITION CHECK

Steering : Serviceable
Foot brakes : Serviceable
Hand brakes : Serviceable
Paintwork : Good
General Condition : Good

4 TIRE CONDITION CHECK RH/MAKE

LH/MAKE

SIZE

Front tread	: 5 mm/Goodyear	5 mm/Goodyear	225/55R17
Rear tread	: 5 mm/Goodyear	5 mm/Goodyear	225/55R17

5 BRIEF DESCRIPTION OF DAMAGE

Rear windscreen glass broken, rear boot lid dented/bent/distorted, rear bumper broken, rear bumper reinforcement badly bent/distorted, rear end panel dented/bent/distorted, rear wheelhouse panel bent, spare tyre panel bowed, front bumper cover squashed/scraped/deformed, etc. Please see para. 8 of this report for more details.

6 REMARKS

This inspection is carried out on a "WITHOUT PREJUDICE" basis and I have not authorized any repairs.

7 RECOMMENDATION

Cost of repairs : \$7,600.00 (lump sum)
Estimated no of days : Five (5)

8 ASSESSMENT OF DAMAGE AND COSTS

Report no: 292M0719.MCS

Vehicle no: SKN5811P

A SPARE PARTS

Description	Qtv	Assessed Condition	Repairer's Amount	Revised Amount
Rear windscreen glass	1	broken	799.20	799.20
Rear windscreen moulding	1	necessary	34.20	34.20
Rear wiper motor <i>X SUC</i>	1	backet bent/shaft wobbled	424.80	X 424.80
Rear boot lid	1	dented/bent/distorted	910.20	910.20
Rear boot lid lock assy	1	jaws shaky/distorted	200.40	200.40
Rear boot lid lock lower catch <i>X SUC</i>	1	to repair	34.20	X 0.00
Rear boot weatherstrip	1	bent/channel deformed	119.60	119.60
Rear boot lid "SUBARU" emblem	1	necessary	68.50	68.50
rear boot lid "AWD" emblem	1	necessary	39.00	39.00
Rear boot lid "VX" emblem	1	necessary	40.80	40.80
Rear boot lid "Subaru" logo	1	necessary	83.60	83.60
Rear boot lid hinge - LH/RH <i>X SUC</i>	2	to repair	48.80	X 0.00
Rear boot lid trim board c/w clip <i>X SUC</i>	1	to reuse	252.20	X 0.00
Rear boot lid gas strut stay - LH/RH <i>X SUC</i>	2	bent/stiiffened	344.80	X 344.80
LH taillamp assy	1	broken	377.40	377.40
LH taillamp side clip	1	necessary	5.50	5.50
LH taillamp base panel	1	bent/distorted	33.50	33.50
LH rear fender <i>R X</i>	1	to repair	864.20	X 0.00
LH rear fender trim board c/w clip	1	bent/distorted	402.40	402.40
LH rear wheel arc garnish c/w clip <i>X SUC</i>	1	scraped	180.30	X 180.30
Lh rear fender splash shield <i>X SUC</i>	1	scraped/bent/distorted	64.80	X 64.80
RH taillamp assy <i>X SUC</i>	1	to reuse	377.40	X 0.00
RH taillamp side clip	1	necessary	5.50	5.50
RH taillamp base panel <i>X</i>	1	to repair	33.50	X 0.00
Rear bumper cover	1	broken	594.20	594.20
Rear bumper reinforcement	1	Badly bent/distorted	187.20	187.20
Rear bumper side retainer- LH/RH	2	necessary	39.20	39.20
Rear bumper side reflector - LH/RH <i>X SUC</i>	2	to reuse	48.40	✓ 0.00
Rear bumper centre reflector <i>X SUC</i>	1	to reuse	124.20	X 0.00
Tow eye cover	1	missing	16.30	16.30
Rear bumper clip	10	necessary	35.00	35.00
Rear end panel	1	dented/bent/distorted	288.90	288.90
Rear end panel garnish c/w clip	1	squashed/bent	160.20	160.20
Spare tyre panel <i>R X</i>	1	to repair	540.20	X 0.00
Spare tyre board <i>f SUC</i>	1	to reuse	374.20	X 0.00
Spare tyre panel styrofoam tray	1	broken	153.20	153.20
Rear exhaust silencer <i>X R</i>	1	bent	576.20	X 576.20
Front bumper cover	1	squashed/scraped/deformed	594.20	594.20
Front bumper side retainer - LH/RH <i>X SUC</i>	2	necessary	34.40	X 34.40
Front bumper clip	10	necessary	35.00	35.00
Front bumper reinforcment <i>X SUC</i>	1	bent	278.20	X 278.20
Front bumper inner foam filler	1	squashed/creased	79.20	79.20
Tow-eye cover <i>f SUC</i>	1	to reuse	24.20	X 0.00
Subtotal of the above			9,927.40	7,205.90
Discount			20%/ 20%	1,985.48
Subtotal 1:			7,941.92	5,764.72

5302.40
20%
4241.92

Report no:	292M0719.MCS
Vehicle no:	SKN5811P

(Special nett)

Rear windscreen sealant	1 necessary	80.00	80.00 60
Reverse sensor set	1 dented/shorted	280.00	280.00 220
Front number plate set	1 dented/squashed	70.00	70.00 35
Subtotal 2:		430.00	430.00 315
Total cost of parts:		8,371.92	6,194.72

B LABOUR

REAR PORTION

Labour charges to dismantle and remove damaged parts, renew and install; to cut out damaged body panel, install and weld new part; to pull, knock, straighten and reshape affected areas.	1,200.00	900.00 800
Spray painting of the rear bumper, rear end panel, rear boot lid, spare tyre panel, rear LH wheelhouse panel, etc.	1,500.00	1,250.00 1000
To check all affected wiring and electrical parts for condition and rectify where needed.	45.00	30.00
To remove and transfer tailgate inner attachments and electrical parts to new tailgate.	90.00	60.00 2630
To remove, transfer and install rear windscreen glass.	140.00	120.00
To remove and replace exhaust silencer. X 11		
To install reverse sensors and check for proper function.	90.00	60.00
To apply anti-rust undercoat for the affected areas.	200.00	150.00 150
Towing services.	80.00	80.00 60

FRONT PORTION

Labour charges to dismantle and remove damaged parts, renew and install; to cut out damaged body panel, install and weld new part; to pull, knock, straighten and reshape affected areas.	600.00	300.00 200
Spray painting of the front bumper and necessary areas.	350.00	250.00 200
To check all affected wiring and electrical parts for condition and rectify where needed.	45.00	30.00

Total cost of labour:	4,340.00	3,230.00
-----------------------	----------	----------

Total cost of repair:	12,711.92	9,424.72
------------------------------	------------------	-----------------

Report no: 292M0719.MCS
Vehicle no: SKN5811P

9 CONCLUSION

The revised or adjusted cost of repairs to restore the vehicle is

\$9,424.72

(a) The recommended cost of repair based on lump sum basis would be

\$7,600.00

(b) The estimated number of days taken by the repairs would be


Five (5)

The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its pre-accident condition.

Note: Lump Sum Repair Basis

This means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition.

Yours faithfully

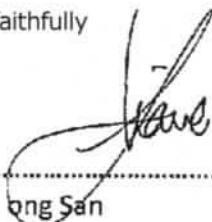

Liaw Leong San

Licensed Automotive Appraiser

Dated: 11 September 2019

4241.92

315.00

2630.00

7186.92

20%

5749.53

43-5750

5 days

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	24/07/2019 14:36
Date Of Accident	24/07/2019 10:00
Exact Location Of Accident	ALONG PIE EXIT CLEMENTI RD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKN5811P
Insured/Policyholder	
Name Of Registered Owner	ANG CHIN CHIN
NRIC No	S7630842Z
Email Address	KATHERINE_57@YAHOO.COM
Mobile Phone No	(LOCAL) +65-97683065
Alternative Phone No	OFFICE-NOPHONE
Vehicle Particulars	
Manufacturer	SUBARU
Model	XV-1.6 (A)
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR
Insurance Company	
Name of Insurance Company	EQ INSURANCE COMPANY LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	DMPPHQ18-007839
Cover Note Number	
Driver	
Name of Driver	ANG CHIN CHIN
NRIC No	S7630842Z
Date Of Birth	24/09/1976
Occupation	INDOOR
Date Of Driving Pass	22/11/2004
Driving Experience	14 YEARS AND 8 MONTHS
Gender	FEMALE
Mobile Number	(LOCAL) +65-97683065
Fax Number	
Contact Number	OFFICE-NOPHONE
EMail Address	KATHERINE_57@YAHOO.COM

Address	19 BEDOK RESERVOIR VIEW #04-01
Postcode	478935
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	3
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	YES
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Police Station Name	TAMPINES N.P.C
Police Station Address	ROAD: TAMPINES N.P.C , POSTCODE: 529682 , COUNTRY: SINGAPORE
Police Station Contact	TEL NO: - FAX NO:
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO POLICE REPORT T/20190725/2015

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SDP1970L
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	WOON
NRIC/Passport Number	
Contact Number	98346601
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	

No. Of Passenger (Including Driver)

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	GBG474E
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	
NRIC/Passport Number	
Contact Number	82553065
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

DETAILS OF INJURED PERSON 1

Name	ANG CHIN CHIN
Approximate Age	
Injuries Sustain	
Injured person in which vehicle?	SKN5811P
Were seat belts worn?	
Was this injured conveyed to hospital by ambulance?	NO
Address	
Postcode	

SKETCH PLAN

IMPORTANT NOTICE


1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims. (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.



 Policyholder's Signature
 Date & Time:

Driver's Signature
 (If driver is not the policyholder)
 Date & Time:

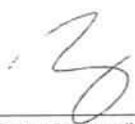
 Reporting Centre Personnel's Signature
 Name:
 NRIC/FIN No.:

I AM AWARE THAT MY INSURER MAY HAVE A 14 DAYS TIMEFRAME FOR ME TO SUBMIT AN OWN DAMAGE CLAIM UNDER MY OWN POLICY. I WILL

Sketch Plan Pg. 2

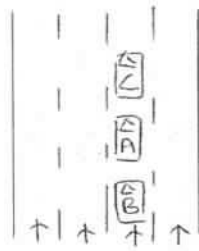

PIE Exit Clementi

A-SKNS811P

B-GBG474E

C-SDP1970L

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Refer to Police Report T/20190725/2015

DECLARATION

I/We declare the foregoing particulars are true in every respect.

[Signature]

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

☐ Claim own policy

☐ Claim third party

☒ Claim CD (TP) at other workshop *Master Car Spray*

☐ For record purpose

Policy No. *DMPPH18-007839*

Insurer *EQ* Veh.No. *SKNS811P*

[Signature]
Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:



SINGAPORE POLICE FORCE



T/20190725/2015

Police Station Of Origin:
Tampines N.P.C
6 Tampines Avenue 4 SINGAPORE 529682
Tel No: 1800-5871999

1 of 3

Report No. T/20190725/2015

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 25/07/2019 08:38	Vide Report No.:	Station Diary No.: 19
--------------------------------------------	------------------	--------------------------

Informant's Particulars

Name of Informant: ANG CHIN CHIN	Address: 19 BEDOK RESERVOIR VIEW #04-01 SINGAPORE 478935		
ID Type / ID No.: NRIC NO / S7630842Z	Contact No.: Home/Office: Mobile: 97683065		
Nationality: SINGAPORE CITIZEN	Email:		
Sex: Female	Age: 42	Date of Birth: 24/09/1976	Type of Informant: Driver
Race: Chinese	Language:		Institution / School Name:
Occupation: PRODUCT MANAGER	Driving Licence Information: Class: Date of Expiry:		

General Information of the Accident

General Information of the Accident				
Type of Accident:	Injury Others	Drink Drive: No	Date/Time of Accident: 24/07/2019 10:00	Type of Location: Straight Road
Location: Along Road 1 PAN ISLAND EXPRESSWAY NEAR CLEMENTI EXIT				
Weather: Cloudy		Road Surface: Wet		Road Speed Limit:
Traffic Flow: One Way		Traffic Control: Not Controlled		Traffic Volume: Moderate
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: No

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
GBG474E	Lorry	TOYOTA	DYNA 150 5MT	Silver	Slightly Damaged	0
SDP1970L	Car	TOYOTA	TOYOTA COROLLA ALTIS 1.6L CVT	Silver	Slightly Damaged	0
SKN5811P	Car	SUBARU	XV 1.6i AWD CVT ABS AIRBAGS 5DR	Black	Slightly Damaged	0



**SINGAPORE
POLICE FORCE**



T/20190725/2015

2 of 3

Report No. T/20190725/2015

Police Station Of Origin:
Tampines N.P.C.
6 Tampines Avenue 4 SINGAPORE 529682
Tel No: 1800-5871999

CONTINUATION OF REPORT

Details of Vehicle Insurance				
Vehicle No.	Insurance Company	Insurance No	Effective	Expiry Date
SKN5811P	EQ INSURANCE COMPANY LTD.	DMPPHQ18-007839	24/11/2018	23/11/2019

Brief Details.

On the 24th of July 2019 at about 1000hrs, I was driving my car bearing plate number SKN5811P, along Pan Island Expressway, near Clementi exit. There was a road re-alignment going on. The car in front of me stopped and I managed to stop in time however the lorry bearing plate number GBG474E, hit onto my car from the back, causing my car to hit on the car in front (SDP1970L).

Due to the accident, my car had its rear windscreen shattered, back door and rear bumper damaged. The lorry had its front bumper and lights damaged. The other car had its rear bumper cracked.

No one was injured at that point of time. No traffic police and ambulance were at scene.

I went to see the gynaecologist and was given 4 days MC (013416205) from 24/7/2019 to 27/7/2019 due to right knee injury.

The lorry driver is contactable at 82553085. The driver of the other car is namely Woon (hp no: 98346601).



**SINGAPORE
POLICE FORCE**



T/20190725/2015

Police Station Of Origin:
Tampines N.P.C
6 Tampines Avenue 4 SINGAPORE 529682
Tel No: 1800-5871999

3 of 3

Report No: T/20190725/2015

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report:
G /
Sgt 3 SITI NUR SYAFIAH BINTE AZMAN

Signature Of Interpreter:
Not applicable

Officer In Charge Of Case:
TP / AEIT /
Sgt 3 KOH CHEE SENG, KEVIN
Contact No: 65472073

Authentication Stamp
NP168

Signature Of Informant:

Date/Time:
25/07/2019 08:38

Classification Of Case:

SIGNATURE

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	842Z
Vehicle Details	
Vehicle No.:	SKN5811P
Vehicle to be Exported:	No
Intended Deregistration Date:	30 Jul 2019
Vehicle Make:	SUBARU
Vehicle Model:	XV 1.6i AWD CVT ABS AIRBAGS 5DR
Primary Colour:	Black
Manufacturing Year:	2012
Engine No.:	FB16R300483
Chassis No.:	JF1GP3KC5CG008303
Maximum Power Output:	84.0 kW (112 bhp)
Open Market Value:	\$22,455.00
Original Registration Date:	27 Jun 2014
First Registration Date:	27 Jun 2014
Transfer Count:	1
Actual ARF Paid:	\$18,437.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	26 Jun 2024
PARF Rebate Amount:	\$12,905.00
Intended COE Rebate Details	
COE Expiry Date:	26 Jun 2024
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$61,899.00
COE Rebate Amount:	\$30,381.00
Total Rebate Amount:	\$43,286.00

The information contained herein is correct as at 30 Jul 2019

OK



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
ALLIED WORLD ASSURANCE COMPANY LTD		Ref : CS3/AWA19013213/R1tf3e2	
(SINGAPORE BRANCH) 60 ANSON ROAD #08-01 (8th FLOOR) MAPLETREE ANSON SINGAPORE 079914		Date : 11-12-2019	
		Code : AWA	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	GBG 474E	Veh. Inspected	SKN 5811P
Policy No.		Coverage (\$)	0.00
Claim No.	NSV1900378/KW	Excess (\$)	0.00
Assign From	STELLA GOH	Assign Date	26/07/2019
2. Vehicle Particulars & Condition			
Make & Model	SUBARU XV 1.6I	c.c	1600
Engine No.	HIDDEN	Year of Reg.	2014
Chassis No.	JF1GP3KC5CG008303	Colour	BLACK
Odometer	99974	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	FAIR		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	225/55 R17	GOODYEAR	6 mm
L/H Front Tyre	225/55 R17	GOODYEAR	6 mm
R/H Rear Tyre	225/55 R17	GOODYEAR	6 mm
L/H Rear Tyre	225/55 R17	GOODYEAR	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	24/07/2019	Inspection Date	26/07/2019
Survey held at	40 TOH GUAN ROAD EAST #01-67		
Repairer	MASTER CAR SPRAY SERVICE		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKN 5811P

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	REAR WINDSCREEN GLASS	BROKEN	799.20	799.20
1	REAR WINDSCREEN MOULDING	NECESSARY	34.20	34.20
1	REAR WIPER MOTOR	SERVICEABLE	424.80	-
1	REAR BOOT LID	DENTED / BENT / DISTORTED	910.20	910.20
1	REAR BOOT LID LOCK ASSY	JAWS SHAKY / DISTORTED	200.40	200.40
1	REAR BOOT LID LOCK LOWER CATCH	SERVICEABLE	34.20	-
1	REAR BOOT WEATHERSTRIP	BENT / CHANNEL DEFORMED	119.60	119.60
1	REAR BOOT LID "SUBARU" EMBLEM	NECESSARY	68.50	68.50
1	REAR BOOT LID "AWD" EMBLEM	NECESSARY	39.00	39.00
1	REAR BOOT LID "VX" EMBLEM	NECESSARY	40.80	40.80
1	REAR BOOT LID "SUBARU" LOGO	NECESSARY	83.60	83.60
2	REAR BOOT LID HINGE - LH / RH	SERVICEABLE	48.80	-
1	REAR BOOT LID TRIM BOARD C/W CLIP	SERVICEABLE	252.20	-
2	REAR BOOT LID GAS STRUT STAY - LH / RH	SERVICEABLE	344.80	-
1	LH TAILLAMP ASSY	BROKEN	377.40	377.40
1	LH TAILLAMP SIDE CLIP	NECESSARY	5.50	5.50
1	LH TAILLAMP BASE PANEL	BENT / DISTORTED	33.50	33.50
1	LH REAR FENDER	TO REPAIR SEE LABOUR	864.20	-
1	LH REAR FENDER TRIM BOARD C/W CLIP	BENT / DISTORTED	402.40	402.40
1	LH REAR WHEEL ARC GARNISH C/W CLIP	SERVICEABLE	180.30	-
1	LH REAR FENDER SPLASH SHIELD	SERVICEABLE	64.80	-
1	RH TAILLAMP ASSY	SERVICEABLE	377.40	-
1	RH TAILLAMP SIDE CLIP	NECESSARY	5.50	5.50
1	RH TAILLAMP BASE PANEL	TO REPAIR SEE LABOUR	33.50	-
1	REAR BUMPER COVER	BROKEN	594.20	594.20
1	REAR BUMPER REINFORCEMENT	BADLY BENT / DISTORTED	187.20	187.20
2	REAR BUMPER SIDE RETAINER - LH / RH	NECESSARY	39.20	39.20
2	REAR BUMPER SIDE REFLECTOR - LH / RH	SERVICEABLE	48.40	-
1	REAR BUMPER CENTRE REFLECTOR	SERVICEABLE	124.20	-
1	TOW EYE COVER	MISSING	16.30	16.30

Report Ref No. CS3/AWA19013213/R1tf3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
10	REAR BUMPER CLIP	NECESSARY	35.00	35.00
1	REAR END PANEL	DENTED / BENT / DISTORTED	288.90	288.90
1	REAR END PANEL GARNISH C/W CLIP	SQUASHED / BENT	160.20	160.20
1	SPARE TYRE PANEL	TO REPAIR SEE LABOUR	540.20	-
1	SPARE TYRE BOARD	SERVICEABLE	374.20	-
1	SPARE TYRE PANEL STYROFOAM TRAY	BROKEN	153.20	153.20
1	REAR EXHAUST SILENCER	TO REPAIR SEE LABOUR	576.20	-
1	FRONT BUMPER COVER	SQUASHED / SCRAPED / DEFORMED	594.20	594.20
2	FRONT BUMPER SIDE RETAINER - LH / RH	SERVICEABLE	34.40	-
10	FRONT BUMPER CLIP	NECESSARY	35.00	35.00
1	FRONT BUMPER REINFORCEMENT	SERVICEABLE	278.20	-
1	FRONT BUMPER INNER FOAM FILLER	SQUASHED / CREASED	79.20	79.20
1	TOW-EYE COVER	SERVICEABLE	24.20	-
	LESS 20% DISCOUNT		-1,985.48	-1,060.48
			7,941.92	4,241.92
	<u>SPECIAL NETT ITEMS</u>			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	80.00	60.00
1	SET REVERSE SENSOR (SN)	DENTED / SHORTED	280.00	220.00
1	SET FRONT NUMBER PLATE (SN)	DENTED / SQUASHED	70.00	35.00
			430.00	315.00
	<u>LABOUR</u>			
	LABOUR CHARGES TO DISMANTLE AND REMOVE DAMAGED PARTS, RENEW AND INSTALL; TO CUT OUT DAMAGED BODY PANEL, INSTALL AND WELD NEW PART; TO PULL, KNOCK, STRAIGHTEN AND RESHAPE AFFECTED AREAS. INCLUSIVE OF THE REPAIR OF LH REAR FENDER, RH TAILLAMP BASE PANEL, SPARE TYRE PANEL AND REAR EXHAUST SILENCER.		1,200.00	800.00
	SPRAY PAINTING OF THE REAR BUMPER, REAR END PANEL, REAR BOOT LID, SPARE TYRE PANEL, REAR LH WHEELHOUSE PANEL, ETC.		1,500.00	1,000.00
	TO CHECK ALL AFFECTED WIRING AND ELECTRICAL PARTS FOR CONDITION AND RECTIFY WHERE NEEDED.		45.00	30.00

Report Ref No. CS3/AWA19013213/R1tf3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND TRANSFER TAILGATE INNER ATTACHMENTS AND ELECTRICAL PARTS TO NEW TAILGATE.		90.00	60.00
	TO REMOVE, TRANSFER AND INSTALL REAR WINDSCREEN GLASS.		140.00	120.00
	TO REMOVE AND REPLACE EXHAUST SILENCER. (NPA)	NOT NECESSARY	-	-
	TO INSTALL REVERSE SENSORS AND CHECK FOR PROPER FUNCTION.		90.00	60.00
	TO APPLY ANTI-RUST UNDERCOAT FOR THE AFFECTED AREAS.		200.00	100.00
	TOWING SERVICES.		80.00	60.00
	LABOUR CHARGES TO DISMANTLE AND REMOVE DAMAGED PARTS, RENEW AND INSTALL; TO CUT OUT DAMAGED BODY PANEL, INSTALL AND WELD NEW PART; TO PULL, KNOCK, STRAIGHTEN AND RESHAPE AFFECTED AREAS.		600.00	200.00
	SPRAY PAINTING OF THE FRONT BUMPER AND NECESSARY AREAS.		350.00	200.00
	TO CHECK ALL AFFECTED WIRING AND ELECTRICAL PARTS FOR CONDITION AND RECTIFY WHERE NEEDED.	NOT NECESSARY	45.00	-
			4,340.00	2,630.00
GRAND TOTAL			12,711.92	7,186.92
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,750.00

Report Ref No. CS3/AWA19013213/R1tf3e2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.