

28/19 (Mon)

Esteem Performance Pte Ltd
385 Sin Ming Drive, Vicom
Vehicle Inspection Centre
(575718)

Claim Reference: SLD1704H
Assessment number: 012114
Version: 1810
Date calculated: 31/07/2019 10:58 AM

Full Report
Registration: SLK3538X
Printed: 31/07/2019 10:58 AM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	AIG Asia Pacific Insurance Pte Ltd
Printed by:	Carmen SG	Currency:	SGD
Claim Reference:	SLD1704H	Date of Incident:	29/07/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	TOYOTA
Model:	PRIUS IV
Sub Model:	BASE MODEL
Model Sheet Number:	70 P5 01
Registration:	SLK3538X
VIN number:	
Odometer:	
Model Specs	
TWO COAT METALLIC	

Not Notified
Minor Repair
2 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Esteem Performance Pte Ltd
385 Sin Ming Drive, Vicom
Vehicle Inspection Centre
(575718)

Claim Reference: SLD1704H
 Assessment number: 012114
 Version: 1810
 Date calculated: 31/07/2019 10:58 AM

Full Report
 Registration: SLK3538X
 Printed: 31/07/2019 10:58 AM


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
 Date of Inspection:

Damage Areas

All ☐
 Underbody ☐

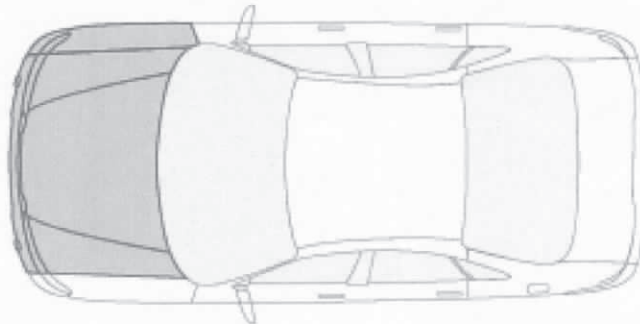

Labour

Code	Description	Time Base 10 WU/h	Price = 50.00 SGD/h	
			WU	Price SGD
B020	RENEW FRONT BUMPER INCLUDES: R + R FRONT BUMPER, RADIATOR GRILLE AND NECESSARY ATTACHED PARTS		15.0	75.00
B040)	R + R LEFT HEADLAMP (BUMPER REMOVED) DOES NOT INCLUDE: ADJUST HEADLAMP		1.0	5.00
B040)	RENEW RIGHT HEADLAMP ASSY (BUMPER REMOVED) NOT INCLUDED: ADJUST HEADLAMPS		2.0	10.00
NO NUMBER	ADJUST HEADLAMPS		2.0	10.00
531041)	R + R RIGHT FRONT WHEELHOUSE SHELL		1.0	5.00
531041A)	R + R L/- AND R/WHEELHOUSE SHELL		2.0	10.00
750101	R + R RIGHT FRONT WING BADGE		5.0	25.00
NO NUMBER	R + R L/F BUMPER MOUNTING		1.0	5.00
NO NUMBER	R + R R/F BUMPER MOUNTING		1.0	5.00
B010)	R + R FRONT BUMPER REINFORCEMENT		3.0	15.00

Esteem Performance Pte Ltd
385 Sin Ming Drive, Vicom
Vehicle Inspection Centre
(575718)

Claim Reference: SLD1704H
 Assessment number: 012114
 Version: 1810

Date calculated: 31/07/2019 10:58 AM

Full Report
 Registration: SLK3538X
 Printed: 31/07/2019 10:58 AM

Code	Description	WU	Price SGD
B010)	R + R FRONT BUMPER LOWER REINFORCEMENT	2.0	10.00
NO NUMBER	R + R FRONT LOWER ENGINE COVER	1.0	5.00
NO NUMBER	R + R UPPER RADIATOR AIR GUIDE	1.0	5.00
851091)	R + R WINDSCREEN WASHER TANK	1.0	5.00
420018)	R + R RIGHT FRONT WHEEL	1.0	5.00
0990	R/RADIATOR BRACKET REPAIR	30.0*	150.00
1017	UPP FRT PNL C-MEMBER REPAIR	30.0*	150.00
1024	R/F PANEL SUPPORT REPAIR	30.0*	150.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		12.90	129.0
Total of Labour			645.00

Paint

Paint Work

SYSTEM AZT

Time Basis 10WU/h

Code	Description - TWO COAT METALLIC	WU	Price SGD
	R/F BUMPER COVER NEW PART PAINT K1R	3.0	
	FRONT BUMPER NEW PART PAINT K1R	15.0	
	BONNET SURFACE PAINT	9.0	
	R/F WING SURFACE PAINT	5.0	
	R/RADIATOR BRACKET SURFACE PAINT	4.0	
	UPP FRT PNL C-MEMBER SURFACE PAINT	4.0	
	R/F PANEL SUPPORT SURFACE PAINT	4.0	

Paint Material Per Part

Code	Description	Price SGD
0278	R/F BUMPER COVER NEW PART PAINT K1R	0.49
0283	FRONT BUMPER NEW PART PAINT K1R	76.26
0471	BONNET SURFACE PAINT	26.64
0742	R/F WING SURFACE PAINT	9.46
0990	R/RADIATOR BRACKET SURFACE PAINT	1.25
1017	UPP FRT PNL C-MEMBER SURFACE PAINT	3.24
1024	R/F PANEL SUPPORT SURFACE PAINT	1.25

Esteem Performance Pte Ltd
385 Sin Ming Drive, Vicom
Vehicle Inspection Centre
(575718)

Claim Reference: SLD1704H
 Assessment number: 012114
 Version: 1810
 Date calculated: 31/07/2019 10:58 AM

Full Report
Registration: SLK3538X
Printed: 31/07/2019 10:58 AM

Code	Description	Price SGD
1001	FRT NUM PLATE FRT NUM PLATE	<i>sn</i> 45.00* <i>X</i>
	Total Extras	45.00

Final Calculation

	SGD	SGD
Parts	4,840.94	
Total Discount(+30.00%)	-1,452.28	
Total Parts		3,388.66
Labour Time Base 10 WU/h		
Total 129.0 WU X 50.00 SGD/h	645.00	
Total of Labour		645.00
Total Of Extras		45.00
Paint Work Time Base 10 WU/h		
Labour Cost 60.0 WU X 50.00 SGD/h	300.00	
Material Cost	145.69	
Total Paint Including Material		445.69
Repair Cost Excludes GST		4,524.35
GST (+7.0%)		316.70
Repair Cost Included GST		4,841.05

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS