

SLQ811U

BMW Dealer

## Performance Motors Limited

A Sime Darby Motors Company  
Co. Reg. No. 197401559M GST Reg. No M2-0020081-X  
Toll-Free Number (1800-2255269)



303, Alexandra Road  
Sime Darby Performance Centre  
Singapore 159941  
Fax: 64747770

280, Kampong Arang Road  
East Coast Centre  
Singapore 438180  
Fax: 63449773

315, Alexandra Road  
Sime Darby Business Centre  
Singapore 159944  
Fax: 64796601 (AfterSales)  
64796624 (Motorrad)

06 AUG 2019

GST REG. NO : M2 - 0020081 - X

## ESTIMATE

#Car in #

Estimate No. : b1 52230	Page No. : 1 of 6
Date Estimated : 05/08/2019	
Prepared By : Han Kwan Yong	

- ESTIMATE REPAIR FOR - Oh Sze Ching (Hu SiQin) 132 Punggol Walk #12-17  Singapore 828777	- ACCOUNT - 40000 Cash Sales - Service Singapore
--	--

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SLQ811U	V925931	28/06/2017	216d CAT	0

DESCRIPTION	VALUE
To tow accident vehicle to PML workshop.	for receipt? ✓ 195.00
To replace rear bumper & attachments, boot lid, tail panel exterior & interior including to pull & straighten both rear chassis, to knock out trunk floor panel and dented area caused by the accident	#250 ✓ 5,950.00
To respray rear bumper, tail panel, rear left fender, rear right fender, boot lid and boot compartment	4470 ✓ 4,967.00
To carry out body cavity preservation. (Per panel).	100 ✓ 118.00
To carry out body cavity preservation. (For cut panel).	45 ✓ 531.00
To replace front exhaust silencer including align exhaust system and conduct checks for leak.	photo? 45 ✓ 531.00
To replace rear exhaust silencer including alignment system and conduct checks for leak.	photo? 45 ✓ 531.00
To replace each diesel particulate filter including alignment and conduct checks for leak.	photo? 564 ✓ 664.00
To replace engine mountings including re-alignment of engine block to body frame.	photo? 577X <sup>mm</sup> 679.00
To replace gearbox mountings including re-alignment of gearbox to cross member and propeller shaft system.	photo? 577X <sup>mm</sup> 679.00
To remove and install boot compartment carpet and garnish to facilitate repairs.	230 ✓ 271.00
To remove and install fuse box at the rear section to facilitate repairs.	photo? 45X <sup>mm</sup> 531.00

## Performance Motors Limited

A Sime Darby Motors Company  
Co. Reg. No. 197401559W GST Reg. No M2-0020081-X  
Toll-Free Number (1800-2255269)

303, Alexandra Road  
Sime Darby Performance Centre  
Singapore 159941  
Fax. 64747770

280, Kampong Arang Road  
East Coast Centre  
Singapore 438180  
Fax. 63449773

315, Alexandra Road  
Sime Darby Business Centre  
Singapore 159944  
Fax. 64796601 (AfterSales)  
64796624 (Motorrad)



GST REG. NO : M2 - 0020081 - X

## E S T I M A T E

Estimate No.	: b1 52230	Page No. : 2 of 6
Date Estimated	: 05/08/2019	
Prepared By	: Han Kwan Yong	

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SLQ811U	V925931	28/06/2017	216d CAT	0

DESCRIPTION	VALUE
To conduct water leak tests.	68 ✓ 75.00
To remove and install rear windscreen glass to transfer from old to new boot lid	450 ✓ 574.00
To supply and install rear windscreen solar film.	451 X <sup>un</sup> 531.00
To replace bootlid smart opener control unit, top and bottom sensor lines including program and conduct checks for proper function.	350 ✓ photo? 561 661.00
To transfer lock mechanism from old to new bootlid including conduct checks on new bootlid central locking system for proper function.	451 ✓ 531.00
To check electrical wiring systems and lightings at the rear section for proper function.	150 ✓ 177.00
Customer Comment: After accide nt engine loss power when accelerate -	photo? 150 X <sup>un</sup> 177.00
To check & rectify engine loss power when accelerate	
Sundries.	✓ 150.00
Total Labour 1:	18,523.00

## DESCRIPTION

CLAMPING BUSH  
RUBBER MOUNTING  
# EXCHANGE EXHAUST PIPE CATALY  
REAR SILENCER  
# MUFFLER CLAMP D=63.2MM  
# EXCH DIESEL PARTICULATE FILT  
TAILPIPE TRIM BLACK CHROME  
# HOLDER EXHAUST SYSTEM  
STABILIZER LINK  
ENGINE MOUNT  
GEARBOX MOUNT  
TRUNK LID  
# INTERIOR TAIL TRIM  
# TAIL PANEL  
# REAR BUMPER PANEL PRIMED (PD  
RR BUMPER LH SIDE GUIDE  
RR BUMPER RH SIDE GUIDE  
REAR BUMPER CARRIER  
SUPPORT

QTY	PRIC	VALUE
1	54.30	bt ✓ 54.30
2	17.00	un X 34.00
1	1,694.80	bt ✓ 1,694.80
1	1,167.45	bt ✓ 1,167.45
1	42.85	un X 42.85
1	3,727.75	H ✓ 3,727.75
1	110.55	bt ✓ 110.55
2	57.20 27.90	bt ✓ 114.40 55.80
1	92.05	? 92.05
1	239.80	✓ 239.80 un X
1	208.50	✓ 208.50
1	1,204.35	bt ✓ 1,204.35
1	279.10	de ✓ 279.10
1	355.20	bt ✓ 355.20
1	1,045.45	de ✓ 1,045.45
1	49.05 61.35	de ✓ 49.05
1	49.05	un X 49.05
1	458.10	bt ✓ 458.10
1	45.30	bt ✓ 45.30



## Performance Motors Limited

A Sime Darby Motors Company  
Co. Reg. No. 197401559W GST Reg. No M2-0020081-X  
Toll-Free Number (1800-2255269)

303, Alexandra Road  
Sime Darby Performance Centre  
Singapore 159941  
Fax: 64747770

280, Kampong Arang Road  
East Coast Centre  
Singapore 438180  
Fax: 63449773

315, Alexandra Road  
Sime Darby Business Centre  
Singapore 159944  
Fax: 64796603  
64796624



GST REG. NO : M2 - 0020081

## E S T I M A T E

HK Auto Consultants hence notify  
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Estimate No. : b1 52230  
Date Estimated : 05/08/2019  
Prepared By : Han Kwan Yong

Page No. : 3 of 6  
Acknowledged By Repairer  
Signature:  
Date:

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SLQ811U	V925931	28/06/2017	216d CAT	0

DESCRIPTION	QTY	PRIC	VALUE
RR BUMPER LH INNER SIDE GUIDE	1	60.05	60.05
RR BUMPER RH INNER SIDE GUIDE	1	60.05	60.05
GROMMET	2	0.75	1.50
PLAQUE 74MM	1	71.25	71.25
STRIKER BOOT LID	1	58.25	58.25
LOCK TRUNK LID	1	193.80	193.80
REAR FLAP TOWING EYE PRIMED	1	42.85	42.85
REAR WINDOW ESG	1	654.35	654.35
# REAR BUMPER HEAT INSULATOR	1	60.60	60.60
# LOWER TAIL LID TRIM PANEL	1	275.70	275.70
# TRUNK LID SEALING	1	97.85	97.85
SENSOR WIRE FOR SMART OPENER TOP	1	43.15	43.15
SENSOR WIRE FOR SMART OPENER BOTTOM	1	41.50	41.50
CONTROL UNIT SMART OPENER	1	494.60	494.60
# LH GUTTER STRIP	1	51.95	51.95
# RH GUTTER STRIP	1	51.95	51.95
REAR LH LIGHT IN THE SIDE PANEL	1	270.50	270.50
RR LH LIGHT IN THE TRUNK LID	1	255.65	255.65
RR RH LIGHT IN THE TRUNK LID	1	255.65	255.65
RR RH LIGHT IN THE SIDE PANEL	1	365.20	365.20
DECOUPLING RING PDC TORQUE CONVERTER	4	5.05	20.20
ULTRASONIC SENSOR MINERALWEISS(WA96	1	368.80	368.80
BLIND RIVET AVIBVLB	6075	0.55	41.25
SCREW (SF PLUS M5X15)	520	0.55	11.00
(DG/SL) BODY ADHESIVE K5B (195ML)	1	326.80	326.80
(DG) BODYWORK ADHESIVE K5A (50ML)	1	112.70	112.70
(DG) CLEANER R1 (100ML)	1	26.15	26.15
(DG/SL) W/SCREEN SEALANT (COLD 1 HOUR)	2	131.55	263.10
PUNCH RIVET N4	4030	0.55	16.50
(DG/SL) GLASS PRIMER 30ML (VP206)	1	27.85	27.85
(S/L) SEAM SEAL 300ML	82	33.80	101.40

Total Parts : 16,800.60

## Claims OD / 3rd Party / Uninsured losses / Direct Settlement

Regn No. \_\_\_\_\_ Claim No. \_\_\_\_\_  
Date & Time 6/8/19 Excess \$

Surveyor's Name Tan Jie Sign \_\_\_\_\_  
Surveyor's Tel 97445449 Authorised Yes / No

Authorised Date WP Time

RESURVEY PARTS PHOTO BY SURVEYOR Yes / No PML Yes / No

Surveyor's E-mail tan.jie@pml.com.sg

No of Working Days Recommend 9-11 days

Labour 1	:	18,523.00
Parts	:	16,800.60
Labour 2	:	0.00
Excess	:	0.00
Total GST @ 7%	:	2,472.65
Grand Total	:	37,796.25

\*\* THIS ESTIMATE IS VALID FOR A PERIOD OF 30 DAYS ONLY\*\*

\*\* PRICE FOR PARTS ARE SUBJECTED TO CHANGE WITHOUT PRIOR NOTICE \*\*

## Vic (LKKAuto)

---

**From:** Sharon Heng L K <sharon.heng.leekun@simedarby.com.sg>  
**Sent:** Friday, 18 October, 2019 1:51 PM  
**To:** Taufikh (LKKAuto)  
**Cc:** Vic (LKKAuto); Toh Jing Xuan; Bernard Wan Chong Huat  
**Subject:** DIRECT SETTLEMENT FINAL REPORT - SLQ811U  
**Attachments:** SKM\_C45819101811470.pdf

Dear Taufikh

For your perusal :

Labour	\$12912.00
Parts	\$13255.15
Total	\$26167.15

TO FINALIZE  
COR

Owner is claiming      LOSS OF USE = \$100 X 15 DAYS  
                                 MEDICAL FEE - \$402.43.  
                                 LTA SERCH FEE - \$7.45.

Note : 11 working days.

Please reply me directly.

Best Regards

Sharon Heng  
Performance Motors Ltd  
Body & Paint  
DID : 63190123  
Fax : 64743229

email Sharon 21/10.  
\$26167.15, 11 days

"This electronic mail content and any accompanying attachments ("the Message") is intended only for the named addressee ("the Recipient") and may contain information that is confidential, privileged and/or proprietary to the Sime Darby group of companies ("Sime Darby") and/or protected under applicable laws. If you are not the intended Recipient, you are strictly prohibited from using, disseminating, forwarding and/or printing the Message. Please notify the sender immediately by return e-mail and permanently delete all copies of the Message. Sime Darby disclaims all liability for any error, loss or damage arising from the Message being infected by computer virus or other malicious software. Any views and/or opinions expressed in the Message are solely those of the author's and do not necessarily represent those of Sime Darby's."

-----Original Message-----

From: service.pml@simedarby.com.sg [mailto:service.pml@simedarby.com.sg]  
Sent: Friday, 18 October, 2019 11:48 AM  
To: Sharon Heng L K  
Subject: Message from KM\_C458

# Performance Motors Limited

A member of the Sime Darby Group  
Co. Reg. No. 197401559W. GST Reg. No. M2-0020081-X



## Final Report

Estimate No. : **b1 52230**  
Date Estimated : **05/08/2019**  
Prepared By : **Han Kwan Yong**

**- ESTIMATE REPAIR FOR -**  
**Oh Sze Ching (Hu SiQin)**  
**132 Punggol Walk**  
**#12-17**

**Singapore 828777**

**- ACCOUNT - 121**  
**AIG Asia Pacific Insurance Pte. Ltd.**  
**78 Shenton Way**  
**#08-16 Chartis Building**  
**Singapore 079120**

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
<b>SLQ811U</b>	<b>WBA2B32000V9259</b>	<b>28/06/2017</b>	<b>216d CAT</b>	<b>0</b>
DESCRIPTION	ACCOUNT: ORIGINAL PRICE	DISC. %	NETT	
To tow accident vehicle to PML workshop.	195.00	0	195.00	
To replace rear bumper and attachments, rear boot lid and attachments, both tail lamps, tail end panel exterior & interior etc including to pull and straighten both rear chassis, to make good trunk floor panel and knock out dented area caused by the accident. To remove and install body parts in order to carry out painting job.	4,250.00	0	4,250.00	
To respray rear bumper, tail end panel, rear left fender, rear right fender, boot lid, boot compartment and both roof frames etc	4,470.00	0	4,470.00	
To carry out body cavity preservation.	100.00	0	100.00	
To carry out body cavity preservation. (For cut panel).	451.00	0	451.00	
To replace front exhaust pipe catalyst silencer including align exhaust system and conduct checks for leak.	451.00	0	451.00	
To replace rear exhaust silencer, chrome pipe and clamping bush etc including to align system and check for leak.	451.00	0	451.00	
To replace each diesel particulate filter including alignment and conduct checks for leak.	564.00	0	564.00	
To remove and install boot compartment carpet and garnish to facilitate repairs.	230.00	0	230.00	
To conduct water leak tests.	75.00	0	75.00	
To remove and install rear windscreen glass to transfer from old to new boot lid	574.00	0	574.00	
To replace bootlid smart opener control unit including to conduct checks for proper function.	350.00	0	350.00	
To transfer lock mechanism from old to new bootlid including conduct checks on new bootlid central locking	451.00	0	451.00	



# Performance Motors Limited

A member of the Sime Darby Group  
Co. Reg. No. 197401559W. GST Reg. No. M2-0020081-X



## Final Report

system for proper function.

To check electrical wiring systems and lightings at the rear section for proper function.

150.00 0 150.00

Sundries.

150.00 0 150.00

DESCRIPTION	UNIT PRICE	QTY	DISC. %	NETT
#				
# BLIND RIVET NUT M6	2.55	4.00	0	10.20
CLAMPING BUSH	✓ 54.30	1.00	0	54.30 ?
# V BAND CLAMP	42.85	1.00	0	42.85
# GASKET	8.25	1.00	0	8.25
EXCHANGE EXHAUST PIPE CATALYST	✓ 1,694.80	1.00	0	1,694.80
REAR SILENCER	✓ 1,167.45	1.00	0	1,167.45 ?
EXCH DIESEL PARTICULATE FILTER EU5	✓ 3,727.75	1.00	0	3,727.75
HOLDER EXHAUST SYSTEM	✓ 27.90	1.00	0	27.90 ?
HOLDER EXHAUST SYSTEM	✓ 27.90	1.00	0	27.90 ?
TAILPIPE TRIM BLACK CHROME	✓ 110.55	1.00	0	110.55 ?
# STEERING BOX HEAT RESISTANT PLATE	61.25	1.00	0	61.25
TRUNK LID	✓ 1,204.35	1.00	0	1,204.35 ?
INTERIOR TAIL TRIM	✓ 279.10	1.00	0	279.10 ?
TAIL PANEL	✓ 355.20	1.00	0	355.20 ?
REAR BUMPER PANEL PRIMED (PDC)	✓ 1,045.45	1.00	0	1,045.45
# EXPANDING NUT	1.00	2.00	0	2.00
RR BUMPER LH SIDE GUIDE	✓ 61.35	1.00	0	61.35 ?
REAR BUMPER CARRIER	✓ 458.10	1.00	0	458.10 ?
SUPPORT	✓ 45.30	1.00	0	45.30 ?
RR BUMPER LH INNER SIDE GUIDE	✓ 61.35	1.00	0	61.35 ?
RR BUMPER RH INNER SIDE GUIDE	✓ 61.35	1.00	0	61.35 ?
GROMMET	✓ 0.75	2.00	0	1.50 ?
PLAQUE 74MM	✓ 71.25	1.00	0	71.25 ?
# BUMP STOP	3.50	8.00	0	28.00
# HOOK AND LOOP FASTENER	2.85	8.00	0	22.80
CONTROL UNIT SMART OPENER	✓ 494.60	1.00	0	494.60 ?
# SNAP LOCKING COUPLING	1.00	3.00	0	3.00
RR LH LIGHT IN THE TRUNK LID	✓ 255.65	1.00	0	255.65 ?
RR RH LIGHT IN THE TRUNK LID	✓ 255.65	1.00	0	255.65 ?
RR LH LIGHT IN THE SIDE PANEL	✓ 365.20	1.00	0	365.20
ULTRASONIC SENSOR MINERALWEISS(WA96)	✓ 368.80	1.00	0	368.80 ?
BLIND RIVET AVIBVLB	✓ 0.55	60.00	0	33.00 ?
SCREW (SF PLUS M5X15)	✓ 0.55	5.00	0	2.75 ?
(DG/SL) BODY ADHESIVE K5B (195ML)	✓ 326.80	1.00	0	326.80 ?
PUNCH RIVET N4	✓ 0.55	40.00	0	22.00 ?
(DG) BODYWORK ADHESIVE K5A (50ML)	✓ 112.70	1.00	0	112.70 ?
(DG) CLEANER R1 (100ML)	✓ 26.15	1.00	0	26.15 ?
(DG/SL) W/SCREEN SEALANT (COLD 1 HOUR)	✓ 131.55	2.00	0	263.10 ?
(DG/SL) GLASS PRIMER 30ML (VP206)	✓ 27.85	1.00	0	27.85 ?
(S/L) SEAM SEAL 300ML	33.80	2.00	0	67.60 ?

#

#

# SUPPLEMENTARY ITEMS

# Performance Motors Limited

A member of the Sime Darby Group  
Co. Reg. No. 197401559W. GST Reg. No. M2-0020081-X



## Final Report

Total Labour :	12,912.00
Total Parts :	13,255.15
Total Labour & Parts :	26,167.15
GST @7%:	1,831.70
Grand Total :	<u>27,998.85</u>

DD	MO	PARTY	DATE	TIME
		Taufik LKK	18/10/19	11
DATE TO				
DATE FROM				
TEL				
CONFIRMED				
DATE				
PLEASE PRINT NAME				

LOSS OF USE = \$100 x 15 days  
MEDICAL FARE - \$402.43  
LTA SEARCH FEE - \$7.45

# Performance Motors Limited

A member of the Sime Darby Group  
Co. Reg. No. 197401559W. GST Reg. No. M2-0020081-X



## Supplementary

Estimate No. : **b1 52230**  
Date Estimated : **05/08/2019**  
Prepared By : **Han Kwan Yong**

### - ESTIMATE REPAIR FOR -

**Oh Sze Ching (Hu SiQin)**  
**132 Punggol Walk**  
**#12-17**

**Singapore 828777**

### - ACCOUNT - 121

**AIG Asia Pacific Insurance Pte. Ltd.**  
**78 Shenton Way**  
**#08-16 Chartis Building**  
**Singapore 079120**

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
<b>SLQ811U</b>	<b>WBA2B32000V9259</b>	<b>28/06/2017</b>	<b>216d CAT</b>	<b>0</b>

DESCRIPTION	ACCOUNT:		DISC. %	NETT
	ORIGINAL PRICE			

DESCRIPTION	UNIT PRICE	QTY	DISC. %	NETT
#				
# BLIND RIVET NUT M6	2.55	4.00	0	10.20 <i>new</i>
# V BAND CLAMP	42.85	1.00	0	42.85 <i>bt</i>
# GASKET	8.25	1.00	0	8.25 <i>new</i>
# STEERING BOX HEAT RESISTANT PLATE	61.25	1.00	0	61.25 <i>bt</i>
# EXPANDING NUT	1.00	2.00	0	2.00 <i>new</i>
# BUMP STOP	3.50	8.00	0	28.00 <i>new</i>
# HOOK AND LOOP FASTENER	2.85	8.00	0	22.80 <i>new</i>
# SNAP LOCKING COUPLING	1.00	3.00	0	3.00 <i>new</i>

### # SUPPLEMENTARY ITEMS

Total Labour :	
Total Parts :	178.35
Total Labour & Parts :	178.35



# VEHICLE CONDITION REPORT FORM / JOB RECORD

Allianz

Worldwide Partners

Date: 3/8/19 Time: 15:50

Customer Name: Mr. 345 1st

Technician Name: Wei

Customer Telephone: 967733

Reg. No: 5LQ811U Job No:

Make/Model: BMW 216

Odometer Reading (Customer Vehicle):

Location: Boundary House

KM Travelled by Assistance Vehicle: (1 way)

Time on Scene: 16:40

Fault Reported:

Time Job Completed:

Fault Found:

Repaired at Breakdown Scene: Y/N

How was vehicle repaired?

VIN No:

Hubcaps Y/N

Spare Wheel Y/N

Tools Y/N

Audio System Y/N

Keys + Remote Y/N

Aerial Y/N

Cashcard Y/N

Fuel E F

Interior Condition :

Front Seats

Rear Seats

Floor Covering

Headlining




Day/Night

Wet/Dry

Clean/Soiled

Please circle the above as appropriate

Place X on damaged area for scratch and Y for dent

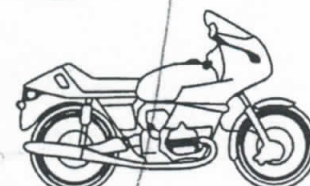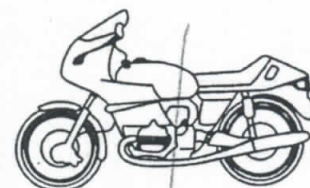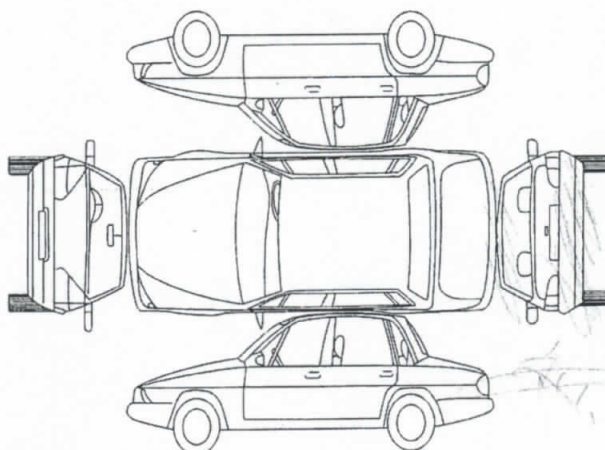

Delivery to Dealership / Date and Time:

Vehicle received in the above condition YES/NO

If not stated as above specify difference:

## CUSTOMER DECLARATION

- I am entitled to the service requested. In the event of this subsequently not being the case I shall be responsible for the cost of any assistance provided.
- I accept that any roadside repairs will be of a temporary nature and that advice of a franchised dealer should be sought by me as soon as possible.
- In the case of forced entry, I confirm that I specifically requested that the operator forcefully enter the vehicle and that all damages occasioned thereby is and shall be my sole responsibility.
- I accept that any removable items left in the vehicle will not be the responsibility of the emergency service or their agents.

Customer Name & Signature (green copy)	Dealer/Workshop Signature, Name & Stamp (yellow copy)	Operators Signature (white & pink copy)