

REF: Passer

REF: CC3/Alq 19014826 / Rivd3er

02

541 I

ASSIGNMENT

Date: 22/8/19

Veh No: SHN 8618J Yr Regn: 2018 / MCV

Estimated Cost: _____

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

Truck / Trailer or _____

To inspect Vehicle No: SHN 8618J

Make: Audi Q5 2.0 c.c. 1984

at Workshop n/s: premium

Colour: grey A/C: Insured / Std / NI / NA

of: 2A Beroi Seefor

Sp. Reading: 17913 T/Radio: Insured / Std / NI / NA

Insured: _____

Eng/No: _____

Policy No: 1800137600

C/No: WAU222445J2239125

Claims No: _____

Gen. Cond: Good / Fair / Poor / Burnt

Sum Insured: _____ Excess: 750

Steering: In order / Jammed / Leaked / Burnt or _____

(Client's Record)

Brake: In order / Jammed / Leaked / Burnt or _____


Make of Veh: Vehicle In

Mod: Nil / S/Rim / STD A/Rim or _____

(Policy Condition)

Tyre Size: F: 235/55R19

Remark: The veh had commenced its repair at the time of inspection.

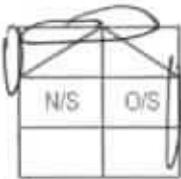

R: 1 -

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or CONTINENTAL

Bal. or Market Value: 277K 190K

Front 6 mm Rear 6 mm

IDAC Accident Rpt: _____ Consistent? : Yes or No

R/Bal. 6 mm L/Bal. 6 mm

GIA / PR Seen: _____ Consistent? : Yes or No

L/Bal. 6 mm D.O.A. 17/08/19 D.O.I. 22/08/19

Est. Repairs: 18 days Res: Yes or No

Survey held at PREMIUM

Lum. Sum: _____ % J Val: Yes or No

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or _____

CA / REV / REP. / 24 HRS

The U/C / Chassis frame / Body Structure affected due to collision.

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Date / Time	Action / Instruction
<u>23/8/19</u>	<u>Revert via merimen</u>
<u>29/8/19</u>	<u>Rece approved \$55000 from Andy by merimen</u>
<u>29/8/19</u>	<u>Informed Huzaini c/A ex \$750 by email</u>
<u>12/11/19</u>	<u>@ 4:24pm Carine agree \$55000, 18 days</u>
<u>26/11/19</u>	<u>Confirmed \$55,000 by email (Reel 33, 171.20, 3810)</u>

Date/Time, File Path to? : Prel. Report

Days Of Repair: 18

ii : Final Report

Resurvey No. of Trip: 2

Date/Time, File Return to? 20/11 - typist

Add Fee: Site Insp (\$) Interview (\$) Tech. Invs (\$) Weekend (?)

Report Format: merimen

Lump Sum / T.B.H: 55,000/-

Survey Fee:	<u>700</u>
Transportation:	
3-RE-SI	
Photos	
Other	<u>11</u>
TOTAL	<u>711</u>

View Received Message

This mail is associated with :

***SGN8618J (63012927635G)**

OD

Aug 17 2019 4:00PM

[TEOW KHEK SOO]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 26/11/2019 14:25 PM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$55000.00) - SGN8618J - Claim Handler: Chan, Yoke Shi

Approved:55000.00.

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd. AIG Building 78 Shenton Way #08-16 Singapore 079120	From: LKK Auto Consultants Pte Ltd 51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park Singapore 408933
--	--

Attn: Chan, Yoke Shi	Date: 25 Oct 2019
-----------------------------	--------------------------

Preliminary Advice

Vehicle No	: SGN8618J	Accident Date	: 17/08/2019
Make	: AUDI Q5	Policy No.	: 1800137600
Assignment Date	: 23/08/2019	Excess	: S\$750.00
Date of Inspection	: 22/08/2019	Est. Duration of Repair	: 12.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (UBI) 55 UBI ROAD 1 SINGAPORE 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front portion,n/s front portion and o/s body and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	88,973.00 (incl.supplementary \$10,294)
Revised Amount	:S\$	58,438.50
Check Items (Estimated)	:S\$	16,764.00
Total	:S\$	75,202.50 (incl.supplementary \$10,294)

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	190,000.00
COE / PARF Rebate	:S\$	69,123.00
Salvage Value	:S\$	
Margin for Repair	:S\$	120,877.00

Remarks

(X)	The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
-------	---

()	The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
-----	---

()	Other comments :
-----	------------------

Veron Chen (LKKAuto)

From: Veron Chen (LKKAuto)
Sent: Thursday, 29 August 2019 5:42 PM
To: claims@premiumauto.com.sg; SUR
Cc: (nora.khai@premiumauto.com.sg)
Subject: RE: OD CLAIM FOR SGN 8618 J ON 17/8/2019

Dear Ezuwan Huzaini,

As instructed by our client , please proceed to repair the **insured vehicle SGN 8618J, (Excess S750/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

NOTE: Please note that AIG has approved at S55,000, re-seek mandate after dismantling all awarded parts and labour to be supported with clear photographs.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims <claims@premiumauto.com.sg>
Sent: Thursday, 29 August 2019 1:41 PM
To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: claims@premiumauto.com.sg
Subject: RE: OD CLAIM FOR SGN 8618 J ON 17/8/2019

Hi Veron,

Noted. Update me if any. Customer is asking about his car already

Thank you.

Best Regards,
Ezuwan Huzaini
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.

If you have received it in error, please notify us immediately by reply email and then delete this message from your system.

Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Veron Chen (LKKAuto) <veronchen@lkkauto.com>

Sent: Thursday, 29 August 2019 1:35 PM

To: claims@premiumauto.com.sg; SUR <sur@lkkauto.com>

Subject: RE: OD CLAIM FOR SGN 8618 J ON 17/8/2019

Dear Ezuwan Huzaini,

Still pending AIG approval.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims <claims@premiumauto.com.sg>

Sent: Thursday, 29 August 2019 1:25 PM

To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>; SUR <sur@lkkauto.com>

Cc: claims@premiumauto.com.sg

Subject: RE: OD CLAIM FOR SGN 8618 J ON 17/8/2019

Hi Veron,

Any update on the approval?

Thank you.

Best Regards,
Ezuwan Huzaini
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.

If you have received it in error, please notify us immediately by reply email and then delete this message from your system.

Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Claims <claims@premiumauto.com.sg>

Sent: Tuesday, 27 August 2019 5:51 PM

To: 'Veron Chen (LKKAuto)' <veronchen@lkkauto.com>; 'SUR' <sur@lkkauto.com>

Subject: RE: OD CLAIM FOR SGN 8618 J ON 17/8/2019

Hi Veron,

Noted with thanks

Thank you.

Best Regards,
Ezuwan Huzaini
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223

Your closest companion
on the road.

The new Audi A8.



Find out more

Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Veron Chen (LKKAuto) <veronchen@lkkauto.com>
Sent: Tuesday, 27 August 2019 4:13 PM
To: claims@premiumauto.com.sg; SUR <sur@lkkauto.com>
Subject: RE: OD CLAIM FOR SGN 8618 J ON 17/8/2019

Dear Ezuwan Huzaini,

AIG is checking further policy coverage review.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims <claims@premiumauto.com.sg>
Sent: Tuesday, 27 August 2019 4:08 PM
To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: claims@premiumauto.com.sg
Subject: RE: OD CLAIM FOR SGN 8618 J ON 17/8/2019

Hi Veron,

Any update on the approval?

Thank you.

Best Regards,
Ezuwan Huzaini
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Claims <claims@premiumauto.com.sg>
Sent: Friday, 23 August 2019 10:03 AM
To: 'Veron Chen (LKKAuto)' <veronchen@lkkauto.com>; 'SUR' <sur@lkkauto.com>
Cc: claims@premiumauto.com.sg
Subject: RE: OD CLAIM FOR SGN 8618 J ON 17/8/2019

Hi Veron,

Please find attached for the LTA Rebate & driver's IC, Driving License

Thank you.

Best Regards,
Ezuwan Huzaini
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Veron Chen (LKKAuto) <veronchen@lkkauto.com>
Sent: Friday, 23 August 2019 9:29 AM
To: 'Chang Chee Sing' <claims@premiumauto.com.sg>; SUR <sur@lkkauto.com>
Subject: FW: OD CLAIM FOR SGN 8618 J ON 17/8/2019

Dear Ezuwan Huzaini,

Please provide copy of LTA rebate, CI and driver's driving licensed.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims <claims@premiumauto.com.sg>
Sent: Thursday, 22 August 2019 5:53 PM
To: Admin A <admin-a@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: claims@premiumauto.com.sg
Subject: RE: OD CLAIM FOR SGN 8618 J ON 17/8/2019

Dear all,

Vehicle already survey by rasul
Do let us know on the approval status
Thank you.

Best Regards,
Ezuwan Huzaini
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged. If you have received it in error, please notify us immediately by reply email and then delete this message from your system. Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Claims <claims@premiumauto.com.sg>

Sent: Wednesday, 21 August 2019 8:45 PM

To: 'Admin A' <admin-a@lkkauto.com>; 'Admin-D (LKKAuto)' <admin-d@lkkauto.com>; 'SUR' <sur@lkkauto.com>

Cc: claims@premiumauto.com.sg

Subject: RE: OD CLAIM FOR SGN 8618 J ON 17/8/2019

Dear all,

Please arrange surveyor at benoi. Vehicle already in

Address for benoi:

24 Benoi Sector, Singapore 629857

Person to contact: Chang - 96530326

Thank you.

Best Regards,
Ezuwan Huzaini
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged. If you have received it in error, please notify us immediately by reply email and then delete this message from your system. Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Claims <claims@premiumauto.com.sg>
Sent: Wednesday, 21 August 2019 6:37 PM
To: 'Admin A' <admin-a@lkkauto.com>; 'Admin-D (LKKAuto)' <admin-d@lkkauto.com>; 'SUR' <sur@lkkauto.com>
Cc: 'Claims' <claims@premiumauto.com.sg>
Subject: RE: OD CLAIM FOR SGN 8618 J ON 17/8/2019

Dear all,

Attached is the estimate for your kind reference.

Best Regards,
Syafiq
Claims Admin Assistant

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Claims <claims@premiumauto.com.sg>
Sent: Tuesday, 20 August 2019 5:52 PM
To: 'Admin A' <admin-a@lkkauto.com>; 'Admin-D (LKKAuto)' <admin-d@lkkauto.com>; 'SUR' <sur@lkkauto.com>
Cc: 'Claims' <claims@premiumauto.com.sg>
Subject: OD CLAIM FOR SGN 8618 J ON 17/8/2019

Dear All,

Kindly register OD claims for this vehicle. Attached is GIA report for your reference.

We will forward you the estimate once is available.

We will arrange for survey once the estimate is ready.

Best Regards,
Syafiq
Claims Admin Assistant

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183

View Received Message

This mail is associated with :

***SGN8618J (6301292763SG)**
OD
Aug 17 2019 4:30PM
[TEOW KHEK SOO]
Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 29/08/2019 17:19 PM.
To LKK_HQ
Subject Alert - Adj Mandate Approved (S\$55000.00) - SGN8618J - Claim Handler: Chan, Yoke Shi

Approved:55000.00:to commence OD repairs and re-seek mandate after dismantling, all awarded parts and labour to be supported with clear photographs.

DOCUMENTS SUMMARY

There are no documents.

Veron Chen (LKKAuto)

From: Fong, Andy-SY <Andy-SY.Fong@aig.com>
Sent: Thursday, 29 August 2019 5:20 PM
To: Veron Chen (LKKAuto)
Cc: Koh, Victor-CK; Chan, Yoke Shi
Subject: RE: RE: PENDING MANDATE APPROVAL

Mandate request has been processed.

The longer than expected turnaround time arose out of a background investigation conducted with insured.

Andy Fong
AIG
Head of Claims Technical Control
Singapore | Hong Kong
AIG Asia Pacific Insurance Pte. Ltd.

78 Shenton Way #08-16 Singapore 079120
Tel +(65) 6419 1708|M: +(65) 9138 1785
Andy-SY.Fong@AIG.com | www.AIG.com.sg

AIG 100 | Celebrating 100 years of risk expertise, promises kept, and creating a better world. Visit 100.aig to learn more.

AIG Asia Pacific won General Insurance Company of the Year at the 22nd Asia Insurance Industry Awards. [Click here to find out more.](#)

From: Veron Chen (LKKAuto) [mailto:veronchen@lkkauto.com]
Sent: Thursday, August 29, 2019 2:06 PM
To: Fong, Andy-SY
Cc: Koh, Victor-CK; Chan, Yoke Shi
Subject: [EXTERNAL] RE: RE: PENDING MANDATE APPROVAL

This message is from an external sender; be cautious with links and attachments.

Dear Andy,

Any approval for SGN 8618J as insured and repairer is chasing.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Fong, Andy-SY <Andy-SY.Fong@aig.com>
Sent: Tuesday, 27 August 2019 8:43 AM
To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>
Cc: Koh, Victor-CK <Victor-CK.Koh@aig.com>; Chan, Yoke Shi <yokeshi.chan@aig.com>
Subject: Re: RE: PENDING MANDATE APPROVAL

Yes maintain as i reckon \$8,000 will suffice. Please proceed with repair commencement

On 27 Aug 2019, at 8:39 AM, Veron Chen (LKKAuto) <veronchen@lkkauto.com> wrote:

This message is from an external sender; be cautious with links and attachments.

Dear Andy,

Mandate still under maintain.

<image001.jpg>

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Fong, Andy-SY <Andy-SY.Fong@aig.com>

Sent: Monday, 26 August 2019 5:55 PM

To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>

Cc: Koh, Victor-CK <Victor-CK.Koh@aig.com>; Chan, Yoke Shi <yokeshi.chan@aig.com>

Subject: RE: PENDING MANDATE APPROVAL

Mandate for SJM1008K set.

Please hold for SGN8618J as we are pending further policy coverage review.

Thanks

Andy

From: Veron Chen (LKKAuto) [<mailto:veronchen@lkkauto.com>]

Sent: Monday, August 26, 2019 5:37 PM

To: Koh, Victor-CK

Cc: Fong, Andy-SY

Subject: [EXTERNAL] PENDING MANDATE APPROVAL

Dear Victor,

Kindly assist for mandate approval

1. SJM 1008K
2. SGN 8618J

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

Your password will expire in 5 days. [Click here to change it.](#)

- OD claim # SGN8618J # potential delay on coverage confirmation

From: Chan, Yoke Shi
To: sur@lkkauto.com
Cc: Lim, Sheng Yang, Parthiban, Theerthan
Sent: 28/8/2019 11:19:39 AM

Good day Team ,

Please be informed that there is potential delay while we further review on coverage confirmation.

Thank you.

Regards,

Yoke Shi

AIG

Claim Adjuster II, Singapore FNOL, Claims Operations – Auto

yokeshi.chan@aig.com | www.aig.com

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

 51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
 Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

 To: AIG Asia Pacific Insurance Pte. Ltd.
 AIG Building
 78 Shenton Way #08-16
 Singapore 079120

 From: LKK Auto Consultants Pte Ltd
 51 Ubi Ave 1 #01-25
 Paya Ubi Industrial Park
 Singapore 408933

Attn: Khoo, Kay-Eng

Date: 23 Aug 2019

Preliminary Advice

Vehicle No	: SGN8618J	Accident Date	: 17/08/2019
Make	: AUDI Q5	Policy No.	: 1800137600
Assignment Date	: 23/08/2019	Excess	: S\$0.00
Date of Inspection	: 22/08/2019	Est. Duration of Repair	: 12.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (UBI) 55 UBI ROAD 1 SINGAPORE 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front portion, n/s front portion and o/s body and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	78,679.00	
Revised Amount	:S\$	50,916.50	+7500
Check Items (Estimated)	:S\$	16,764.00	
Total	:S\$	67,680.50	

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	190,000.00
COE / PARF Rebate	:S\$	69,123.00
Salvage Value	:S\$	
Margin for Repair	:S\$	120,877.00

Remarks

The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.

The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.

Other comments :

> [Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	901E
Vehicle Details	
Vehicle No.:	SGNB618J
Vehicle to be Exported:	No
Intended Deregistration Date:	23 Aug 2019
Vehicle Make:	AUDI
Vehicle Model:	Q5 SPORT 2.0 TFSI QU S TRONIC
Primary Colour:	Silver
Manufacturing Year:	2018
Engine No.:	DAX046070
Chassis No.:	WAUZZZF5J2239125
Maximum Power Output:	185.0 kW (248 bhp)
Open Market Value:	\$43,064.00
Original Registration Date:	27 Nov 2018
First Registration Date:	27 Nov 2018
Transfer Count:	0
Actual ARF Paid:	\$52,290.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	26 Nov 2028
PARF Rebate Amount:	\$39,217.00
Intended COE Rebate Details	
COE Expiry Date:	26 Nov 2028
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$32,302.00
COE Rebate Amount:	\$29,906.00
Total Rebate Amount:	\$69,123.00

The information contained herein is correct as at 23 Aug 2019

OK

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	901E
Vehicle Details	
Vehicle No.:	SGN8618J
Vehicle to be Exported:	Yes
Intended Deregistration Date:	24 Aug 2019
Vehicle Make:	AUDI
Vehicle Model:	Q5 SPORT 2.0 TFSI QU 5 TRONIC
Primary Colour:	Silver
Manufacturing Year:	2018
Engine No.:	DAX046070
Chassis No.:	WAUZZZFY5J2239125
Maximum Power Output:	185.0 kW (248 bhp)
Open Market Value:	\$43,064.00
Original Registration Date:	27 Nov 2018
First Registration Date:	27 Nov 2018
Transfer Count:	0
Actual ARF Paid:	\$52,290.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	26 Nov 2028
PARF Rebate Amount:	\$39,217.00
Intended COE Rebate Details	
COE Expiry Date:	26 Nov 2028
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$32,302.00
COE Rebate Amount:	\$25,841.00
Total Rebate Amount:	\$65,058.00

The information contained herein is correct as at 23 Aug 2019

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	20/08/2019 17:14
Date Of Accident	17/08/2019 16:30
Exact Location Of Accident	ALONG PIE TOWARDS TUAS
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SGN8618J
Insured/Policyholder	
Name Of Registered Owner	TEOW KHEK SOO
NRIC No	S0649541I
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-97376819
Alternative Phone No	OFFICE-97376819

Vehicle Particulars

Manufacturer	AUDI
Model	Q5-2.0 TFSI QUATTRO (A)
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	1800137600
Cover Note Number	

Driver

Name of Driver	TEOW KHEK SOO
NRIC No	S0649541I
Date Of Birth	06/12/1946
Occupation	INDOOR
Date Of Driving Pass	04/12/1967
Driving Experience	51 YEARS AND 8 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-97376819
Fax Number	
Contact Number	OFFICE-97376819
Email Address	NOEMAIL

Address	760 JURONG WEST ST 74 #12-02
Postcode	2264
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	3
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : ALICIA TIEW GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Police Station Name	NANYANG N.P.C
Police Station Address	ROAD: 2 JURONG WEST AVE 5 , POSTCODE: 649482 , COUNTRY: SINGAPORE
Police Station Contact	TEL NO: 1800-7929999 - FAX NO:
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO POLICE REPORT. REASON FOR LATE REPORTING, DRIVER IS INJURED UNABLE TO DO REPORTING WITHIN TIME FRAME.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SJK5576X
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number

SJY7678Z

Vehicle Make/Model/Colour

Details Of Properties

Vehicle Category

PRIVATE CAR

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

DETAILS OF INJURED PERSON 1

Name

TEOW KHEK SOO

Approximate Age

Injuries Sustain

Injured person in which vehicle?

Were seat belts worn?

Was this injured conveyed to hospital by ambulance?

Address

Postcode

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
 2. This form must be **completed by the Policyholder and/or the Authorised Driver**.
 3. Information provided must be as **truthful and accurate as possible**. Any willful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
 4. The issue and acceptance of this form by insurance companies is not an admission of policy liability on the part of the insurance companies.
 5. **Any false reporting may be referred to the Police for investigation.**
 6. The report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
 7. By the lodging of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
- E. Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (i) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes;
 - (ii) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims;
 - (iii) the information so collected under (i) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.



Policyholder's Signature
Date & Time:




Driver's Signature
(if driver is not the policyholder)
Date & Time:



Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Sketch Plan #2

SKETCH PLAN

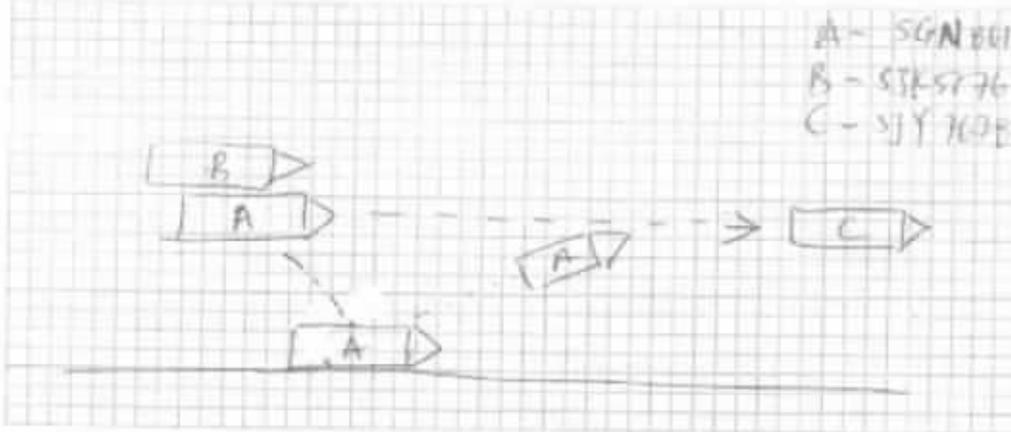

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Refer to police report
Reason for late reporting: Driver is injured unable to do reporting within time frame

DECLARATION

(We declare the foregoing particulars are true in every respect)


Policyholder's Signature
Date & Time:


Driver's Signature
(If driver is not the policyholder)
Date & Time:


Reporting Centre Personnel's Signature
Name:
NIC/VIN No.:

Accident Photo



Accident Photo



Police Report



**SINGAPORE
POLICE FORCE**



T201905192158

Police Station Of Origin:
Nanyang N.P.C.
2 Jurong West Avenue 5 SINGAPORE
649482
Tel No: 1800-7521809

1 of 3
Report No: T201905192158

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 17/05/2019 16:44	Video Report No :	Station Diary No : 401
--	-------------------	---------------------------

Informant's Particulars

Name of Informant: TEOW KHEK SOO		Address: APT BLK 760 JURONG WEST STREET 74 #12-02 SINGAPORE 640780	
ID Type / ID No. NRIC NO / S09495411		Contact No :	Mobile: 97378819
Nationality: SINGAPORE C.TIZEN		Home/Office:	
Email:			
Sex: Male	Age: 72	Date of Birth: 09/12/1946	Type of Informant: Driver
Race: Chinese	Language: English		Institution / School Name:
Occupation: SELF EMPLOYED	Driving Licence Information: Class: 2B,2A,2 J		Date of Expiry:

General information of the Accident

Type of Accident:	Injury Others	Drink Drive No	Date/Time of Accident: 17/05/2019 16:20	Type of Location Straight Road
Location: Along Road 1 PAN ISLAND EXPRESSWAY				
Towards/Just after/Eng Neo Exit:				
Weather: Clear		Road Surface: Dry		Road Speed Limit:
Traffic Flow: One Way		Traffic Control: Not Controlled		Traffic Volume: Moderate
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: No

Details of Vehicle Involved

Vehicle No	Type	Make	Model	Color	Condition	No of Passenger
SGN8818J	Car	AUDI	Q5	Silver	Slightly Damaged	1

Details of Vehicle Insurance

Vehicle No	Insurance Company	Insurance No	Effective	Expiry Date
SGN8818J	AIK ASIA PACIFIC INSURANCE PTE LTD.	1800137600	27/11/2018	28/11/2018

Police Report



SINGAPORE
POLICE FORCE



1:291908192155

2 of 3

Police Station Of Origin:
Nanyang N.P.C
2 Jurong West Avenue 5 SINGAPORE
649482
Tel No: 1800-7523593

Report No: 1001908192155

CONTINUATION OF REPORT

Brief Details.

On the 17/08/2019 at around 1020hrs, I was driving my silver colour car bearing registration no. SGN6618J and travelling on the 2nd lane along PIE (towards Tuas, after Eng Neo exit).

Out of sudden, one black colour car bearing registration no. SJK5376X who was travelling on the 3rd lane had collided onto the left side of my car. Due to the collision, my car swerved into the first lane however I managed to re-enter back to the 2nd lane. It continued moving and the front part of my car had collided onto the rear bumper of one black colour car bearing registration no. SJY7678Z who was travelling at front of my car.

Due to the collision, my front car bumper is damaged. I had also injured my left arm and finger. My female passenger is not injured. I was given 7 days of medical leave from NUH. That's all.

Police Report



SINGAPORE
POLICE FORCE



T:001900182138

Police Station Of Origin
Nanyang N.P.C
2 Jurong West Avenue 5 SINGAPORE
649482
Tel No: 1800-7925999

Page 2
Report No: T:001900182138

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474865 stating the report number as reference.

Signature Of Officer Recording The Report. Staff Sgt MUHAMMAD HAFIZ BIN DARUS	Signature Of Informant
Signature Of Interpreter Not applicable	Date/Time 19/06/2015 18:44
Officer In Charge Of Case IP / AEIT / SIANG YI TING, STEPHANIE Contact No: 65475414	Classification Of Case:
Authentication Stamp N/208	

Singapore Police Force

UNDERTAKING FORM

UNDERTAKING

I Tiew Khek Seng (NRIC No. S06 492911) hereby confirm that the Singapore Accident Statement lodged by me on 19/8/19 at 1000h hours pertaining to the accident involving motor car Reg. No. S04 86187, in which I was the driver are true and accurate to the best of my knowledge, information and belief.

I acknowledge that my insurers are not liable under the contract of insurance if there is a breach of policy terms and conditions.

In the event that an unrelated/unreported third party property or injury claim arises or there is evidence emerges that there is a breach of policy terms and conditions, I irrevocably undertake to absolve my insurer from all liability under the contract of insurance and I undertake to re-pay any sums paid by my insurers pursuant to the contract of insurance upon receipt of written demand by my insurers.

Signature :



Name of Insured / Driver :

Tiew Khek Seng

Nric No. :

S06 492911

Date :

19/8/19

Signature :



Name of Policyholder :

Tiew Khek Seng

Nric No. :

S06 492911

Date :

19/8/19

INTERVIEW FORM



400 West 10th Street, Suite 100
Wichita, KS 67202
Tel: 316.262.1234
Fax: 316.262.1235
www.aig.com

MOTOR ACCIDENT INTERVIEW FORM

NAME YOUNG CHUCK SUI

VEHICLE NUMBER 50-6497416

DATE/TIME OF ACCIDENT 12/8/19 16:20hrs

PLACE OF ACCIDENT Along F16 towards Tully

THIRD PARTY VEHICLE (IF ANY) _____

WHERE DID YOU START YOUR JOURNEY AND WHERE WAS THE INTENDED DESTINATION BEFORE THE ACCIDENT?

From Area adjacent road to the house and going back home

DID YOU DRINK ANY ALCOHOLIC DRINKS BEFORE YOU DRIVE ON THE DAY OF THE ACCIDENT? IF YES, DID THE TRAFFIC POLICE CONDUCT ANY BREATHE ANALYSER TEST ON YOU? IF YES, WHAT WAS THE RESULT?

No

WHAT IS THE TYPE OF COLLISION AND THE EXTENSIVENESS OF THE DAMAGES TO ALL VEHICLES INVOLVED?

Minor collision
Damage front portion left of right portion

WERE YOU OR YOUR PASSENGER/S INJURED? IF INJURED, WHICH HOSPITAL? WERE YOU TAKEN TO THE TRAFFIC POLICE FOR INVESTIGATION?

Minor injured
Admitted to hospital N/A
No traffic police investigation

NAME: Young Chuck Sui (SUI)

I AFFIRMED THE ABOVE INFORMATION IS GIVEN TO MY BEST KNOWLEDGE

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0996/2019/N5
Date : 21-Aug-19

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

7B Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : MR TEOH KHEK SOO
Address : 760 JURONG WEST ST 74
#12-02
Singapore 248732
Telephone : HP +65 97376819
Type of Claim : Own Damage Claims
Policy No. : 1800137600
Vehicle No : **SGN 8618 J**
Model Code : Audi Q5 SPORT 2.0 TFSI qu
Model / Year : 27/11/2018
Engine No : DAX 046070
Chassis No : WAUZZZFYSJ2239125
Mileage :
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 17-Aug-19
Place of Accident : ALONG PIE TOWARDS TUAS

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle. SGN 8618]

<u>S/n</u>	<u>Nature of Jobs</u>	<u>Estimated Charges</u>	<u>Surveyor's Recommendation</u>
1	To remove, check and reinstall front wire harness for headlights, horns, outside temperature sensor, headlight washer assy and front parking aid.	S/N \$ 480.00 ✓	✓
2	To remove and transfer aircond condenser, charged air cooler, radiator. Check electrical fans and control unit. Pressurise cooling system. To carry put vacuum and regas.	S/N \$ 1,400.00 ✓	✓
3	To dismantle both front door panel trims. To remove and reinstall both wing mirror assys.	S/N \$ 600.00 ✓	✓
4	To dismantle and renew front bumper, both front fenders, bonnet and both headlights. To repair both front doors. Renew front lock carrier and align to position. Re-organise crash management components. Reinstall all parts removed.	\$ 8,000.00 4000 ✓	✓
5	To respray front bumper, front bumper lower spoiler, both front fenders, bonnet hinges, both front wheel arch trims and both front doors.	\$ 7,800.00 3850 4350 ✓	✓
6	To renew both rims and carry out wheel alignment.	S/N \$ 320.00 ✓	✓
7	To carry out diagnostic checks.	S/N \$ 192.00 ✓	✓
TOTAL LABOUR CHARGES		: <u>\$ 18,792.00</u>	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
 Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SGN 8618]

S/N	Parts Description			Damaged Parts & Prices	
		S	Nett	S/Nett	Remark
1	FRONT BUMPER - LH / RH <i>tan</i>	2	S	2,180.00	1891.20
2	FRONT BUMPER CONNECTING PIECE - CENTRE <i>ca & suc</i>		S	184.00	X
3	FRONT BUMPER FIXING PARTS <i>ca & n</i>		S	244.00	X
4	FRONT BUMPER SECURING STRIP - LH / RH <i>cut</i>	2	S	68.00	52.96
5	FRONT BUMPER CLOSING ELEMENT - LH / RH <i>de</i>	2	S	202.00	161.60
6	FRONT BUMPER GRILLE - CENTRE <i>ca</i>		S	129.00	102.80
7	FRONT BUMPER SPOILER <i>ca</i>		S	685.00	548
8	FRONT BUMPER GUARD <i>at</i>		S	431.00	344.80
9	FRONT BUMPER CLOSING ELEMENT <i>de</i>		S	156.00	124.40
10	RADIATOR GRILLE <i>ca</i>		S	3,258.00	2606.40
11	QUATTRO INSCRIPTION <i>ca</i>		S	87.00	69.28
12	RADIATOR GRILLE STRIKER PLATE <i>cut</i>		S	222.00	177.20
13	FRONT BUMPER AIR GUIDE GRILLE - LH / RH <i>Mis</i>	2	S	1,038.00	829.60
14	FRONT BUMPER END CAP - LH / RH <i>Mis</i>	2	S	166.00	131.68
15	FRONT BUMPER LOCKING CLIP <i>ca</i>	4	S	15.00	11.52
16	FRONT BUMPER CARRIER <i>St</i>		S	831.00	664.40
17	FOAM FILLER PIECE <i>Mis</i>		S	260.00	207.20
18	FRONT LOWER SIGHT SHIELD <i>cut</i>		S	116.00	92.40
19	FRONT BUMPER BRACKET - LH / RH <i>bt</i>	2	S	462.00	368.80
20	FRONT BUMPER GUIDE SECTION - LH / RH <i>ca</i>	2	S	68.00	54.24
SUB TOTAL SPARE PARTS				\$ 10,802.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
 Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SGN 8618]

S/N	Parts Description			Damaged Parts & Prices	
				S/Nett	Remark
21	CAUTION SIGN <i>nee /</i>	NEC	S	13.00	9.76
22	AIRCON STICKER <i>nee /</i>	NEC	S	18.00	14
23	HORN - LH LOW TONE <i>? . cm /</i>		S	178.00	143.40
24	HORN - RH - HIGH TONE <i>? . cm /</i>		S	178.00	143.40
25	FENDER - LH / RH <i>bt /</i>	2	S	2,602.00	2081.60
26	FENDER ATTACHMENT PARTS - FRONT <i>? X sue</i>	2	S	119.00	X
27	FENDER BRACE - LH / RH <i>? . bt /</i>	2	S	412.00	338.80
28	FENDER BRACKET - LH / RH <i>nee /</i>	2	S	32.00	24.64
29	CLOSURE PANEL - LH / RH OUTER <i>nee /</i>	2	S	56.00	44.48
30	CLOSURE PANEL - LH / RH INNER <i>nee /</i>	2	S	72.00	56.80
31	INNER SHIELD - LH / RH OUTER <i>nee X sue</i>	2	S	142.00	X
32	WHEEL HOUSING LINER - LH / RH <i>X sue</i>	2	S	492.00	X
33	WHEEL HOUSING LINER ATTACHMENT PARTS FRONT <i>X sue</i>	2	S	69.00	X
34	WHEEL HOUSING LINER - LH / RH <i>sue /</i>	2	S	285.00	227.60
35	BONNET <i>bt /</i>		S	3,707.00	2965.60
36	BONNET LID HINGE - LH / RH <i>X sue</i>	2	S	292.00	X
37	BONNET ATTACHMENT PARTS <i>X sue</i>	2	S	127.00	X
38	GAS FILLED STRUT <i>X sue</i>	2	S	217.00	X
39	BONNET STRIKER - LH / RH <i>? X sue</i>	2	S	218.00	X
40	ENGINE BONNET SOUND ABSORBER <i>X sue</i>		S	289.00	X
SUB TOTAL SPARE PARTS				\$	9,518.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699
 Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SGN 8618]

S/N	Parts Description			Damaged Parts & Prices	
				S/Nett	Remark
41	IMPACT PROTECTION - LH / RH / CENTRTE <i>nee ✓</i>	3	S	75.00	59.44
42	PLENUM CHAMBER COVER <i>X sue</i>		S	131.00	X
43	WATER BOX SEAL <i>X sue</i>		S	185.00	X
44	FRONT BUMPER SEAL STRIP - LH / RH <i>? X sue</i>	2	S	30.00	X
45	FRONT BUMPER CUSHION - LH / RH <i>? X sue</i>	2	S	30.00	X
46	BONNET LID LOCK - FRONT <i>? X sue</i>	2	S	391.00	X
47	MICRO SWITCH <i>? X sue</i>	2	S	24.00	X
48	CONNECTOR HOUSIN BRACKET <i>? X sue</i>	2	S	18.00	X
49	BONNET BOWDEN CABLE - CENTRE <i>? X sue</i>		S	53.00	X
50	BONNET RELEASE ELEMENT <i>X can ✓</i>		S	53.00	41.68
51	BONNET RELEASE LEVER <i>X sue</i>		S	13.00	X
52	BONNET LID LOCK CABLE <i>X sue</i>		S	67.00	X
53	FRONT PARKING AID SENSOR - INNER / OUTER <i>PS ✓</i>	2	S	924.00	739.30
54	PARKING AID SEAL RING <i>nee ✓</i>	4	S	12.00	8.96
55	BUMPER WIRING SET <i>? cut ✓</i>		S	378.00	302
56	MAIN BEAM HEADLIGHT MOUNTING - LH / RH <i>can ✓</i>	2	S	214.00	171.30
57	LED HEADLIGHT - LH / RH <i>bro ✓</i>	2	S	14,454.00	11,563.20
58	LIGHT CONTROL SYSTEM CONTROL UNIT <i>? X sue</i>	2	S	1,383.00	X
59	MAIN LIGHT ELECTRONICS POWER MODULE <i>? X sue</i>	2	S	1,385.00	X
60	LED WITH HEAT SINK - LH / RH <i>? X sue</i>	2	S	1,980.00	X
SUB TOTAL SPARE PARTS				\$	21,800.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SGN 8618]

S/N	Parts Description			Damaged Parts & Prices	
				S/Nett	Remark
61	HEADLIGHT HOSE - LH / RH ? fou	2	S	70.00	X
62	HEADLIGHT WASHER LIFT CYLINDER - LH / RH ? con	2	S	256.00	204
63	LIFT CYLINDER HOSE ? con		S	113.00	90
64	HEADLIGHT WASHER PUMP ?		S	147.00	X
65	PUMP INSULATOR ?		S	19.00	X
66	WASH WATER RESERVOIR HOSE ?		S	61.00	X
67	WASH WATER RESERVOIR ?		S	200.00	X
68	WINDSCREEN WASHER SYSTEM PUMP ?		S	118.00	X
69	RESERVOIR CAP X		S	24.00	X
70	WATER RESERVOIR END CAP X		S	59.00	X
71	COOLANT RADIATOR LOCK CARRIER con		S	1,169.00	935.00
72	RADIATOR SUPPORT - LH / RH ? con	2	S	96.00	76.64
73	RADIATOR BRACE - LH / RH LOWER ? con	2	S	104.00	81.76
74	EXTERNAL TEMPERATURE SENSOR ? Xsu		S	54.00	X
75	TEMPERATURE SENSOR BRACKET con		S	14.00	11.20
76	A/C CONDENSER ? bt		S	547.00	437.60
77	REFRIGERANT LINE ?		S	263.00	X
78	REFRIGERANT LINE ? } Xsu		S	273.00	X
79	A/C ADAPTER CABLE ?		S	27.00	X
80	RADIATOR ? bt		S	820.00	655.60
	SUB TOTAL SPARE PARTS		S	4,434.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SGN 8618 1

S/N	Parts Description			Damaged Parts & Prices		
				S/Nett	Remark	
81	READY MIX COOLANT <i>na ✓</i>	4	S	84.00	67.20	
82	CHARGE AIR COOLER <i>bt ✓</i>		S	724.00	578.80	
83	CHARGE AIR COOLER SEAL RING <i>na ✓</i>	2	S	82.00	64.96	
84	CHARGE AIR COOLER PRESSURE HOSE <i>? xsu</i>		S	283.00	X	
85	CHARGE AIR COOLER PRESSURE PIPE <i>? xsu</i>		S	477.00	X	
86	FAN RING <i>? ca ✓</i>		S	373.00	298.40	
87	RADIATOR FAN WITH CONTROL UNIT <i>? na ✓</i>		S	2,159.00	1727.20	
88	RADIATOR AIR GUIDE - UPPER / LOWER <i>? ca ✓</i>	2	S	86.00	67.68	
89	RADIATOR AIR GUIDE - CENTRE <i>? ca ✓</i>		S	37.00	29.52	
90	RADIATOR AIR GUIDE - LH / RH <i>Red ✓</i>	2	S	100.00	79.36	
91	RADIATOR LOUVRE <i>? ca ✓</i>		S	483.00	386	
92	ADJUST MOTOR <i>?</i>		S	166.00	X	
93	AIR INTAKE DUCT AIR GUIDE <i>? } xsu</i>		S	79.00	X	
94	AIR INTAKE HOSE <i>? } xsu</i>		S	85.00	X	
95	AIR INTAKE AIR FILTER <i>? } xsu</i>		S	368.00	X	
96	WHEEL COVER - LH / RH FRONT <i>su ✓</i>	2	S	1,154.00	923.20	
SUB TOTAL SPARE PARTS				S	6,740.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
 Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SGN 86181

S/N	Parts Description			Damaged Parts & Prices	
				S/Nett	Remark
97	S-LINE INSCRIPTION <i>new/</i>	2	S	225.00	180
98	NOISE INSULATION <i>? new/</i>		S	743.00	591.11g
99	WINDOW SLOT SEAL - LH / RH FRONT <i>cut/ (REMOVED)</i>	2	S	1,074.00	859.00
100	WINDOW GUIDE TRIM STRIP <i>X su</i>	2	S	622.00	X
101	ALUMINIUM RIM - LH <i>(LH & RH) cut/</i>	2	S	1,846.00	1476.80
102	ALUMINIUM RIM RUBBER VALVE <i>new/ X su</i>	<i>2/5.4</i>	S	13.00	X
103	ACCELERATOR PEDAL <i>OK/</i>		S	216.00	173.80
104	ACCELERATOR PEDAL CAP <i>X su</i>		S	64.00	X
105	ACCELERATOR PEDAL CBRACKET <i>? X su</i>		S	712.00	X
106	BRAKE PEDAL <i>X su</i>		S	338.00	X
107	FRONT NO. PLATE <i>bt/</i>	5/N	S	40.00	40
108	SUNDRIES <i>? new/</i>		S	700.00	133.53
TOTAL SPARE PARTS				\$ 59,887.00	
TOTAL LABOUR CHARGES				\$ 18,792.00	
GRAND TOTAL				\$ 78,679.00	

All charges are not inclusive of GST.

Legend :

Remarks (OK) = Approved, Remarks (X) = Not approved
 Spare parts are Special Nett.

88771-30

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Name

Surveyed Date

Authorised Date

Excess Cost

Liability

Remarks


: Rasul - Hp 90010068
: 22/08/19 @ 1500
: 12 days
: EXCESS: TBA
: REVERS
: Resurvey before paint

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Please Note

- : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly. For inspection of vehicle, please refer to Ms Norah Khai at Tel:6768 9828 for appointment.

Yours faithfully,

Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0996/2019/N5
Date : 21-Aug-19

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way
#07-16 AIG Building
Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : MR TEOW KHEK SOO
Address : 760 JURONG WEST ST 74
#12-02
Singapore 248732
Telephone : HP +65 97376819
Type of Claim : Own Damage Claims
Policy No. : 1800137600
Vehicle No : **SGN 8618 J**
Model Code : Audi Q5 SPORT 2.0 TFSI qu
Model / Year : 27/11/2018
Engine No : DAX 046070
Chassis No : WAUZZZF5J2239125
Mileage :
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 17-Aug-19
Place of Accident : ALONG PIE TOWARDS TUAS

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle, SGN 8618]

S/n	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
1	To remove, check and reinstall front wire harness for headlights, horns, outside temperature sensor, headlight washer assy and front parking aid.	S/N \$ 480.00 ✓	
2	To remove and transfer aircond condenser, charged air cooler, radiator. Check electrical fans and control unit. Pressurise cooling system. To carry put vacuum and regas.	S/N \$ 1,400.00 ✓	
3	To dismantle both front door panel trims. To remove and reinstall both wing mirror assys.	S/N \$ 600.00 ✓	
4	To dismantle and renew front bumper, both front fenders, bonnet and both headlights. To repair both front doors. Renew front lock carrier and align to position. Re-organise crash management components. Reinstall all parts removed.	\$ 8,000.00 4000	
5	To respray front bumper, front bumper lower spoiler, both front fenders, bonnet hinges, both front wheel arch trims and both front doors.	\$ 7,800.00 3850 4250	
6	To renew both rims and carry out wheel alignment.	S/N \$ 320.00 ✓	
7	To carry out diagnostic checks.	S/N \$ 192.00 ✓	
	TOTAL LABOUR CHARGES	: <u>\$ 18,792.00</u>	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
 Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SGN 8618 1**

S/N	Parts Description	Damaged Parts & Prices		Remark
		S/Nett		
1	FRONT BUMPER - LH / RH <i>tan</i>	2	\$ 2,180.00	
2	FRONT BUMPER CONNECTING PIECE - CENTRE <i>ca</i>	\$	184.00	
3	FRONT BUMPER FIXING PARTS <i>ca</i>	\$	244.00	
4	FRONT BUMPER SECURING STRIP - LH / RH <i>cut</i>	2	\$ 68.00	
5	FRONT BUMPER CLOSING ELEMENT - LH / RH <i>de</i>	2	\$ 202.00	
6	FRONT BUMPER GRILLE - CENTRE <i>ca</i>	\$	129.00	
7	FRONT BUMPER SPOILER <i>ca</i>	\$	685.00	
8	FRONT BUMPER GUARD <i>at</i>	\$	431.00	
9	FRONT BUMPER CLOSING ELEMENT <i>de</i>	\$	156.00	
10	RADIATOR GRILLE <i>ca</i>	\$	3,258.00	
11	QUATTRO INSCRIPTION <i>ca</i>	\$	87.00	
12	RADIATOR GRILLE STRIKER PLATE <i>at</i>	\$	222.00	
13	FRONT BUMPER AIR GUIDE GRILLE - LH / RH <i>mis</i>	2	\$ 1,038.00	
14	FRONT BUMPER END CAP - LH / RH <i>mis</i>	2	\$ 166.00	
15	FRONT BUMPER LOCKING CLIP <i>ca</i>	4	\$ 15.00	
16	FRONT BUMPER CARRIER <i>st</i>	\$	831.00	
17	FOAM FILLER PIECE <i>mis</i>	\$	260.00	
18	FRONT LOWER SIGHT SHIELD <i>cut</i>	\$	116.00	
19	FRONT BUMPER BRACKET - LH / RH <i>st</i>	2	\$ 462.00	
20	FRONT BUMPER GUIDE SECTION - LH / RH <i>ca</i>	2	\$ 68.00	
SUB TOTAL SPARE PARTS		\$ 10,802.00		

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
 Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
 Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SGN 8618]

S/N	Parts Description	Damaged Parts & Prices		Remark
		S/Nett		
21	CAUTION SIGN <i>nee</i>	NEC	\$	13.00
22	AIRCON STICKER <i>nee</i>	NEC	\$	18.00
23	HORN - LH LOW TONE <i>? con</i>		\$	178.00
24	HORN - RH - HIGH TONE <i>? ca</i>		\$	178.00
25	FENDER - LH / RH <i>bt</i>	2	\$	2,602.00
26	FENDER ATTACHMENT PARTS - FRONT <i>? x suc</i>	2	\$	119.00
27	FENDER BRACE - LH / RH <i>? bt</i>	2	\$	412.00
28	FENDER BRACKET - LH / RH <i>nee</i>	2	\$	32.00
29	CLOSURE PANEL - LH / RH OUTER <i>nee</i>	2	\$	56.00
30	CLOSURE PANEL - LH / RH INNER <i>nee</i>	2	\$	72.00
31	INNER SHIELD - LH / RH OUTER <i>x suc</i>	2	\$	142.00
32	WHEEL HOUSING LINER - LH / RH <i>x suc</i>	2	\$	492.00
33	WHEEL HOUSING LINER ATTACHMENT PARTS FRONT <i>x suc</i>	2	\$	69.00
34	WHEEL HOUSING LINER - LH / RH <i>suc</i>	2	\$	285.00
35	BONNET <i>bt</i>		\$	3,707.00
36	BONNET LID HINGE - LH / RH <i>x suc</i>	2	\$	292.00
37	BONNET ATTACHMENT PARTS <i>x suc</i>	2	\$	127.00
38	GAS FILLED STRUT <i>x suc</i>	2	\$	217.00
39	BONNET STRIKER - LH / RH <i>? x suc</i>	2	\$	218.00
40	ENGINE BONNET SOUND ABSORBER <i>x suc</i>		\$	289.00
SUB TOTAL SPARE PARTS		\$		9,518.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699
 Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SGN 86181

S/N	Parts Description	Damaged Parts & Prices		Remark
		S/	Nett	
41	IMPACT PROTECTION - LH / RH / CENTRTE <i>nee ✓</i>	3	\$ 75.00	
42	PLENUM CHAMBER COVER <i>X svc</i>	\$	131.00	
43	WATER BOX SEAL <i>X svc</i>	\$	185.00	
44	FRONT BUMPER SEAL STRIP - LH / RH <i>? X svc</i>	2	\$ 30.00	
45	FRONT BUMPER CUSHION - LH / RH <i>? X svc</i>	2	\$ 30.00	
46	BONNET LID LOCK - FRONT <i>? X svc</i>	2	\$ 391.00	
47	MICRO SWITCH <i>? X svc</i>	2	\$ 24.00	
48	CONNECTOR HOUSIN BRACKET <i>? X svc</i>	2	\$ 18.00	
49	BONNET BOWDEN CABLE - CENTRE <i>? X svc</i>	\$	53.00	
50	BONNET RELEASE ELEMENT <i>X ca ✓</i>	\$	53.00	
51	BONNET RELEASE LEVER <i>X svc</i>	\$	13.00	
52	BONNET LID LOCK CABLE <i>X svc</i>	\$	67.00	
53	FRONT PARKING AID SENSOR - INNER / OUTER <i>PCS ✓</i>	2	\$ 924.00	
54	PARKING AID SEAL RING <i>nee ✓</i>	4	\$ 12.00	
55	BUMPER WIRING SET <i>? cut ✓</i>	\$	378.00	
56	MAIN BEAM HEADLIGHT MOUNTING - LH / RH <i>ca ✓</i>	2	\$ 214.00	
57	LED HEADLIGHT - LH / RH <i>bro ✓</i>	2	\$ 14,454.00	
58	LIGHT CONTROL SYSTEM CONTROL UNIT <i>? X svc</i>	2	\$ 1,383.00	
59	MAIN LIGHT ELECTRONICS POWER MODULE <i>? X svc</i>	2	\$ 1,385.00	
60	LED WITH HEAT SINK - LH / RH <i>? X svc</i>	2	\$ 1,980.00	
SUB TOTAL SPARE PARTS		\$	21,800.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
 Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SGN 86181

S/N	Parts Description			Damaged Parts & Prices	
				S/Nett	Remark
61	HEADLIGHT HOSE - LH / RH ? xsvl	2	S	70.00	
62	HEADLIGHT WASHER LIFT CYLINDER - LH / RH ? cm ✓	2	S	256.00	
63	LIFT CYLINDER HOSE ? cut ✓		S	113.00	
64	HEADLIGHT WASHER PUMP ? xsvl		S	147.00	
65	PUMP INSULATOR ? xsvl		S	19.00	
66	WASH WATER RESERVOIR HOSE ? xsvl		S	61.00	
67	WASH WATER RESERVOIR ? xsvl		S	200.00	
68	WINDSCREEN WASHER SYSTEM PUMP ? xsvl		S	118.00	
69	RESERVOIR CAP xsvl		S	24.00	
70	WATER RESERVOIR END CAP xsvl		S	59.00	
71	COOLANT RADIATOR LOCK CARRIER ca ✓		S	1,169.00	
72	RADIATOR SUPPORT - LH / RH ? cm ✓	2	S	96.00	
73	RADIATOR BRACE - LH / RH LOWER ? cm ✓	2	S	104.00	
74	EXTERNAL TEMPERATURE SENSOR ? xsvl		S	54.00	
75	TEMPERATURE SENSOR BRACKET ca ✓		S	14.00	
76	A/C CONDENSER ? bt ✓		S	547.00	
77	REFRIGERANT LINE ? xsvl		S	263.00	
78	REFRIGERANT LINE ? xsvl		S	273.00	
79	A/C ADAPTER CABLE ? xsvl		S	27.00	
80	RADIATOR ? bt ✓		S	820.00	
	SUB TOTAL SPARE PARTS	5		4,434.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SGN 86181**

S/N	Parts Description	Damaged Parts & Prices		Remark
		S/	Nett	
81	READY MIX COOLANT <i>neu ✓</i>	4	S	84.00
82	CHARGE AIR COOLER <i>bt ✓</i>		S	724.00
83	CHARGE AIR COOLER SEAL RING <i>nu ✓</i>	2	S	82.00
84	CHARGE AIR COOLER PRESSURE HOSE <i>? XSVC</i>		S	283.00
85	CHARGE AIR COOLER PRESSURE PIPE <i>? XSVC</i>		S	477.00
86	FAN RING <i>? CR ✓</i>		S	373.00
87	RADIATOR FAN WITH CONTROL UNIT <i>? nu ✓</i>		S	2,159.00
88	RADIATOR AIR GUIDE - UPPER / LOWER <i>? CR ✓</i>	2	S	86.00
89	RADIATOR AIR GUIDE - CENTRE <i>? CR ✓</i>		S	37.00
90	RADIATOR AIR GUIDE - LH / RH <i>Red ✓</i>	2	S	100.00
91	RADIATOR LOUVRE <i>? CR ✓</i>		S	483.00
92	ADJUST MOTOR <i>? XSVC</i>		S	166.00
93	AIR INTAKE DUCT AIR GUIDE <i>? XSVC</i>		S	79.00
94	AIR INTAKE HOSE <i>? XSVC</i>		S	85.00
95	AIR INTAKE AIR FILTER <i>? XSVC</i>		S	368.00
96	WHEEL COVER - LH / RH FRONT <i>SUR ✓</i>	2	S	1,154.00
	SUB TOTAL SPARE PARTS	S		6,740.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SGN 86181

S/N	Parts Description			Damaged Parts & Prices	
		S/Nett	Remark	S/Nett	Remark
97	S-LINE INSCRIPTION <i>new/</i>	2	S	225.00	
98	NOISE INSULATION <i>? new/</i>		S	743.00	
99	WINDOW SLOT SEAL - LH / RH FRONT <i>cut/ (S/N)</i>	2	S	1,074.00	
100	WINDOW GUIDE TRIM STRIP <i>X sue</i>	2	S	622.00	
101	ALUMINIUM RIM - LH <i>(LH & RH) cut/</i>	2	S	1,846.00	
102	ALUMINIUM RIM RUBBER VALVE <i>cut/ X N</i>	<i>2/5</i>	S	13.00	<i>6.50 X</i>
103	ACCELERATOR PEDAL <i>OK/</i>		S	216.00	
104	ACCELERATOR PEDAL CAP <i>X sue</i>		S	64.00	
105	ACCELERATOR PEDAL CBRACKET <i>? X sue</i>		S	712.00	
106	BRAKE PEDAL <i>X sue</i>		S	338.00	
107	FRONT NO. PLATE <i>bt/</i>	S/N	S	40.00	
108	SUNDRIES <i>? new/</i>		S	700.00	
TOTAL SPARE PARTS				\$	59,887.00
TOTAL LABOUR CHARGES				\$	18,792.00
GRAND TOTAL				\$	78,679.00

All charges are not inclusive of GST.

Legend :

Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

28/7/70

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Name

Surveyed Date

Authorised Date

Excess Cost

Liability

Remarks

: RASUL - Hp 90010068
: 22/08/19 @ 1500
: 12 days
: EXCESS: TBA
: REVERT
: Resurvey before paint

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Please Note

- : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,

Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel: (65) 6366 2323 Fax: (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Estimate No. PA/OD/0996/2019/N5
Date 3-Sep-19
Service Advisor Glory Tan
Pages 1 of 1
Regn No SGN 861B J
Model No Audi Q5 SPORT 2.0 TFSI qu

Quantity	Description	Unit Price	Amount
<u>Parts</u>			
1	Air cond compressor ? sea -	\$ 1,769.00	
2	Poly V-Belt ? X	\$ 47.00	
3	Vibration damper sea -	\$ 396.00	
4	Wiring set for starter and alternator with earth lead cat -	\$ 772.00	
5	Butt connector, watertight GG11-F-2 car -	\$ 48.00	
6	Butt connector, watertight GG11-F-1 car -	\$ 48.00	
		<u>\$ 3,080.00</u>	

Paul
04/08/19

LABORS

1	To renew air cond compressor, poly v-belt and other engine components.	S/N	\$ 480.00
---	--	-----	-----------

Labour total	<u>\$ 480.00</u>
Part total	<u>\$ 3,080.00</u>
GRAND TOTAL	<u>\$ 3,560.00</u>

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel: (65) 6366 2323 Fax: (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd
 78 Shenton Way
 #07-16 AIG Building
 Singapore 079120
Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Estimate No. PA/OD/0996/2019/N5
Date 3-Sep-19
Service Advisor Glory Tan
Pages 1 of 1
Regn No SGN 8618 J
Model No Audi Q5 SPORT 2.0 TFSI qu

Quantity	Description	Unit Price	Amount
Parts			
1	Air cond compressor ? see -	\$ 1,769.00	1445.00
2	Poly V-Belt ? X see	\$ 47.00	
3	Vibration damper see -	\$ 396.00	316.80
4	Wiring set for starter and alternator with earth lead at -	\$ 772.00	617.50
5	Butt connector, watertight GG11-F-2 see -	\$ 48.00	38.40
6	Butt connector, watertight GG11-F-1 see -	\$ 48.00	38.40
		\$ 3,080.00	

LABORS

1	To renew air cond compressor, poly v-belt and other engine components.	S/N	\$ 480.00
---	--	-----	-----------

Labour total	\$ 480.00
Part total	\$ 3,080.00
GRAND TOTAL	\$ 3,560.00

For Premium Automobiles Pte Ltd

 Authorised Signature

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315		Estimate No. PA/OD/0996/2019/NS Date 17-Sep-19 Service Advisor Glory Tan Pages 1 of 1 Regn No SGN 8618 J Model No Audi Q5 SPORT 2.0 TFSI qu	
Quantity	Description	Unit Price	Amount
Parts			
1	Rear bumper wheel arch cover LHS	\$ 487.00	389.60
2	Rear bumper wheel arch cover RHS	\$ 487.00	389.60
		\$ 974.00	
LABORS			
1	To remove and reinstall rear parking aid and rear lid kick sensor assy.	S/N \$ 360.00	✓
2	To dismantle rear bumper. Repair rhs rear door. Reinstall all parts removed.	\$ 1,600.00 750	✓
3	To respray rhs A-pillar, rhs rear door, rear bumper, lower spoiler and both wheel arch trims.	\$ 3,800.00 2050	
Labour total		\$ 5,760.00	
Part total		\$ 974.00	
GRAND TOTAL		\$ 6,734.00	

For Premium Automobiles Pte Ltd

 Authorised Signature

Shirley Hiew (LKK Auto)

From: Carrine Leong <carrine.leong@premiumauto.com.sg>
Sent: Tuesday, 29 October 2019 5:00 pm
To: Veron Chen (LKKAuto); Rasul (LKKAuto)
Subject: FW: FINAL REVISION - SGN8618J - OD AIG - SURVEYED - RASUL 22 AUG 19
Attachments: PA09972019 - SGN 8618 J - AUDI Q5 SPORT 2.0 TFSI qu - FRONT OD (AIG).xlsx;
WhatsApp Image 2019-10-24 at 6.07.42 PM (resize).jpeg; WhatsApp Image 2019-10-24 at 6.07.43 PM (resize).jpeg; WhatsApp Image 2019-10-24 at 6.07.43 PM (1) (resize).jpeg; WhatsApp Image 2019-10-24 at 6.07.39 PM (resize).jpeg; WhatsApp Image 2019-10-24 at 6.07.39 PM (1) (resize).jpeg; WhatsApp Image 2019-10-24 at 6.07.42 PM (1) (resize).jpeg; WhatsApp Image 2019-10-24 at 6.07.35 PM (resize).jpeg; WhatsApp Image 2019-10-24 at 6.07.40 PM (resize).jpeg; WhatsApp Image 2019-10-24 at 6.07.40 PM (1) (resize).jpeg; WhatsApp Image 2019-10-24 at 6.07.41 PM (resize).jpeg; WhatsApp Image 2019-10-24 at 6.07.36 PM (1) (resize).jpeg

Hi Adrian, Rasul and all,

Revised estimate and photo file is attached.

Please confirm repair cost of \$55,619.68 @ ¹⁸24 days of repairs exclude weekend.

Your early confirmation is well appreciated.

Thanks & Best Regard
Carrine Leong
Claims Administrator

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9925 f. +65 6841 1183
e. carrine.leong@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Boo seng yak [mailto:boojohnny@gmail.com]
Sent: Friday, 25 October, 2019 1:48 PM
To: Adrian Ling <adrianling@lkkauto.com>; Veron Chen <veronchen@lkkauto.com>; SUR <sur@lkkauto.com>; Chang

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0996/2019/NS
Date : 21-Aug-19

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way
#07-16 AIG Building
Singapore 079120

Hi Rasul, Adrian

*You recommended 12 days
We took 24 days exclude weekend
jb 24 Oct 19*

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : MR TEOW KHEK SOO
Address : 760 JURONG WEST ST 74
#12-02
Singapore 248732
Telephone : HP +65 97376819
Type of Claim : Own Damage Claims
Policy No. : 1800137600
Vehicle No : **SGN 8618 J**
Model Code : Audi Q5 SPORT 2.0 TFSI qu
Model / Year : 27/11/2018
Engine No : DAX 046070
Chassis No : WAUZZZF5J2239125
Mileage :
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 17-Aug-19
Place of Accident : ALONG PIE TOWARDS TUAS

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle. SGN 8618 J

<u>S/n</u>	<u>Nature of Jobs</u>	<u>Estimated Charges</u>	<u>Surveyor's Recommendation</u>
1	To remove, check and reinstall front wire harness for headlights, horns, outside temperature sensor, headlight washer assy and front parking aid.	S/N \$ 480.00	\$ 480.00
2	To remove and transfer aircond condenser, charged air cooler, radiator. Check electrical fans and control unit. Pressurise cooling system. To carry put vacuum and regas.	S/N \$ 1,400.00	\$ 1,400.00
3	To dismantle both front door panel trims. To remove and reinstall both wing mirror assys.	S/N \$ 600.00	\$ 600.00
4	To dismantle and renew front bumper, both front fenders, bonnet and both headlights. To repair both front doors. Renew front lock carrier and align to position. Re-organise crash management components. Reinstall all parts removed.	\$ 8,000.00	\$ 4,000.00
5	To respray front bumper, front bumper lower spoiler, both front fenders, bonnet hinges, both front wheel arch trims and both front doors. (Added 2 pcs wheel arches)	\$ 7,800.00	\$ 4,250.00
6	To renew both rims and carry out wheel alignment.	S/N \$ 320.00	\$ 320.00
7	Added labour charges - see attached	\$ 480.00	\$ 480.00
8	Added labour charges - see attached	\$ 5,760.00	\$ 3,160.00
9	To carry out diagnostic checks.	S/N \$ 192.00	\$ 192.00
TOTAL LABOUR CHARGES		: \$ 25,032.00	\$ 14,882.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SGN 8618 J**

S/N	Parts Description	Damaged Parts & Prices	
		S/Nett	Remark
1	FRONT BUMPER - LH / RH	2 \$ 2,180.00	\$ 1,891.20
2	FRONT BUMPER CONNECTING PIECE - CENTRE	\$ 184.00	
3	FRONT BUMPER FIXING PARTS	\$ 244.00	
4	FRONT BUMPER SECURING STRIP - LH / RH	2 \$ 68.00	\$ 52.96
5	FRONT BUMPER CLOSING ELEMENT - LH / RH	2 \$ 202.00	\$ 161.60
6	FRONT BUMPER GRILLE - CENTRE	\$ 129.00	\$ 102.80
7	FRONT BUMPER SPOILER	\$ 685.00	\$ 548.00
8	FRONT BUMPER GUARD	\$ 431.00	\$ 344.80
9	FRONT BUMPER CLOSING ELEMENT	\$ 156.00	\$ 124.40
10	RADIATOR GRILLE	\$ 3,258.00	\$ 2,606.40
11	QUATTRO INSCRIPTION	\$ 87.00	\$ 69.28
12	RADIATOR GRILLE STRIKER PLATE	\$ 222.00	\$ 177.20
13	FRONT BUMPER AIR GUIDE GRILLE - LH / RH	2 \$ 1,038.00	\$ 829.60
14	FRONT BUMPER END CAP - LH / RH	2 \$ 166.00	\$ 131.68
15	FRONT BUMPER LOCKING CLIP	4 \$ 15.00	\$ 11.52
16	FRONT BUMPER CARRIER	\$ 831.00	\$ 664.40
17	FOAM FILLER PIECE	\$ 260.00	\$ 207.20
18	FRONT LOWER SIGHT SHIELD	\$ 116.00	\$ 92.40
19	FRONT BUMPER BRACKET - LH / RH	2 \$ 462.00	\$ 368.80
20	FRONT BUMPER GUIDE SECTION - LH / RH	2 \$ 68.00	\$ 54.24
SUB TOTAL SPARE PARTS		\$ 10,802.00	\$ 8,438.48

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SGN 8618 J**

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 8,438.48
21	CAUTION SIGN	NEC	\$ 13.00	\$ 9.76
22	AIRCON STICKER	NEC	\$ 18.00	\$ 14.00
23	HORN - LH LOW TONE		\$ 178.00	\$ 142.40
24	HORN - RH - HIGH TONE		\$ 178.00	\$ 142.40
25	FENDER - LH / RH	2	\$ 2,602.00	\$ 2,081.60
26	FENDER ATTACHMENT PARTS - FRONT	2	\$ 119.00	
27	FENDER BRACE - LH / RH	2	\$ 412.00	\$ 328.80
28	FENDER BRACKET - LH / RH	2	\$ 32.00	\$ 24.64
29	CLOSURE PANEL - LH / RH OUTER	2	\$ 56.00	\$ 44.48
30	CLOSURE PANEL - LH / RH INNER	2	\$ 72.00	\$ 56.80
31	INNER SHIELD - LH / RH OUTER	2	\$ 142.00	
32	WHEEL HOUSING LINER - LH / RH	2	\$ 492.00	
33	WHEEL HOUSING LINER ATTACHMENT PARTS FRONT	2	\$ 69.00	
34	WHEEL HOUSING LINER - LH / RH	2	\$ 285.00	\$ 227.60
35	BONNET		\$ 3,707.00	\$ 2,965.60
36	BONNET LID HINGE - LH / RH	2	\$ 292.00	
37	BONNET ATTACHMENT PARTS	2	\$ 127.00	
38	GAS FILLED STRUT	2	\$ 217.00	
39	BONNET STRIKER - LH / RH	2	\$ 218.00	
40	ENGINE BONNET SOUND ABSORBER		\$ 289.00	
	SUB TOTAL SPARE PARTS		\$ 9,518.00	\$ 14,476.56

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SGN 8618 J**

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 14,476.56
41	IMPACT PROTECTION - LH / RH / CENTRTE	3	\$ 75.00	\$ 59.44
42	PLENUM CHAMBER COVER		\$ 131.00	
43	WATER BOX SEAL		\$ 185.00	
44	FRONT BUMPER SEAL STRIP - LH / RH	2	\$ 30.00	
45	FRONT BUMPER CUSHION - LH / RH	2	\$ 30.00	
46	BONNET LID LOCK - FRONT	2	\$ 391.00	
47	MICRO SWITCH	2	\$ 24.00	
48	CONNECTOR HOUSIN BRACKET	2	\$ 18.00	
49	BONNET BOWDEN CABLE - CENTRE		\$ 53.00	
50	BONNET RELEASE ELEMENT		\$ 53.00	\$ 41.68
51	BONNET RELEASE LEVER		\$ 13.00	
52	BONNET LID LOCK CABLE		\$ 67.00	
53	FRONT PARKING AID SENSOR - INNER / OUTER	2	\$ 924.00	\$ 739.20
54	PARKING AID SEAL RING	4	\$ 12.00	\$ 8.96
55	BUMPER WIRING SET		\$ 378.00	\$ 302.00
56	MAIN BEAM HEADLIGHT MOUNTING - LH / RH	2	\$ 214.00	\$ 171.20
57	LED HEADLIGHT - LH / RH	2	\$ 14,454.00	\$ 11,563.20
58	LIGHT CONTROL SYSTEM CONTROL UNIT	2	\$ 1,383.00	
59	MAIN LIGHT ELECTRONICS POWER MODULE	2	\$ 1,385.00	
60	LED WITH HEAT SINK - LH / RH	2	\$ 1,980.00	
	SUB TOTAL SPARE PARTS		\$ 21,800.00	\$ 27,362.24

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SGN 8618 J**

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 27,362.24
21	HEADLIGHT HOSE - LH / RH	2	\$ 70.00	
22	HEADLIGHT WASHER LIFT CYLINDER - LH / RH	2	\$ 256.00	\$ 204.00
23	LIFT CYLINDER HOSE		\$ 113.00	\$ 90.00
24	HEADLIGHT WASHER PUMP		\$ 147.00	
25	PUMP INSULATOR		\$ 19.00	
26	WASH WATER RESERVOIR HOSE		\$ 61.00	
27	WASH WATER RESERVOIR		\$ 200.00	
28	WINDSCREEN WASHER SYSTEM PUMP		\$ 118.00	
29	RESERVOIR CAP		\$ 24.00	
30	WATER RESERVOIR END CAP		\$ 59.00	
31	COOLANT RADIATOR LOCK CARRIER		\$ 1,169.00	\$ 935.20
32	RADIATOR SUPPORT - LH / RH	2	\$ 96.00	\$ 76.64
33	RADIATOR BRACE - LH / RH LOWER	2	\$ 104.00	\$ 81.76
34	EXTERNAL TEMPERATURE SENSOR		\$ 54.00	
35	TEMPERATURE SENSOR BRACKET		\$ 14.00	\$ 11.20
36	A/C CONDENSER		\$ 547.00	\$ 437.60
37	REFRIGERANT LINE		\$ 263.00	
38	REFRIGERANT LINE		\$ 273.00	
39	A/C ADAPTER CABLE		\$ 27.00	
40	RADIATOR		\$ 820.00	\$ 655.60
	SUB TOTAL SPARE PARTS		\$ 4,434.00	\$ 29,854.24

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SGN 8618 J**

S/N	Parts Description	c/l	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 29,854.24
21	READY MIX COOLANT	4	\$ 84.00	\$ 67.20
22	CHARGE AIR COOLER		\$ 724.00	\$ 578.80
23	CHARGE AIR COOLER SEAL RING	2	\$ 82.00	\$ 64.96
24	CHARGE AIR COOLER PRESSURE HOSE		\$ 283.00	
25	CHARGE AIR COOLER PRESSURE PIPE		\$ 477.00	
26	FAN RING		\$ 373.00	\$ 298.40
27	RADIATOR FAN WITH CONTROL UNIT		\$ 2,159.00	\$ 1,727.20
28	RADIATOR AIR GUIDE - UPPER / LOWER	2	\$ 86.00	\$ 67.68
29	RADIATOR AIR GUIDE - CENTRE		\$ 37.00	\$ 29.52
30	RADIATOR AIR GUIDE - LH / RH	2	\$ 100.00	\$ 79.36
31	RADIATOR LOUVRE		\$ 483.00	\$ 386.00
32	ADJUST MOTOR		\$ 166.00	
33	AIR INTAKE DUCT AIR GUIDE		\$ 79.00	
34	AIR INTAKE HOSE		\$ 85.00	
35	AIR INTAKE AIR FILTER		\$ 368.00	
36	WHEEL COVER - LH / RH FRONT	2	\$ 1,154.00	\$ 922.40
	SUB TOTAL SPARE PARTS		\$ 6,740.00	\$ 34,075.76

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax**Material List for Accident Vehicle Regn No. SGN 8618 J**

S/N	Parts Description	c/f	Damaged Parts & Prices	
			S/Nett	Remark
				\$ 34,075.76
21	S-LINE INSCRIPTION	2	\$ 225.00	\$ 180.00
22	NOISE INSULATION		\$ 743.00	\$ 594.40
23	WINDOW SLOT SEAL - LH / RH FRONT	2	\$ 1,074.00	\$ 859.20
24	WINDOW GUIDE TRIM STRIP	2	\$ 622.00	
25	ALUMINIUM RIM - LH	2	\$ 1,846.00	\$ 1,476.80
26	ALUMINIUM RIM RUBBER VALVE	4	\$ 13.00	
27	ACCELERATOR PEDAL		\$ 216.00	\$ 172.80
28	ACCELERATOR PEDAL CAP		\$ 64.00	
29	ACCELERATOR PEDAL CBRACKET		\$ 712.00	
30	BRAKE PEDAL		\$ 338.00	
31	FRONT NO. PLATE	S/N	\$ 40.00	\$ 40.00
32	Added parts - see attached		\$ 3,080.00	\$ 2,426.00
33	Added parts - see attached		\$ 974.00	\$ 779.20
34	SUNDRIES		\$ 700.00	\$ 133.52
TOTAL SPARE PARTS			\$ 10,647.00	\$ 40,737.68
TOTAL LABOUR CHARGES			\$ 25,032.00	\$ 14,882.00
GRAND TOTAL			\$ 35,679.00	\$ 55,619.68

All charges are not inclusive of GST.

Legend :

Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/0996/2019/NS 3-Sep-19 Glory Tan 1 of 1 SGN 8618 J Audi Q5 SPORT 2.0 TFSI qu
Quantity	Description	Unit Price	Amount
Parts			
1	Air cond compressor	\$ 1,769.00	\$ 1,415.20
2	Poly V-Belt	\$ 47.00	
3	Vibration damper	\$ 396.00	\$ 316.80
4	Wiring set for starter and alternator with earth lead	\$ 772.00	\$ 617.20
5	Butt connector, watertight GG11-F-2	\$ 48.00	\$ 38.40
6	Butt connector, watertight GG11-F-1	\$ 48.00	\$ 38.40
		\$ 3,080.00	\$ 2,426.00
LABORS			
1	To renew air cond compressor, poly v-belt and other engine components. S/N	\$ 480.00	\$ 480.00
Labour total		\$ 480.00	\$ 480.00
Part total		\$ 3,080.00	\$ 2,426.00
GRAND TOTAL		\$ 3,560.00	\$ 2,906.00

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/0996/2019/NS 17-Sep-19 Glory Tan 1 of 1 SGN 8618 J Audi Q5 SPORT 2.0 TFSI qu
Quantity	Description	Unit Price	Amount
Parts			
1	Rear bumper wheel arch cover LHS	\$ 487.00	\$ 389.60
2	Rear bumper wheel arch cover RHS	\$ 487.00	\$ 389.60
		\$ 974.00	\$ 779.20
LABORS			
1	To remove and reinstall rear parking aid and rear lid kick sensor assy.	S/N \$ 360.00	\$ 360.00
2	To dismantle rear bumper. Repair rhs rear door. Reinstall all parts removed.	\$ 1,600.00	\$ 750.00
3	To respray rhs A-pillar, rhs rear door, rear bumper, lower spoiler and both wheel arch trims.	\$ 3,800.00	\$ 2,050.00
Labour total		\$ 5,760.00	\$ 3,160.00
Part total		\$ 974.00	\$ 779.20
GRAND TOTAL		\$ 6,734.00	\$ 3,939.20

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the
progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Veron Chen (LKKAuto)

From: Veron Chen (LKKAuto)
Sent: Tuesday, 26 November 2019 4:36 PM
To: Carrine Leong; Rasul (LKKAuto); SUR
Cc: nora.khai@premiumauto.com.sg; (boojohnny@gmail.com)
Subject: RE: FINAL REVISION - SGN8618J - OD AIG - SURVEYED - RASUL 22 AUG 19

Dear Carrine,

Confirmed repair limit at \$55,000 before excess \$750 and GST @ **18 working days**

Kindly send us invoice and discharge voucher for us to close file.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Veron Chen (LKKAuto)
Sent: Friday, 1 November 2019 3:53 PM
To: Carrine Leong <carrine.leong@premiumauto.com.sg>; Rasul (LKKAuto) <Rasul@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: nora.khai@premiumauto.com.sg; (boojohnny@gmail.com) <boojohnny@gmail.com>
Subject: RE: FINAL REVISION - SGN8618J - OD AIG - SURVEYED - RASUL 22 AUG 19

Dear Carrine,

Vehicle repair limit at \$55,000 before excess \$750 and GST @ **18 working days instead of 24 days.**

Please check and confirm.

We need to get approval from AIG.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Carrine Leong <carrine.leong@premiumauto.com.sg>
Sent: Tuesday, 29 October 2019 5:00 PM
To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>; Rasul (LKKAuto) <Rasul@lkkauto.com>
Subject: FW: FINAL REVISION - SGN8618J - OD AIG - SURVEYED - RASUL 22 AUG 19

Hi Adrian, Rasul and all,


Revised estimate and photo file is attached.

Please confirm repair cost of \$55,619.68 @ 24 days of repairs exclude weekend.

Your early confirmation is well appreciated.

Thanks & Best Regard
Carrine Leong
Claims Administrator

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9925 f. +65 6841 1183
e. carrine.leong@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223

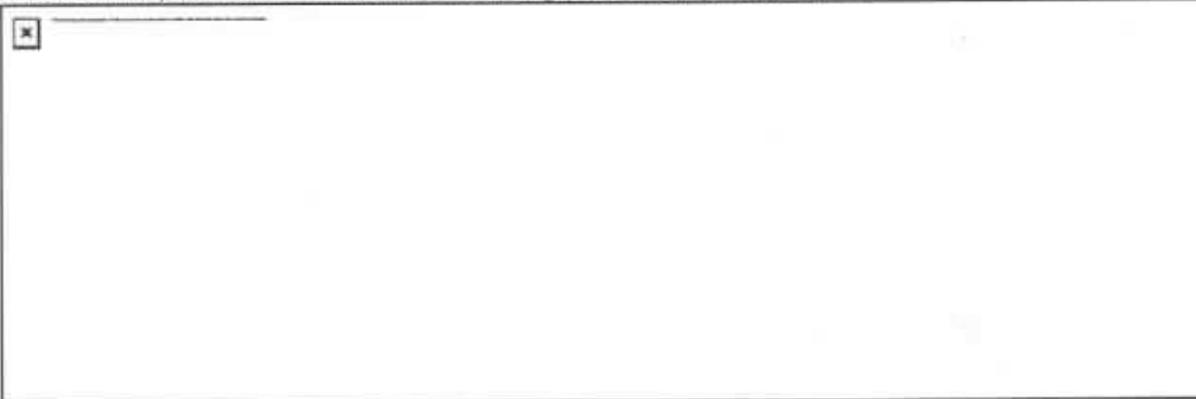

Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Boo seng yak [mailto:boojohnny@gmail.com]
Sent: Friday, 25 October, 2019 1:48 PM
To: Adrian Ling <adrianling@lkkauto.com>; Veron Chen <veronchen@lkkauto.com>; SUR <sur@lkkauto.com>;
Chang Chee Sing <claims@premiumauto.com.sg>; jiayee.yap@premiumauto.com.sg; Carrine Leong
<carrine.leong@premiumauto.com.sg>
Subject: FINAL REVISION - SGN8618J - OD AIG - SURVEYED - RASUL 22 AUG 19

Hi Adrian, Rasul and all,

Revised estimate and photo file is attached.

Please confirm repair cost of \$55,619.68 @ 24 days of repairs exclude weekend.

Your early confirmation is well appreciated.

Best regards - jb

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SGN 8618 J

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/0996/2019/NH

21st JAN 2020

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

RE: INSURANCE CLAIM FOR SGN 8618 J, Audi Q5 SPORT 2.0 TFSI qu.

With reference to the above-mentioned vehicle, no. **SGN 8618 J**, claimant, **Mrs. Teow Kheok Soo Nee Ho Joen Hsien**, please find the related document per attached.

1. A copy of the Original invoice no. 85014763 – S\$ 58,047.50.
2. A copy of the Discharge Voucher duly signed by client.

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept


Encl
AIG – SGN 8618 J

total pages

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183

Premium Automobiles Pte Ltd



Audi Centre Singapore

281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre

281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre

55 Ubi Road 1
Singapore 408699
Main Telephone 6388 2323
Main Telefax 6841 1183

Customer Service

Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 1 16:06

Company Reg.No.199902271W

GST Reg.No.199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85014763 Date : 20/01/2020 Order: SGN8618J Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	--	--

Regn No: SGN8618J (V 40020)

Regn Date: 27/11/2018

Mileage: 17895

WIP No: 64636

Model: Q5 SPORT 2.0 TFSI qu

Chassis: WAUZZZFYSJ2239125

Engine: DAX 046070

DEPT: U

You have been assisted by: -UB-Tony Poong (33)

		Details	Qty	Unit Price	Amount
S	SUBLET	To carry out contractual LIMIT repair basis as agreed	55,000.00	1.00	55,000.00
Q	EXC	Insurance Excess/Liability	-750.00	1.00	-750.00

Parts 0.00
Labour 0.00
Sublet 55,000.00
Menus 0.00
Lubricant 0.00

Sub- Total 54,250.00

7% GST 3,797.50

Grand Total 58,047.50



Received by

For & on behalf of
Premium Automobiles Pte Ltd

Premium Automobiles

Telefax

¹⁰ AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SGN 8618 J

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/0996/2019/EH
27 September 2019

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

total pages

RE: CLAIM – OWNER'S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi Q5 SPORT 2.0 TFSI
Vehicle Chassis No. : WAUZZZFY5J2239125
Vehicle Regn No. : SGN 8618 J
Vehicle Mileage : 17895 KM
Vehicle Owner : Mrs Teow Khok Soo Nee Ho Joen Hsien
Certificate No : 1800137600
Own Damage Excess : S 802.50
Accident Date : 17 Aug 2019
Place : Along PIE Towards Tuas
Repair Cost : S 58047.50
WIP No. : 64636
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature : 
Time : 1030 am
Date : 28/9/19

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	23 Aug 2019 11:38		23 Aug 2019 11:19 Edit Adj Rpt	S\$55,000.00 Edit Estimates	S\$55,000.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured:	TEOW KHEK SOO, ID: S06495411, Tel: +6597376819, Email: NOEMAIL								
Vehicle Reg. No.:	SGN8618J	Date of Loss:	17/08/2019 16:00 - :59 [8 Months and 21 Days From LTA Reg Date (Man Yr)]						
Claim Type:	OD / 6301292763SG	Policy/Cover Note No.:	1800137600 (Comprehensive)						
		Excess:	S\$750.00						
Repairer:	Premium Automobiles Pte Ltd (UB1) 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911								
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Chan, Yoke Shi] yokeshi.chan@aig.com								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MOHD RASUL] ... [Final Rpt due 03/09/2019]								
Driver/Custodian:	TEOW KHEK SOO (72 / Male) , NRIC: S06495411, Tel: +6597376819 Email: NOEMAIL								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
<ul style="list-style-type: none"> AIG_SG (26/11/2019): Alert - Adj Mandate Approved (S\$55000.00) - SGN8618J - Claim Handler: Chan, Yoke... AIG_SG (29/08/2019): Alert - Adj Mandate Approved (S\$55000.00) - SGN8618J - Claim Handler: Chan, Yoke... AIG_SG (29/08/2019): SGN8618J / OD / 17/08/2019 / Coverage & Excess update 									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SGN8618J (6301292763SG)
 OD
 Aug 17 2019 4:00PM
 [TEOW KHEK SOO]
 Premium Automobiles Pte Ltd

Upload Documents		Upload Photos	Compose New Letter	Upload Video	Upload Audio	View <input type="button" value="View in Browser"/>
Video						1 per page <input type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)			Thumbnail	Print
1	20/08/19 17:42	Video - Accident <small>[Linked Accident Report Documents]</small>			Load MP4	<input type="checkbox"/>
Assessment Reports						1 per page <input type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)			Thumbnail	Print
1	23/08/19 14:56	Adjuster Immediate Advice			Load HTM	<input type="checkbox"/>
2	25/10/19 13:42	Adjuster Immediate Advice			Load HTM	<input type="checkbox"/>
Photos/Images						3 per page <input type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)			Thumbnail	Print
1	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
2	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
3	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
4	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
5	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
6	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
7	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
8	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
9	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
10	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
11	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
12	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
13	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
14	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
15	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
16	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
17	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
18	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
19	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
20	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
21	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
22	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
23	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
24	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
25	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
26	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
27	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
28	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
29	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>
30	23/08/19 15:30	General View			Load JPG <input type="checkbox"/>	<input checked="" type="checkbox"/>

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
31	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
32	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
33	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
34	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
35	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
36	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
37	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
38	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
39	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
40	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
41	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
42	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
43	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
44	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
45	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
46	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
47	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
48	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
49	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
50	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
51	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
52	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
53	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
54	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
55	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
56	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
57	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
58	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
59	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
60	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
61	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
62	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
63	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
64	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
65	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
66	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
67	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
68	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
69	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
70	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
71	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
72	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
73	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
74	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
75	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
76	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
77	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
78	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
79	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
80	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
81	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
82	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
83	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
84	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
85	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
86	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
87	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
88	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
89	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
90	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
91	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
92	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
93	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
94	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
95	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
96	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
97	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
98	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
99	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
100	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
101	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
102	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
103	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
104	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
105	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
106	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
107	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
108	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
109	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
110	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
111	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
112	23/08/19 15:30	General View	 Load JPG	<input checked="" type="checkbox"/>
113	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
114	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
115	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
116	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
117	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
118	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
119	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
120	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
121	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
122	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
123	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
124	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
125	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
126	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
127	25/10/19 12:57	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
128	25/10/19 12:57	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
129	25/10/19 12:57	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
130	25/10/19 12:57	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
131	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
132	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
133	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
134	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
135	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
136	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
137	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
138	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
139	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
140	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
141	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
142	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
143	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
144	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
145	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
146	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
147	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
148	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
149	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
150	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
151	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
152	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
153	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
154	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
155	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
156	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
157	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
158	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
159	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
160	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
161	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
162	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
163	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
164	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
165	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
166	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
167	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
168	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
169	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
170	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
171	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
172	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
173	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
174	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
175	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
176	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
177	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
178	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
179	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>
180	25/10/19 12:57	Reinspection Photo		<input checked="" type="checkbox"/>

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
181	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
182	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
183	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
184	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
185	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
186	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
187	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
188	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
189	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
190	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
191	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
192	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
193	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
194	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
195	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
196	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
197	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
198	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
199	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
200	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
201	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
202	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
203	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
204	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
205	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
206	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
207	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
208	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
209	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
210	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
211	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
212	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
213	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
214	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
215	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
216	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
217	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
218	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
219	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
220	25/10/19 12:57	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
221	30/10/19 12:00	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
222	30/10/19 12:00	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
223	30/10/19 12:00	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
224	30/10/19 12:00	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
225	30/10/19 12:00	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
226	30/10/19 12:00	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
227	30/10/19 12:00	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
228	30/10/19 12:00	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
229	30/10/19 12:00	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
230	30/10/19 12:00	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
231	30/10/19 12:00	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
232	30/10/19 12:00	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
233	30/10/19 12:00	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
234	30/10/19 12:00	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
235	30/10/19 12:00	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
236	30/10/19 12:00	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
237	30/10/19 12:00	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
238	30/10/19 12:00	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
239	30/10/19 12:00	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
240	30/10/19 12:00	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
241	30/10/19 12:00	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
242	30/10/19 12:00	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
243	30/10/19 12:00	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
244	30/10/19 12:00	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
245	30/10/19 12:00	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>
246	30/10/19 12:00	Reinspection Photo	Load JPG	<input checked="" type="checkbox"/>

Documentation			1 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	23/08/19 12:12	Singapore Accident Statement	Load PDF	
2	23/08/19 12:12	Police Report	Load PDF	
3	23/08/19 12:12	Insured's Driving License	Load PDF	
4	23/08/19 12:13	INTERVIEW FORM	Load PDF	
5	23/08/19 12:13	MARK ESTIMATE	Load PDF	
6	25/10/19 09:02	ADDENDUM REPORT	Load PDF	
7	25/10/19 13:44	SUPPLEMENTARY	Load PDF	
8	01/11/19 15:33	FINAL MARKING	Load PDF	
9	01/11/19 15:34	SUPPLEMENTARY MARKING	Load PDF	
10	23/01/20 10:37	Workshop Invoice	Load PDF	
11	23/01/20 10:37	Discharge Voucher	Load PDF	

Linked Accident Report Documents

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	20/08/19 17:42	Video - Accident	Load MP4	

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	04/09/19 02:22	Accident Statement	Load HTM	
2	05/09/19 20:23	Addendum Sheet	Load JPG	<input checked="" type="checkbox"/>
3	06/12/19 18:25	Accident Statement	Load HTM	
4	06/12/19 18:26	Accident Statement	Load HTM	
5	06/12/19 18:28	Accident Statement	Load HTM	
6	06/12/19 18:28	Accident Statement	Load HTM	

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	20/08/19 17:23	Accident Photo	Load JPG	<input checked="" type="checkbox"/>
2	20/08/19 17:23	Accident Photo	Load JPG	<input checked="" type="checkbox"/>
3	20/08/19 17:23	Accident Photo	Load JPG	<input checked="" type="checkbox"/>
4	20/08/19 17:23	Accident Photo	Load JPG	<input checked="" type="checkbox"/>
5	20/08/19 17:23	Accident Photo	Load JPG	<input checked="" type="checkbox"/>

Video			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
6	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
7	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
8	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
9	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
10	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
11	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
12	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
13	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
14	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
15	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
16	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
17	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
18	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
19	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
20	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
21	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
22	20/08/19 17:23	Accident Photo		<input checked="" type="checkbox"/>
23	20/08/19 17:27	UNDERTAKING FORM		<input checked="" type="checkbox"/>
24	20/08/19 17:27	INTERVIEW FORM		<input checked="" type="checkbox"/>

Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	20/08/19 17:31	Sketch Plan		<input checked="" type="checkbox"/>
2	20/08/19 17:31	Sketch Plan #2		<input checked="" type="checkbox"/>
3	05/09/19 20:23	police report		<input checked="" type="checkbox"/>
4	05/09/19 20:23	police report		<input checked="" type="checkbox"/>
5	05/09/19 20:23	police report		<input checked="" type="checkbox"/>
6	05/09/19 20:23	police report		<input checked="" type="checkbox"/>

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)			
<div style="border: 1px solid black; padding: 5px;"> <!-- Empty text area for remarks --> </div>			
Show Remarks To: <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small>			

LKK Auto Consultants Pte Ltd (Co. Reg. No: 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #08-16
Singapore 079120

Our File No: CC3/AIG19014826/R1VD3E2

Date: 23/01/2020

REFERENCE

Insured/Claimant:	TEOW KHEK SOO	Policy No:	1800137600
Date of Loss:	17/08/2019	Nature of Claim:	OD
		Claim No:	6301292763SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SGN8618J	Engine No:	DAX046070
Make & Model:	AUDI Q5, 2.0 TFSI Quattro (A)	Chassis No:	WAUZZZF5J2239125
Reg. Date:	27/11/2018 (Man. Year: 2018)	Odometer:	17913 km
Colour:	Grey		
Engine Capacity:	1984 cc		
Market Value/New Car Price:	S\$190,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	235/55 R19	Rear Tyre Size:	235/55 R19
Front Left Side:	Continental 6 mm	Rear Left Side:	Continental 6 mm
Front Right Side:	Continental 6 mm	Rear Right Side:	Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	63,139.20	40,737.68	22,401.52	35.48
Miscellaneous Items	0.00	0.00	0.00	
Labour	25,032.00	14,882.00	10,150.00	40.55
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	88,171.20	55,619.68	32,551.52	36.92
Approved Total (Overridden) (S\$)		55,000.00		
- Excess (S\$)	750.00	750.00	0.00	0.00
(S\$)	87,421.20	54,250.00	33,171.20	37.94
+ GST 7.00/7.00% (S\$)	6,119.48	3,797.50	2,321.98	37.94
Nett Amount (S\$)	93,540.68	58,047.50	35,493.18	37.94

INSPECTION

Date of Assignment:	23/08/2019	
Date Inspected:	22/08/2019 Inspected At:	24 BENOI SECTOR Repairer : Premium Automobiles Pte Ltd (UBI)
Estimated Period of Repair:	18.0 days	

Adjuster: MOHD RASUL

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	2		*FRONT BUMPER - LH / RH	Torn	2,180.00 FS	*1,891.20 FS
2	1		*FRONT BUMPER CONNECTING PIECE - CENTRE	Serviceable	184.00 FS	*- FS
3	1		*FRONT BUMPER FIXING PARTS	Not Necessary	244.00 FS	*- FS
4	2		*FRONT BUMPER SECURING STRIP - LH / RH	Cut	68.00 FS	*52.96 FS
5	2		*FRONT BUMPER CLOSING ELEMENT - LH / RH	Deformed	202.00 FS	*161.60 FS
6	1		*FRONT BUMPER GRILLE - CENTRE	Cracked	129.00 FS	*102.80 FS
7	1		*FRONT BUMPER SPOILER	Cracked	685.00 FS	*548.00 FS
8	1		*FRONT BUMPER GUARD	Cut	431.00 FS	*344.80 FS
9	1		*FRONT BUMPER CLOSING ELEMENT	Deformed	156.00 FS	*124.40 FS
10	1		*RADIATOR GRILLE	Cracked	3,258.00 FS	*2,606.40 FS
11	1		*QUATTRO INSCRIPTION	Necessary	87.00 FS	*69.28 FS
12	1		*RADIATOR GRILLE STRIKER PLATE	Cut	222.00 FS	*177.20 FS
13	2		*FRONT BUMPER AIR GUIDE GRILLE - LH / RH	Missing	1,038.00 FS	*829.60 FS
14	2		*FRONT BUMPER END CAP - LH / RH	Missing	166.00 FS	*131.68 FS
15	4		*FRONT BUMPER LOCKING CLIP	Necessary	15.00 FS	*11.52 FS
16	1		*FRONT BUMPER CARRIER	Bent	831.00 FS	*664.40 FS
17	1		*FOAM FILLER PIECE	Missing	260.00 FS	*207.20 FS
18	1		*FRONT LOWER SIGHT SHIELD	Cut	116.00 FS	*92.40 FS
19	2		*FRONT BUMPER BRACKET - LH / RH	Bent	462.00 FS	*368.80 FS
20	2		*FRONT BUMPER GUIDE SECTION - LH / RH	Cracked	68.00 FS	*54.24 FS
21	1		*CAUTION SIGN	Necessary	13.00 FS	*9.76 FS
22	1		*AIRCON STICKER	Necessary	18.00 FS	*14.00 FS
23	1		*HORN - LH LOW TONE	Cracked	178.00 FS	*142.40 FS
24	1		*HORN - RH - HIGH TONE	Cracked	178.00 FS	*142.40 FS
25	2		*FENDER - LH / RH	Bent	2,602.00 FS	*2,081.60 FS
26	2		*FENDER ATTACHMENT PARTS - FRONT	Serviceable	119.00 FS	*- FS
27	2		*FENDER BRACE - LH / RH	Bent	412.00 FS	*328.80 FS
28	2		*FENDER BRACKET - LH / RH	Necessary	32.00 FS	*24.64 FS
29	2		*CLOSURE PANEL - LH / RH OUTER	Necessary	56.00 FS	*44.48 FS
30	2		*CLOSURE PANEL - LH / RH INNER	Necessary	72.00 FS	*56.80 FS
31	2		*INNER SHIELD - LH / RH OUTER	Serviceable	142.00 FS	*- FS
32	2		*WHEEL HOUSING LINER - LH / RH	Serviceable	492.00 FS	*- FS
33	2		*WHEEL HOUSING LINER ATTACHMENT PARTS FRONT	Serviceable	69.00 FS	*- FS
34	2		*WHEEL HOUSING LINER - LH / RH	Scratched	285.00 FS	*227.60 FS
35	1		*BONNET	Bent	3,707.00 FS	*2,965.60 FS
36	2		*BONNET LID HINGE - LH / RH	Serviceable	292.00 FS	*- FS
37	2		*BONNET ATTACHMENT PARTS	Serviceable	127.00 FS	*- FS
38	2		*GAS FILLED STRUT	Serviceable	217.00 FS	*- FS
39	2		*BONNET STRIKER - LH / RH	Serviceable	218.00 FS	*- FS
40	1		*ENGINE BONNET SOUND ABSORBER	Serviceable	289.00 FS	*- FS
41	1		*IMPACT PROTECTION - LH / RH / CENTRE (3PCS)	Necessary	75.00 FS	*59.44 FS
42	1		*PLENUM CHAMBER COVER	Serviceable	131.00 FS	*- FS
43	1		*WATER BOX SEAL	Serviceable	185.00 FS	*- FS
44	2		*FRONT BUMPER SEAL STRIP - LH / RH	Serviceable	30.00 FS	*- FS
45	2		*FRONT BUMPER CUSHION - LH / RH	Serviceable	30.00 FS	*- FS
46	2		*BONNET LID LOCK - FRONT	Serviceable	391.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
47	2		*MICRO SWITCH	Serviceable	24.00 FS	*- FS
48	2		*CONNECTOR HOUSIN BRACKET	Serviceable	18.00 FS	*- FS
49	1		*BONNET BOWDEN CABLE - CENTRE	Serviceable	53.00 FS	*- FS
50	1		*BONNET RELEASE ELEMENT	Cracked	53.00 FS	*41.68 FS
51	1		*BONNET RELEASE LEVER	Serviceable	13.00 FS	*- FS
52	1		*BONNET LID LOCK CABLE	Serviceable	67.00 FS	*- FS
53	2		*FRONT PARKING AID SENSOR - INNER / OUTER	Distorted	924.00 FS	*739.20 FS
54	4		*PARKING AID SEAL RING	Necessary	12.00 FS	*8.96 FS
55	1		*SET BUMPER WIRING	Cut	378.00 FS	*302.00 FS
56	2		*MAIN BEAM HEADLIGHT MOUNTING - LH / RH	Cracked	214.00 FS	*171.20 FS
57	2		*LED HEADLIGHT - LH / RH	Broken	14,454.00 FS	*11,563.20 FS
58	2		*LIGHT CONTROL SYSTEM CONTROL UNIT	Serviceable	1,383.00 FS	*- FS
59	2		*MAIN LIGHT ELECTRONICS POWER MODULES	Serviceable	1,385.00 FS	*- FS
60	2		*LED WITH HEAT SINK - LH / RH	Serviceable	1,980.00 FS	*- FS
61	2		*HEADLIGHT HOSE - LH / RH	Serviceable	70.00 FS	*- FS
62	2		*HEADLIGHT WASHER LIFT CYLINDER - LH / RH	Cracked	256.00 FS	*204.00 FS
63	1		*LIFT CYLINDER HOSE	Cut	113.00 FS	*90.00 FS
64	1		*HEADLIGHT WASHER PUMP	Serviceable	147.00 FS	*- FS
65	1		*PUMP INSULATOR	Serviceable	19.00 FS	*- FS
66	1		*WASH WATER RESERVOIR HOSE	Serviceable	61.00 FS	*- FS
67	1		*WASH WATER RESERVOIR	Serviceable	200.00 FS	*- FS
68	1		*WINDSCREEN WASHER SYSTEM PUMP	Serviceable	118.00 FS	*- FS
69	1		*RESERVOIR CAP	Serviceable	24.00 FS	*- FS
70	1		*WATER RESERVOIR END CAP	Serviceable	59.00 FS	*- FS
71	1		*COOLANT RADIATOR LOCK CARRIER	Cracked	1,169.00 FS	*935.20 FS
72	2		*RADIATOR SUPPORT - LH / RH	Cracked	96.00 FS	*76.64 FS
73	2		*RADIATOR BRACE - LH / RH LOWER	Cracked	104.00 FS	*81.76 FS
74	1		*EXTERNAL TEMPERATURE SENSOR	Serviceable	54.00 FS	*- FS
75	1		*TEMPERATURE SENSOR BRACKET	Cracked	14.00 FS	*11.20 FS
76	1		*A/C CONDENSER	Bent	547.00 FS	*437.60 FS
77	1		*REFRIGERANT LINE	Serviceable	263.00 FS	*- FS
78	1		*REFRIGERANT LINE	Serviceable	273.00 FS	*- FS
79	1		*A/C ADAPTER CABLE	Serviceable	27.00 FS	*- FS
80	1		*RADIATOR	Bent	820.00 FS	*655.60 FS
81	4		*READY MIX COOLANT	Necessary	84.00 FS	*67.20 FS
82	1		*CHARGE AIR COOLER	Bent	724.00 FS	*578.80 FS
83	2		*CHARGE AIR COOLER SEAL RING	Necessary	82.00 FS	*64.96 FS
84	1		*CHARGE AIR COOLER PRESSURE HOSE	Serviceable	283.00 FS	*- FS
85	1		*CHARGE AIR COOLER PRESSURE PIPE	Serviceable	477.00 FS	*- FS
86	1		*FAN RING	Cracked	373.00 FS	*298.40 FS
87	1		*RADIATOR FAN WITH CONTROL UNIT	Not Working	2,159.00 FS	*1,727.20 FS
88	2		*RADIATOR AIR GUIDE - UPPER / LOWER	Cracked	86.00 FS	*67.68 FS
89	1		*RADIATOR AIR GUIDE - CENTRE	Cracked	37.00 FS	*29.52 FS
90	2		*RADIATOR AIR GUIDE - LH / RH	Cut	100.00 FS	*79.36 FS
91	1		*RADIATOR LOURVE	Cracked	483.00 FS	*386.00 FS
92	1		*ADJUST MOTOR	Serviceable	166.00 FS	*- FS
93	1		*AIR INTAKE DUCT AIR GUIDE	Serviceable	79.00 FS	*- FS
94	1		*AIR INTAKE HOSE	Serviceable	85.00 FS	*- FS
95	1		*AIR INTAKE AIR FILTER	Serviceable	368.00 FS	*- FS
96	2		*WHEEL COVER - LH / RH FRONT	Scratched	1,154.00 FS	*922.40 FS
97	2		*S-LINE INSCRIPTION	Necessary	225.00 FS	*180.00 FS
98	1		*NOISE INSULATION	Necessary	743.00 FS	*594.40 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
99	2		*WINDOW SLOT SEAL - LH / RH FRONT	Cut	1,074.00 FS	*859.20 FS
100	2		*WINDOW GUIDE TRIM STRIP	Serviceable	622.00 FS	*- FS
101	2		*ALUMINIUM RIM - LH & RH	Cut	1,846.00 FS	*1,476.80 FS
102	4		*ALUMINIUM RIM RUBBER VALVE	Not Necessary	13.00 FS	*- FS
103	1		*ACCELERATOR PEDAL	Cracked	216.00 FS	*172.80 FS
104	1		*ACCELERATOR PEDAL CAP	Serviceable	64.00 FS	*- FS
105	1		*ACCELERATOR PEDAL BRACKET	Serviceable	712.00 FS	*- FS
106	1		*BRAKE PEDAL	Serviceable	338.00 FS	*- FS
107	1		*FRONT NO. PLATE	Bent	40.00 FS	*40.00 FS
108	1		*SUNDRIES	Necessary	700.00 FS	*133.52 FS
109	1		*AIR COND COMPRESSOR	Scratched	1,415.20 FS	*1,415.20 FS
110	1		*POLY V-BELT	Serviceable	47.00 FS	*- FS
111	1		*VIBRATION DAMPER	Scratched	316.80 FS	*316.80 FS
112	1		*WIRING SET FOR STARTER AND ALTERNATOR WITH EARTH LEAD	Cut	617.20 FS	*617.20 FS
113	1		*BUTT CONNECTOR, WATERTIGHT GG11-F-2	Cracked	38.40 FS	*38.40 FS
114	1		*BUTT CONNECTOR, WATERTIGHT GG11-F-1	Cracked	38.40 FS	*38.40 FS
115	1		*REAR BUMPER WHEEL ARCH COVER LHS	Necessary	389.60 FS	*389.60 FS
116	1		*REAR BUMPER WHEEL ARCH COVER RHS	Scratched	389.60 FS	*389.60 FS

F=Franchise part. S=SpcNett.

Total Parts (S\$) 63,139.20 40,737.68

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE, CHECK AND REINSTALL FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID	New	480.00	480.00
2	TO REMOVE AND TRANSFER AIRCOND CONDENSER, CHARGED AIR COOLER, RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS	New	1,400.00	1,400.00
3	TO DISMANTLE BOTH FRONT DOOR PANEL TRIMS. TO REMOVE AND REINSTALL BOTH WING MIRROR ASSYS	New	600.00	600.00
4	TO DISMANTLE AND RENEW FRONT BUMPER, BOTH FRONT FENDERS, BONNET AND BOTH HEADLIGHTS. TO REPAIR BOTH FRONT DOORS. RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	8,000.00	4,000.00
5	TO RESPRAY FRONT BUMPER, FRONT BUMPER LOWER SPOILER, BOTH FRONT FENDERS, BONNET HINGES, BOTH FRONT WHEEL ARCH TRIMS AND BOTH FRONT DOORS	New	7,800.00	4,250.00
6	TO RENEW BOTH RIMS AND CARRY OUT WHEEL ALIGNMENT	New	320.00	320.00
7	TO CARRY OUT DIAGNOSTIC CHECKS	New	192.00	192.00
8	TO RENEW AIR CON COMPRESOR, POLY V-BELT AND OTHER ENGINE COMPONENTS	New	480.00	480.00
9	TO REMOVE AND REINSTALL REAR PARKING AID AND REAR LID KICK SENSOR ASSY	New	360.00	360.00
10	TO DISMANTLE REAR BUMPER. REPAIR RHS REAR DOOR. REINSTALL ALL PARTS REMOVED	New	1,600.00	750.00
11	TO RESPRAY RHS A-PILLAR, RHS REAR DOOR, REAR BUMPER, LOWER SPOILER AND BOTH WHEEL ARCH TRIMS	New	3,800.00	2,050.00
Gross Labour Cost (S\$)			25,032.00	14,882.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >