

**Sng Ah Tee Motor Pte Ltd**  
**Blk 3 Pioneer Road North, #01-18,**  
**628457**

**Insurer Reference:**  
**Repairer Reference: SLV9370P TP AXA**  
**Date calculated: 29/08/2019 9:39 AM**

**Full Report**  
**Registration: SLV9370P**  
**Printed: 29/08/2019 10:03 AM**

### Summary Information

#### Claim

Location:	Singapore (SG)	Work Provider:	AXA Insurance Pte Ltd
Printed by:	DARREN SNG	Currency:	SGD
Claim Reference:		Date of Incident:	26/08/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

### Vehicle Details

#### Vehicle

Manufacturer:	VW
Model:	CADDY IV (TYP SA)
Sub Model:	HIGHLINE
Model Sheet Number:	06 CL 06
Registration:	SLV9370P
VIN number:	WV2ZZZ2KZJX054074
Odometer:	

#### Model Specs

FROM 09/2017	S/PAN/SLDG DOOR WDW	S/PAN/SLDG DOOR WDW	INSTR PANEL COMFORT
AUTO LIGHT CONTROL	PARKING AID/CAMERA	CLIMATRONIC	ELECTRIC WINDOWS
VEH W/PASS CAR REGIS	REAR SCREEN	ELEC/HEATED D/MIRROR	WIPER/RAIN SENSOR
RADIO "COMP MEDIA"	6 SPEAKER	PHONE PREPARATION	FOG LAMPS
XENON/CORNERING LAMP	HEADLAMP WASHERS	DIPPING INNER MIRROR	REAR WIPER
LEATHER-/ALCANT CVR	FRT HEIGHT ADJ SEATS	HEATED FRONT SEATS	2 SEAT CUSH 2ND ROW
DRIVER'S SEAT COMF	PASS SEAT COMFORT	TRIM COMFORT	START & STOP SYSTEM
LUGGAGE COMP COVER	ARMREST W/LONGIT ADJ	1.4 LTR 92KW	7-SPEED DSG
BLUE MOTION TECHNO	ALTERNATOR 140A	DEACTIVATED P/AIRBAG	STRG WHEEL LEATHER
CRUISE CONTROL	TYRES 205/55 HR 16	WHEELS 6J X 16	WHEELBASE LONG
HD COOLING	SPARE WHEEL	B-REST FOLDING TABLE	EMISSION STD EURO 6
SIDE AIRBAGS	FRONT BRAKE 312 X 25	ROOF RAILS	L/SLIDING DOOR
R/SLIDING DOOR	SPORTS SUSP 16 INCH	PAINTED BUMPER	TWO COAT METALLIC
PREPARE OFF VEHICLE			

**Sng Ah Tee Motor Pte Ltd**  
**Blk 3 Pioneer Road North, #01-18,**  
**628457**

Insurer Reference:  
 Repairer Reference: SLV9370P TP AXA  
 Date calculated: 29/08/2019 9:39 AM

Full Report  
 Registration: SLV9370P  
 Printed: 29/08/2019 10:03 AM


## Vehicle Condition

### Vehicle Status

Pre-Accident Damage:  
 Date of Inspection:

### Damage Areas

All ☐  
 Underbody ☐

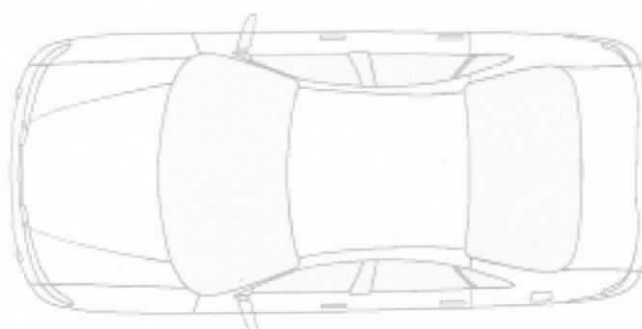

## Labour

Code	Description	Time Base 10 WU/h	Price = 45.00 SGD/h	
			WU	Price SGD
55 59 19 00	R + R TAILGATE INCLUDES: R + R TAILGATE TRIM, DETACHED HARNES. ADJUST TAILGATE.		13.0	58.50
55 59 55 55	REPLACE TAILGATE (WITH UNIT REMOVED) INCLUDES: REMOVE/REFIT ALL COMPONENT PARTS		22.0	99.00
94 31 19 00	R + R LEFT TAIL LAMP		2.0	9.00
55 70 19 00	R + R REAR CLOSURE RUBBER SEAL		3.0	13.50
63 69 19 06	R + R REAR BUMPER COVER		8.0	36.00
63 69 55 65	RENEW REAR BUMPER (REAR BUMPER REMOVED AND DRILLED) INCLUDES: PARKING HELP SYSTEM SENSORS REMOVE AND REFIT.		13.0	58.50
NO NUMBER	RENEW REAR NUMBER PLATE (REMOVED)		1.0	4.50
63 50 19 50	R + R REAR CROSSMEMBER (BUMPER COVER REMOVED)		2.0	9.00
51 01 73 00)	APPLY UNDERSEALANT ON BODY SHELL		2.0	9.00
51 01 73 50	APPLY UNDERSEALANT ON REAR BOOT FLOOR (COMPOSITE WORK)		1.0	4.50
2711	REAR PANEL REPAIR		20.0*	90.00

**Sng Ah Tee Motor Pte Ltd**  
**Blk 3 Pioneer Road North, #01-18,**  
**628457**

**Insurer Reference:**  
**Repairer Reference: SLV9370P TP AXA**  
**Date calculated: 29/08/2019 9:39 AM**

**Full Report**  
**Registration: SLV9370P**  
**Printed: 29/08/2019 10:03 AM**

Code	Description	WU	Price SGD
4255	REAR FLOOR PANEL REPAIR	10.0*	45.00
4255	REAR FLOOR PANEL UNDERBODY SEALANT		
<b>Labour Cost</b>		<b>Hrs</b>	<b>WU</b>
<b>Panel / Mechanical Labour</b>		<b>9.40</b>	<b>94.0</b>
<b>Total of Labour</b>			<b>423.00</b>

**Paint**

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	REAR CROSSMEMBER SURFACE PAINT	4.0
	BOOTLID/TAILGATE NEW PART PAINTING	21.0
	REAR COVER BUMPER NEW PART PAINT K1N	12.0
	L/R OUT PARK AID SEN NEW PART PAINT K1N	3.0
	R/R OUT PARK AID SEN NEW PART PAINT K1N	3.0
	L/R IN PARK SYS SENS NEW PART PAINT K1N	3.0
	R/R IN PARK SYS SENS NEW PART PAINT K1N	3.0
	REAR PANEL REPAIR PAINTING >50%	13.0
	L/SIDE PANEL SURFACE PAINT	11.0
	REAR FLOOR PANEL SURFACE PAINT	12.0

**Paint Material Per Part**

Code	Description	Price SGD
2640	REAR CROSSMEMBER SURFACE PAINT	0.50
2931	BOOTLID/TAILGATE NEW PART PAINTING	67.08
2583	REAR COVER BUMPER NEW PART PAINT K1N	51.70
2781	L/R OUT PARK AID SEN NEW PART PAINT K1N	0.56
2782	R/R OUT PARK AID SEN NEW PART PAINT K1N	0.56
2783	L/R IN PARK SYS SENS NEW PART PAINT K1N	0.56
2784	R/R IN PARK SYS SENS NEW PART PAINT K1N	0.56
2711	REAR PANEL REPAIR PAINTING >50%	8.69
3481	L/SIDE PANEL SURFACE PAINT	34.86
4255	REAR FLOOR PANEL SURFACE PAINT	41.83

Labour Cost - Paint	Hrs	WU	Price SGD
Factor	45.00 SGD/h		
Time Paint		85.0	
Preparation Main Work Metal	2.50	25.0	112.50
Preparation Comp. Work Plastic	0.80	8.0	36.00
<b>Total</b>	<b>10 WU/h</b>	<b>118.0</b>	<b>531.00</b>



**Sng Ah Tee Motor Pte Ltd**  
**Blk 3 Pioneer Road North, #01-18,**  
**628457**

**Insurer Reference:**  
**Repairer Reference: SLV9370P TP AXA**  
**Date calculated: 29/08/2019 9:39 AM**

**Full Report**  
**Registration: SLV9370P**  
**Printed: 29/08/2019 10:03 AM**

**Material Cost - Paint**

New Part Painting  
 New Part Painting - Plastic K1N  
 Repair Painting  
 Surface-/Blend Paint  
 Material-constant Metal Preparation  
 Material-constant Plastic  
**Total**

**Price SGD**  
 67.08  
 53.94  
 8.69  
 77.19  
 28.60  
 12.70  
 248.20

**Spare Parts**

				prices as at 2015-06-01
Code	Description	Part Number	Supplier	Price SGD
2583	REAR COVER BUMPER	2K5 807 417 A	CR ✓	350.00
		GRU		
2591	LWR T-GATE MOULDING	2K5 853 079	cut ✓	160.00
2640	REAR CROSSMEMBER	2K5 807 305 B	?	280.00
2652	REAR BUMPER REP SET	D 007 700	sis ✓	30.00
2702	REAR NUMBER PLATE	KNPL6	*	0.00
2781	L/R OUT PARK AID SEN	5Q0 919 275 B	*	0.00
		GRU		
2782	R/R OUT PARK AID SEN	5Q0 919 275 B		0.00
		GRU		
2783	L/R IN PARK SYS SENS	5Q0 919 275 B		0.00
		GRU		
2784	R/R IN PARK SYS SENS	5Q0 919 275 B		0.00
		GRU		
2795	RR SENSOR BRKT SET	2K5 998 491		0.00
2931	BOOTLID/TAILGATE	2K5 827 025 C	bf ✓	1,150.00
2944	TAILGATE SEAL	2K0 829 193 AA	ne ✓	85.00
2975	TAILGATE LOCK	2K5 827 505 E	? X	45.00
3011	REAR BADGE -VW-	7E0 853 630 D	ne ✓	50.00
		DPJ		
3013	L/R BADGE	2K5 853 687	739 ne ✓	35.00
3019	R/R UPPER BADGE	5G0 853 675 A	ne ✓	38.00
		JZQ		
3160	REAR SCREEN BOND KIT	D 004 660 M2	Adel ✓	0.00
3161	RR-SCREEN ACTIVATOR	D 181 802 M1		0.00
3162	CLEANING SOLUTION	D 009 401 04		0.00
3165	REAR SCREEN PRIMER	D 009 200 02		0.00
3166	APPLICATOR	D 009 500 25		0.00
3167	APPLICATOR	D 009 500 25		0.00
3172	REAR SCREEN PRIMER	D 009 200 02		0.00
3281	L/R LAMP	2K2 945 095 M	X	100.00
3417	L/R REFLECTOR	2K5 945 105 D	X	25.00
4907	TAILGATE TRIM	2K0 867 605 D	CR ✓	45.00
		TZ6		

f: OEM Parts  
 n: Non-OEM Parts  
 u: Used parts

**Sng Ah Tee Motor Pte Ltd**  
**Blk 3 Pioneer Road North, #01-18,**  
**628457**

Insurer Reference:  
 Repairer Reference: SLV9370P TP AXA  
 Date calculated: 29/08/2019 9:39 AM

Full Report  
 Registration: SLV9370P  
 Printed: 29/08/2019 10:03 AM

Savings	0.00
Subtotal	2,393.00
Addition(+15.00%)	358.95
<b>Total</b>	<b>2,751.95</b>

Extras Code	Description	Price SGD
1000	REAR NUMBER PLATE . <i>SLA</i>	35.00*
1001	REAR BUMPER REVERSE SENSOR ?	<i>200</i> <del>250.00</del> *
1002	WINDSCREEN SEALANT	40.00*
1003	TO APPLY ANTI RUST COATING <i>me</i>	<i>50</i> <del>100.00</del> *
	<b>Total Extras</b>	<b>425.00</b>

### Final Calculation

	SGD	SGD
<b>Parts</b>		
Addition(+15.00%)	2,393.00	
<b>Total Parts</b>	358.95	2,751.95
<b>Labour Time Base 10 WU/h</b>		
Total 94.0 WU X 45.00 SGD/h	423.00	423.00
<b>Total of Labour</b>		
<b>Additional Costs</b>		
Underbody Sealer	13.50	
Rate 3.0 WU X 45.00 SGD/h		13.50
<b>Total Of Additional Costs</b>		425.00
<b>Total Of Extras</b>		
<b>Paint Work Time Base 10 WU/h</b>		
Labour Cost 118.0 WU X 45.00 SGD/h	531.00	
Material Cost	248.20	
<b>Total Paint Including Material</b>		779.20
<b>Repair Cost Excludes GST</b>		4,392.65
GST (+7.0%)		307.49
<b>Repair Cost Included GST</b>		4,700.14

**Sng Ah Tee Motor Pte Ltd**  
**Blk 3 Pioneer Road North, #01-18,**  
**628457**

**Insurer Reference:**

**Repairer Reference: SLV9370P TP AXA**

**Date calculated: 29/08/2019 9:39 AM**

**Full Report**

**Registration: SLV9370P**

**Printed: 29/08/2019 10:03 AM**

**Comments**

\* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

**Assessment Note**

---

No assessment notes entered.

Pass  
Ap 90010068  
5 days  
P/P  
04/09/19 @ 1030  
Reming before part