

ASS. REC. BY:

REF: TMI / CC3/TMI19015251/Kvd3n2

Kenneth

ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s Trans Cob

of \_\_\_\_\_

Insured: SIR8077P

Policy No. MK000572

Claims No. M1906567

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Rpt: \_\_\_\_\_ Consistent?: Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent?: Yes or No

Est. Repairs: 02 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Veh No: SHC 5669C Yr Regn: 12, 14

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or \_\_\_\_\_

Make: Renault Latitude cc 1985

Colour: M. White / Red A/C: Insured / Std / NI / NA

Sp. Reading 431491 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: VIFIABL15AUC 281155

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 215/60R16

R: \_\_\_\_\_

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or Skilun

Front

Rear

R/Bal. 9 mm R/Bal. 9 mm

L/Bal. 9 mm L/Bal. 9 mm

D.O.A. 24/8/19 D.O.I. 28/8/19

Survey held at \_\_\_\_\_

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or Rear O/S

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1 / File pass to

29/8/19 6/1 Imp @ 1900h (Red 32863-80, 9470)

SHC 5669C - CC3/AXA 3015393/Khb3s.2 - SIR 8077P

DOA: 18/8/19

29/8/19 Email GIA to TMI

Date/Time, File Pass to?

: Prell. Report

Days Of Repair: 2

1)

: Final Report

Resurvey No. of Trip: -

Date/Time, File Return to?

2) 29/8 - typist

Add Fee:  : Site Insp (\$)

: Interview (\$)

: Tech Invs (\$)

: Weekend (\$)

Survey Fee:

Transportation: 250  
S + RS: 11

Fuel

Others

Report Format: Merimen

Lump Sum / I.B.I: (\$ 1900/2)

TOTAL

261



Auto  
Consultants  
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your ref: PLEASE ADVISED

Our ref: CC3/TMI19015251/Kvd3

Date :29/8/2019

The Motor Claims Department  
M/S TOKIO MARINE INSURANCE SINGAPORE LTD

Dear Sir/Madam,


**PRELIMINARY ADVICE OF VEHICLE NO.SHC 5669C**

Please be informed that we had conducted the inspection of the above mentioned vehicle on 28/8/2019 at the premises of M/ TRANS-CAB AUTO SERVICES PTE TLD and have the following to report:-

Workshop Estimate Amount	: S\$34,763.80
Revised Estimate Amount	: S\$1,900.00 (LUMP SUM)
"Check" Items Amount	: S\$
Market Value	: S\$
LTA Reimbursement Value	: S\$
Nett Value	: S\$

Description of Damage:

The vehicle sustained damages at the rear o/s portion

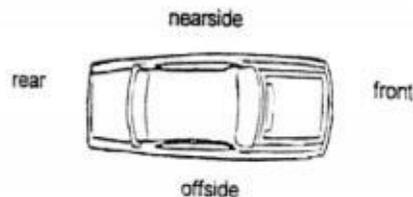

Comments/Present Status:

Damages Consistent

Yours faithfully,

Kenneth Kong

**Licensed Appraiser**

## ...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	26 Aug 2019		29 Aug 2019 15:07 <a href="#">Edit Adj Rpt</a>				<b>Pending for Survey Report</b> <a href="#">Cancel Case</a>

Main	Reference	Claim Details	Documents	Show All					
<b>CLAIM SUBFOLDER DETAILS</b> <span style="float: right;">[Created by insurer]</span>									
Insured:	LCRF PTE LTD, Co. Reg. No.: 201504621K								
Main Claimant:	TRANS-CAB SERVICES PTE LTD, Co. Reg. No.: 200303878K								
Vehicle Reg. No.:	SHC5669C	Date of Loss:	24/08/2019 19:00 - :59						
Claim Type:	TP / M1906567	Policy/Cover Note No.:	MK000572 (Third Party Only) Coverage: 25/06/2019 - 24/02/2020						
Vehicle Reg. No. (Insured):	SLR8077P	Policy No. (Claimant):	VFX/P1680520						
		Excess:	S\$1,600.00						
Repairer:	Trans Cab Auto Services Pte Ltd - Amk (HQ) No 2 Ang Mo Kio St 63, 569111 Ang Mo Kio - Tel:								
Handling Insurer:	Tokio Marine Insurance Singapore Ltd (HQ) - Tel: 6221 6111 ... [Handled by Nurulhaida Binte Mohd Seain]								
Claimant's Insurer:	AXA Insurance Pte Ltd (HQ) - Tel: 6338 7288								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by KENNETH KONG] ... [Final Rpt due 09/09/2019]								
<b>ASSOCIATED MAIL RECEIVED</b>				<a href="#">View All</a>	<a href="#">Compose Case Mail</a>				
There are no mail for this case.									
<b>ALL ASSOCIATED TASKS</b>				<a href="#">View All</a>	<a href="#">Search Tasks</a>	<a href="#">Create New Task</a>	<a href="#">Complete</a>		
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

**Veron Chen (LKKAuto)**

---

**From:** Veron Chen (LKKAuto)  
**Sent:** Thursday, 29 August 2019 1:45 PM  
**To:** motorclaims@tokiomarine.com.sg; SUR  
**Subject:** DIRECT SURVEY INSPECTION ON WORKSHOP -TRANS-CAB AUTO SERVICES PTE LTD, DOA:24/8/2019, SHC 5669C (TP VEHICLE), SLR 8077P (OI VEHICLE)  
**Attachments:** EST.pdf; GIA.pdf; PRELI REVISED.pdf

Dear Sir/Madam,

Please be informed that we had inspected the vehicle SHC 5669C at M/s: TRANS-CAB AUTO SERVICES PTE LTD, NO.2 ANG MO KIO ST 63 SINGAPORE 569111 on 28/8/2019

Enclosed herewith a copy of TP's GIA report and estimated cost of repair.

Kindly create claim in merimen for our necessary action.

Best Regards,

**Veron Chen** | Case Handler

**LKK Auto Consultants Pte Ltd**

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

**Veron Chen (LKKAuto)**

---

**From:** Veron Chen (LKKAuto)  
**Sent:** Thursday, 29 August 2019 2:01 PM  
**To:** Ng Wai Yin; calvin.er@transcab.com.sg  
**Cc:** jasminetan@transcab.com.sg; SUR  
**Subject:** SHC 5669C-DOA: 24/8/2019  
**Attachments:** EST.pdf

Dear Wai Yin/Calvin,

WITHOUT PREJUDICE

Lump Sum \$1900 @ 2 working days.

Best Regards,

**Veron Chen** | Case Handler

**LKK Auto Consultants Pte Ltd**

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)



## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	26/08/2019 14:18
Date Of Accident	24/08/2019 19:25
Exact Location Of Accident	CTE SLIP ROAD TOWARDS BRADDELL ROAD
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHC5669C
<b>Insured/Policyholder</b>	
Name Of Registered Owner	TRANS-CAB SERVICES PTE LTD
Co Reg No	200303878K
Email Address	CLAIMS@TRANSCAB.COM.SG
Mobile Phone No	
Alternative Phone No	OFFICE-62876666

### Vehicle Particulars

Manufacturer	RENAULT
Model	LATITUDE-2.0 D DCI (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

### Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	THIRD PARTY
Fleet Policy	YES
Policy Number	VFX/P1680520
Cover Note Number	

### Driver

Name of Driver	NG PUI HENG
NRIC No	S1444452A
Date Of Birth	19/03/1960
Occupation	OUTDOOR
Date Of Driving Pass	09/05/1980
Driving Experience	39 YEARS AND 3 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-98424163
Fax Number	
Contact Number	
EEmail Address	NOEMAIL

Address	BLK 408B FERNSVALE ROAD #09-14
Postcode	792408
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
Insurance Company of Driver's Own Vehicle	-

#### General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

#### Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	3
Passenger 1	NAME: : UNKNOWN GENDER: : MALE
Passenger 2	NAME: : UNKNOWN GENDER: : FEMALE

#### Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

ON 24/08/2019 AT ABOUT 1925HRS, I WAS STATIONARY AT THE CTE SLIP ROAD TOWARDS BRADDELL ROAD WAITING FOR TRAFFIC CLEARANCE TO ENTER BRADDELL ROAD. WHILE STATIONARY, I FELT AN IMPACT ON THE REAR OF MY TAXI. VEHICLE B(SLR8077P) HAS FAILED TO STOP IN TIME AND COLLIDED ONTO THE REAR RIGHT PORTION OF MY TAXI.

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

#### Details of Witness 1

Name	UNKNOWN MALE
Phone Number	90225328
Email Address	

#### Details of Witness 2

Name	UNKNOWN FEMALE
Phone Number	86917731

Email Address

**DETAILS OF OTHER VEHICLE PROPERTY 1**

Vehicle Registration Number	SLR8077P
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Sketch Plan Pg. 1

SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any wilful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims. (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
  - (ii) for complying with requirements under any regulations, laws or court orders.


\_\_\_\_\_  
Policyholder's Signature  
Date & Time:

  
\_\_\_\_\_  
Driver's Signature  
(If driver is not the policyholder)  
Date & Time:

  
\_\_\_\_\_  
Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:

Sketch Plan #2 Pg. 1

SKETCH PLAN

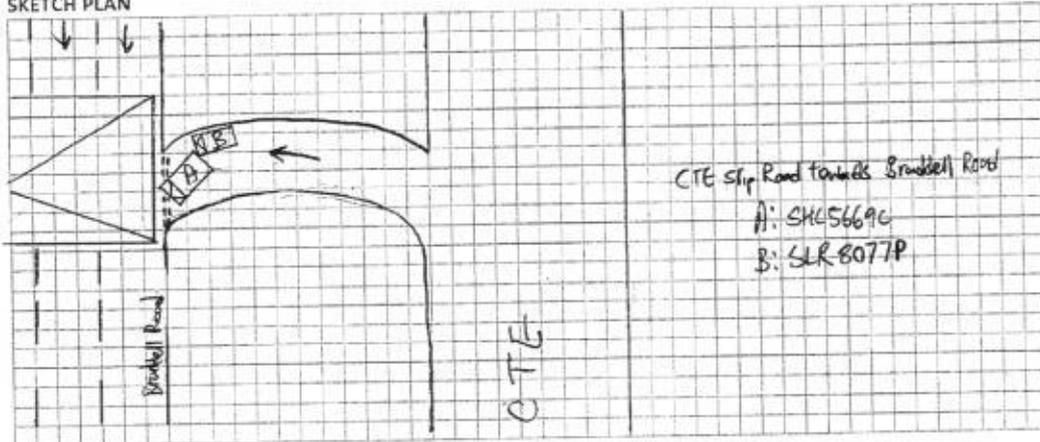

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Refer to CIA Report.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature  
Date & Time:

  
Driver's Signature  
(If driver is not the policyholder)  
Date & Time:

  
Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:

**Trans-cab Auto Services Pte Ltd**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHC 5669C****AAD1908-197***Not Notified*  
*11 Sep 819001*

Vehicle No.:  
 Chassis No.:  
 Vehicle Make:  
 Vehicle Model:  
 Date of Accident :  
 Third Party Insurer :  
 Date of Registration :

**SHC 5669C**

VF1ABL15AUC281155

RENAULT

LATITUDE

24.8.19

**TOKIO MARINE**

24/12/2014

		<b>PART</b>	<b>LIST</b>	
1	1	BUMPER COVER REAR	\$ <i>Per Item</i>	1,108.46 ✓
2	1	BUMPER LOWER REAR	\$ <i>Per Item</i>	768.84 ✓
3	1	BUMPER BRACKET CTR REAR	\$	<i>Per</i> 113.47
4	1	BUMPER BRACKET SIDE RH REAR	\$	<i>Per</i> 135.97
5	1	BUMPER RETAINER RH REAR	\$	<i>Per</i> 44.99
6	1	BUMPER REFLECTOR RH	\$	<i>Per</i> 43.61
7	1	BUMPER BRACKET SIDE LH REAR	\$	<i>Per</i> 135.97
8	1	BUMPER RETAINER LH REAR	\$	<i>Per</i> 44.99
9	1	BUMPER REFLECTOR LH	\$	<i>Per</i> 43.61
10	1	BUMPER BEAM REAR	\$	<i>Per</i> 777.52
11	1	BUMPER BEAM BRACKET LH REAR	\$	<i>Per</i> 225.95
12	1	BUMPER BEAM BRACKET RH REAR	\$	<i>Per</i> 225.95
13	1	OUTER PANEL REAR (End Panel)	\$	<i>Per</i> 1,471.77
14	1	OUTER PANEL REAR (End Panel)TRIM	\$	<i>Per</i> 404.56
15	1	TAILLAMP RH	\$	<i>Per</i> 552.55
16	1	TAILLAMP PANEL RH	\$	<i>Per</i> 986.70
17	1	TAILLAMP LH	\$	<i>Per</i> 552.55
18	1	TAILLAMP PANEL LH	\$	<i>Per</i> 986.70
19	1	BOOT REAR	\$	<i>Per</i> 2,872.68
20	1	BOOT FINISHER	\$	<i>Per</i> 470.06
21	1	BOOT WHEATERSTRIP	\$	<i>Per</i> 323.05
22	1	BOOT REFLECTOR LAMP LH	\$	<i>Per</i> 493.35
23	1	BOOT REFLECTOR LAMP RH	\$	<i>Per</i> 493.35
24	1	BOOT BADGE 'RENAULT'	\$	<i>Per</i> 225.36
25	1	BOOT BADGE	\$	<i>Per</i> 225.36
26	1	BOOT STRUT LH	\$	<i>Per</i> 276.08
27	1	BOOT STRUT RH	\$	<i>Per</i> 276.08
28	1	BOOT HINGE LH	\$	<i>Per</i> 367.84

X

# Trans-cab Auto Services Pte Ltd

AAD1908-197

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5669C

29	1	BOOT HINGE RH	\$	<i>R</i>	367.84	}
30	1	BOOT INNER TRIM	\$	<i>Sn</i>	586.45	
31	1	BOOT SWITCH	\$	<i>Sn</i>	168.13	
32	1	BOOT LOCK	\$	<i>R</i>	202.67	
33	1	BOOT LOCK CATCH	\$	<i>R</i>	74.40	
34	1	EXHAUST REAR	\$	<i>R</i>	7,489.05	
35	1	EXHAUST CAP REAR	\$	<i>R</i>	230.49	}
<b>TOTAL</b>			<b>\$</b>		<b>23,766.42</b>	
			<b>10%</b>	<b>\$</b>	<b>2,376.64</b>	
				<b>\$</b>	<b>21,389.78</b>	

## Special Nett

1	1SET	PARKING AID	\$	<i>Sn</i>	700.00	X
2	1SET	REAR BUMPER CLIP	\$	<i>na</i>	66.00	✓
3	1SET	BUMPER BRACKET CTR CLIP	\$	<i>na</i>	33.00	✓
4	1SET	BUMPER BRACKET SIDE CLIP RH RR	\$	<i>na</i>	10.00	X
5	1SET	BUMPER RETAINER RH CLIP RR	\$	<i>na</i>	20.00	X
6	1SET	BUMPER BRACKET SIDE CLIP LH RR	\$	<i>na</i>	10.00	X
7	1SET	BUMPER RETAINER CLIP LH RR	\$	<i>na</i>	20.00	✓
8	1SET	BUMPER LOWER REAR RIVET	\$	<i>na</i>	22.00	X
9	1SET	BUMPER LOWER REAR CLIP	\$	<i>na</i>	66.00	✓
10	1	BOOT STICKER "Trans-cab"	\$	<i>na</i>	30.00	}
11	1	BOOT STICKER "6555-3333"	\$	<i>na</i>	30.00	
12	1	EXHAUST MOUNTING REAR	\$	<i>na</i>	17.82	
13	2	REAR WINDSCREEN SEALANT	\$	<i>na</i>	80.00	
14	1	WINDSCREEN MOULDING	\$	<i>na</i>	100.00	
15	1	REAR WINDSCREEN INNER SPONGE SEAL	\$	<i>na</i>	100.00	
16	1	BOOT INNER TRIM CLIP	\$	<i>na</i>	45.00	
17	1SET	BOOT FINISHER CLIP	\$	<i>na</i>	24.20	
18	1	TAILLAMP CLIP LH	\$	<i>na</i>	5.00	
19	1	TAILLAMP CLIP RH	\$	<i>na</i>	5.00	
20	1	REAR BUMPER PROTECTOR	\$	<i>na</i>	100.00	405n ✓
<b>TOTAL</b>			<b>\$</b>		<b>1,484.02</b>	
<b>TOTAL PARTS</b>			<b>\$</b>		<b>22,873.80</b>	

## LABOUR

**Trans-cab Auto Services Pte Ltd**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHC 5669C****AAD1908-197**

To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	<i>na</i> 380.00 X
To transfer of bootlid fittings, attachments and perform water seepage test.	\$	<i>na</i> 170.00 X
To Check Electrical Lighting Concerned.	\$	170.00 <i>15/</i>
To Rust-Proofing Of The Affected Areas.	\$	<i>na</i> 170.00 X
To transfer of tire, rim and on wheel balancing.	\$	<i>in</i> 170.00 X
To reinstall rear bumper parking sensor.	\$	170.00 <i>601</i>
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	4,500.00 <i>2001</i>
Putty And Spray Painting Of The Affected Portion.	\$	4,500.00 <i>2201</i>
To repair and realign rear exhaust pipe.	\$	<i>na</i> 170.00 X
To drop rear exhaust box, renew the same, to repair and realign centre exhaust pipe.	\$	<i>↳</i> 170.00 X
To transfer of rear end panel fittings, attachment and perform water seepage test.	\$	<i>↳</i> 170.00 X
To transfer of rear windscreen fittings and conduct water seepage test.	\$	<i>↳</i> 170.00 X
To check steering geometry and computer wheel alignment	\$	<i>↳</i> 220.00 X
To transfer of rear bumper fittings, attachment and perform water seepage test.	\$	<i>↳</i> 380.00 X

**Trans-cab Auto Services Pte Ltd**

**AAD1908-197**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHC 5669C**

Labour charge to mount and dismount vehicle on jig  
bench, to facilitate repair.

	\$	<i>PN 380.00</i> X
<b>TOTAL</b>	<b>\$</b>	<b>11,890.00</b>

<b>Over All Total</b>	<b>\$</b>	<b>34,763.80</b>
-----------------------	-----------	------------------

**LUMP SUM ( REPAIR DAY)**

~~15 DAYS~~

*2 days*

LKK Auto Consultants hence notify  
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification is allowed
- Supplementary items must be resurveyed and  
is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:

## LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC3/TMI19015251/KVD3N2

Date: 03/09/2019

## REFERENCE

Handling Insurer:	Tokio Marine Insurance Singapore Ltd	Policy No:	MK000572
Claimant Vehicle No :	SHC5669C	Insured Vehicle No :	SLR8077P
Date of Loss:	24/08/2019	Nature of Claim:	TP
		Claim No:	M1906567

## DESCRIPTION &amp; IDENTIFICATION OF VEHICLE

Reg No:	SHC5669C	Engine No:	M9R8839C002410
Make & Model:	RENAULT LATITUDE, 2.0 D dCi (A)	Chassis No:	VF1ABL15AUC281155
Reg. Date:	24/12/2014 (Man. Year: 2014)	Odometer:	431491 km
Colour:	Metallic White/Red		
Engine Capacity:	1995 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

## CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

## CONDITION OF TYRES

Front Tyre Size:	215/60R16	Rear Tyre Size:	215/60R16
Front Left Side:	Sailun 9 mm	Rear Left Side:	Sailun 9 mm
Front Right Side:	Sailun 9 mm	Rear Right Side:	Sailun 9 mm

The above values represent the remaining tyre treads depth

## COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	22,873.78	1,894.57	20,979.21	91.72
Miscellaneous Items	0.00	0.00	0.00	
Labour	11,890.00	495.00	11,395.00	95.84
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (S\$)</b>	<b>34,763.78</b>	<b>2,389.57</b>	<b>32,374.21</b>	<b>93.13</b>
<b>Approved Total (Overridden) (S\$)</b>		<b>1,900.00</b>		
<b>(S\$)</b>	<b>34,763.78</b>	<b>1,900.00</b>	<b>32,863.78</b>	<b>94.53</b>
<b>+ GST 7.00/7.00% (S\$)</b>	<b>2,433.46</b>	<b>133.00</b>	<b>2,300.46</b>	<b>94.53</b>
<b>Nett Amount (S\$)</b>	<b>37,197.24</b>	<b>2,033.00</b>	<b>35,164.24</b>	<b>94.53</b>

## INSPECTION

Date of Assignment:	29/08/2019	
Date Inspected:	28/08/2019	Inspected At: Trans Cab Auto Services Pte Ltd - Amk (HQ) No 2 Ang Mo Kio St 63 Singapore 569111
Estimated Period of Repair:	2.0 days	

Adjuster: KENNETH KONG

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our

*knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

<b>Reference</b>	
<b>Part Source:</b> MRM-SG	Version: 1.0 (Last Synchronised: 03 Sep 2019)
<b>Parts:</b> 143	RENAULT LATITUDE 2.0 D dCi (A) (Catalogue:Merimen Singapore 1.0)
<b>Labour:</b> Repairer's	(Price-denominated Standard List)
<b>Print Code:</b>	(Unsubmitted, no print-code for SHC5669C)
<b>Validity:</b>	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
<b>Further Info:</b> Items/values not in reference catalogue are prefixed with an asterisk *.	

## Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BUMPER COVER REAR	Dented/Cracked	1,108.46 FL	*1,108.46 FL
2	1		*BUMPER LOWER REAR	Dented/Cracked	768.84 FL	*768.84 FL
3	1		*BUMPER BRACKET CTR REAR	Serviceable	113.47 FL	*-FL
4	1		*BUMPER BRACKET SIDE RH REAR	Serviceable	135.97 FL	*-FL
5	1		*BUMPER RETAINER RH REAR	Serviceable	44.99 FL	*-FL
6	1		*BUMPER REFLECTOR RH	Serviceable	43.61 FL	*-FL
7	1		*BUMPER BRACKET SIDE LH REAR	Serviceable	135.97 FL	*-FL
8	1		*BUMPER RETAINER LH REAR	Serviceable	44.99 FL	*-FL
9	1		*BUMPER REFLECTOR LH	Serviceable	43.61 FL	*-FL
10	1		*BUMPER BEAM REAR	Repair	777.52 FL	*-FL
11	1		*BUMPER BEAM BRACKET LH REAR	Repair	225.95 FL	*-FL
12	1		*BUMPER BEAM BRACKET RH REAR	Repair	225.95 FL	*-FL
13	1		*OUTER PANEL REAR (END PANEL)	Repair	1,471.77 FL	*-FL
14	1		*OUTER PANEL REAR (END PANEL) TRIM	Serviceable	404.56 FL	*-FL
15	1		*TAILLAMP RH	Serviceable	552.55 FL	*-FL
16	1		*TAILLAMP PANEL RH	Repair	986.70 FL	*-FL
17	1		*TAILLAMP LH	Serviceable	552.55 FL	*-FL
18	1		*TAILLAMP PANEL LH	Repair	986.70 FL	*-FL
19	1		*BOOT REAR	Repair	2,872.68 FL	*-FL
20	1		*BOOT FINISHER	Serviceable	470.06 FL	*-FL
21	1		*BOOT WEATHERSTRIP	Serviceable	323.05 FL	*-FL
22	1		*BOOT REFLECTOR LAMP LH	Serviceable	493.35 FL	*-FL
23	1		*BOOT REFLECTOR LAMP RH	Serviceable	493.35 FL	*-FL
24	1		*BOOT BADGE RENAULT	Not Necessary	225.36 FL	*-FL
25	1		*BOOT BADGE	Not Necessary	225.36 FL	*-FL
26	1		*BOOT STRUT LH	Serviceable	276.08 FL	*-FL
27	1		*BOOT STRUT RH	Serviceable	276.08 FL	*-FL
28	1		*BOOT HINGE LH	Repair	367.84 FL	*-FL
29	1		*BOOT HINGE RH	Repair	367.84 FL	*-FL
30	1		*BOOT INNER TRIM	Serviceable	586.45 FL	*-FL
31	1		*BOOT SWITCH	Serviceable	168.13 FL	*-FL
32	1		*BOOT LOCK	Repair	202.67 FL	*-FL
33	1		*BOOT LOCK CATCH	Repair	74.40 FL	*-FL
34	1		*EXHAUST REAR	Repair	7,489.05 FL	*-FL
35	1		*EXHAUST CAP REAR	Repair	230.49 FL	*-FL
36	1		*SET PARKING AID	Serviceable	700.00 FS	*-FS
37	1		*SET REAR BUMPER CLIP	Necessary	66.00 FS	*66.00 FS
38	1		*SET BUMPER BRACKET CTR CLIP	Necessary	33.00 FS	*33.00 FS
39	1		*SET BUMPER BRACKET SIDE CLIP RH RR	Not Necessary	10.00 FS	*-FS
40	1		*SET BUMPER RETAINER RH CLIP RR	Not Necessary	20.00 FS	*-FS
41	1		*SET BUMPER BRACKET SIDE CLIP LH RR	Not Necessary	10.00 FS	*-FS
42	1		*SET BUMPER RETAINER CLIP LH RR	Not Necessary	20.00 FS	*-FS
43	1		*SET BUMPER LOWER REAR RIVET	Not Necessary	22.00 FS	*-FS
44	1		*SET BUMPER LOWER REAR CLIP	Necessary	66.00 FS	*66.00 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
45	1		*BOOT STICKER TRANS-CAB	Not Necessary	30.00 FS	*- FS
46	1		*BOOT STICKER 6555-3333	Not Necessary	30.00 FS	*- FS
47	1		*EXHAUST MOUNTING REAR	Not Necessary	17.82 FS	*- FS
48	2		*REAR WINDSCREEN SEALANT	Not Necessary	80.00 FS	*- FS
49	1		*WINDSCREEN MOULDING	Not Necessary	100.00 FS	*- FS
50	1		*REAR WINDSCREEN INNER SPONGE SEAL	Not Necessary	100.00 FS	*- FS
51	1		*BOOT INNER TRIM CLIP	Not Necessary	45.00 FS	*- FS
52	1		*SET BOOT FINISHER CLIP	Not Necessary	24.20 FS	*- FS
53	1		*TAILLAMP CLIP LH	Not Necessary	5.00 FS	*- FS
54	1		*TAILLAMP CLIP RH	Not Necessary	5.00 FS	*- FS
55	1		*REAR BUMPER PROTECTOR	Necessary	100.00 FS	*40.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

<b>Sub Total (\$\$)</b>	<b>25,250.42</b>	<b>2,082.30</b>
- List Item Discount on L Items 10.00/10.00% (\$\$)	2,376.64	187.73
<b>Total Parts (\$\$)</b>	<b>22,873.78</b>	<b>1,894.57</b>

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER,TO ENABLE REPAIR	New	380.00	0.00
2	TO TRANSFER OF BOOTLID FITTINGS,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST	New	170.00	0.00
3	TO CHECK ELECTRICAL LIGHTING CONCERNED	New	170.00	15.00
4	TO RUST-PROOFING OF THE AFFECTED AREAS	New	170.00	0.00
5	TO TRANSFER OF TIRE,RIM AND ON WHEEL BALANCING	New	170.00	0.00
6	TO REINSTALL REAR BUMPER PARKING SENSOR	New	170.00	60.00
7	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME	New	4,500.00	200.00
8	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION	New	4,500.00	220.00
9	TO REPAIR AND REALIGN REAR EXHAUST PIPE	New	170.00	0.00
10	TO DROP REAR EXHAUST BOX,RENEW THE SAME,TO REPAIR AND REALIGN CENTRE EXHAUST PIPE	New	170.00	0.00
11	TO TRANSFER OF REAR END PANEL FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST	New	170.00	0.00
12	TO TRANSFER OF REAR WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST	New	170.00	0.00
13	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT	New	220.00	0.00
14	TO TRANSFER OF REAR BUMPER FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST	New	380.00	0.00
15	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH,TO FACILITATE REPAIR	New	380.00	0.00
<b>Gross Labour Cost (\$\$)</b>			<b>11,890.00</b>	<b>495.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >