

Inspector: *T. Taylor*

REF: *A19 CC3/A1919015461/THF352*

ASSIGNMENT

From: *2.9.2019*

Veh No: *SMC 4890B* Yr Regn: *2018 July*

Estimated Cost:

Type: *Car* / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

Truck / Trailer or

To inspect Vehicle No: *SMC 4890B*

Make: *Ind A4* C.C. *1984*

at Workshop m/s *Premium*
of *281 Alexandra Road*

Colour: *Black* A/C: *Insured / Std / NI / NA*

Sp. Reading: *17422* T/Radio: *Insured / Std / NI / NA*

Insured:

Eng/No: *WAM 227 F44 JA 185075*

Policy No.

C/No:

Claims No.

Gen. Cond: *Good* / Fair / Poor / Burnt

Sum Insured: *\$1600* Excess:

Steering: *Inorder* / Jammed / Leaked / Burnt or

(Client's Record)

Brake: *Inorder* / Jammed / Leaked / Burnt or

Make of Veh: *10 a.m Owner waiting*

Modi: *Nil* / S/Rim / STD A/Rim or

(Policy Condition)

Tyre Size: F: *205/6-R16*

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or *Continental*

Bal. or Market Value: *\$135K*

Front Rear

IDAC Accident Rpt: Consistent? : Yes or No

R/Bal. *6* mm

GIA / PR Seen: Consistent? : Yes or No

L/Bal. *6* mm

Est. Repairs: *6* days Res.: Yes or No

D.O.A. D.O.I. *2/4/19 @ 11am*

Lum Sum: % 3 Val.: Yes or No

Survey held at *1 Premium Alexandra*

CA / *REV* REP. / 24 HRS

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Date: Person Contacted: Vehicle: IN / OUT

Frt N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

SMC 4890B - X
2/9@ 16:00 mandate request via menimen
3/9@ 10:35 mandate approval by victor kon
3/9@ 10:53am inform workshop authorise repair excess \$1600

\$12,456.64 (Red: 13,179.36; 51%) RECEIVED 19 DEC 2019
Part by part

Date/Time, File Pass to? ☐ : Preli. Report

Days Of Repair: *6*

19/12 Typist ☒ : Final Report

Resurvey No. of Trip:

Date/Time, File Return to?

Add Fee: ☐ Site Insp (\$)

Survey Fee:

2)

☐ Interview (\$)

Transportation:

Report Format: *OD*

☐ Tech. Invs (\$)

9 + RS, SI

Lump Sum / I.B.I: (\$) *12,456.64*

☐ Weekend (\$)

Photos

Others

TOTAL

Note: This document has not been finalised.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn:

Date: 02 Sep 2019

Preliminary Advice

Vehicle No	: SMC4890B	Accident Date	: 27/08/2019
Make	: AUDI A4	Policy No.	: 1800067813-01
Assignment Date	: 02/09/2019	Excess	: S\$0.00
Date of Inspection	: 02/09/2019	Est. Duration of Repair	: 6.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (UBI) 55 UBI ROAD 1 SINGAPORE 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages for n/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	25,636.00
Revised Amount	:S\$	14,500.00
Check Items (Estimated)	:S\$	3,182.00
Total	:S\$	17,682.00
Lump Sum Repair	:S\$	

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	135,000.00
COE / PARF Rebate	:S\$	60,879.00
Salvage Value	:S\$	
Margin for Repair	:S\$	74,121.00

Remarks

- (x) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

View Received Message

This mail is associated with :

***SMC4890B (3710196571SG)**

OD

Aug 27 2019 10:30AM

[CHEN QIONG]

Premium Automobiles Pte Ltd

[Reply](#)[Reply All](#)[Mark as Unread](#)[Print Message](#)[Delete Message](#)[Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 03/09/2019 10:35 AM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$14500.00) - SMC4890B - Claim Handler: Gan, Hunchung

Approved:14500.00:Re-inspection to be done for damage check and supplementary items / labour.

DOCUMENTS SUMMARY

There are no documents.

Denise Tay (LKKAuto)

From: Denise Tay (LKKAuto)
Sent: Tuesday, 3 September 2019 10:53 AM
To: Claims Dept; SUR; assignments
Subject: RE: OD CLAIMS FOR SMC 4890 B

Dear Sir,

As instructed by our client, please proceed to repair the insured vehicle **SMC 4890B (Excess \$1,600/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right not to pay if there is no valid approval obtained before repair.

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims Dept <claims@premiumauto.com.sg>
Sent: Monday, 2 September 2019 6:41 PM
To: 'Claims' <claims@premiumauto.com.sg>; SUR <sur@lkkauto.com>; assignments <assignments@lkkauto.com>
Subject: RE: OD CLAIMS FOR SMC 4890 B

Dear all,

Kindly assist follow up repair approval.

Thank you.

Best Regards,
Tony Foong
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)

55 Ubi Road 1 Singapore 408699

p. +65 6366 2323, d. +65 67689911

e.<mailto:claims@premiumauto.com.sg> w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT	
Date Of Report	28/08/2019 16:11
Date Of Accident	27/08/2019 10:30
Exact Location Of Accident	CITY GATE
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE	
Vehicle Registration Number	SMC4890B
Insured/Policyholder	
Name Of Registered Owner	CHEN QIONG
NRIC No	S6869169I
Email Address	8W95066107@GMAIL.COM
Mobile Phone No	(LOCAL) +65-98578841
Alternative Phone No	OFFICE-98578841
Vehicle Particulars	
Manufacturer	AUDI
Model	A4 SEDAN 2.0 TFSI
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR
Insurance Company	
Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	1800067813-01
Cover Note Number	
Driver	
Name of Driver	ZHANG WEIQIANG
NRIC No	S9176131I
Date Of Birth	24/12/1991
Occupation	INDOOR
Date Of Driving Pass	28/02/2013
Driving Experience	6 YEARS AND 5 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-98578841
Fax Number	
Contact Number	
Email Address	ZWQ5066107@GMAIL.COM

Address	2 WHAMPOA RASE #20-06
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	FRIEND
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

ON 27/8/2019@1030, THE LORRY STOPPED IN FRONT OF ME. I ACCIDENTALLY DAMAGED THE LORRY REAR BUMPER WHEN I WAS OVERTAKING THE LORRY.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated; or
 - (ii) for complying with requirements under any regulations, laws or court orders.


Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name: Wendy Khor Seng Heng
NRIC/FIN No.:

Sketch Plan #2

SKETCH PLAN

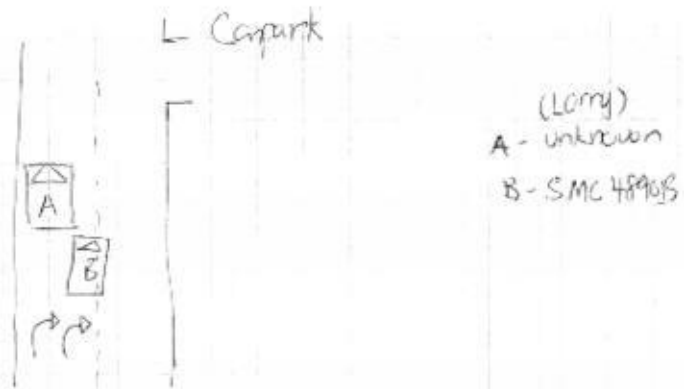

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

ON 27/08/19 @ 1030, ~~the~~ the lorry stopped in front of me ~~and was overtaking~~ ~~and~~ I accidentally ~~accidentally~~ damaged the lorry rear bumper when I was overtaking the lorry.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name: Wanda Luthin Dean, Group
NRIC/FIN No: C29871458

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	169I
Vehicle Details	
Vehicle No.:	SMC4890B
Vehicle to be Exported:	No
Intended Deregistration Date:	02 Sep 2019
Vehicle Make:	AUDI
Vehicle Model:	A4 SEDAN 2.0 TFSI S TRONIC (NAV)
Primary Colour:	Black
Manufacturing Year:	2018
Engine No.:	CVK063662
Chassis No.:	WAUZZZF44JA185075
Maximum Power Output:	140.0 kW (187 bhp)
Open Market Value:	\$33,419.00
Original Registration Date:	02 Jul 2018
First Registration Date:	02 Jul 2018
Transfer Count:	0
Actual ARF Paid:	\$38,787.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	01 Jul 2028
PARF Rebate Amount:	\$29,090.00
Intended COE Rebate Details	
COE Expiry Date:	01 Jul 2028
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$36,000.00
COE Rebate Amount:	\$31,789.00
Total Rebate Amount:	\$60,879.00

The information contained herein is correct as at 02 Sep 2019

OK

Accident Photo



Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

WIP :10341

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/1034/2019/NS
Date : 29-Aug-19

Vehicle NOT IN workshop. Please arrange for survey

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Chen Qiong
Address : 2 Ridgewood Close
#16-02
Singapore 276693
Telephone : HP +65 98578841
Type of Claim : Own Damage Claim
Policy No. : 1800067813-01
Vehicle No : **SMC 4890 B**
Model Code : Audi A4 Sedan 2.0 TFSI 8W
Model / Year : Jul-18
Engine No : CVK 063662
Chassis No : WAUZZZF44JA185075
Mileage :
Date In :
Estimated By : Johnny Boo / Allan Wu
Accident Date : 27-Aug-19
Place of Accident : City Gate

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SMC 4890 B

S/N	Nature of Jobs	Estimated Charges	Surveyor's Recommendation
1	To remove, check and reinstall front wire harness for headlights, horns, outside temperature sensor, headlight washer assy and front parking aid.	S/N \$ 480.00 ✓	✓
2	To dismantle and renew front bumper, bonnet, lhs front fender and lhs headlight. To inspect lhs front fender top support and front lock carrier for further damages. Re-organise crash management components. Reinstall all parts removed.	\$ 3,150.00 1750 ✓	✓
3	To respray front bumper, bonnet and lhs front fender.	\$ 3,000.00 1650 ✓	✓
4	To carry out diagnostic checks.	S/N \$ 192.00 ✓	✓
TOTAL LABOUR CHARGES		: \$ 6,822.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 4890 B

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	FRONT BUMPER	\$ 1,999.00	Rx
2	FRONT BUMPER FIXING PARTS	\$ 258.00	x
3	RADIATOR AIR GUIDE - LH	\$ 56.00	X
4	FRONT BUMPER AIR GUIDE GRILLE - LH	\$ 123.00	x
5	FRONT BUMPER FOAM FILLER PIECE	\$ 113.00	x
6	FRONT BUMPER CARRIER	\$ 733.00	x
7	FRONT BUMPER GUIDE SECTION - LH	\$ 33.00	x
8	FRONT BUMPER FOAM FILLER PIECE - LH	\$ 16.00	x
9	FRONT PARKING AID SENSOR - INNER / OUTER	\$ 231.00	X
10	FRONT PARKING AID SENSOR SEAL RING	\$ 12.00	rect 559.00 ✓
11	FENDER - LH	\$ 700.00	bt - nn x
12	FENDER ATTACHMENT PARTS	\$ 183.00	?
13	FENDER CLOSING ELEMENT - LH	\$ 45.00	?
14	FENDER BRACKET - LH	\$ 32.00	?
15	FENDER DEFORMATION ELEMENT BRACKET - LH	\$ 45.00	?
16	FENDER BRACKET - LH	\$ 29.00	?
17	FENDER BRACE - LH FRONT	\$ 107.00	?
18	WHEEL HOUSING LINER - LH	\$ 223.00	x
19	WHEEL HOUSING LINER ATTACHMENT PARTS - FRONT / REAR	\$ 82.00	x
20	WHEEL SPOILER	\$ 66.00	x
	SUB TOTAL SPARE PARTS	\$ 5,086.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 4890 B

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
21	WHEEL SPOILER END PLATE - LH	\$ 32.00	X nn
22	STONE CHIP GUARD - LH	\$ 46.00	X nn
23	BONNET	\$ 2,554.00	ht - 2043.20
24	BONNET ATTACHMENT PARTS	\$ 111.00	? nn
25	LID HINGE - LH / RH	2 \$ 554.00	X nn
26	BONNET IMPACT PROTECTION - CENTRE	NEC \$ 25.00	new 19.92
27	BONNET IMPACT PROTECTION - LH / RH	2 \$ 50.00	new 39.52
28	FENDER LEDGE COVER - LH INNER	\$ 56.00	? X
29	FENDER TOP LEDGE COVER - LH UPPER	\$ 28.00	? X
30	FENDER TOP LEDGE COVER - LH LOWER	\$ 21.00	? X
31	BONNET STRIKER - LH / RH	2 \$ 92.00	X
32	BONNET GAS FILLED STRUT	\$ 109.00	X
33	BONNET LID LOCK	2 \$ 391.00	X
34	CONNECTOR HOUSING BRACKET	2 \$ 18.00	X
35	BONNET BOWDEN CABLE - CENTRE	\$ 53.00	X
36	BOWDEN RELEASE CABLE	\$ 53.00	X
37	BONNET RELEASE LEVER	\$ 12.00	X
38	PLENUM CHAMBER COVER	\$ 89.00	X
39	ENGINE BONNET SOUND ABSORBER	\$ 311.00	? X
40	LED HEADLIGHT - LH	\$ 7,087.00	new 5669.60
SUB TOTAL SPARE PARTS		\$ 11,692.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 4890 B

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
41	MAIN LIGHT ELECTRONIC POWER MODULE	\$ 716.00	?
42	LIGHT CONTROL SYSTEM CONTROL UNIT	\$ 685.00	?
43	HEADLIGHT HOSE - LH	\$ 32.00	X
44	HEADLIGHT ASSEMBLY SPACER	3 \$ 111.00	?
46	HEADLIGHT WASHER LIFT CYLINDER - LH	\$ 192.00	?
47	SUNDRIES	\$ 300.00	?
TOTAL SPARE PARTS		\$ 18,814.00	
TOTAL LABOUR CHARGES		\$ 6,822.00	
GRAND TOTAL		\$ 25,636.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

26183-604

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax


3/9/11

Name : Tan Jiah 97445749
Surveyed Date : 2/11/10 11am
Authorised Date :
Excess Cost : Not Authorise
Liability : Ex: to be advise.
Remarks : Resurvey before paint.
sure@khanto.com -
6 days

Please Note

- : This estimate is based on visual inspection of the affected vehicle.
- Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
- For inspection of vehicle, please refer to Ms Norah Khai at Tel: 6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

WIP :10341

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/1034/2019/NS
Date : 29-Aug-19

Vehicle NOT IN workshop. Please arrange for survey

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120

Hi Taufik,
6 days exclude 1 Sunday -
ok - Jy - 29 Oct 2019

Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Chen Qiong
Address : 2 Ridgewood Close
#16-02
Singapore 276693
Telephone : HP + 65 98578841
Type of Claim : Own Damage Claim
Policy No. : 1800067813-01
Vehicle No : **SMC 4890 B**
Model Code : Audi A4 Sedan 2.0 TFSI 8W
Model / Year : Jul-18
Engine No : CVK 063662
Chassis No : WAUZZZF44JA185075
Mileage :
Date In :
Estimated By : Johnny Boo / Allan Wu
Accident Date : 27-Aug-19
Place of Accident : City Gate

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SMC 4890 B

S/N	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To remove, check and reinstall front wire harness for headlights, horns, outside temperature sensor, headlight washer assy and front parking aid	S/N \$	480.00	\$ 480.00
2	To dismantle and renew front bumper, bonnet, lhs front fender and lhs headlight. To inspect lhs front fender top support and front lock carrier for further damages. Re-organise crash management components. Reinstall all	\$	3,150.00	\$ 1,750.00
3	To respray front bumper, bonnet and lhs front fender.	\$	3,000.00	\$ 1,650.00
4	To carry out diagnostic checks.	S/N \$	192.00	\$ 192.00
TOTAL LABOUR CHARGES		:	\$ 6,822.00	\$ 4,072.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 4890 B

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	FRONT BUMPER	\$ 1,999.00	
2	FRONT BUMPER FIXING PARTS	\$ 258.00	
3	RADIATOR AIR GUIDE - LH	\$ 56.00	
4	FRONT BUMPER AIR GUIDE GRILLE - LH	\$ 123.00	
5	FRONT BUMPER FOAM FILLER PIECE	\$ 113.00	
6	FRONT BUMPER CARRIER	\$ 733.00	
7	FRONT BUMPER GUIDE SECTION - LH	\$ 33.00	
8	FRONT BUMPER FOAM FILLER PIECE - LH	\$ 16.00	
9	FRONT PARKING AID SENSOR - INNER / OUTER	\$ 231.00	
10	FRONT PARKING AID SENSOR SEAL RING	4 \$ 12.00	
11	FENDER - LH	\$ 700.00	\$ 559.60
12	FENDER ATTACHMENT PARTS	\$ 183.00	
13	FENDER CLOSING ELEMENT - LH	\$ 45.00	
14	FENDER BRACKET - LH	\$ 32.00	
15	FENDER DEFORMATION ELEMENT BRACKET - LH	\$ 45.00	
16	FENDER BRACKET - LH	\$ 29.00	
17	FENDER BRACE - LH FRONT	\$ 107.00	
18	WHEEL HOUSING LINER - LH	\$ 223.00	
19	WHEEL HOUSING LINER ATTACHMENT PARTS - FRONT / REAR	\$ 82.00	
20	WHEEL SPOILER	\$ 66.00	
	SUB TOTAL SPARE PARTS	\$ 5,086.00	

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 4890 B

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
			\$ 559.60
21	WHEEL SPOILER END PLATE - LH	\$ 32.00	
22	STONE CHIP GUARD - LH	\$ 46.00	
23	BONNET	\$ 2,554.00	\$ 2,043.20
24	BONNET ATTACHMENT PARTS	\$ 111.00	
25	LID HINGE - LH / RH	2 \$ 554.00	
26	BONNET IMPACT PROTECTION - CENTRE	NEC \$ 25.00	\$ 19.92
27	BONNET IMPACT PROTECTION - LH / RH	2 \$ 50.00	\$ 39.52
28	FENDER LEDGE COVER - LH INNER	\$ 56.00	
29	FENDER TOP LEDGE COVER - LH UPPER	\$ 28.00	
30	FENDER TOP LEDGE COVER - LH LOWER	\$ 21.00	
31	BONNET STRIKER - LH / RH	2 \$ 92.00	
32	BONNET GAS FILLED STRUT	\$ 109.00	
33	BONNET LID LOCK	2 \$ 391.00	
34	CONNECTOR HOUSING BRACKET	2 \$ 18.00	
35	BONNET BOWDEN CABLE - CENTRE	\$ 53.00	
36	BOWDEN RELEASE CABLE	\$ 53.00	
37	BONNET RELEASE LEVER	\$ 12.00	
38	PLENUM CHAMBER COVER	\$ 89.00	
39	ENGINE BONNET SOUND ABSORBER	\$ 311.00	
40	LED HEADLIGHT - LH	\$ 7,087.00	\$ 5,669.60
	SUB TOTAL SPARE PARTS	: \$ 11,692.00	\$ 8,331.84

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SMC 4890 B

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
			\$ 8,331.84
41	MAIN LIGHT ELECTRONIS POWER MODULE	\$ 716.00	
42	LIGHT CONTROL SYSTEM CONTROL UNIT	\$ 685.00	
43	HEADLIGHT HOSE - LH	\$ 32.00	
44	HEADLIGHT ASSEMBLY SPACER	3 \$ 111.00	
46	HEADLIGHT WASHER LIFT CYLINDER - LH	\$ 192.00	
47	SUNDRIES	\$ 300.00	\$ 52.80
	TOTAL SPARE PARTS	: \$ 18,814.00	\$ 8,384.64
	TOTAL LABOUR CHARGES	: \$ 6,822.00	\$ 4,072.00
	GRAND TOTAL	: \$ 25,636.00	\$ 12,456.64

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SMC 4890 B

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/1034/2019/NH

12 Dec 2019

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

RE: INSURANCE CLAIM FOR SMC 4890 B, Audi A3 SEDAN 1.4 TFSI.

With reference to the above-mentioned vehicle, no. **SMC 4890 B**, claimant, **Ms. Chen Qiong**, please find the related document per attached.

1. A copy of the Original invoice no. 85014580 – S\$ 11,616.60
2. A copy of the Discharge Voucher duly signed by client.

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept


Encl
AIG – SMC 4890 B

total pages

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 1183

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6388 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 1 11:46

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014580 Date : 09/12/2019 Order : SMC4890B Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	--	--

Regn No: SMC4890B (V 38505) Regn Date: 02/07/2018 Mileage: 18793 WIP No.: 10341
Model: A4 SEDAN 2.0 TFSI BW2ADG (NAV, Chassis: WAUZZZF44JA185075 Engine: CVK 063662 Dept: U
You have been assisted by :- UB-Tony Foong (33)

		Details	Qty	Unit Price	Amount
Q	EXC	M: 8888 Insurance Excess/Liability	-1600.00	1.00	-1,600.00
S	BODYWORK	M: TO REMOVE,CHECK AND REINSTALL FRONT WIRE HARNES FOR HEADLIGHTS,HORNS,OUTSIDE TEMPERATURE SENSOR,HEADLIGHT WASHER ASSY AND FRONT PARKING AID	480.00	1.00	480.00
S	BODYWORK	M: TO DISMANTLE AND RENEW BONNET,LHS FRONT FENDER AND LHS HEADLIGHT.TO INSPECT LHS FRONT FENDER TOP SUPPORT AND FRONT LOCK CARRIER FOR FURTHER DAMAGES.REORGANISE CRASH MANAGEMENT COMPONENTS.REINSTALL ALL PARTS REMOVED.	1750.00	1.00	1,750.00
S	BODYWORK	M: TO RESPRAY FRONT BUMPER,BONNET AND LHS FRONT FENDER	1650.00	1.00	1,650.00
S	BODYWORK	M: TO CARRY OUT DIAGNOSTIC CHECK	192.00	1.00	192.00
X	A8W0941773A	HEADLIGHT	Less 020%	1.00	7087.00
X	A8W0821105A	FENDER	Less 020%	1.00	699.50
X	A8W0823029A	HOOD	Less 020%	1.00	2554.00
X	A8W0823745	COVER AP	Less 020%	1.00	20.20
X	A8W0823125	PROTECTION	Less 020%	1.00	24.90
X	A8W0823126	PROTECTION	Less 020%	1.00	24.70
X	A8W0820581C	COVER AP	Less 020%	1.00	27.80
X	AN 0161857	POP-RIVET	Less 020%	6.00	3.00
X	A8W0823124	PROTECTION	Less 020%	1.00	24.70

Parts 8,384.64
Labour 0.00
Sublet 4,072.00
Menus 0.00
Lubricant 0.00



Sub-Total 10,856.64
7% GST 759.96
Grand Total 11,616.60

Received by

For & on behalf of
Premium Automobiles Pte Ltd

Premium Automobiles

Telefax

to **AIG Asia Pacific Insurance Pte Ltd**
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SMC4890B

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/1034/2019/TF
19 September 2019

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

1

total pages

RE: CLAIM – OWNER'S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi A4 Sedan 1.4 TFSI S
Vehicle Chassis No. : WAUZZZF44JA019865
Vehicle Regn No. : **SMC4890B**
Vehicle Mileage : 18793 KM
Vehicle Owner : Ms. Chen Qiong
Certificate No : 1800067813-01
Own Damage Excess : \$1,712.00 (Inclusive GST)
Accident Date : 27/8/2019
Place : City Gate
Repair Cost : S\$ 11616.60
WIP No. : 10341
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature : 
Time : _____
Date : _____

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	02 Sep 2019 14:14		02 Sep 2019 12:59 Edit Adj Rpt	S\$12,456.64 Edit Estimates	S\$12,456.64 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
------	-----------	---------------	-----------	--------------------------

CLAIM SUBFOLDER DETAILS [Created by insurer]

Insured: CHEN QIONG , ID: S6869169I, Tel: +6598578841	
Vehicle Reg. No.: SMC4890B	Date of Loss: 27/08/2019 10:00 - :59 [13 Months and 25 Days From LTA Reg Date (Man Yr)]
Claim Type: OD / 3710196571SG	Policy/Cover Note No.: 1800067813-01 (Comprehensive)
	Excess: S\$1,600.00
Repairer: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911	
Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Gan, Hunchung] Hunchung.Gan@aig.com	
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MOHD TAUFIKH BIN HAMID] ... [Final Rpt due 11/09/2019]	
Driver/Custodian: ZHANG WEIQIANG (27 / Male) , NRIC: S9176131I, Tel: +6598578841 Email: ZWQ5066107@GMAIL.COM	

ASSOCIATED MAIL RECEIVED [View All](#) [Compose Case Mail](#)

- AIG_SG (03/09/2019): Alert - Adj Mandate Approved (S\$14500.00) - SMC4890B - Claim Handler: Gan, Hunchung...
- AIG_SG (02/09/2019): Alert - Adj Mandate Maintained - SMC4890B - Claim Handler: Gan, Hunchung

ALL ASSOCIATED TASKS [View All](#) [Search Tasks](#) [Create New Task](#) [Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SMC4890B (3710196571SG)

OD

Aug 27 2019 10:30AM

[CHEN QIONG]

Premium Automobiles Pte Ltd

Upload Documents			Upload Photos			Compose New Letter			Upload Video			Upload Audio			View			View in Browser		
Assessment Reports															1 per page			☒		
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)														Thumbnail	Print			
1	02/09/19 16:00	Adjuster Immediate Advice													1	Load HTM				
Photos/Images															3 per page			☒		
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)														Thumbnail	Print			
1	03/09/19 09:16	General View													1	Load JPG	☒			
2	03/09/19 09:16	General View													1	Load JPG	☒			
3	03/09/19 09:16	General View													1	Load JPG	☒			
4	03/09/19 09:16	General View													1	Load JPG	☒			
5	03/09/19 09:16	General View													1	Load JPG	☒			
6	03/09/19 09:16	General View													1	Load JPG	☒			
7	03/09/19 09:16	General View													1	Load JPG	☒			
8	03/09/19 09:16	General View													1	Load JPG	☒			
9	03/09/19 09:16	General View													1	Load JPG	☒			
10	03/09/19 09:16	General View													1	Load JPG	☒			
11	03/09/19 09:16	General View													1	Load JPG	☒			
12	03/09/19 09:16	General View													1	Load JPG	☒			
13	03/09/19 09:16	General View													1	Load JPG	☒			
14	03/09/19 09:16	General View													1	Load JPG	☒			
15	03/09/19 09:16	General View													1	Load JPG	☒			
16	03/09/19 09:16	General View													1	Load JPG	☒			
17	03/09/19 09:16	General View													1	Load JPG	☒			
18	03/09/19 09:16	General View													1	Load JPG	☒			
19	03/09/19 09:16	General View													1	Load JPG	☒			
20	19/12/19 11:36	Reinspection Photo													1	Load JPG	☒			
21	19/12/19 11:36	Reinspection Photo													1	Load JPG	☒			
22	19/12/19 11:36	Reinspection Photo													1	Load JPG	☒			
Documentation															1 per page			☒		
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)														Thumbnail	Print			
1	02/09/19 14:08	Certificate of Insurance / Driving License													1	Load PDF				
2	02/09/19 14:08	estimate													1	Load PDF				
3	02/09/19 14:08	Singapore Accident Statement													1	Load PDF				
4	30/12/19 11:06	DISCHARGE VOUCHER													1	Load PDF				
5	30/12/19 11:06	WORKSHOP INVOICE													1	Load PDF				

Linked Accident Report Documents

										View		View In Browser	
Assessment Reports										1 per page		☒	
No	Finalized On	Premium Automobiles Pte Ltd (UBI)							Thumbnail	Print			
1	02/09/19 13:59	Addendum Sheet							Load JPG	☒			
2	02/09/19 14:01	Accident Statement							Load HTM				
3	04/09/19 02:47	Accident Statement							Load HTM				

Assessment Reports			1 per page ▾	✓
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
Photos/Images			3 per page ▾	✓
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	28/08/19 17:32	Accident Photo		Load JPG ✓
2	28/08/19 17:32	Accident Photo		Load JPG ✓
3	28/08/19 17:32	Accident Photo		Load JPG ✓
4	28/08/19 17:32	Accident Photo		Load JPG ✓
5	28/08/19 17:32	Accident Photo		Load JPG ✓
6	28/08/19 17:32	Accident Photo		Load JPG ✓
7	28/08/19 17:32	Accident Photo		Load JPG ✓
8	28/08/19 17:32	Accident Photo		Load JPG ✓
9	28/08/19 17:32	Accident Photo		Load JPG ✓
10	28/08/19 17:32	Accident Photo		Load JPG ✓
11	28/08/19 17:32	Accident Photo		Load JPG ✓
12	28/08/19 17:32	Accident Photo		Load JPG ✓
13	28/08/19 17:32	Accident Photo		Load JPG ✓
14	28/08/19 17:32	Accident Photo		Load JPG ✓
15	28/08/19 17:32	Accident Photo		Load JPG ✓
16	28/08/19 17:32	Accident Photo		Load JPG ✓
Documentation			1 per page ▾	✓
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	02/09/19 13:59	Sketch Plan		Load JPG ✓
2	02/09/19 13:59	Sketch Plan #2		Load JPG ✓

Documents Checklist

DOCUMENTS CHECKLIST

[Reset](#) [Save](#) [Print](#)

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.,Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #08-16
Singapore 079120

Our File No: CC3/AIG19015461/T1TF3S2
Date: 30/12/2019

REFERENCE

Insured/Claimant:	CHEN QIONG	Policy No:	1800067813-01	
Date of Loss:	27/08/2019	Nature of Claim:	OD	Claim No: 3710196571SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMC4890B	Engine No:	CVK063662
Make & Model:	AUDI A4, 2.0 (A)	Chassis No:	WAUZZZF44JA185075
Reg. Date:	02/07/2018 (Man. Year: 2018)	Odometer:	17422 km
Colour:	Black		
Engine Capacity:	1984 cc		
Market Value/New Car Price:	S\$135,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Good	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	205/60 R16	Rear Tyre Size:	205/60 R16
Front Left Side:	Continental 6 mm	Rear Left Side:	Continental 6 mm
Front Right Side:	Continental 6 mm	Rear Right Side:	Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	19,361.60	8,384.64	10,976.96	56.69
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,822.00	4,072.00	2,750.00	40.31
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	26,183.60	12,456.64	13,726.96	52.43
- Excess (S\$)	1,600.00	1,600.00	0.00	0.00
(S\$)	24,583.60	10,856.64	13,726.96	55.84
+ GST 7.00/7.00% (S\$)	1,720.85	759.96	960.89	55.84
Nett Amount (S\$)	26,304.45	11,616.60	14,687.85	55.84

INSPECTION

Date of Assignment:	02/09/2019	
Date Inspected:	02/09/2019	Inspected At: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699
Estimated Period of Repair:	6.0 days	

Adjuster: MOHD TAUFIKH BIN HAMID

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*FRONT BUMPER	Repair	1,999.00 FS	*- FS
2	1	*FRONT BUMPER FIXING PARTS	Not Necessary	258.00 FS	*- FS
3	1	*RADIATOR AIR GUIDE - LH	Not Necessary	56.00 FS	*- FS
4	1	*FRONT BUMPER AIR GUIDE GRILLE - LH	Not Necessary	123.00 FS	*- FS
5	1	*FRONT BUMPER FOAM FILLER PIECE	Not Necessary	113.00 FS	*- FS
6	1	*FRONT BUMPER CARRIER	Not Necessary	733.00 FS	*- FS
7	1	*FRONT BUMPER GUIDE SECTION - LH	Not Necessary	33.00 FS	*- FS
8	1	*FRONT BUMPER FOAM FILLER PIECE - LH	Not Necessary	16.00 FS	*- FS
9	1	*FRONT PARKING AID SENSOR - INNER / OUTER	Not Necessary	231.00 FS	*- FS
10	4	*FRONT PARKING AID SENSOR SEAL RING	Necessary	559.60 FS	*559.60 FS
11	1	*FENDER - LH	Not Necessary	700.00 FS	*- FS
12	1	*FENDER ATTACHMENT PARTS	Not Necessary	183.00 FS	*- FS
13	1	*FENDER CLOSING ELEMENT - LH	Not Necessary	45.00 FS	*- FS
14	1	*FENDER BRACKET - LH	Not Necessary	32.00 FS	*- FS
15	1	*FENDER DEFORMATION ELEMENT BRACKET - LH	Not Necessary	45.00 FS	*- FS
16	1	*FENDER BRACKET - LH	Not Necessary	29.00 FS	*- FS
17	1	*FENDER BRACE - LH FRONT	Not Necessary	107.00 FS	*- FS
18	1	*WHEEL HOUSING LINER - LH	Not Necessary	223.00 FS	*- FS
19	1	*WHEEL HOUSING LINER ATTACHMENT PARTS - FRONT / REAR	Not Necessary	82.00 FS	*- FS
20	1	*WHEEL SPOILER	Not Necessary	66.00 FS	*- FS
21	1	*WHEEL SPOILER END PLATE - LH	Not Necessary	32.00 FS	*- FS
22	1	*STONE CHIP GUARD - LH	Not Necessary	46.00 FS	*- FS
23	1	*BONNET	Bent	2,554.00 FS	*2,043.20 FS
24	1	*BONNET ATTACHMENT PARTS	Not Necessary	111.00 FS	*- FS
25	2	*LID HINGE - LH / RH	Not Necessary	554.00 FS	*- FS
26	1	*BONNET IMPACT PROTECTION - CENTRE	Necessary	25.00 FS	*19.92 FS
27	2	*BONNET IMPACT PROTECTION - LH/RH	Necessary	50.00 FS	*39.52 FS
28	1	*FENDER LEDGE COVER - LH INNER	Not Necessary	56.00 FS	*- FS
29	1	*FENDER TOP LEDGE COVER - LH UPPER	Not Necessary	28.00 FS	*- FS
30	1	*FENDER TOP LEDGE COVER - LH LOWER	Not Necessary	21.00 FS	*- FS
31	2	*BONNET STRIKER - LH / RH	Not Necessary	92.00 FS	*- FS
32	1	*BONNER GAS FILLED STRUT	Not Necessary	109.00 FS	*- FS
33	2	*BONNET LID LOCK	Not Necessary	391.00 FS	*- FS
34	2	*CONNECTOR HOUSING BRACKET	Not Necessary	18.00 FS	*- FS
35	1	*BONNET BOWDEN CABLE - CENTRE	Not Necessary	53.00 FS	*- FS
36	1	*BOWDEN RELEASE CABLE	Not Necessary	53.00 FS	*- FS
37	1	*BONNET RELEASE LEVER	Not Necessary	12.00 FS	*- FS
38	1	*PLENUM CHAMBER COVER	Not Necessary	89.00 FS	*- FS
39	1	*ENGINE BONNET SOUND ABSORBER	Not Necessary	311.00 FS	*- FS
40	1	*LED HEADLIGHT - LH	Cracked	7,087.00 FS	*5,669.60 FS
41	1	*MAIN LIGHT ELECTRONIC POWER MODULE	Not Necessary	716.00 FS	*- FS
42	1	*LIGHT CONTROL SYSTEM CONTROL UNIT	Not Necessary	685.00 FS	*- FS
43	1	*HEADLIGHT HOSE - LH	Not Necessary	32.00 FS	*- FS
44	3	*HEADLIGHT ASSEMBLY SPACER	Not Necessary	111.00 FS	*- FS
45	1	*HEADLIGHT WASHER LIFT CYLINDER - LH	Not Necessary	192.00 FS	*- FS
46	1	*SUNDRIES	Necessary	300.00 FS	*52.80 FS

F=Franchise part, S=SpcNett.

Total Parts (\$\$)	19,361.60	8,384.64
---------------------------	------------------	-----------------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE, CHECK AND REINSTALL FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID.	New	480.00	480.00
2	TO DISMANTLE AND RENEW FRONT BUMPER, BONNET, LHS FRONT FENDER AND LHS HEADLIGHT. TO INSPECT LHS FRONT FENDER TOP SUPPORT AND FRONT LOCK CARRIER FOR FURTHER DAMAGES. RE-ORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	New	3,150.00	1,750.00
3	TO RESPRAY FRONT BUMPER, BONNET AND LHS FRONT FENDER.	New	3,000.00	1,650.00
4	TO CARRY OUT DIAGNOSTIC CHECKS.	New	192.00	192.00
Gross Labour Cost (\$\$)			6,822.00	4,072.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >