

22/03/2002

ASS. REC. BY:

REF:

CS/SM0190160751 Byf302

Special Instruction:

Surveyor: Mr Jim

ASSIGNMENT (Office)

Merimen

From (Person): Melvin Ye of SMO Date/Time: 10/09/2019

Estimated Cost: _____ Bill to: _____

OD / ~~TP~~ / WS / TP RES / OD RES / EVA / INV / MV / CSTo Inspect Vehicle No: S33 4134S Insured: SJU 3344Jat Workshop m/s Team Autopro Pte Ltd Tel: 62581955of 160 Sin Ming Drive #9-14Policy No: D18MTPV01018460 Claim No: CMTD1904275

Sum Insured: _____ Excess: _____

Make of Veh: _____ D.O.A. 09/09/2019
(Client's Record)

CA / REV / REP. / REV 24 HRS

"wp"

11/09/2019

H.O.D. Endorsement: _____

Date/Time: 10/09/2019 @ 5:30pm Person Contacted: _____ Vehicle: ~~IN~~ / OUT

Photo O.K

Date/Time	Action/Instruction (✓) Estimate
	<u>SJU 3344J - NA/INK11002957/102 D.O.A: 10/02/2011</u>
	<u>S33 4134S : X</u>
<u>18/9/19</u>	<u>Sent Prel: Revise by Merimen</u>

ASSIGNMENT

From: Date: 11/09/2019

Estimated Cost:

OD (TP) WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SJJ 4134 A
at Workshop m/s Team Autopro
of 160 Sin Ming Drive # 01-14

Insured:

Policy No.

Claims No.


Sum Insured: Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

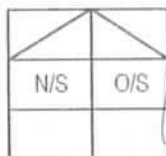

Bal. or Market Value:

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 6 days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS (up)

Vehicle: IN / OUT

Date: Person Contacted:

Veh No: SJJ 4134 A Yr Regn: 12/9/2008

Type: (M) Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Mitsubishi Lancer 1.6 A c.c 1584

Colour: Black A/C: Insured / Std / NI / NA

Sp. Reading: 143716 T/Radio: Insured / Std / NI / NA

Eng/No: 4G18JR1950

C/No: JMYSTCS3A8U008085*

Gen. Cond: Good / Fair / Poor / Burnt

Steering: (order) / Jammed / Leaked / Burnt or

Brake: (order) / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195/60/15 MIC
R: 195/60/15 DAYTON

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or MIC / Dayton

Front

Rear

R/Bal. 5 mic mm R/Bal. 5 mic mm

L/Bal. 6 Dayton mm L/Bal. 6 Dayton mm

D.O.A. 9/9/19 D.O.I. 11/9/19

Survey held at Team Autopro

Des. of Damages: Frt / Rear / (O/S) N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	Range 7,000/- - 8,000/-
13/12/19	L/S 5650.00 (Red \$16,150-99, 74%)
	MV 21,800/-
	PV 12,921/-
	NV 8,879/-

RECEIVED 18 DEC 2019

Team Autopro
12/9/19

Date/Time, File Pass to? ☐ : Preli. Report

1) ☐ : Final Report

Date/Time, File Return to?

2) 17/12/19 Typist

Report Format:

Lump Sum: \$5650/-

Days Of Repair: 6

Resurvey No. of Trip: 2

Add Fee: ☐ : Site Insp (\$)

☐ : Interview (3)

☐ : Tech. Invt (3)

☐ : Weekend (2)

Survey Fee:

Transportation:

S + RS: \$

Photos

Others

TOTAL

490
11
461

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	10 Sep 2019		10 Sep 2019 16:51 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured:	NG KOK PHENG, ID: S6816633J								
Main Claimant:	KHOO ENG HOCK, ID: S0117496G								
Vehicle Reg. No.:	SJJ4134S	Date of Loss:	09/09/2019 17:00 - :59						
Claim Type:	TP / CMTD1904275	Policy/Cover Note No.:	D18MTPV01018460 (Comprehensive)						
Vehicle Reg. No. (Insured):	SJU3344J	Policy No. (Claimant):							
		Excess:							
Repairer:	Team Autopro Pte Ltd (sin Ming) (HQ) 160 SIN MING DRIVE, #01-14 SIN MING AUTOCITY, 575722 Sin Ming - Tel:								
Handling Insurer:	Sompo Insurance Singapore Pte. Ltd. (HQ) - Tel: 6461 6555 ... [Handled by Melvin Ye - 6322 4667]								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 19/09/2019]								
Driver/Custodian (Insured):	JOHAN NG CHOON HERUG (24 / Male) , NRIC: S9443191C, Tel: +6596498261 Email: NOEMAIL								
Adj Asg. Remarks:	WS: ERIC LEE 8269 9999								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
There are no mail for this case.									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Yvonne Wong (LKK Auto)

From: Team AutoPro <tap.finalization@gmail.com>
Sent: Tuesday, December 17, 2019 7:29 PM
To: Yvonne Wong (LKK Auto)
Subject: Re: (reminder) Finalization on COR : SJJ 4134 A / DOA : 09/09/19 Somp

Dear Yvonne,

After speaking to Mr Lim, we have decided to accept the offer of \$5650 and 6 repair days.

Thank you.

The above settlement is in respect of our client for damage pertaining to his motor vehicle and shall not prejudice our client's claim in respect of damages and consequential loss in relation to his personal injuries.

Cheers,
John Ko
Team AutoPro Pte Ltd
HP : 6258 1955
Fax: 6258 1956

Main Office: 160 Sin Ming Dr, #02-12 Sin Ming AutoCity Singapore 575722
Workshop/Survey Venue: 160 Sin Ming Dr, #01-14 Sin Ming AutoCity Singapore 575722

On Tue, Dec 17, 2019 at 10:19 AM Team AutoPro <tap.finalization@gmail.com> wrote:
Gd Day Yvonne,

Without Prejudice

Thank You for your prompt reply.

Kindly find attached the after marked estimate by Mr Lim and pls refer to our calculation as follows:-

Labour	- \$ 2330.00
Special Netts	- \$ 130.00
Parts After 20 %	- \$ 3112.26
Sub Total (Labour + S/N + Parts)	- \$ 8472.26

L/S - 20% - \$ 6800.00 & 07 Repairs Days

We are of the opinion that your offered COR of \$5650.00/ 06 days is not justifying and hereby seek your kind review on COR and repair days.

Our proposed is **\$6500.00 / 07 Repair days**. We await soonest your favorable reply.

Thank you.

The above settlement is in respect of our client for damage pertaining to his motor vehicle and shall not prejudice our client's claim in respect of damages and consequential loss in relation to his personal injuries.

Cheers,
John Ko
Team AutoPro Pte Ltd
HP : 6258 1955
Fax: 6258 1956

Main Office: 160 Sin Ming Dr, #02-12 Sin Ming AutoCity Singapore 575722
Workshop/Survey Venue: 160 Sin Ming Dr, #01-14 Sin Ming AutoCity Singapore 575722

On Sat, Dec 14, 2019 at 7:04 PM Team AutoPro <tap.finalization@gmail.com> wrote:
Gd Day Mr Lim ,

Without Prejudice

Thank You for assisting as SJE for subject vehicle

Attach with after marked estimate amount for SJJ 4134 A

Parts After 20%	- \$ 3112.26
Special Netts	- \$ 130
Labour	- \$ 2330

Sub Total (Parts + S/N + Labour) - \$ 8472.26

L/S - 20% - **\$ 6800.00 & 07 Repair Days**

Enclosed herewith after-repair photos FYN.

Look forward for your favorable reply.

The above settlement is in respect of our client for damage pertaining to his motor vehicle and shall not prejudice our client's claim in respect of damages and consequential loss in relation to his personal injuries.

Cheers,
John Ko
Team AutoPro Pte Ltd
HP : 6258 1955
Fax: 6258 1956

Main Office: 160 Sin Ming Dr, #02-12 Sin Ming AutoCity Singapore 575722
Workshop/Survey Venue: 160 Sin Ming Dr, #01-14 Sin Ming AutoCity Singapore 575722

Note: This document has not been finalised.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To: Somp Insurance Singapore Pte. Ltd.
50 Raffles Place
#05-01/06, Singapore Land Tower
Singapore 048623

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Melvin Ye

Date: 18 Sep 2019

Preliminary Advice

Insured Vehicle No	: SJU3344J		
TP Vehicle No	: SJJ4134S	Accident Date	: 09/09/2019
Make	: MITSUBISHI LANCER	Assignment Date	: 10/09/2019
Date of Inspection	: 11/09/2019	Est. Duration of Repair	: 6.00
Inspection At	: TEAM AUTOPRO PTE LTD (SIN MING) (HQ) 160 SIN MING DRIVE, #01-14 SIN MING AUTOCITY SINGAPORE 575722		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages O/S portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	21,800.99
Revised Amount	:S\$	11,120.26
Check Items (Estimated)	:S\$	0.00
Total	:S\$	11,120.26

Lump Sum Repair	:S\$
-----------------	------

Total Loss Consideration

New for Old Value	:S\$
Pre-Accident Value	:S\$
COE / PARF Rebate	:S\$
Salvage Value	:S\$
Margin for Repair	:S\$

Remarks

- () The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : THE ABOVE SURVEY WAS CONDUCTED ON A "WITHOUT" PREJUDICE BASIS

Email: sm@idac.com.sg

Tel no: 6555 6888 Fax no: 6454 3279

Personal Particulars of Owner & Driver (Vehicle A)

Date of Accident: 09/09/2019 (dd/mm/yy) Time of Accident: 17:45 (24-HR-FORMAT)
Vehicle No.: SJJ 4134 A Vehicle Make & Model: MITSUBISHI LANCER 1.6 A
Exact location of Accident: NANYANG TERRACE TOWARDS STUDENT WALK
Policyholder's Name / IC No.: KHOO ENG HOCK S0117496G
Driver's Name / IC No.: KHOO ENG HOCK S0117496G (As Above) ☐
Driver's Contact No.: 9878 3619 Company Contact No.: _____
Driver's Address: 624 SENJA ROAD #03-98 S670624
Insurance Company: TOKIO MARINE Email address (if any): _____

Relationship between Owner & Driver: OWNER

or Others specify: _____

What do you wish to claim? (Please TICK one only)

☐ Own Insurance / ☒ Other Vehicle (The one you want to claim against) / ☐ Reporting (For Record Purpose)

**Exact purpose for which the vehicle
Was being used at time of accident?**

Occupation (nature of job) ☐ Indoor/ ☒ Outdoor

☐ Private use / ☒ Work purpose

No. of Passengers (Including Driver): 01

Passenger Name : _____
Passenger Name : _____

Gender : -
Gender : -

Weather condition & Road conditions? (On the day of accident)

☒ Clear & Dry / ☐ Raining & Wet / ☐ After-Rain & Wet / ☐ Drizzling & Wet / Others: _____

Was there any video captured by your Car Camera? ☒ Yes / ☒ No

Any Injuries: ☐ Yes / ☒ No (If YES) Injured Person's Name: _____

Injuries Sustain: _____ Injured Person in Which Vehicle: _____

Police Report filed: ☐ Yes / ☒ No (If YES) Which Police Station: _____

The Other Party(s) Details:

1. Driver's Name / IC No: _____ Vehicle No: SJU 3344 J (B)

Driver's Contact No: _____ Insurance Company (If any): _____

2. Driver's Name / IC No: _____ Vehicle No: _____


Driver's Contact No: _____ Insurance Company (If any): _____

*Independent Witness (If Any): _____ Contact No: _____

Preferred Workshop Name: _____ Contact No: _____

*If no proper documents are produced, IDAC should not file the report. Information will be discarded after one week.

SKETCH PLAN

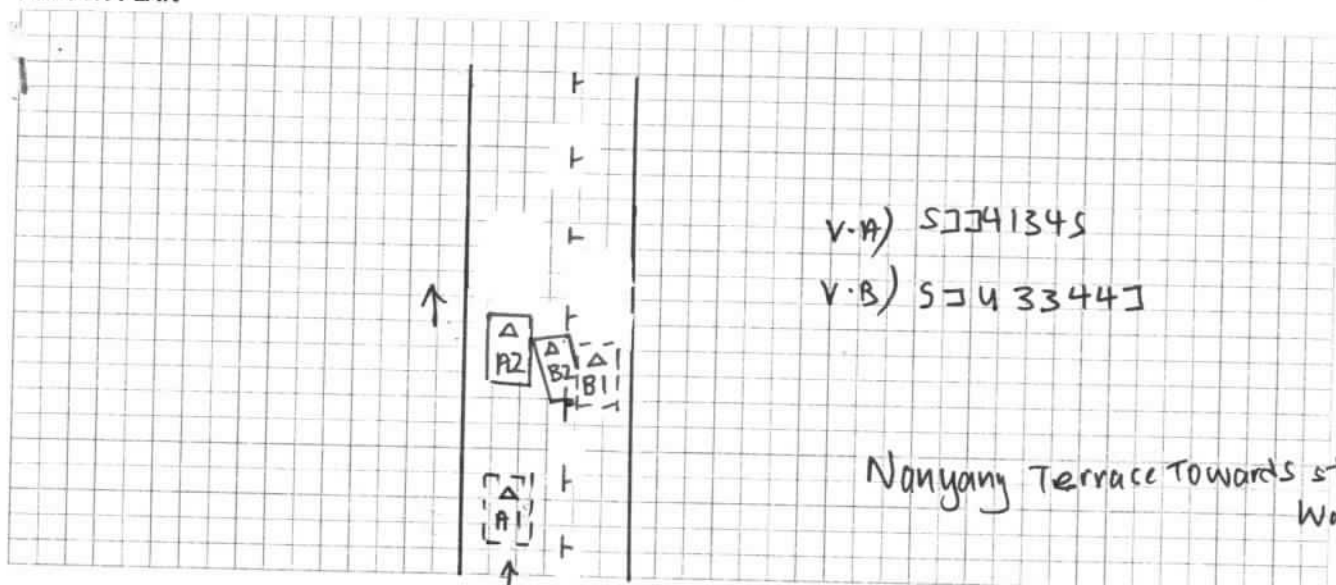

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On the stated date and time, I vehicle 'A' SJJ41345 was travelling on the stated route. I was travelling straight in my lane, suddenly vehicle 'B' came out from the parking lot and collided against my entire vehicle right portion. Shortly I got out of my vehicle and exchange particulars, we then decide to let our insurance to handle. I wish to state that my rear rims were affected too.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

[Signature]

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Work Order: R033743
VIN: SJJ4134A
Year: 08
Date: 11.9.19 9:53



SJJ4134A

Mitsubishi : Lancer : 2003-08 (CS) : Rest of World : except Sport

Front : Left

Actual	Before	Specified Range
0°11'	0°11'	-0°25' 0°35'
2°34'	2°34'	2°15' 3°15'
0°01'	0°02'	-0°03' 0°09'
12°31'	12°31'	11°00' 14°00'
12°42'	12°42'	10°35' 14°35'
		-3°12' -0°12'

Camber
Caster
Toe
SAI
Included Angle
Turning Angle Diff.

Front : Right

Actual	Before	Specified Range
-1°22'	-1°23'	-0°25' 0°35'
2°55'	2°55'	2°15' 3°15'
-0°01'	-0°01'	-0°03' 0°09'
13°35'	13°35'	11°00' 14°00'
12°12'	12°12'	10°35' 14°35'
		-3°12' -0°12'

Front

Cross Camber
Cross Caster
Cross SAI
Total Toe
Cross Turn Diff.

Actual	Before	Specified Range
1°33'	1°34'	-0°30' 0°30'
-0°22'	-0°22'	-0°30' 0°30'
-1°04'	-1°04'	
0°00'	0°00'	-0°06' 0°18'

Rear : Left

Actual	Before	Specified Range
-0°06'	-0°05'	-1°10' -0°10'
-0°06'	-0°06'	0°03' 0°13'

Camber
Toe

Rear : Right

Actual	Before	Specified Range
-2°21'	-2°21'	-1°10' -0°10'
-0°58'	-0°58'	0°03' 0°13'

Rear

Cross Camber
Total Toe
Thrust Angle

Actual	Before	Specified Range
2°15'	2°16'	
-1°04'	-1°04'	0°06' 0°26'
0°26'	0°26'	-0°09' 0°09'

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	496G
Vehicle Details	
Vehicle No.:	SJJ4134A
Vehicle to be Exported:	No
Intended Deregistration Date:	13 Sep 2019
Vehicle Make:	MITSUBISHI
Vehicle Model:	LANCER 1.6 A
Primary Colour:	Black
Manufacturing Year:	2008
Engine No.:	4G18JR1950
Chassis No.:	JMYSTCS3A8U008085
Maximum Power Output:	79.0 kW (105 bhp)
Open Market Value:	\$11,300.00
Original Registration Date:	12 Sep 2008
First Registration Date:	12 Sep 2008
Transfer Count:	1
Actual ARF Paid:	\$11,300.00
Intended PARF Rebate Details	
PARF Eligibility:	Forfeited
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	11 Sep 2023
COE Category:	A - Car (1600cc & below)
COE Period(Years):	5
PQP Paid:	\$16,170.00
COE Rebate Amount:	\$12,921.00
Total Rebate Amount:	\$12,921.00
Message	
Please note that the 5-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 13 Sep 2019

OK

MV 21,800/-
PV 12,921/-
NV 8,879/-

TCG Mr. Min
13/9/19



Evo 10 Blue Paintwork. Car Tuned By Reputable Workshop! Carefully Taken Care Since Day One, No Repairs Needed, High Loan Available, Act Fast! Maintained Regularly, Refurbished Till Look And Feel Brand New. Call Us Now, We Open Daily.

Posted: 18-Jul-2019

Tags: 2008 Mitsubishi Lancer, 2008 mitsubishi lancer, Mitsubishi Lancer, mitsubishi lancer, Mitsubishi, Lancer, lancer, Used Mitsubishi



Mitsubishi Lancer EX 1.5A GLS (COE till 03/2023)

N.A

12-Mar-2008

1,499 cc

Sedan

SOLD

Low Cost Suitable For Short Term Commitment. Sporty Responsive 1499cc Sedan Ideally For Daily Joy Drives. 14,000km Mileage Clocked Annually Only, Under Usage Low Mileage. Pristine Condition With No Modifications Done. High PQP Value Of \$19,637 Equivalent To High...

Posted: 17-Jul-2019

Tags: 2008 Mitsubishi Lancer, 2008 mitsubishi lancer, Mitsubishi Lancer, mitsubishi lancer, Mitsubishi, Lancer, lancer, Used Mitsubishi



Mitsubishi Lancer EX 1.5A GLS (COE till 03/2023)

\$28,888

\$8,240 /yr

17-Mar-2008

1,499 cc

Sedan

Available

Beautiful Paintwork, Low Depreciation, Low Mileage, Very Well Maintained By Previous Owner, Reliable And Fuel Efficient, Nice And Clean Interior, Viewing Available, First Come First Serve Basis, Call To Arrange For Viewing! High Loan Available, Bank Loan Available Too!

Monster Motors Pte Ltd

PREMIUM AD

Posted: 31-Aug-2019

Tags: 2008 Mitsubishi Lancer, 2008 mitsubishi lancer, Mitsubishi Lancer, mitsubishi lancer, Mitsubishi, Lancer, lancer, Used Mitsubishi



Mitsubishi Lancer 1.6A GLX (COE till 03/2023)

\$21,800

\$6,200 /yr

20-Mar-2008

1,584 cc

135,700 km

Sedan

Available

Superbly Well Maintained, Low Mileage, Guarantee No Further Repair Needed. Flexible Loan Scheme And Trade In Are Welcome. Please Contact Our Friendly Sales Consultant For A Viewing Appointment Before It's Gone.

Posted: 06-Sep-2019

Tags: 2008 Mitsubishi Lancer, 2008 mitsubishi lancer, Mitsubishi Lancer, mitsubishi lancer, Mitsubishi, Lancer, lancer, Used Mitsubishi

Save this search criteria, to get email alerts whenever a match is found.

Make

Model

Price

Depreciation

Reg Date

Eng Cap

Mileage

Veh Type

Status

For old advertisements, view **Expired ads**

« Back (1 ... 2 3 4 5 6 ... 13) Next »

20 results/page

[Home](#) | [New Cars](#) | [Used Cars](#) | [Sell My Car](#) | [Directory](#) | [Products](#) | [Insurance](#) | [Article](#) | [Forum](#) | [Resources](#)

sgCarMart is the number one car classifieds for parallel import cars, Toyota, Honda, Nissan, Mitsubishi & BMW. There are plenty of cars for sale, from vans, trucks, sedan cars, luxury cars, sports cars or stationwagons, SUV, MPV, hatchback, to COE cars & OPC cars. You can also buy from a car auction, look up car loans, financial services, low mileage cars, car brands, carpark rates & car insurance. Find buy used Mitsubishi, Mitsubishi Singapore, used Mitsubishi Singapore, used Mitsubishi, used vehicles Singapore or even buy used Mitsubishi Singapore. We have new car dealers comprising parallel importers, authorised car dealers, and used car dealers on our site. Find new car price lists, new car launches and new car promotions. Visit our partner sites for job openings for Singapore jobs, real estate properties for sale, mover, car performance parts, car discussion, forum discussion, commercial vehicle leasing & COE results.

All prices and other information displayed on sgCarMart.com are gathered from sources and based on algorithms that are believed by sgCarMart.com to be reliable, but no assurance can be given that this information is accurate, complete or current. sgCarMart.com does not assume any responsibility for errors or omissions or warrant the accuracy of this information.

Follow sgCarMart.com

[About Us](#) | [Careers](#) | [Contact Us](#) | [Sitemap](#) | [Terms of Service](#) | [Privacy Policy](#) | [Personal Data Protection Statement](#)
©2004-2019 sgCarMart. All rights reserved.

Work Order: R033743
N: SJJ4134A
Year: 08
Date: 11.9.19 9:53



Mitsubishi : Lancer : 2003-08 (CS) : Rest of World : except Sport

Front : Left

Actual	Before	Specified Range
0°11'	0°11'	-0°25' 0°35'
2°34'	2°34'	2°15' 3°15'
0°02'	0°02'	-0°03' 0°09'
12°31'	12°31'	11°00' 14°00'
12°42'	12°42'	10°35' 14°35'
		-3°12' -0°12'

Camber
Caster
Toe
SAI
Included Angle
Turning Angle Diff.

Front : Right

Actual	Before	Specified Range
-1°22'	-1°23'	-0°25' 0°35'
2°56'	2°56'	2°15' 3°15'
-0°01'	-0°01'	-0°03' 0°09'
13°35'	13°35'	11°00' 14°00'
12°12'	12°12'	10°35' 14°35'
		-3°12' -0°12'

Front

Cross Camber
Cross Caster
Cross SAI
Total Toe
Cross Turn Diff.

Actual	Before	Specified Range
1°33'	1°34'	-0°30' 0°30'
-0°22'	-0°22'	-0°30' 0°30'
-1°04'	-1°04'	
0°01'	0°00'	-0°06' 0°18'

Rear : Left

Actual	Before	Specified Range
-0°05'	-0°05'	-1°10' -0°10'
-0°06'	-0°06'	0°03' 0°13'

Camber
Toe

Rear : Right

Actual	Before	Specified Range
-2°21'	-2°21'	-1°10' -0°10'
-0°58'	-0°58'	0°03' 0°13'

Rear

Cross Camber
Total Toe
Thrust Angle

Actual	Before	Specified Range
2°15'	2°16'	
-1°04'	-1°04'	0°06' 0°26'
0°26'	0°26'	-0°09' 0°09'

Team AutoPro Pte Ltd 160 Sin Ming Dr, #02-12 Sin Ming AutoCity Singapore 575722

Tel: 8269-9999 Email: estimate.tap@gmail.com/teamautopl@gmail.com

SJE : _____
 Date of Survey : _____
 Date of ReSurvey: _____
 Contacts : _____

Vehicle Nos : **SJJ 4134 A**
 Made : Mitsubishi
 Model : Lancer
 Chassis No : _____

*** AGREED Cost Of Repair and Repair Day/s with SJE ***

Amount: _____

Working Day: _____

Nos.	PARTS	Qty	Unit S\$	TOTAL S\$
1	Front Rh fender	1	\$ 812.50	\$ 812.50
2	Front Rh door	1	\$ 1,035.20	\$ 899.00 1,035.20
3	Front Rh weatherstrip	1	\$ 198.00	\$ 198.00
4	Front Rh weatherstrip (body)	1	\$ 128.00	\$ 128.00
5	Front Rh door top moulding	1	\$ 162.80	\$ 102.00 162.80
6	Front Rh door regulator assy	1	\$ 576.20	\$ 576.20
7	Front Rh door lock assy	1	\$ 457.00	\$ 290.00 457.00
8	Front Rh door trim	1	\$ 315.60	\$ 315.60
9	Front Rh power motor	1	\$ 516.00	\$ 516.00
10	Front Rh top door hinge	1	\$ 56.00	\$ 56.00
11	Front Rh bottom door hinge	1	\$ 56.00	\$ 56.00
12	Front Rh door checker	1	\$ 48.00	\$ 48.00
13	Front Rh door outer handle	1	\$ 134.00	\$ 134.00
14	Front Rh knuckle	1	\$ 468.90	\$ 468.90
15	Front Rh knuckle bearing	1	\$ 189.20	\$ 189.20
16	Front Rh lower arm	1	\$ 345.60	\$ 345.60
17	Front Rh shock absorber	1	\$ 689.40	\$ 689.40
18	Front Rh side mirror	1	\$ 315.60	\$ 315.60
19	Front Rh door outer chrome garnish	1	\$ 196.70	\$ 97.00 196.70
20	Rear Rh door	1	\$ 1,035.20	\$ 899.00 1,035.20
21	Rear Rh weatherstrip	1	\$ 198.00	\$ 142.00 198.00
22	Rear Rh weatherstrip (body)	1	\$ 128.00	\$ 128.00
23	Rear Rh top moulding	1	\$ 162.80	\$ 102.00 162.80
24	Rear Rh door regulator assy	1	\$ 576.20	\$ 344.00 576.20
25	Rear Rh door lock assy	1	\$ 457.00	\$ 290.00 457.00
26	Rear Rh door trim	1	\$ 315.60	\$ 315.60
27	Rear Rh power motor	1	\$ 516.00	\$ 516.00
28	Rear Rh top door hinge	1	\$ 56.00	\$ 56.00
29	Rear Rh bottom door hinge	1	\$ 56.00	\$ 56.00
30	Rear Rh door checker	1	\$ 48.00	\$ 48.00
31	Rear Rh door outer handle	1	\$ 134.00	\$ 134.00
32	Rear Rh knuckle	1	\$ 468.90	\$ 468.90
33	Rear Rh knuckle bearing	1	\$ 189.20	\$ 189.20
34	Rear Rh lower arm	1	\$ 345.60	\$ 219.00 345.60

NNX
 DDV
 NNX
 TNV
 NECV
 NNX
 JM
 NNX
 NNX
 NNX
 BTV
 NNX
 NNX
 RX
 BTV
 DDV
 TNV
 NNX
 NECV
 BTV
 JM
 NNX
 NNX
 BTV
 BTV
 BTV
 NNX
 NNX
 BTV

35	Rear Rh shock absorber	1	\$	689.40	\$	689.40	NNX
36	Rear Rh door outer chrome garnish	1	\$	196.70	\$	97.00 196.70	BTU
37	Rear Rh rocker panel	1	\$	927.00	\$	927.00	RX
38	Rear Rh rocker panel garnish	1	\$	884.00	\$	884.00	NNX
39	Rear Rh fender	1	\$	987.60	\$	987.60	RX
40	Rear Rh fender cowl	1	\$	315.00	\$	315.00	NNX
41	Rear Rh fender inner shield	1	\$	58.00	\$	58.00	NNX
42	Rear windscreen moulding	1	\$	139.00	\$	101.00 139.00	NECV
43	Rear bumper	1	\$	975.20	\$	875.80 -975.20	CUT
44	Rear bumper side retainer	1	\$	84.00	\$	84.00	NNX
45	Tail lamp Rh	1	\$	518.00	\$	421.00 518.00	BR
				Parts Sub Total :	\$	5214.80 17,161.10	
				Discount 10%	\$	521.48 1,716.11	
				PARTS TOTAL :	\$	4693.32 15,444.99	

Nos.	SPECIAL NETT	Qty	Unit S\$	TOTAL S\$	
1	Rear fender cowl clips	1	\$	50.00	\$ 50.00 NNX
2	Brake fluid	1	\$	120.00	\$ 120.00 NNX
3	Taip lamp clips	1	\$	50.00	\$ 30.00 50.00 NECV
4	Front Rh rim cover	1	\$	118.00	\$ 118.00 NNX
5	Rear Rh rim cover	1	\$	118.00	\$ 30.00 118.00 CUT
6	Front Rh tyre	1	\$	160.00	\$ 160.00 NNX
7	Rear Rh tyre	1	\$	160.00	\$ 160.00 NNX
8	Rear bumper clips	1	\$	50.00	\$ 30.00 50.00 NECV
9	Rear windscreen sealant	1	\$	NEC 120.00	\$ 40.00 120.00 X
10	Front windscreen sealant	1	\$	120.00	\$ 120.00 NNX
11	Front windscreen in bracket	1	\$	60.00	\$ 60.00 NNX
				SPECIAL NETT TOTAL :	\$ 130.00 1,126.00

Nos.	LABOUR	S\$	
1	To R&R Front Door Mechanism	\$ 80.00	150.00
2	To R&R Rear Door Mechanism	\$ 80.00	150.00
3	To R&R front undercarriage work	\$	350.00
4	To R&R rear undercarriage work	\$ 100.00	350.00
5	To R&R undercarriage component (brake pad, caliper etc)	\$	150.00
6	Wheel alignment	\$ 60.00	120.00
7	Panel beat and straighten accident portion	\$ 800.00	1,500.00
8	Repair replace and check wiring	\$ 50.00	100.00
9	Rust proofing	\$ 60.00	300.00
10	To R&R door quarter glass	\$	60.00
11	Spray paint	\$ 1000.00	2,000.00
		LABOUR TOTAL :	\$ 2230.00 5,230.00

Survey on 11/9/19
@ 1400 hrs

Resurvey on 12/9/19
@ 1500 hrs

Lump Sum Repair
Repair days 6

PARTS TOTAL : \$ 15,444.99 4693.32
SPECIAL NETT TOTAL : \$ 1,126.00 130.00
LABOUR TOTAL : \$ 5,230.00 2230.00
GRAND TOTAL : \$ 21,800.99 7053-32

@ 20 % 1410-66
5642-65

45 5650.00

TG M
17/9/19

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	10 Sep 2019		10 Sep 2019 16:51 Edit Adj Rpt	S\$5,650.00 Edit Estimates	S\$5,650.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
----------------------	---------------------------	-------------------------------	---------------------------	--------------------------

CLAIM SUBFOLDER DETAILS		[Created by insurer]							
Insured:	NG KOK PHENG, ID: S6816633J								
Main Claimant:	KHOO ENG HOCK, ID: S0117496G								
Vehicle Reg. No.:	SJJ4134S	Date of Loss: 09/09/2019 17:00 - :59 [131 Months and 28 Days From LTA Reg Date (Man Yr)]							
Claim Type:	TP / CMTD1904275	Policy/Cover Note No.: D18MTPV01018460 (Comprehensive)							
Vehicle Reg. No. (Insured):	SJU3344J	Policy No. (Claimant):							
		Excess:							
Repairer:	Team Autopro Pte Ltd (sin Ming) (HQ) 160 SIN MING DRIVE, #01-14 SIN MING AUTOCITY, 575722 Sin Ming - Tel:								
Handling Insurer:	Sompo Insurance Singapore Pte. Ltd. (HQ) - Tel: 6461 6555 ... [Handled by Melvin Ye - 6322 4667]								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by Lim Teow Guan] ... [Final Rpt due 19/09/2019]								
Driver/Custodian (Insured):	JOHAN NG CHOON HERUG (24 / Male) , NRIC: S9443191C, Tel: +6596498261 Email: NOEMAIL								
Adj Asg. Remarks:	WS: ERIC LEE 8269 9999								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
There are no mail for this case.									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SJJ4134S (CMTD1904275)
[SJU3344J]
TP
KHOO ENG HOCK
Sep 9 2019 5:00PM
[NG KOK PHENG]
Team Autopro Pte Ltd (sin Ming)

Upload Documents			Upload Photos			Compose New Letter			View View in Browser		
Assessment Reports									1 per page		☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)							Thumbnail	Print	
1	18/09/19 19:25	Adjuster Immediate Advice							Load HTM		
Photos/Images									3 per page		☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)							Thumbnail	Print	
1	17/12/19 10:01	General View							Load JPG	☒	
2	17/12/19 10:01	General View							Load JPG	☒	
3	17/12/19 10:01	General View							Load JPG	☒	
4	17/12/19 10:01	General View							Load JPG	☒	
5	17/12/19 10:01	General View							Load JPG	☒	
6	17/12/19 10:01	General View							Load JPG	☒	
7	17/12/19 10:01	General View							Load JPG	☒	
8	17/12/19 10:01	General View							Load JPG	☒	
9	17/12/19 10:01	General View							Load JPG	☒	
10	17/12/19 10:04	Reinspection Photo							Load JPG	☒	
11	17/12/19 10:04	Reinspection Photo							Load JPG	☒	
12	17/12/19 10:04	Reinspection Photo							Load JPG	☒	
13	17/12/19 10:04	Reinspection Photo							Load JPG	☒	
14	17/12/19 10:04	Reinspection Photo							Load JPG	☒	
15	17/12/19 10:04	Reinspection Photo							Load JPG	☒	
16	17/12/19 10:04	Reinspection Photo							Load JPG	☒	
17	17/12/19 10:04	Reinspection Photo							Load JPG	☒	
18	17/12/19 10:04	Reinspection Photo							Load JPG	☒	
19	17/12/19 10:04	Reinspection Photo							Load JPG	☒	
20	17/12/19 10:04	Reinspection Photo							Load JPG	☒	
21	17/12/19 10:04	Reinspection Photo							Load JPG	☒	
22	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
23	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
24	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
25	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
26	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
27	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
28	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
29	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
30	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
31	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
32	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
33	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
34	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
35	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
36	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
37	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
38	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
39	17/12/19 10:05	Reinspection Photo							Load JPG	☒	
40	17/12/19 10:05	Reinspection Photo							Load JPG		

Assessment Reports				1 per page	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
					☒
41	17/12/19 10:05	Reinspection Photo		Load JPG	☒

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)	
Show Remarks To: ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.	

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/SMO19016075/BYF3E2

Date: 30/12/2019

REFERENCE

Handling Insurer:	Sompo Insurance Singapore Pte. Ltd.	Policy No:	D18MTPV01018460
Claimant Vehicle No :	SJJ4134S	Insured Vehicle No :	SJU3344J
Date of Loss:	09/09/2019	Nature of Claim:	TP
		Claim No:	CMTD1904275

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJJ4134S	Engine No:	4G18JR1950
Make & Model:	MITSUBISHI LANCER, 1.6 (A)	Chassis No:	JMYSTCS3A8U008085
Reg. Date:	12/09/2008 (Man. Year: 2008)	Odometer:	143716 km
Colour:	Black		
Engine Capacity:	1584 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/60 R15	Rear Tyre Size:	195/60 R15
Front Left Side:	Dayton 6 mm	Rear Left Side:	Dayton 6 mm
Front Right Side:	Michelin 5 mm	Rear Right Side:	Michelin 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	16,570.99	4,823.32	11,747.67	70.89
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,230.00	2,230.00	3,000.00	57.36
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	21,800.99	7,053.32	14,747.67	67.65
Approved Total (Overridden) (S\$)		5,650.00		
Nett Amount (S\$)	21,800.99	5,650.00	16,150.99	74.08

INSPECTION

Date of Assignment:	10/09/2019	
Date Inspected:	11/09/2019 Inspected At:	Team Autopro Pte Ltd (sin Ming) (HQ) 160 SIN MING DRIVE, #01-14 SIN MING AUTOCITY Singapore 575722
Estimated Period of Repair:	6.0 days	

Adjuster: Lim Teow Guan

Manager: YVONNE WONG YIN CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 30 Dec 2019)
Parts:	143	MITSUBISHI LANCER 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SJJ4134S)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT RH FENDER	Not Necessary	812.50 FL	*- FL
2	1		*FRONT RH DOOR	Dented	1,035.20 FL	*899.00 FL
3	1		*FRONT RH WEATHERSTRIP	Not Necessary	198.00 FL	*- FL
4	1		*FRONT RH WEATHERSTRIP (BODY)	Torn	128.00 FL	*128.00 FL
5	1		*FRONT RH DOOR TOP MOULDING	Necessary	162.80 FL	*102.00 FL
6	1		*FRONT RH DOOR REGULATOR ASSY	Not Necessary	576.20 FL	*- FL
7	1		*FRONT RH DOOR LOCK ASSY	Jammed	457.00 FL	*290.00 FL
8	1		*FRONT RH DOOR TRIM	Not Necessary	315.60 FL	*- FL
9	1		*FRONT RH POWER MOTOR	Not Necessary	516.00 FL	*- FL
10	1		*FRONT RH TOP DOOR HINGE	Not Necessary	56.00 FL	*- FL
11	1		*FRONT RH BOTTOM DOOR HINGE	Not Necessary	56.00 FL	*- FL
12	1		*FRONT RH DOOR CHECKER	Bent	48.00 FL	*48.00 FL
13	1		*FRONT RH DOOR OUTER HANDLE	Not Necessary	134.00 FL	*- FL
14	1		*FRONT RH KNUCKLE	Not Necessary	468.90 FL	*- FL
15	1		*FRONT RH KNUCKLE BEARING	Not Necessary	189.20 FL	*- FL
16	1		*FRONT RH LOWER ARM	Not Necessary	345.60 FL	*- FL
17	1		*FRONT RH SHOCK ABSORBER	Not Necessary	689.40 FL	*- FL
18	1		*FRONT RH SIDE MIRROR	Repair	315.60 FL	*- FL
19	1		*FRONT RH DOOR OUTER CHROME GARNISH	Bent	196.70 FL	*97.00 FL
20	1		*REAR RH DOOR	Dented	1,035.20 FL	*899.00 FL
21	1		*REAR RH WEATHERSTRIP	Torn	198.00 FL	*142.00 FL
22	1		*REAR RH WEATHERSTRIP (BODY)	Not Necessary	128.00 FL	*- FL
23	1		*REAR RH TOP MOULDING	Necessary	162.80 FL	*102.00 FL
24	1		*REAR RH DOOR REGULATOR ASSY	Bent	576.20 FL	*344.00 FL
25	1		*REAR RH DOOR LOCK ASSY	Jammed	457.00 FL	*290.00 FL
26	1		*REAR RH DOOR TRIM	Not Necessary	315.60 FL	*- FL
27	1		*REAR RH TOP DOOR HINGE	Bent	56.00 FL	*56.00 FL
28	1		*REAR RH BOTTOM DOOR HINGE	Bent	56.00 FL	*56.00 FL
29	1		*REAR RH DOOR CHECKER	Bent	48.00 FL	*48.00 FL
30	1		*REAR RH DOOR OUTER HANDLE	Not Necessary	134.00 FL	*- FL
31	1		*REAR RH KNUCKLE	Not Necessary	468.90 FL	*- FL
32	1		*REAR RH KNUCKLE BEARING	Not Necessary	189.20 FL	*- FL
33	1		*REAR RH LOWER ARM	Bent	345.60 FL	*219.00 FL
34	1		*REAR RH SHOCK ABSORBER	Not Necessary	689.40 FL	*- FL
35	1		*REAR RH DOOR OUTER CHROME GARNISH	Bent	196.70 FL	*97.00 FL
36	1		*REAR RH ROCKER PANEL	Repair	927.00 FL	*- FL
37	1		*REAR RH ROCKER PANEL GARNISH	Not Necessary	884.00 FL	*- FL
38	1		*REAR RH FENDER	Repair	987.60 FL	*- FL
39	1		*REAR RH FENDER COWLING	Not Necessary	315.00 FL	*- FL
40	1		*REAR RH FENDER INNER SHIELD	Not Necessary	58.00 FL	*- FL
41	1		*REAR WINDSCREEN MOULDING	Necessary	139.00 FL	*101.00 FL
42	1		*REAR BUMPER	Cut	975.20 FL	*875.80 FL
43	1		*REAR BUMPER SIDE RETAINER	Not Necessary	84.00 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
44	1		*TAIL LAMP RH	Broken	518.00 FL	*421.00 FL
45	1		*REAR FENDER COWLING CLIPS	Not Necessary	50.00 FS	*- FS
46	1		*BRAKE FLUID	Not Necessary	120.00 FS	*- FS
47	1		*TAIL LAMP CLIPS	Necessary	50.00 FS	*30.00 FS
48	1		*FRONT RH RIM COVER	Not Necessary	118.00 FS	*- FS
49	1		*REAR RH RIM COVER	Cut	118.00 FS	*30.00 FS
50	1		*FRONT RH TYRE	Not Necessary	160.00 FS	*- FS
51	1		*REAR RH TYRE	Not Necessary	160.00 FS	*- FS
52	1		*REAR BUMPER CLIPS	Necessary	50.00 FS	*30.00 FS
53	1		*REAR WINDSCREEN SEALANT	Necessary	120.00 FS	*40.00 FS
54	1		*FRONT WINDSCREEN SEALANT	Not Necessary	120.00 FS	*- FS
55	1		*FRONT WINDSCREEN IU BRACKET	Not Necessary	60.00 FS	*- FS
56	1		*REAR RH POWER MOTOR	Not Necessary	516.00 FL	*- FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	18,287.10	5,344.80
- List Item Discount on L Items 10.00/10.00% (\$\$)	1,716.11	521.48
Total Parts (\$\$)	16,570.99	4,823.32

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO R&R FRONT DOOR MECHANISM	New	150.00	80.00
2	TO R&R REAR DOOR MECHANISM	New	150.00	80.00
3	TO R&R FRONT UNDERCARRIAGE WORK	New	350.00	0.00
4	TO R&R REAR UNDERCARRIAGE WORK	New	350.00	100.00
5	TO R&R UNDERCARRIAGE COMPONENT (BRAKE PAD, CALIPER ETC)	New	150.00	0.00
6	WHEEL ALIGNMENT	New	120.00	60.00
7	PANEL BEAT AND STRAIGHTEN ACCIDENT PORTION	New	1,500.00	800.00
8	REPAIR REPLACE AND CHECK WIRING	New	100.00	50.00
9	RUST PROOFING	New	300.00	60.00
10	TO R&R DOOR QUARTER GLASS	New	60.00	0.00
11	SPRAY PAINT	New	2,000.00	1,000.00
Gross Labour Cost (S\$)			5,230.00	2,230.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >