



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2102654

INV Date 15/04/2021

Reference CC4/LPC19016246/Uea3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SKD 5849J
Insured Veh. XD 4626M
Claim No. 19/19/19/VC10/022347
Policy No. Z/19/VC10/103265
Accident Date 05/09/2019
Inspection Date 16/09/2019

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC19016246/Uea3q2 Date: 15/04/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XD 4626M	Veh. Inspected	SKD 5849J	
Policy No.	Z/19/VC10/103265	Coverage (\$)	0.00	
Claim No.	19/19/19/VC10/022347	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	12/09/2019	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA WISH (A)	c.c	1797	
Engine No.	HIDDEN	Year of Reg.	2011	
Chassis No.	ZGE200023479	Colour	SILVER	
Odometer	279500 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/45 ZR17	PARKOUR	6 mm	
L/H Front Tyre	225/45 ZR17	PARKOUR	6 mm	
R/H Rear Tyre	225/45 ZR17	PARKOUR	6 mm	
L/H Rear Tyre	225/45 ZR17	PARKOUR	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	05/09/2019	Inspection Date	16/09/2019	
Survey held at	FOCUS AUTO PTE LTD NO 1 KAKI BUKIT AVE 6 AUTOBAY #02-48 SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKD 5849J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR DOOR -RIGHT	BADLY DENTED	955.80	955.80
1	REAR DOOR LOCK -RIGHT	TWISTED / JAMMED	346.20	346.20
1	REAR DOOR RUBBER -RIGHT	NECESSARY	299.60	299.60
1	REAR DOOR OUTER HANDLE -RIGHT	NOT NECESSARY	161.40	-
2	REAR DOOR HINGES -RIGHT @\$151.90	NOT NECESSARY	303.80	-
1	REAR DOOR GLASS MOTOR-RIGHT	JAMMED	386.20	386.20
1	REAR DOOR GLASS REGULATOR -RIGHT	BENT	289.40	289.40
1	REAR DOOR GLASS OUTER MOULDING -RIGHT	BENT	146.20	146.20
1	REAR DOOR INNER BOARD -RIGHT	DEFORMED / CRACKED	498.20	498.20
1	REAR FENDER -RIGHT	BADLY DENTED / BUCKLED	816.90	816.90
1	REAR BUMPER	DEFORMED / TORN	655.90	655.90
1	REAR BUMPER SIDE RETAINER -RIGHT	NOT NECESSARY	85.90	-
1	REAR SHOCK ABSORBER -RIGHT	NOT NECESSARY	289.40	-
1	REAR HUB BEARING -RIGHT	NOT NECESSARY	367.20	-
	LESS 25% DISCOUNT		-1,400.53	-1,098.60
			4,201.57	3,295.80
<u>SPECIAL NETT ITEMS</u>				
1	REAR SPORT RIM -RIGHT (SN)	CUT	750.00	450.00
1	REAR SIDE GLASS GUM -RIGHT (SN)	NECESSARY	60.00	40.00
			810.00	490.00
<u>LABOUR</u>				
	PANEL BEATING.		950.00	600.00
	CHECK WIRING.		60.00	20.00
	RUST PROOFING.		60.00	60.00
	REMOVE & REPLACE REAR UNDER CARRIAGE.	NOT NECESSARY	150.00	-
	REMOVE & REFIT SIDE GLASS.	NOT NECESSARY	150.00	-
	REMOVE & REFIT ROOFING ,SEAT & UPHOLSTERY.		160.00	80.00
	REMOVE & REPLACE DOOR ASSY .		80.00	50.00

Report Ref No. CC4/LPC19016246/Uea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	SPRAY PAINTING.		900.00	850.00
			2,510.00	1,660.00
GRAND TOTAL			7,521.57	5,445.80
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,350.00

Report Ref No. CC4/LPC19016246/Uea3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKD 5849J

INSPECTION

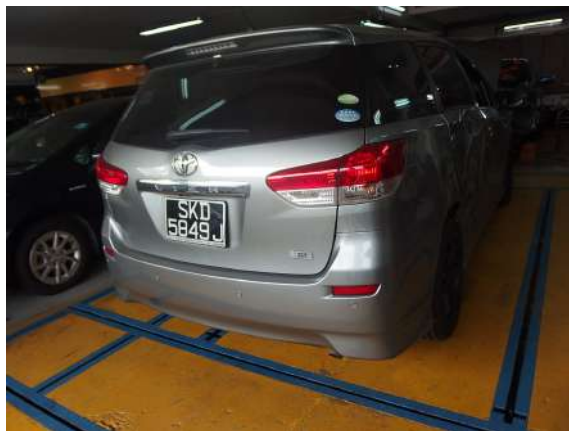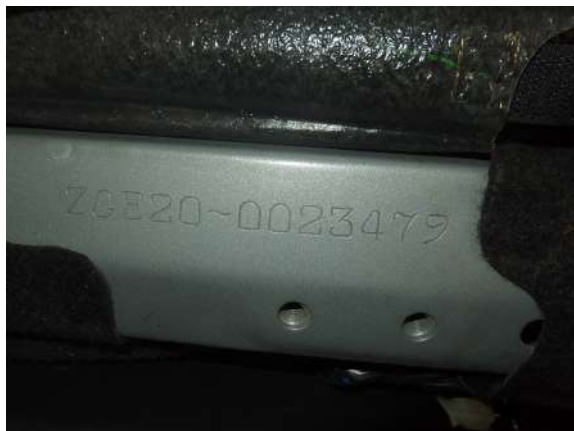



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKD 5849J

RE-INSPECTION

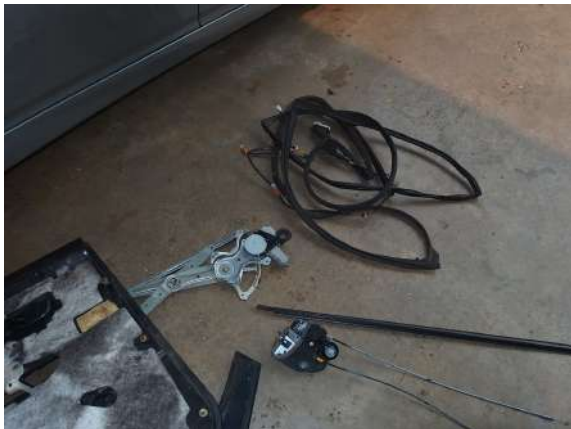



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

