

ASS. REC. BY:

REF: CS/INC19016439/Rlyd3

n2

Special Instruction:

Surveyor: RASUL

ASSIGNMENT (Office)

From (Person): Annie Koh

of

INC

Date/Time: 9.45am @ 17/9/16

Estimated Cost:

Bill to:

OD ☒ TP WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SLK 9697E

Insured:

SMD 16855

at Workshop m/s

Tune Cars

Tel:

63310697

of

27A Tanjung Benjurm

Policy No:

Claim No:

MT/1053631-001

Sum Insured:

Excess:

Make of Veh:

D.O.A.

6/7/2016

(Client's Record)

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time: 10.03am @ 17/9/16

Person Contacted:

Rick

Vehicle ☒ IN ☐ OUT

Date/Time	Action/Instruction
	SLK 9697E -X
	SMD 16855 -X

ASS. REC. BY:

PASUL

REF:

9600

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD ☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SLK 9697E

at Workshop m/s TransEurocars

of 27A Johnson Parkway

Insured: IWC

Policy No. _____

Claims No. _____


Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

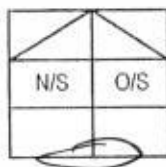

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res: Yes or No

Lum Sum: _____ % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SLK 9697E Yr Regn: 2018 / MAR

Type: ☒ M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: MAZDA 6 SEDAN 2.0A C.C. 1998

Colour: GRAY A/C: Insured / Std / NI / NA

Sp Reading: 26046 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JM6GL107130144416

Gen. Cond: Good ☒ Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 225/55 R17

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 6 mm R/Bal. 6 mm

L/Bal. 6 mm L/Bal. 6 mm

D.O.A. 06/07/19 D.O.I. 17/09/19

Survey held at TransEurocars 10:49am

Des. of Damages: Frt / ☒ Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

16/10/19 finalised amt \$3385.40 (Red \$7182.08, 67%)

RECEIVED 17 OCT 2019

16/10/2019

Date/Time, File Pass to?

☐ : Preli. Report

1)

☐ : Final Report

Date/Time, File Return to?

2) 16/10/19 Typist

Report Formed:

Lump Sum / L.B.C.:

P/P = \$3385.40

Days Of Repair: 3

Resurvey No. of Trip: 1

Add Fee: ☐ : Site Insp (\$)☐ : Interview (\$)☐ : Tech. Invs (\$)☐ : Weekend (\$)

Survey Fee:

Transportation:

S + RS: \$

Photos

Others

TOTAL

250

Yvonne Wong (LKK Auto)

From: Mei Kwan (LKKAuto)
Sent: Tuesday, October 01, 2019 5:26 PM
To: SUR
Subject: FW: finalization SLK9697E
Attachments: 4373_001.pdf; FINALIZATION NTUC SLK9697E MAZDA6 RR (TP).pdf

Follow Up Flag: Follow up
Flag Status: Flagged

CS/INC19016439/R1yd3

From: jessicahs@eurokars.com.sg <jessicahs@eurokars.com.sg>
Sent: Tuesday, 1 October, 2019 4:13 PM
To: Rasul (LKKAuto) <Rasul@lkkauto.com>; Admin A <admin-a@lkkauto.com>
Cc: samuel.ng@eurokars.com.sg; jen.lim@eurokars.com.sg
Subject: finalization SLK9697E

Dear Rasul,

Please find our computation attached for your agreement.

COR: \$3,385.40 before GST
03repair days (not including preparation of estimate, wait for liability/wait for survey/authorization/spare parts, Sat/Sun/PH)

Appreciate your confirmation for this case.

Thank you very much

Regards,
Jessica Shastri
Admin Executive – Insurance Claims
27A, Tanjong Penjuru
Singapore 609042
Dir: +65 6331 0691 | Fax: +65 6331 0690 | Email: jessicahs@eurokars.com.sg
Website: www.eurokarsgroup.com

Nivitha (LKK Auto)

From: Annie Koh <annie.koh@income.com.sg>
Sent: Tuesday, 17 September 2019 11:43 AM
To: 'assignments@lkkauto.com'; Admin-D (LKKAuto)
Subject: RE: TP CASES FARMED OUT TO LKK ON 17/09/2019

Re-send

Warmest Regards

Annie Koh
Senior Admin,
Motor Insurance
T +65 64 307899
www.income.com.sg



From: Annie Koh
Sent: Tuesday, 17 September 2019 9:48 AM
To: 'assignments@lkkauto.com' <assignments@lkkauto.com>; 'Admin-D (LKKAuto)' <admin-d@lkkauto.com>
Cc: Thio Tse Kiat <tsekiat.thio@income.com.sg>; Teng Ken Leong <kenleong.teng@income.com.sg>
Subject: RE: TP CASES FARMED OUT TO LKK ON 17/09/2019

Dear LKK,

Please assist to survey the following vehicles as per Mr Teng's instruction :-

SN	OIC	Claim No.	Vehicle	WorkShop Name	WorkShop Address	WorkShop Contact	Survey Time	OI VEH	DOA	Additional Remarks
----	-----	-----------	---------	---------------	------------------	------------------	-------------	--------	-----	--------------------

1	Quek Swee Keng	MT/1062704-001	SHC7550Y	DING AUTOMOTIVE PTE LTD	31 CORPORATION ROAD SINGAPORE 649825	vadivelan mohan / 96891857		FBK5883D	16/9/19	
2	Cyndie Yong	MT/1062707-001	SHB4588P	DING AUTOMOTIVE PTE LTD	31 CORPORATION ROAD SINGAPORE 649825	vadivelan mohan / 96891857		GZ4035D	16/9/19	avoid lunch time 12-1pm OWNER WANT VEH TO BE SURVEYED AT 10AM.
3	Jared Liu	MT/1053631-001	SLK9697E	EUROKARS SERVICES PTE LTD	27A TANJONG PENJURU SINGAPORE 609042	samuel / 63310697	10:00-12:00	SMD1685S	6/7/19	
4	David Phua	MT/1062351-002	GBB3166B	MILLION AUTO SERVICE	4 PENJURU PLACE #01-12 2.8 PENJURU TECH HUB	Ms Chong / 62649091	10:00-12:00	SGU2459D	12/9/19	82285020
5	Alice Low	MT/1062478-001	SLL7112J	PEGASUS ENGINEERING & TRADING PTE LTD	74 KIAN TECK ROAD SINGAPORE 628800	KALA / 65137748	10:00-12:00	GBJ4486D	14/9/19	

6	Jared Liu	MT/1062601- 001	SLJ2693S	PEGASUS ENGINEERING & TRADING PTE LTD	74 KIAN TECK ROAD SINGAPORE 628800	chern /	SGT4453L	14/9/19	
7	Serene Lim	MT/1062510- 001	SKC878M	TRIDENTE AUTOMOBILI PTE LTD	30 LENG KEE ROAD, UNIT 01-02	JOSEPH TEE / 64752168	FBG1984T	9/9/19	

Please contact workshops.

Please revert to officer-in-charge after survey.

Thank you.

Annie Koh

Senior Admin Assistant, Motor Insurance

T +65 6430 7899

www.income.com.sg



SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	08/07/2019 14:08
Date Of Accident	06/07/2019 20:00
Exact Location Of Accident	BRAS BASAH RD TWDS SUNTEC CITY
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLK9697E
Insured/Policyholder	
Name Of Registered Owner	ONG HWEE SEONG
NRIC No	S1102960D
Email Address	ONGHS1@GMAIL.COM
Mobile Phone No	(LOCAL) +65-96716257
Alternative Phone No	OFFICE-64661761

Vehicle Particulars

Manufacturer	MAZDA
Model	6-2.0 SDN V (A)
Exact Purpose for which vehicle was being used at time of accident	PERSONAL USE
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	
Cover Note Number	

Driver

Name of Driver	ONG HWEE SEONG
NRIC No	S1102960D
Date Of Birth	19/04/1955
Occupation	INDOOR
Date Of Driving Pass	12/05/1979
Driving Experience	40 YEARS AND 1 MONTH
Gender	MALE
Mobile Number	(LOCAL) +65-96716257
Fax Number	
Contact Number	OFFICE-64661761
Email Address	ONGHS1@GMAIL.COM

Address	BLK 7 GHIM MOH ROAD #10-269
Postcode	270007
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : KO LAY ING
	GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO SKETCH PLAN


Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SMD1685S
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	BENEDICT JOSEPH GOH
NRIC/Passport Number	S8725544A
Contact Number	8811878
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

SKETCH PLAN

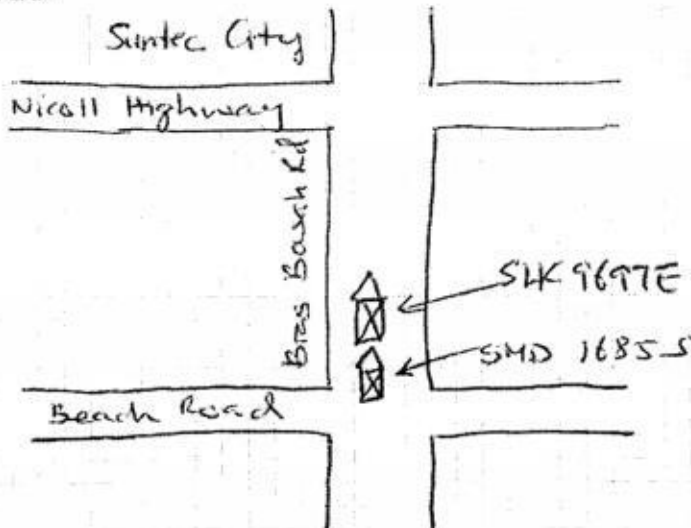

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

LICENSE PLATE NO: SLK 9697E

ACCIDENT DATE: 6 July 2019	CONTACT NUMBER: 96716257
ACCIDENT TIME: 2000 hours	EMAIL:
LOCATION: Bras Basah Road	
<p>On 6 July 2019 at about 2000 hours, I was driving my car SLK 9697E (Mazda 6) with my wife along Bras Basah Road towards Sintercity. There was a NDP rehearsal going on at the time with road closures and traffic diversions. The traffic was heavy and I was following direction from the police. I was on the second lane (third lanes onwards were closed) waiting to move forward. Suddenly I heard a loud bang and felt an impact on my car rear. I came out and saw a car (SMD 16855) had hit my rear bumper, damaging it. Front bumper of SMD 16855 was also damaged. Due to the road closures, night condition and very little time given by the police to exchange our particulars, the accident location in the sketch is an estimation only.</p>	
NOTE: PLEASE NOTE THAT YOUR INSURER MAY HAVE 14 DAYS TIME FRAME FOR YOU TO SUBMIT AN OWN DAMAGE CLAIMS UNDER YOUR OWN POLICY.	
PLEASE CHECK YOUR POLICY FOR MORE INFORMATION	
PLEASE STATE: <input type="checkbox"/> CLAIM OWN POLICY <input checked="" type="checkbox"/> CLAIM THIRD PARTY <input type="checkbox"/> REPORTING ONLY	


DECLARATION

I/We declare the foregoing particulars are true in every respect.


Policyholder's Signature

Date & Time:
8/7/2019

Driver's Signature
(If driver is not the policyholder)
Date & Time:


Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


Policyholder's Signature

Date & Time:

8/7/19

Bar hrs

Driver's Signature
(If driver is not the policyholder)
Date & Time:


Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

ORIGINAL

Co. Reg. No. 201009404M

Hotline: (65) 6419-3000 Fax: (65) 6415-3723

If you do not receive your Certificate of Insurance and policy documents within 30 days from the inception date stated on this cover note, please contact AIG immediately.

1200027381
AIG
1070 1070 1070

Cover Note: 3100027381

The following risk described in the Schedule below is hereby covered subject to the applicable terms and conditions of AIG's policy issued to the Policyholder. The Policy to which this Cover Note relates to is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia).

Schedule (please circle where applicable)

Policyholder/Insured	ONG 1/WEF S'BOANG		Policy Period	27/03/2012 to 27/03/2012 23:59	
Age Condition	1	All Age	Registration Number		
	2	30 Years Old and Above	Make/Model	MAZDA 6 2.0 EXECUTIVE	
	3	35 Years Old and Above	CC/Tonnage	1998	
	4	40 Years Old and Above	Engine Number	PE 21087873	
	5	Named Driver Basis	Chassis Number	JM6GL107J0144416	
Policy Type		Comprehensive	Year of Registration	2012	
		Third Party Fire and Theft	Hire Purchase Company	OCBC	
		Third Party only	Excess	SS 688 (Section I/II Both) SS 100 (Windscreen excess)	

Please note that acceptance of the risk is subject to our final acceptance and the terms and conditions applicable to the policy. For important notes and applicable laws and regulations, please refer to the reverse page.

Issued in Singapore

19/02/2012
Date of issuance

Authorised Representative

503599-190
Agent Code

Manik Bucha, Personal Insurance

This insurance is underwritten by AIG Asia Pacific Insurance Pte. Ltd.



TRANS EUROKARS PTE LTD



ESTIMATE COST OF REPAIRS

NTUC INCOME INSURANCE		NAME : Ong Hwee Seong		WIP : 45562	
1 MARITIME SQUARE		ADDRESS : 7 Ghim Moh Road		EXCESS :	
#10-01 HARBOURFRONT CENTRE		#10-269		DATE : 8-Jul-19	
SINGAPORE 099253		Singapore 270007			
ATTN. : MOTOR CLAIMS		TEL : 96716257			
FAX :					
VEH NO :	SLK9697E	DATE IN :		CONTACT PERSON :	Vion 63957877
CHASSIS NO :	JM6GL1071J0144416	MILEAGE :		TYPE OF CLAIM :	THIRD PARTY CLAIM
MODEL :	MAZDA6	DATE REG.:	22-Mar-18	POLICY NO. :	

NATURE OF WORKS

Parts Description

NO		QTY		REVISED	PRICES
1	REAR BUMPER <i>de /</i>	1	MGJS1-50-221ABB		\$ 1,266.60
2	RETAINER LHS <i>2 X su</i>	1	MGJR9-50-2J1		\$ 41.00
3	BRACKET CENTER <i>7. f8u</i>	1	MKD53-50-251		\$ 5.40
4	REFLECTOR LHS <i>2 X su</i>	1	MD350-51-5L0E		\$ 53.00
5	TOWING COVER LHS <i>X su</i>	1	MGJR9-50-EL1A2M		\$ 24.90
6	REAR REINFORCEMENT <i>7. f8u</i>	1	MGHK1-50-260		\$ 538.30
7	RETAINER CENTER, SENSOR <i>X su</i>	2	MKD45-67-UC5A2Y		\$ 31.00
8	RETAINER SIDE, SENSOR <i>X su</i>	1	MKD47-67-UC5A2Y		\$ 15.50
9	SENSOR CENTER, ULTRASONIC <i>X su</i>	2	MGMK6-67-UC1 2Y		\$ 361.80
10	SENSOR SIDE, ULTRASONIC <i>X su</i>	1	MKD47-67-UC1 2Y		\$ 180.90
11	TAPE PROTECTOR, SENSOR <i>ne /</i>	4	MGS1D-50-EM1A		\$ 34.40
12	GROMMET, REAR BUMPER <i>ne /</i>	2 2	M9991-00-501		\$ 22.00
13	GROMMET, REAR BUMPER <i>2 X M</i>	5	M9991-00-501		\$ 15.00
14	GROMMET, REAR BUMPER <i>4u /</i>	4	MBHN1-50-0Z1A		\$ 10.80
15	CLIP, REAR BUMPER <i>ne /</i>	4	MC274-50-133		\$ 14.80
16	FASTENER, REAR BUMPER <i>ne /</i>	6	MB45A-56-146A		\$ 18.00
17	GASKET LHS, TAILLAMP <i>ne /</i>	1	MGJA1-51-163		\$ 27.70
18	GASKET RHS, TAILLAMP <i>ne /</i>	1	MGJA1-51-153		\$ 27.70
19	EXHASUT, SILENCER <i>2 X M su</i>	1	MPE23-40-100B		\$ 1,833.00
20	GASKET, EXHAUST <i>2 X su</i>	1	MPE23-40-305		\$ 25.40
			TOTAL PARTS		\$ 4,597.20
			LESS 10%		\$ 459.72
			TOTAL PARTS COST		\$ 4,137.48

Labour Description

1	MZ-BR-REAR02	TO REPLACE REAR BUMPER AND REAR REINFORCEMENT. TO REPAIR REAR END PANEL AND ALL AREAS AFFECTED BY THE ACCIDENT.	660	\$ 1,980.00
---	--------------	---	-----	-------------

2		TO RESPRAY REAR BUMPER, REAR REINFORCEMENT AND REAR END PANEL.	630	\$ 1,980.00
3	MZ-BR-REVSER	TO TRANSFER REVERSE SENSORS.	NETT	\$ 330.00
4	MZ-BR-EXASSY	TO REMOVE & INSTALL REAR EXHAUST ASSY.	max	\$ 990.00
5	MZ-BR-CAVITY	TO CARRY-OUT BODY CAVITY PRESERVATION.	max	\$ 250.00
6	MZ-BR-ELECTR	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.	150	\$ 250.00
7	MZ-BR-REPROG	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.	180	\$ 350.00
8		TO APPLY BRILA COATING TO REAR BUMPER. (invoice)	150	\$ 200.00
9	MZ-BR-SUNDRI	SUNDRIES. nec	20	\$ 100.00

TOTAL LABOUR	\$ -	\$ 6,430.00
TOTAL PARTS	\$ -	\$ 4,137.48
TOTAL	\$ -	\$ 10,567.48
LESS EXCESS	\$ -	\$ -
TOTAL AFTER EXCESS	\$ -	
GST 7%	\$ -	\$ -
GRAND TOTAL	\$ -	\$ -

REMARKS:

THIS IS ONLY AN ESTIMATE FROM VISUAL INSPECTION AND SHOULD THERE BE MORE DAMAGES FOUND DURING THE PROCESS OF REPAIRING, YOU WILL BE INFORMED BEFORE THE REPAIRS ARE BEING CARRIED OUT. TAKE NOTE THAT SHOULD YOU DECIDE NOT TO PROCEED WITH THE REPAIRS, A **QUOTATION FEE OF \$400** WILL BE APPLIED ACCORDINGLY FOR MAN-HOURS INVOLVED IN SOURCING FOR PARTS PRICE AS WELL AS LABOUR CHARGES.

TRANS EUROKARS PTE LTD

Authorised Signature

Rasul
Hp 90012568
3 days
17/09/19 @ 1100
Reqs before part

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting.
- To display damaged part(s) during resurvey.
- Parts prices are subject to confirmation.
- Third party survey is on a "Without Prejudice" basis.
- No illegal modification(s) is allowed.
- Supplementary claim(s) must be resurveyed and is subject to final approval from Insurance Company.

Acknowledged by Repairer:
Signature:
Date:



TRANS EUROKARS PTE LTD



FINALIZATION COST OF REPAIRS

NTUC INCOME INSURANCE 1 MARITIME SQUARE #10-01 HARBOURFRONT CENTRE SINGAPORE 099253 ATTN.: MOTOR CLAIMS FAX :		NAME : Ong Hwee Seong ADDRESS : 7 Ghim Moh Road #10-269 Singapore 270007 TEL : 96716257		WIP : 45562 EXCESS : DATE: 8-Jul-19		
VEH NO :	SLK9697E	DATE IN :		CONTACT PERSON :	Vion 63957877	
CHASSIS NO :	JM6GL1071J0144416	MILEAGE :		TYPE OF CLAIM :	THIRD PARTY CLAIM	
MODEL :	MAZDA6	DATE REG.:	22-Mar-18	POLICY NO. :		
NATURE OF WORKS						
Parts Description						
NO	QTY			REVISED	PRICES	
1	REAR BUMPER	1	MGJS1-50-221ABB	\$ 1,266.60	\$ 1,266.60	
2	RETAINER LHS	1	MGJR9-50-2J1		\$ 41.00	
3	BRACKET CENTER	1	MKD53-50-251		\$ 5.40	
4	REFLECTOR LHS	1	MD350-51-5L0E		\$ 53.00	
5	TOWING COVER LHS	1	MGJR9-50-EL1A2M		\$ 24.90	
6	REAR REINFORCEMENT	1	MGHK1-50-260		\$ 538.30	
7	RETAINER CENTER, SENSOR	2	MKD45-67-UC5A2Y		\$ 31.00	
8	RETAINER SIDE, SENSOR	1	MKD47-67-UC5A2Y		\$ 15.50	
9	SENSOR CENTER, ULTRASONIC	2	MGMK6-67-UC1 2Y		\$ 361.80	
10	SENSOR SIDE, ULTRASONIC	1	MKD47-67-UC1 2Y		\$ 180.90	
11	TAPE PROTECTOR, SENSOR	4	MG51D-50-EM1A	\$ 34.40	\$ 34.40	
12	GROMMET, REAR BUMPER	2	M9991-00-501	\$ 6.00	\$ 72.00	
13	GROMMET, REAR BUMPER	5	M9991-00-501		\$ 15.00	
14	GROMMET, REAR BUMPER	4	MBHN1-50-021A	\$ 10.80	\$ 10.80	
15	CLIP, REAR BUMPER	4	MC274-50-133	\$ 14.80	\$ 14.80	
16	FASTENER, REAR BUMPER	6	MB45A-56-146A	\$ 18.00	\$ 18.00	
17	GASKET LHS, TAILLAMP	1	MGJA1-51-163	\$ 27.70	\$ 27.70	
18	GASKET RHS, TAILLAMP	1	MGJA1-51-153	\$ 27.70	\$ 27.70	
19	EXHASUT, SILENCER	1	MPE23-40-100B		\$ 1,833.00	
20	GASKET, EXHAUST	1	MPE23-40-305		\$ 25.40	
TOTAL PARTS				\$ 1,406.00	\$ 4,597.20	
LESS 10%				\$ 140.60	\$ 459.72	
TOTAL PARTS COST				\$ 1,265.40	\$ 4,137.48	
Labour Description						
1	MZ-BR-REAR02	TO REPLACE REAR BUMPER AND REAR REINFORCEMENT. TO REPAIR REAR END PANEL AND ALL AREAS AFFECTED BY THE ACCIDENT.			\$ 660.00	\$ 1,980.00

2		TO RESPRAY REAR BUMPER, REAR REINFORCEMENT AND REAR END PANEL.	\$ 630.00	\$ 1,980.00
3	MZ-BR-REVSER	TO TRANSFER REVERSE SENSORS.	\$ 330.00	\$ 330.00
4	MZ-BR-EXASSY	TO REMOVE & INSTALL REAR EXHAUST ASSY.	\$ -	\$ 990.00
5	MZ-BR-CAVITY	TO CARRY-OUT BODY CAVITY PRESERVATION.	\$ -	\$ 250.00
6	MZ-BR-ELECTR	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.	\$ 150.00	\$ 250.00
7	MZ-BR-REPROG	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.	\$ 180.00	\$ 350.00
8		TO APPLY BRILA COATING TO REAR BUMPER.	\$ 150.00	\$ 200.00
9	MZ-BR-SUNDRI	SUNDRIES.	\$ 20.00	\$ 100.00
TOTAL LABOUR			\$ 2,120.00	\$ 6,430.00
TOTAL PARTS			\$ 1,265.40	\$ 4,137.48
TOTAL			\$ 3,385.40	\$ 10,567.48
LESS EXCESS			\$ -	\$ -
TOTAL AFTER EXCESS			\$ 3,385.40	
GST 7%			\$ 236.98	\$ -
GRAND TOTAL			\$ 3,622.38	\$ -

Number of days: 3 working days(exclude waiting for survey,authorization,parts,sat,sun & ph)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

DAMAGE ASSESSMENT REPORT

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: CS/INC19016439/R1yd3n2
73 BRAS BASAH ROAD Date: 18-10-2019
#05-01 NTUC TRADE UNION HOUSESINGAPORE
189556



ATTN: JARED LIU

Code: INC

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SMD 1685S	Veh. Inspected	SLK 9697E
Policy No.		Coverage (\$)	0.00
Claim No.	MT/1053631-001	Excess (\$)	0.00
Assign From	ANNIE KOH	Assign Date	17/09/2019

2. Vehicle Particulars & Condition

Make & Model	MAZDA 6 SEDAN 2.0 A	c.c	1998
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	JM6GL1071J0144416	Colour	GREY
Odometer	26046 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	FAIR		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	225/55 R17	MICHELIN	6 mm
L/H Front Tyre	225/55 R17	MICHELIN	6 mm
R/H Rear Tyre	225/55 R17	MICHELIN	6 mm
L/H Rear Tyre	225/55 R17	MICHELIN	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	06/07/2019	Inspect Date / Time	17/09/2019 (10:49 AM)
Survey held at	27A TANJONG PENJURU		
Repairer	TRANS EUROKARS PTE LTD		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	3 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLK 9697E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	DEFORMED	1,266.60	1,266.60
1	RETAINER LHS	SERVICEABLE	41.00	-
1	BRACKET CENTER	SERVICEABLE	5.40	-
1	REFLECTOR LHS	SERVICEABLE	53.00	-
1	TOWING COVER LHS	SERVICEABLE	24.90	-
1	REAR REINFORCEMENT	SERVICEABLE	538.30	-
2	RETAINER CENTER.SENSOR	SERVICEABLE	31.00	-
1	RETAINER SIDE.SENSOR	SERVICEABLE	15.50	-
2	SENSOR CENTER,ULTRASONIC	SERVICEABLE	361.80	-
1	SENSOR SIDE,ULTRASONIC	SERVICEABLE	180.90	-
4	TAPE PROTECTOR,SENSOR	NECESSARY	34.40	34.40
24	GROMMET,REAR BUMPER	NECESSARY (2 PCS ONLY)	72.00	6.00
5	GROMMET,REAR BUMPER	NOT NECESSARY	15.00	-
4	GROMMET,REAR BUMPER	NECESSARY	10.80	10.80
4	CLIP,REAR BUMPER	NECESSARY	14.80	14.80
6	FASTENER,REAR BUMPER	NECESSARY	18.00	18.00
1	GASKET LHS,TAILLAMP	NECESSARY	27.70	27.70
1	GASKET RHS,TAILLAMP	NECESSARY	27.70	27.70
1	EXHAUST,SILENCER	SERVICEABLE	1,833.00	-
1	GASKET,EXHAUST	SERVICEABLE	25.40	-
	LESS 10% DISCOUNT		-459.72	-140.60
			4,137.48	1,265.40
<u>SPECIAL NETT ITEMS</u>				
1	SUNDRIES (SN)	NECESSARY	100.00	20.00
			100.00	20.00
<u>LABOUR</u>				
	TO REPLACE REAR BUMPER AND REAR REINFORCEMENT.TO REPAIR REAR END PANEL AND ALL AREAS AFFECTED BY THE ACCIDENT.		1,980.00	660.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO RESPRAY REAR BUMPER, REAR REINFORCEMENT AND REAR END PANEL.		1,980.00	630.00
	TO TRANSFER REVERSE SENSORS.		330.00	330.00
	TO REMOVE & INSTALL REAR EXHAUST ASSY.	NOT NECESSARY	990.00	-
	TO CARRY-OUT BODY CAVITY PRESERVATION.	NOT NECESSARY	250.00	-
	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.		250.00	150.00
	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.		350.00	180.00
	TO APPLY BRILA COATING TO REAR BUMPER.		200.00	150.00
			6,330.00	2,100.00
GRAND TOTAL			10,567.48	3,385.40
RECOMMENDED COST OF REPAIRS (CONFIRMED)				3,385.40

Report Ref No. CS/INC19016439/R1yd3n2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

K.K. LAU CPT (RET)

BEng(Hons), B.Bus, MBA, PEng, PE,
MInstAEA, MASME, MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.